

A14-1
SEP

Service Invoice

ACCOUNT INQUIRIES
PH: (902) 468-6777 / (866) 822-8777
EM: accrec@partsfortrucks.com



Invoice Number	SRO	Invoice Date
70214688-00	EDMS000110	7/10/2025
Customer PO	Terms	
3934	Net 30 Days	

Bill To 201332

Westcore Links Inc
2306 4 ST
Nisku AB T9E 7W5
Canada

FAX:

Ship To 90000000

Westcore Links Inc
2306 4 ST
Nisku AB T9E 7W5
Canada

Phone: 8255222633
Email:

Company

Parts For Trucks Inc.
230 Brownlow Avenue
Suite 120
Dartmouth NS B3B 0G5
(902)468-6777

Product and Description	Quantity	Unit	Price	Ext Price
Serial Number: 4V4NC9KL7GN935140	Customer Unit: 321			
Item: Truck	Meter Amount: 1,476,603			
Description: 2016 VOLVO VN				

Oper: 10	Code: SVC-2090	Description: Provincial Motor Vehicle Inspection
Subject: CUSTOMER'S REQUEST	Subject: REPAIRS PERFORMED	
Notes: PERFORM CVIP & GREASE UNIT	Notes: PERFORMED CVIP & GREASED UNIT	

Parts:	585.12
Labour:	239.58
Misc:	0.00
Operation Sub-Total:	824.70

Line: 1				239.58
Work Code: REP				
Work Code: REP Repair				
Line: 2	1.00	EA	140.84	140.84
Item: CALMONT-20489116				
Work Code: PARKING BRAKE PRESSURE SWITCH				
Line: 3	2.00	EA	30.00	60.00
Item: BAT-924-5503				
Work Code: HD Hood Release Cable Assem				
Line: 4	2.00	EA	192.14	384.28
Item: CALMONT-24288517				
Work Code: HOOD LATCH CABLE				

Oper: 20	Code: SVC-1100	Description: Foundation Brakes
----------	----------------	--------------------------------

Product and Description	Quantity	Unit	Price	Ext Price
Subject: CUSTOMER'S REQUEST				
Notes: REPLACE BRAKE RELEASE VALVE (DASH MOUNTED)				
Subject: REPAIRS PERFORMED				
Notes: TOOK OUT OLD BRAKE RELEASE VALVE INSTALLED NEW ONE HAD TO WAIT FOR PARTS AS THERE WERE 2 THAT WERE VERY SIMILAR				

WHEN TRAILER BRAKE IS PUSHED A AIRLEAK IS HEARD FROM DASH.				
IS NOT THE RELEASE VALVE IT IS THE TRAILER BRAKE SENSOR FARTHER DOWN IN THE DASH				
REMOVED DASH PANELS & PRESSURE SWITCH FOR PARK BRAKE VALVE.				
			Parts:	0.00
			Labour:	242.00
			Misc:	0.00
			Operation Sub-Total:	242.00
Line: 5				242.00
Work Code: REP				
Work Code: REP Repair				
Oper: 30	Code: SVC-2080		Description: Cab Components	
Subject: CUSTOMER'S REQUEST				
Notes: REPLACE WIPER BLADES				
Subject: REPAIRS PERFORMED				
Notes: REMOVED & REPLACED WIPER BLADES & TESTED ALL GOOD				
			Parts:	464.66
			Labour:	71.50
			Misc:	0.00
			Operation Sub-Total:	536.16
Line: 8				71.50
Work Code: REP				
Work Code: REP Repair				
Line: 9	2.00	EA1	16.76	33.52
Item: ANO-C-21-UB				
Work Code: Contour Beam				
Line: 10	2.00	EA	114.43	228.86
Item: MER-M83048				
Work Code: Shock				
Line: 11	2.00	EA	101.14	202.28
Item: AUT-ABSZ70-2453				
Work Code: Air Spring Cabin Volvo				
Oper: 40	Code: SVC-2010		Description: Suspension Systems	

Product and Description	Quantity	Unit	Price	Ext Price
Subject: CUSTOMER REQUEST	Subject: REPAIRS PERFORMED			
Notes:	Notes: REMOVE CAB AIRBAGS I HAD TO PRY THE BOTTOM WASHER PLATE OFF, LIFT THE CAB UP/ SUPPORT THE WEIGHT WITH 2 BOTTLE JACKS. ONCE WEIGHT WAS SUPPORTED I REMOVED THE TOP OF THE AIRBAGS BY UNSCREWING THE BAG. WHILE REMOVING DRIVERS SIDE BAG, EXCESSIVE RUST WAS CAUSING THE BAG NOT TO UNSCREW PROPERLY SO I CUT THE THREAD AT THE TOP OF THE BAG IN ORDER TO GET THE BAG OUT. AFTERWARDS ONCE BOTH BAGS WERE REMOVED I INSTALLED THE NEW BAGS WITH THE SAME BOTTOM WASHER. TESTED THE BAGS WITH THE LEVELING VALVE AT THE REAR OF THE CAB SO THEY WOULD SIT PROPERLY			
REPLACE SLEEPER CAB AIR BAGS (CORDS EXPOSED)				
			Parts:	0.00
			Labour:	181.50
			Misc:	0.00
			Operation Sub-Total:	181.50
Line: 12				181.50
Work Code: REP				
Work Code: REP Repair				
Oper: 50	Code: SVC-1090	Description: Air Brake Systems		
Subject: CUSTOMER REQUEST	Subject: REPAIRS PERFORMED			
Notes:	Notes: REMOVED & REPLACED REFLECTIVE BRACKETS AT REAR MUDFLAPS			
REPLACE DAMAGED REFLECTIVE TAPE/BRACKETS AT REAR MUDFLAPS				
			Parts:	562.46
			Labour:	181.50
			Misc:	0.00
			Operation Sub-Total:	743.96
Line: 14				181.50
Work Code: REP				
Work Code: REP Repair				
Line: 15	1.00	EA1	24.10	24.10
Item: CLS-RS3000				
Work Code: Reflector Strip (Pairs)				
Line: 16	5.00	EA1	6.02	30.10
Item: FAI-PC1468-6B				
Work Code: Dot Ptc Adptr;3/8X1/4Mpt				
Line: 17	1.00	EA1	508.26	508.26
Item: BEN-800519				
Work Code: MV-3 Control Module				
Oper: 60	Code: SVC-2080	Description: Trailer Body Repairs		
Subject: CUSTOMER REQUEST	Subject: REPAIRS PERFORMED			
Notes:	Notes: REPLACED WITH AN INCADECENT LIGHT AND ALL IS GOOD			
REPLACE RIGHT REAR BRAKE LAMP (4" ROUND LED RED)				
			Parts:	13.44
			Labour:	60.50
			Misc:	0.00
			Operation Sub-Total:	73.94

Product and Description	Quantity	Unit	Price	Ext Price
Line: 18				60.50
Work Code: REP				
Work Code: REP Repair				
Line: 19	1.00	EA1	13.44	13.44
Item: GRT-52892				
Work Code: Oval STT Lamp Red				

Oper: 70	Code: SVC-1060	Description: Electrical	
Subject: CUSTOMER REQUEST		Subject: REPAIRS PERFORMED	
Notes:		Notes:	
REPAIR LOOSE L/S LOWER STEP AT DOOR		REMOVED KICKER PANELS + DASH PANELS +	
R/S HOOD NOT LOCKING WHEN CLOSING HOOD		CARPET CUT ZIP TIES & PULLED HOOD LATCH CABLES	
		THROUGH FIREWALL,	
		INSTALLED NEW CUSTOMER SUPPLIED HOOD LATCH	
		CABLE	
		RE-INSTALLED KICKER PANELS + DASH PANELS +	
		CARPET CUT ZIP TIES	
		Parts:	0.00
		Labour:	121.00
		Misc:	0.00
		Operation Sub-Total:	121.00

Line: 20				121.00
Work Code: REP				
Work Code: REP Repair				

Oper: 80	Code: SVC-1080	Description: Electrical	
Subject: CUSTOMER REQUEST		Subject: REPAIRS PERFORMED	
Notes:		Notes:	
CHECK LAMP IS ON ON DASH (SCAN FOR CODES)			
*R/R BRAKE LAMP OPEN		SECURED BATTERY TIE DOWN BRACKET	
SECURE LOSOE BATTERY TIE DOWN BRACKET		REMOVED & REPLACED RUBBER LATCH AT L/S	
REPLACE MISSING RUBBER LATCH AT L/S BATTERY		BATTERY COVER/STEP	
COVER/STEP			
		Parts:	0.00
		Labour:	242.00
		Misc:	0.00
		Operation Sub-Total:	242.00

Line: 21				242.00
Work Code: REP				
Work Code: REP Repair				

Oper: 90	Code: SVC-2070	Description: Coupling Devices	
Subject: CUSTOMER REQUEST		Subject: REPAIRS PERFORMED	
Notes:		Notes:	
ADJUST 5TH WHEEL		ADJUSTED 5TH WHEEL	
		Parts:	0.00
		Labour:	60.50
		Misc:	0.00
		Operation Sub-Total:	60.50

Line: 24				60.50
Work Code: REP				
Work Code: REP Repair				

Product and Description**Quantity Unit****Price****Ext Price****Oper: 100 Code: SVC-2010 Description: Suspension Systems****Subject: CUSTOMER REQUEST**
Notes:RECOMMEND TO REPLACE SLEEPER/CAB SHOCKS
(CORRODING BUT NOT LEAKING)**Subject: REPAIRS PERFORMED**
Notes:REMOVED CAB SHOCKS, HAD A REAL HARD TIME
GETTING THOSE BOLTS OUT, HAD TO HEAT IT UP BIG
TIME JUST TO GET IT STARTED GOT SHOCKS OUT &
INSTALLED NEW SHOCKS & TIGHTENED UP

Parts:	0.00
Labour:	121.00
Misc:	0.00
Operation Sub-Total:	121.00

Line: 26	121.00
Work Code: REP	
Work Code: REP Repair	

Oper: 110 Code: SVC-1050 Description: Engine Components**Subject: CUSTOMER REQUEST**
Notes:L/S & REAR OF ENGINE TYPE 2 OIL LEAK, HOWEVER
THERE IS A BLOWBY TUBE IN THE SAME AREA**Subject: REPAIRS PERFORMED**
Notes:CLEANED L/S & REAR OF ENGINE AND FOUND NO
MAJOR LEAK WAS FROM THE BLOWBY TUBE IN THE
SAME AREA

Parts:	0.00
Labour:	143.00
Misc:	0.00
Operation Sub-Total:	143.00

Line: 28	143.00
Work Code: REP	
Work Code: REP Repair	

Net Amount	3,289.76
Misc. Charges	0.00
Freight	0.00
Sales Tax	164.49
Sales Tax 2	0.00
Invoice Total	3,454.25

Notes****** WHEELS MUST BE RE-TORQUED BY A QUALIFIED INDIVIDUAL WITHIN 100 KM ********HST/GST/TPS# 104086277****Interest of 1.5% per mo. (18% per annum) will be charged on overdue accounts**
Intérêt de 1.5% par mois (18% par an) sur tout montant Impayé