

T/4-40
SEP

- Engine October 2022
- Transmissions June 2018
- Auxiliary April 2021
- Differential 1 17321 hrs
- Differential 2 May 2019
- Trans oil 14719 hrs
- Trans filter 14719 hrs

WORK ORDER



29262

SWAN HILLS ACHESON
FOX CREEK WHITECOURT

QUAN	PART NUMBER	DESCRIPTION	COST
40L		Hydraulic oil	209.60
1/16	R134A		44.00
9L	ATF	P.S. fluid	41.84
90L		trans fluid	462.80
1/2L	15W10	engine oil	143.64
50L		coolant	142.50
1	33225	Exhaust pump	13.96
1	5-281X	US oil	98.95
2	G3003	Rad. lamp	33.26
1	3050A	Rad. lamp	5.85
1	80111L	Condenser switch	17.99
2	AL25-12	Air filters	274.62
1		rad. mat. kit	
1		rad. front structure	
1		rad. front structure	
			1489.01
SUBLET			

Unit: 2140 Date: Oct 31 2022
K.M. 259603 H.M. 17892
Location: Rod Deer

Disassemble CAT Engine and Rebuild	
Add Hydraulic oil	
Pulled engine and trans	
Send trans in to get tested	
Disassembled frame for rebuild	
Rebuilt engine after inspection was	
Replaced Engine oil pump, cylinder packs, water pump, cylinder head, injectors and front structure	
Replaced all engine gaskets and rings	
Replaced crank seal (rod and rear)	
Timed engine and set all lash	
Reprogrammed injectors and assembled engine	
Installed injectors and installed engine/trans into truck	
SUBLET: pulled new rad and	
SHOP TIME: 57.75	SUBLET: id's
TOTAL HOURS:	LABOUR 4620.00
	PARTS 1489.01
	S/S 74.45
TOTAL HOURS:	TOTAL 6183.46
	THANK YOU

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



SWAN HILLS ACHESON
FOX CREEK WHITECOURT

28947

Unit 214 Date Nov 17 2022
K.M. 25863 H.M. 15892
Location RD

Replaced All filters
Replaced 41 V Domet
Replaced front PTO Drive shaft
Replaced Air compressor valve safety valve
Replaced hydraulic hoses v3 to pump.
Tied up all hoses/elect.
Replaced trans. harness.
Replaced engine mounts
Replaced starter motor
Replaced Power steering pump return hose
Ran engine and tested (tested good)

SUBLET

SUBLET:

SHOP TIME: 8.5
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR

PARTS

S/S

TOTAL
THANK YOU

680.00

680.00

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



SWAN HILLS ACHESON
FOX CREEK WHITECOURT

27849

QUAN	PART NUMBER	DESCRIPTION	COST
1	084-1000-3082875	Fan belt	31.30
1	084-1000-3061315	A/C Belt	22.00
1	SR2000028	Heater valve	33.99
2'	3/8 Heater hose		8.98
8"	2 1/2 Heater hose		22.08
6"	3" Heater hose		21.78
			140.3
SUBLET			

Unit 214 Date Oct 19, 2022

K.M. _____ H.M. _____

Location Red deer

- Switch tras cooler Lines
- Checked coolant leaks Found Red leak
- tested transmission cooling capability
- Found tras didn't cool fast enough & pulled tras
- Replaced Heater valve
- Replaced hoses on thermostat housing
- Resealed Fittings on thermostat housing
- Pulled air compressor
- Found air compressor std worn out in structure
- pulled Eng and washed Eng Bay

SUBLET:

SHOP TIME: 31.5
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR 2520.00

PARTS 140.13

S/S 126.00

TOTAL
THANK YOU

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

[illegible]

Unit 214 Date Aug 12 2022
K.M. 256411 H.M. 17826
Location Red Deer

CVIP	
- change RH Rear steer wheel seal.	
- change Hyd Filter (Return)	
- change Air Dryer Element and purge Valve	
- Remove All Rear Drums Bearing to change wheel seals	
- Replaced Both joints on steering shaft	
- install 4 wide hood Flags	
- Repair wiring harness for Engine Heater	
- Replaced Oils Wind shield.	
- Top up Aux.	
- Replace Air line at Alcohol injector	
- Re fill hubs.	
- Drained number one cylinder and filled with	
- change signal stat and AIT.	
SUBLET:	
SHOP TIME: 100.75	
TOTAL HOURS:	
TOTAL HOURS:	

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



27592

SWAN HILLS ACHESON
FOX CREEK WHITECOURT

QUAI	PART NUMBER	DESCRIPTION	COST
1	001002626X	R-12 Valve	37.50
3		1/4 Synflex	3.21
1	124287	out put seal	14.45
1	123779	input seal	12.17
4/4	ATF	auto trans oil	20.92
2	F33/14-10-10	f. flgs	37.98

126.23

Unit 214 Date Sept 22
K.M. 257088 H.M. 17862
Location Red deer

- Test Rear Brakes found Malfunctioning
- Valve For Spike For Rear axle
- Replaced leaking power steering hose
- Replaced melted Synflex For Rear axle Spike air line
- Replaced Rear axle brake valve
- Replaced Leaking Front diff out put
- Replaced Leaking Rear diff input
- Changed oil & Filters in auto trans
- took oil sample & checked for codes
- Checked turbo waste gate & used smoke machine to check for Boost leaks
- ~~check~~ test 2 speed on # 2 winch works fine

SUBLET

SUBLET:

SHOP TIME: 15.5
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR 1240.00

PARTS 126.23

S/S 62.00

TOTAL THANK YOU 1428.23

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



27586

SWAN HILLS ACHESON
FOX CREEK WHITECOURT

QUAN	PART NUMBER	DESCRIPTION	COST
386	18-00-40	eng oil	129.96
1	LF 691A	o.17.11or	32.13
1	1R-0159	fuel c/b	25.36
1	FS1000	f/w exp.	19.70

207.15

Unit

Date

K.M.

H.M.

Location

- attached Level valve arm For cab
and R. side that had Backed off

- Re set popits in main steer box
I tested till perfect

- Wolder Replace d Deck pin pockets to 2"

- Re calibrated ECM to Heavy Haul Package

- Replaced all tool box locks

- Rilled #1 in floor and limited TDC #1
set all valves/VVAs

checked injectors and reassembled
replaced engine oil and filters to complete service

SUBLET

SUBLET:

SHOP TIME: 7
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR

PARTS

S/S

TOTAL
THANK YOU

560.00

207.15

28.00

795.15

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

P. B-264



NORTHWELL
Oilfield Hauling
(09) INC.

SWAN HILLS ACHESON
FOX CREEK WHITECOURT.

K.M. _____ H.M. _____

Location Acheson

[illegible]

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER

QUAN	PART NUMBER	DESCRIPTION	COST
20	K374-26-2	Shocks	Billed to unit
20	75W-90	gear oil	162.40
32L	15-W-40	Eng oil	129.96
1	FS-1000	Fuel Filter	19.70
1	LF6911A	oil Filter	32.13
1	IR-0749	Fuel Filter	25.36
1	123779	input seal	12.17
1	41033	Reflector	11.62
1	084-1000-306315	A/C BELT	22.00

Unit 214 Date Jan 21, 2023
 K.M. 263171 H.M. 18188
 Location Red deer

415.34

- Changed oil & Filter
- changed Fuel Filters
- Replaced Broken Reflector on Front Bumper
- Replaced Leaking Rear diff input Seal
- Filled Both d.f.s
- Greased Front to back
- tied up Loose transmission cooler lines
- Replaced Front L.H. & torque arm

SUBLET

SUBLET:

SHOP TIME:
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR

PARTS

S/S

TOTAL
THANK YOU

1040.00

415.34

52.00

 
1507.34

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK



SWAN HILLS ACHESON
FOX CREEK WHITECOURT

30139

[illegible]

26300

Unit 214 Date Mar 3 2022

K.M. 256353 H.M. 17821

Location Dawson Creek

Install Rear D.F.E.s. Aux Transmission
and Drive line.

SUBLET

1057 m

SUBLET:

SHOP TIME:
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR

PARTS

S/S

**TOTAL
THANK YOU**

1520	00
------	----

76	vi
----	----

1596	e)
------	----

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



SWAN HILLS ACHESON
FOX CREEK WHITECOURT

92692

Unit 214 Date Dec 2021

K.M. _____ H.M. _____

Location Acheson

[illegible]

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK

WORK ORDER



SWAN HILLS ACHESON
FOX CREEK WHITECOURT

2526

Unit 2141 Date Apr 10
K.M. 256353 H.M. 17221
Location Dawn Creek

[illegible]

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK	THANK YOU	16380
--	-----------	-------

[illegible]

25025

SWAN HILLS ACHESON
FOX CREEK WHITECOURT

Unit

Date _____

K.M.

H.M.

Location

- Suspension Repairs ✓
- Brake Repairs
- Suspension ✓
 - Replace Lower Ends & Bushings
 - Replace L.S. Rear Axles
 - Replace Torque Rod Bushings & Seals
 - Align rear axles as Best as possible
 - Repair all 4 Spindles ✓
 - Replace all H/S-Cons, Slacks, Brake Pots
 - Replace all H/BR Valves & Hoses
- Reline all sets of Brake Shoes & Machine drums
- All new oil in Diffs & Planets.

SUBLET

V. 700000 117

MITCHELL L

SUBLET:

Diurnal 10

SHOP TIME:
TOTAL HOURS:

TOTAL HOURS:

SUBLET:

LABOUR

PARTS

S/S

**TOTAL
THANK YOU**

ALL ESTIMATES ARE FOR LABOUR ONLY. MATERIALS ADDITIONAL. THIS COMPANY DOES NOT ASSUME ANY RESPONSIBILITY WHATSOEVER FOR VEHICLES OR EQUIPMENT LEFT FOR REPAIRS, STORAGE OR OTHER PURPOSES OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNER'S RISK