



WESTERN STAR TRUCKS (NORTH) LTD.

Address: 24210 - 114 Avenue | Acheson, AB T7X 6B9
Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Fax: 780-701-2272

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

**** Reprint ****

Invoice: **0010373291**

Date / Hour: 2026-08-14 3:53:39PM

Repair Order: 73291

Customer:

Branch: WSN

Total Invoice: \$ 5,586.43

CHARGE AR

Page 1

Bill To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5

Ship To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5
Office Phone: 250-787-9243
Email:

Work: 250-787-9243

Fax:

Customer P/O:

Add User: DKETCHUM

Open Date: 08/05/2026

Completion Date: 08/13/2026

Salesperson: HOUSE

Unit Number: 22074

Model Year: 2014

Make/Model: WST 4900EX

Type: USED TRACTOR

VIN: 5KJJABD10EPFY7062

Meter: 404167 Kilometers

ECM Reading: 25746

Task: 1 35-000001.01 AIR SYSTEM DIAGNOSE

Department: SERVICE

Complaint: CVIP ADD ON - REPAIR FOR:

- AIR LEAK AT FRONT DIFF LOCK
- AIR LEAK AT 5TH WHEEL SLIDE
- AIR LEAK AT FIREWALL
- AIR LEAK FROM REAR BRAKE VALVE WHEN BRAKES ARE APPLIED

Cause: QUOTED TIME IS FOR DIAGNOSTICS, ADDITIONAL PARTS AND LABOR MAY BE REQUIRED ONCE FAILURE IS DETERMINED

Correction: CVIP ADD ON FOR AIR LEAKS. REPAIRED REAR CHASSIS AIR LEAKS. HAD TO AIR UP UNIT FROM AIR TANK. LOTS OF MOISTURE WAS PRESENT. REPLACED BULKHEAD AIR FITTING AT FIFTH WHEEL AND CONNECTED AIRLINES. REPLACED AIR FITTING AT #2A DIFF LOCK AND CONNECTED AIRLINE. TESTED FOR LEAKS. READJUSTED AIRLINES AT BULKHEAD CONNECTOR AND DIFF LOCK FITTING. RETEST FOR AIR LEAKS. TIGHTENED AIR LINE AT FIREWALL. REMOVED AND REPLACED LHS REAR MODULATOR VALVE. TESTED FOR AIR LEAKS. TASK COMPLETE.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	884.PC1469-4B	ELBOW, PTC 90 Deg 1/4X1/4	EA	1.0	\$5.41	\$5.41
	HLD XB11298	FITTING	EA	1.0	\$19.36	\$19.36
	TDA S472 195 079 0	VALVE, Modulator	EA	1.0	\$294.48	\$294.48
	SS SVC	SHOP SUPPLIES		1.0	\$70.08	\$70.08
				Task 1 Subtotals	Parts:	\$319.25
					Labor:	\$876.00
					Miscellaneous:	\$70.08
				Task 1 Subtotals		\$1,265.33

Task: 2 60-100014.01 INSTALL REFLECTIVE TAPE

Department: SERVICE

Complaint: CVIP ADD ON - REPAIR FOR MISSING REFLECTORS ON REAR MUDFLAPS

Correction: REMOVED OLD MUD FLAPS AND INSTALLED NEW ONES. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	671-8599-02	MUDFLAP, Triple Header - WSNORTH	EA	2.0	\$36.25	\$72.50
	BTS RT25	STRIPS, Reflective (2)	EA	1.0	\$51.03	\$51.03
BAY 30	SS SVC	SHOP SUPPLIES		1.0	\$14.02	\$14.02
				Task 2 Subtotals	Parts:	\$123.53
					Labor:	\$175.20
					Miscellaneous:	\$14.02
				Task 2 Subtotals		\$312.75

**** See Last Page for Invoice Total ****



WESTERN STAR TRUCKS (NORTH) LTD.

Address: 24210 - 114 Avenue | Acheson, AB T7X 6B9
Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Fax: 780-701-2272

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

**** Reprint ****

Invoice: **0010373291**

Date / Hour: 2026-08-14 3:53:39PM

Repair Order: 73291

Customer:

Branch: WSN

Total Invoice: \$ 5,586.43

CHARGE AR

Page 2

Bill To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5

Ship To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5
Office Phone: 250-787-9243
Email:

Work: 250-787-9243

Fax:

Customer P/O:

Open Date: 08/05/2026

Completion Date: 08/13/2026

Add User: DKETCHUM

Salesperson: HOUSE

Task: 3 34-000001.01 LIGHTING DIAGNOSE

Department: SERVICE

Complaint: CVIP ADD ON - CHECK AND ADVISE FOR:

- LICENSE PLATE LIGHT NOT WORKING
- REVERSE LIGHT'S NOT WORKING

Correction: FOUND CORRODED WIRED CUT OUT CORROSION TESTED, REVERSE LIGHTS STILL NOT WORKING, TESTED POWER TO THE PLUGS AND HAD GROUND BUT NO POWER, CHECKED PLUG ON TOP OF TRANSMISSION HAD NO POWER, CHECKED AND REPLACED FUSE TESTED AT REVERSE SWITCH AND HAD POWER AND GROUND REPLACED REVERSE SWITCH AND REVERSE LIGHTS NOW WORK.
REPLACED LICENSE PLATE LIGHT TIED UP ALL WIRING AND REINSTALLED BACK COVER. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	FUL 15900	GASKET, Reverse Switch	EA	1.0	\$2.43	\$2.43
	GRO 60701	LICENSE LAMP, 15 SERIES DOT	EA	1.0	\$18.29	\$18.29
	SDO 72152	SWITCH - BACKUP LT, TRAN, 9/16	EA	1.0	\$27.17	\$27.17
	SS SVC	SHOP SUPPLIES		1.0	\$31.54	\$31.54
Task 3 Subtotals				Parts:		\$47.89
				Labor:		\$394.20
				Miscellaneous:		\$31.54
				Task 3 Subtotals		\$473.63

Task: 4 16-100020.02 TORQUE ROD REPLACEMENT (ONE)

Department: SERVICE

Complaint: CVIP ADD ON - REPLACE TORQUE ROD ON CAB (WORN)

Cause: CAB TORQUE ROD WORN

Correction: CAB TORQUE ROD WORN. INSPECTED AND CONFIRMED ROD IS WORN AND HAS MOVEMENT. REMOVED ROD. HAD TO ZIP CUT ONE BOLT OUT. INSTALL NEW TORQUE ROD. TASK COMPLETE. NO WARRANTY

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	18-69199-000	ROD, Cab Tracking 364.22mm	EA	1.0	\$220.47	\$220.47
	SS SVC	SHOP SUPPLIES		1.0	\$26.28	\$26.28
Task 4 Subtotals				Parts:		\$220.47
				Labor:		\$328.50
				Miscellaneous:		\$26.28
				Task 4 Subtotals		\$575.25

Task: 5 46-200001.01 AFTER TREATMENT REPAIR

Department: SERVICE

Complaint: CVIP ADD ON - REPLACE DEF TANK BOTTONG MOUNTING (RUSTED/BROKEN)

FABRICATE TO CORRECT ISSUE AS NEW TANK BRACKET IS \$700.00

** See Last Page for Invoice Total **



WESTERN STAR TRUCKS (NORTH) LTD.

Address: 24210 - 114 Avenue | Acheson, AB T7X 6B9
Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Fax: 780-701-2272

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

**** Reprint ****

Invoice: **0010373291**

Date / Hour: 2026-08-14 3:53:39PM

Repair Order: 73291

Customer:

Branch: WSN

Total Invoice: \$ 5,586.43

CHARGE AR

Page 3

Bill To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5

Ship To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5
Office Phone: 250-787-9243
Email:

Work: 250-787-9243

Fax:

Customer P/O:

Open Date: 08/05/2026

Completion Date: 08/13/2026

Add User: DKETCHUM

Salesperson: HOUSE

Correction: DEF TANK BRACKET BROKEN. DRAINED COOLANT. REMOVED LINES FROM HEADER. REMOVED TANK.
REMOVED DEF TANK BRACKET. HANDED OVER TO FAB FOR REPAIRS. REBUILD DEF TANK SUPPORT. INSTALLED DEF TANK
BRACKET. REINSTALLED DEF TANK AND ALL HOSE /BRACKETS AND COVERS. REFILLED WITH COOLANT. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	SS SVC	SHOP SUPPLIES		1.0	\$96.36	\$96.36
				Task 5 Subtotals	Parts:	\$0.00
					Labor:	\$1,204.50
					Miscellaneous:	\$96.36
				Task 5 Subtotals		\$1,300.86

Task: 6 17-200001.01 TIRE REPAIR

Department: SERVICE

Complaint: CVIP ADD ON - REPLACE LHS #3 OUTER VALVE CORE (LEAKING)

Correction: REMOVED AND REPLACED #3A LHS OUTER VALVE CORE. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	ABP N83 320110	CORE, SCHRADER VALVE	EA	1.0	\$1.12	\$1.12
	SS SVC	SHOP SUPPLIES		1.0	\$8.76	\$8.76
				Task 6 Subtotals	Parts:	\$1.12
					Labor:	\$109.50
					Miscellaneous:	\$8.76
				Task 6 Subtotals		\$119.38

Task: 7 43-200001.01 EXHAUST SYSTEM REPAIR

Department: SERVICE

Complaint: CVIP ADD ON - REPAIR FOR EXHAUST HANGER CLAMP BROKEN

Correction: CUT OFF OLD CLAMP AND INSTALLED NEW ONE. CLEANED UP WORK SPACE. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	ABP N35 500GCRS	CLAMP, Guillotine 5" STEEL	EA	1.0	\$8.72	\$8.72
	SS SVC	SHOP SUPPLIES		1.0	\$14.02	\$14.02
				Task 7 Subtotals	Parts:	\$8.72
					Labor:	\$175.20
					Miscellaneous:	\$14.02
				Task 7 Subtotals		\$197.94

Task: 8 13-100005.02 DRIVE/TRAILER BRAKE CHAMBER SPRING POT R/R (TWO)

Department: SERVICE

Complaint: CVIP ADD ON - REPLACE #2 BRAKE POTS - BOTH SIDES (BROKEN SPRINGS)

Cause: BRAKE POTS BROKEN SPRINGS

Correction: AXLE 2 BOTH SIDES BRAKE POT SPRINGS BROKEN. REMOVED BRAKE POTS. INSTALLED BRAKE POTS. TEST BRAKES
FUNCTIONS. WORKING. CUT OLD BRAKE POTS. TASK COMPLETE. NO WARRANTY

** See Last Page for Invoice Total **



WESTERN STAR TRUCKS (NORTH) LTD.

Address: 24210 - 114 Avenue | Acheson, AB T7X 6B9
Phone: 780-453-3452 | Toll Free: 1-800-252-7500 | Fax: 780-701-2272

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

**** Reprint ****

Invoice: **0010373291**

Date / Hour: 2026-08-14 3:53:39PM

Repair Order: 73291

Customer:

Branch: WSN

Total Invoice: \$ 5,586.43

CHARGE AR

Page 4

Bill To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5

Ship To: DUSTY ROSE ENTERPRISES LTD.
12243 PACIFIC AVE
FORT ST. JOHN, BC V1J 8A5
Office Phone: 250-787-9243
Email:

Work: 250-787-9243

Fax:

Customer P/O:

Add User: DKETCHUM

Open Date: 08/05/2026

Completion Date: 08/13/2026

Salesperson: HOUSE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	BW K065544	BRAKE CHAMBER, DISC	EA	2.0	\$300.84	\$601.68
	SS SVC	SHOP SUPPLIES		1.0	\$35.04	\$35.04
Task 8 Subtotals						Parts: \$601.68
						Labor: \$438.00
						Miscellaneous: \$35.04
Task 8 Subtotals						\$1,074.72

Task: 9 35-000001.03 REPLACE GLAD HAND SEALS

Department: SERVICE

Complaint: CVIP ADD ON REPLACE GLAD HAND SEALS (NO TIME)

Cause: NO TIME/ PARTS ONLY

Correction: REPLACED GLAD HAND SEALS. TASK COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	ABP N42AGHSL	GLADHAND SEAL - BLACK NEOPRENE	EA	2.0	\$0.27	\$0.54
	SS SVC	SHOP SUPPLIES		1.0	\$0.00	\$-
Task 9 Subtotals						Parts: \$0.54
						Labor: \$0.00
Task 9 Subtotals						\$0.54

GST/HST Number: 892297052RT0001

Detail Tax Info:

GST \$266.03
Total: \$266.03

Total Parts: \$1,323.20
Total Labor: \$3,701.10
Total Miscellaneous: \$296.10
Invoice Subtotal: \$5,320.40
Total Tax: \$266.03
Total Invoice: \$5,586.43

Payment Method

Terms

Due Date

CHARGE AR

NET 30

2026-09-13

Remit To

WESTERN STAR TRUCKS ACHESON
24210 - 114 AVENUE
ACHESON, AB T7X 6B9



FTCI - Fort St. John
A Division of Velocity Vehicle Group
9604 - 112TH STREET
FORT ST JOHN, BC V1J 7H2
(250) 785 - 7907

Please Remit Payment to:
First Truck Centre, INC
(DBA Velocity Truck Centres)
C/O VX5339
PO Box 7727
Vancouver, BC V6B 4E2

Emailed

GST #:
119401776 RT001

SERVICE ORDER: RA810036649

Date Arrived: 03/03/2025
Date Invoiced:
SalesType: SR
PO No:
Terms: 30
Advisor: LIAM P.
Email: LPAGE@VVGTRUCK.CA
Salesman: LIAM P.
Reviewer:

BILL TO
DUSTY ROSE ENT
12243 PACIFIC AVENUE
FORT ST JOHN BC V1J 8A5
P: (250) 261-0466 F:

DELIVER TO
DUSTY ROSE ENT
12243 PACIFIC AVENUE
FORT ST JOHN BC V1J 8A5
P: (250) 261-0466 F:

VIN: 5KJJABD10EPFY7062 Fleet Unit #: C470
Year/Make/Model: 2014 WESTERN STAR 4900EX
Engine Model / Serial#: D473902 / 473908S0220621
Engine Hours: 24,298
Trans Model / Serial#: RTLO-20918B / S1049322
Front Axle Model / Serial#:
Rear FWD Axle Model / Serial#:
Rear Rear Axle Model / Serial#:

Mileage: 887331
Body ID#:
License#:
Axle Ratio:
Tag#: SALP
Selling Dealer:
Date In Svc: 01/22/2014

JOB #1 02 SR

Express Assessment

COMPLAINT INTERMITTENT HIGH IDLE AND CRUISE NOT FUNCTIONING.
WORKS, HITS A BUMP, THEY STOP WORKING.

CAUSE

CORRECTION WARM ENGINE UP
TRY HIGH IDLE AND CONFIRM NOT WORKING
TRY JAKES ALL WORK
CONNECT DDDL8 CHECK CODES NOTHING TO DO WITH HIGH IDLE
CHECK SWITCH FUNCTION
CRUISE ON/OFF CHANGES STATE
CRUISE SET/RESUME CHANGES STATE
CHECK PARK PRAKE SWITCH FUNCTION CHANGES STATE
CHECK SERVICE BRAKE ALSO CHANGES STATE
PUT TICKET INTO CSC #14320781
REMOVED CPC4
BENCH PROGRAM TEST CPC4
AND INSTALLED TEST CPC - CLUTCH SWITCH NOW READING ON/OFF
NO MORE ACTIVE HARDWARE CODE FOR CPC
MADE CHANGES AS PER REQUEST, NO CHANGE IN OPERATION
INSTALLED NEW REPLACEMENT CPC AND TESTED: HIGH IDLE WORKS NOW.
NO FAULTS PRESENT.
TEST DRIVER UNAVAILABLE, CUSTOMER WILL COME AND TEST DRIVE FOR US.
ALL GOOD.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	810D/DDE RA0034461002	ECU CPC 4.0 HDEP GHG14	2,272.49	2,272.49
-1	810D/DDE RA0034461002-CORE	CORE	1,627.49	-1,627.49
1	810D/DDE RA0034461002-CORE	CORE	1,627.49	1,627.49
1	HAZMAT	HAZMAT - DISPOSAL	35.00	35.00
Parts: \$2,272.49 Labor: \$500.00 Other: \$35.00 Sublet: \$0.00				\$2,807.49

JOB #2- 20 SR,

Engine Cooling System, Radiator

COMPLAINT

COOLANT LEAK @ EGR COOLER (INLET SIDE)

CAUSE

CORRECTION

PRESSURE TEST COOLING SYSTEM TO 15 PSI
 CONFIRM REAR WATER MANIFOLD SEAL LEAKING AT EGR COOLER
 DRAIN COOLING SYSTEM
 REMOVED EGR HOT PIPE CLAMPS AND PIPE
 REMOVED COOLANT VENT FITTING
 REMOVED ROCKER COVER MOUNTING PLATE
 REMOVED A/C LINE CLAMPS
 REMOVED EGR COOLER CLAMPS
 REMOVED EGR COOLER
 CLEAN COOLER AND WATERMANIFOLD PORTS
 INSTALLED NEW RUBBER SEALS
 REINSTALLED COOLER TORQUE COOLER MOUNT CLAMPS 14 LBS
 NEW SEAL RINGS ON COOLANT VENT HOSE
 NEW EGR HOT PIPE CLAMPS AND INSTALLED PIPE
 REFILLED COOLING SYSTEM
 CHECKED FOR LEAKS: NONE
 RAN UNIT UP TO TEMP: NO LEAKS.
 ALL GOOD.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2	810D/DDE A0019950502	CLAMP - EGR PIPE	47.59	95.18
1	810D/DDE A4721400648	COUPLING - WATER MANIFOLD	126.99	126.99
2	810D/DDE A4722000154	COUPLING - WATER MANIFOLD	26.79	53.58
2	810D/DDE N000000001069	SEALING RING, M14	1.20	2.40
2	810X/REC 16-914R	HDX ENDR ELC 50/50 OAT - RED	13.68	27.36
1	HAZMAT	HAZMAT - DISPOSAL	0.00	0.00
2	BCEA37	ANTIFREEZE (BCE-A378)	1.32	2.64
	C	208/PALLET		

Parts: \$305.51 Labor: \$620.00 Other: \$2.64 Sublet: \$0.00

\$928.15

JOB #3- 00A SR**Additional Repairs (Add On Op)****COMPLAINT**

EXHAUST LEAK
(CAN SMELL IN CAB)

CAUSE**CORRECTION**

REMOVED EXHAUST TURBO HEAT COVERS
CONFIRM SOOT ON INSIDE
START UNIT AND SPRAY SOAP WATER ON ALL CLAMPS
FOUND APT CLAMPS LEAKING SLIGHTLY
TRY TO TIGHTEN BUT ARE TIGHT
REMOVED BELLOWS CLAMPS AND INSIDE FULL OF SOOT
NOTICED COOLANT LEAK AT EGR COOLER
COULD BE WELD AT SEAM OR MOUNTING SEAL AT REAR OF EGR COOLER WOULD NEED TO PRESSURE UP
COOLANT SYSTEM AND EGR COOLER TO CONFIRM
SENT PICTURES TO SERVICE OF COOLANT LEAK AND EXHAUST LEAK
WILL NEED TO REMOVE TURBO TO REMOVE BELLOWS EXHAUST PIPE
REMOVED TURBO MOUNT BOLTS AND GASKET
REMOVED AIR INTAKE PIPE
REMOVED EXHAUST BELLOWS
CLEAN APT AND TURBO
SOME PITTING ON APT
NOTICED SMALL BURR ON APT BELLOWS
REMOVED EXHAUST S PIPE MOUNTING BOLTS AND REMOVED METAL GASKET (SLIGHT EVIDENCE OF LEAK)
INSTALLED NEW APT BELLOWS PIPE AND CLAMPS
INSTALLED TURBO WITH NEW GASKET AND MOUNTING BOLTS
INSTALLED LOWER TURBO BRACKET AND OIL DRAIN PIPE
INSTALLED AIR LINE AND AIR PIPE
INSTALLED NEW APT CLAMP AND SEAL
TIGHTEN EXHAUST S PIPE
CLEAN HEAT SHIELDS
START UNIT TRY HIGH IDLE WORKS NOW
LET UNIT RUN AND RECHECK FOR EXHAUST LEAKS OK
RECHECK ALL EXHAUST CLAMPS AND TIGHTEN AS NEEDED

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	810D/DDE A0019954102	PIPE CLAMP	41.79	41.79
1	810D/DDE A0019957302	PIPE CLAMP	49.59	49.59
1	810D/DDE A0029951502	CLAMP - PIPE SECTION TURBOCOMP	67.99	67.99
4	810D/DDE A0219901101	MOUNTING BOLT, TURBOCHARGER	18.69	74.76
1	810D/DDE A4721400408	EXH GAS LINE	507.49	507.49
1	810D/DDE A4721421380	GASKET - EXHAUST LINE, TURBOCO	16.89	16.89
1	810D/DDE A4730960280	METAL SEAL	71.99	71.99
1	HAZMAT	HAZMAT - DISPOSAL	0.00	0.00

Parts: \$830.50 Labor: \$1,400.00 Other: \$0.00 Sublet: \$0.00 \$2,230.50

JOB #4 00A SR**Additional Repairs (Add On Op)****COMPLAINT**

SOOT BUILDUP ON HEATSHIELD AROUND TURBO

CAUSE**CORRECTION**

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	HAZMAT	HAZMAT - DISPOSAL	0.00	0.00

Parts: \$0.00 Labor: \$0.00 Other: \$0.00 Sublet: \$0.00 \$0.00

JOB #5 05-INSP SR

Courtesy Inspection

COMPLAINT

COURTESY INSPECTION

CAUSE

CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE

Parts: Labor: Other: Sublet:

REVIEW COPY

I, the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed on this repair order. Permission is also granted to your employees to operate the vehicle herein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that Velocity Truck Centre does not assume any responsibility whatsoever to vehicles or contents while in their possession.

****Disclaimer of Warranty****

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and Velocity Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products. Velocity Truck Centre shall not be liable for special, indirect or consequential damages, e.g.: down time, loss of revenue, loss of vehicle, towing charges, driver's expenses, loss of perishable cargo, etc. Failed parts return requests must be made when the unit is checked in. Please be aware that any aftermarket modifications to OEM components are customer responsibility. Velocity Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs. Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than Velocity Truck Centre then Velocity Truck Centre must be contacted to be involved in the repair decision.

I/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/we agree to pay interest at the rate of 1 1/2% per month (18% per annum), if the balance due is not paid within the credit terms of Velocity Truck Centre.

I/we also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.

LABOR	\$2,520.00
PARTS	\$3,408.50
OTHER	\$37.64
SUBLET	\$0.00
MISCELLANEOUS	\$302.40
SUBTOTAL	6,268.54
GST	\$313.43
PST	\$0.00
TOTAL	\$6,581.97



Tell Us How We Did

As an Elite Support dealer, we inspect every job for quality of workmanship. A 15-point Quality Inspection Report is complete by a factory trained technician at the end of your repair.

Your QI report for RO# RA810036649 was completed by staff ID # _____

AUTHORIZED BY _____ DATE _____