



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca

2/9-5
SEP



SEE REVERSE CELL PRI 780-907-5842

G.S.T. 88512 9155 RT
CUSTOMER NO.

ALL ITEMS ARE SUBJECT TO G.S.T.

O
U
T

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL
OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER.

DATE _____ SIGNATURE ✓

RMS LEASING

ADVISOR KAMI CRERAR	TAG NO. 37839	7295	INVOICE DATE 10/16/23	INVOICE NO. FCCS566534
LABOUR RATE	LICENSE NO.	KILOMETRES 242, 231	COLOUR /	STOCK NO.
YEAR/MAKE/MODEL 03/FORD/F550			DELIVERY DATE	DELIVERY KMS.
VEHICLE I.D. NO. 1 F D A F 5 6 F 9 3 E A 4 3 0 6 9			SELLING DEALER NO.	PRODUCTION DATE
F.T.E. NO.			P.O. NO. 0440	R.O. DATE 09/12/23
F.T.E. NO.			IN SERVICE DATE	

RESIDENCE PHONE

BUSINESS PHONE

COMMENTS

MO: 242231

LABOR & PARTS

J# 1 21FOZ CVIP INSPECTION TECH(S):24496 249.95
COMPLAINT: PERFORM CVIP INSPECTION
CORRECTION: UNABLE TO COMPLETED CVIP DUE TO ALBERTA TRANSPORTATION SITE
TO BE DOWN. CVIP FOR T-7140 2003 F550
BRAKE MEASUREMENTS
PADS, LF: 12MM, RF: 12MM, LR: 8MM, RR: 8MM
ROTORS, LF: 37.93MM, RF: 37.86MM, LR: 37.64MM, RR: 37.76MM
OIL LEAKS, POSSIBLE REAR MAIN, FRONT COVER, OIL PAN, HIGH
PRESSURE OIL PUMP, REAR DIFF HOUSING COVER,
RR INNER WHEEL DAMAGED AND NOT ABLE TO FILL UP WITH AIR DUE
TO INSIDE BEAD NOT SETTING
COOLANT RESERVOIR CRACKED
AIR FILTER
TIRE TREAD DEPTH
LF: 11MM, RF: 11MM, LRI: 12MM, LRO: 11MM, RRI: 11MM, RRO:
11MM

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 1 TOTAL PARTS 0.00
JOB # 1 TOTAL LABOR & PARTS 249.95

J# 2 09FOZZ14 VALET TECH(S):1 0.00
COMPLAINT: C/S: PICK UP AND DELIVER VEHICLE AS PER FORD OF CANADAS COMP
LIMENTARY PICK UP AND DELIVERY PROGRAM

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 2 TOTAL PARTS 0.00
JOB # 2 TOTAL LABOR & PARTS 0.00

J# 3 92FOZ TEXT APPROVAL TECH(S):1 0.00
COMPLAINT: You consent to receiving texts from us on your cell phone
at the number, You have provided. You agree that we may
contact you regarding service updates or offers via text
If you do not agree, you may provide land line

CAUSE:
CORRECTION: .
PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 3 TOTAL PARTS 0.00
JOB # 3 TOTAL LABOR & PARTS 0.00

J# 4 22FOZMISC SHOP SUPPLY/PPE/ENVI TECH(S):1 0.00
COMPLAINT: \$10 ENVIRONMENTAL DISPOSAL FEE, 13% OF LABOR TO MAX \$50 SHOP
SUPPLIES/PPE
PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 4 TOTAL PARTS 0.00
JOB # 4 TOTAL LABOR & PARTS 0.00

IMPORTANT

AS A SERVICE CUSTOMER,
YOU MAY RECEIVE A
RANDOM SURVEY FROM
FORD CANADA
REGARDING HOW
SHERWOOD FORD STAFF
TREATED YOU AND MET
YOUR SERVICE NEEDS.
THESE ARE VERY
IMPORTANT TO OUR
SERVICE STAFF AS WE
USE THESE RESULTS
IN OUR PERSONAL
ASSESSMENT PROGRAMS.
ACCORDINGLY, WE
WOULD APPRECIATE
YOU TAKING THE TIME
TO COMPLETE AND
RETURN THE SURVEY.

Thank You

Due to Environmental
Regulations there is a
nominal fee for the
collection and
disposal of hazardous
material such as
oil filters, engine oil,
glycol transmission
fluid, etc.



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca



SEE REVERSE OF PRIVACY STATEMENT

G.S.T. 88512 9155 RT

ALL ITEMS ARE SUBJECT TO G.S.T.

OUT

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER.

DATE _____ SIGNATURE _____

CUSTOMER NO.	ADVISOR	TAG NO.	INVOICE DATE	INVOICE NO.
RMS LEASING	KAMI CRERAR	37839	10/16/23	FCCS566534 4
	LABOUR RATE	LICENSE NO.	COLOUR	STOCK NO.
			/	
	YEAR/MAKE/MODEL	KILOMETRES	DELIVERY DATE	DELIVERY KMS.
	03/FORD/F550	242, 231		
	VEHICLE I.D. NO.		SELLING DEALER NO.	PRODUCTION DATE
	1 F D A F 5 6 F 9 3 E A 4 3 0 6 9			
	F.T.E. NO.	P.O. NO.	R.O. DATE	IN SERVICE DATE
		0440	09/12/23	
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS		
		M0: 242231		

LABOR & PARTS
JH 5 20F0209 COMPLIMENTARY INSP TECH(S) 24496 0.00
COMPLAINT: COMPLIMENTARY INSPECTION

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 5 TOTAL PARTS 0.00
JOB # 5 TOTAL LABOR & PARTS 0.00

JH 6 150F02 SMALL SERVICE TECH(S) 24496 189.95
Added Operation (KAMI @ 10/02/2023 09:41)
COMPLAINT: check ds rear brake caliper may be seized
CAUSE: CUSTOMER CONCERN OF DRIVER SIDE REAR BRAKE CALIPER SEIZED
CORRECTION: INSPECTED CUSTOMER CONCERN, REMOVED DRIVERS SIDE DUAL REAR WHEEL AND TIRE. REMOVED REAR DRIVERS REAR BRAKE CALIPER AND INSPECTED CONCERN. FOUND THAT I WAS UNABLE TO RECESS ONE OF THE BRAKE CALIPER PISTON. UNIT REQUIRES DRIVERS REAR CALIPER AND LINE DUE TO RUST ON BRAKE LINE AND POSSIBILITY OF THE BOLT TO THE CALIPER BEING SEIZED. PROVIDED ESTIMATE.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 6 TOTAL PARTS 0.00
JOB # 6 TOTAL LABOR & PARTS 189.95

JH 7 20F02 VEHICLE INSPECTIONS TECH(S) 24496 199.95
Added Operation (KAMI @ 10/05/2023 07:22)
COMPLAINT: CVIP REINSPECTION
CAUSE: CVIP INSPECTION
CORRECTION: COMPLETED CVIP INSPECTION. UNIT PASSED, PRINTED OFF PAPERWORK AND SIGNED AND HANDED TO ADVISOR FOR CUSTOMER TO SIGN.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 7 TOTAL PARTS 0.00
JOB # 7 TOTAL LABOR & PARTS 199.95

JH 8 52F0ZZ2552-A RR CALIPER TECH(S) 24496 379.90
Added Operation (KAMI @ 10/05/2023 17:13)
COMPLAINT: REPLACE DRIVERS REAR CALIPER ASSY
CAUSE: DRIVERS REAR CALIPER SEIZED.
CORRECTION: REPLACED REAR CALIPER ASSY AND LINE, BLED DRIVERS REAR BRAKE CALIPER. REQUIRED EXTRA TIME DUE TO REMOVE SEIZED BRAKE LINE 0.5hrs.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 8 3 CPM-1-C FLUID - D02 12.16 36.48
JOB # 8 1 382789-FLEX LINE 52.68 52.68
JOB # 8 2 EOAZ-2149-B WASHER Z00 2.96 5.92
JOB # 8 1 -385116-S2 BOLT Z00 10.28 10.28
JOB # 8 1 3185XA-CALIPOR 240.63 240.63
JOB # 8 TOTAL PARTS 345.99

IMPORTANT
AS A SERVICE CUSTOMER, YOU MAY RECEIVE A RANDOM SURVEY FROM FORD CANADA REGARDING HOW SHERWOOD FORD STAFF TREATED YOU AND MET YOUR SERVICE NEEDS. THESE ARE VERY IMPORTANT TO OUR SERVICE STAFF AS WE USE THESE RESULTS IN OUR PERSONAL ASSESSMENT PROGRAMS. ACCORDINGLY, WE WOULD APPRECIATE YOU TAKING THE TIME TO COMPLETE AND RETURN THE SURVEY.

Thank You

Due to Environmental Regulations there is a nominal fee for the collection and disposal of hazardous material such as oil filters, engine oil, glycol transmission fluid, etc.

HF-10A



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca



SEE REVERSE FOR PRIVATE STATEMENT

G.S.T. 88512 9165 RT

ALL ITEMS ARE SUBJECT TO G.S.T.

O
U
T

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL
OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER.

DATE _____ SIGNATURE ✓ _____

CUSTOMER NO.	ADVISOR KAMI CRERAR	37839	TAG NO. 7295	INVOICE DATE 10/16/23	INVOICE NO. FCCS566534
RMS LEASING	LABOUR RATE	LICENSE NO.	KILOMETRES 242,231	COLOUR /	STOCK NO.
	YEAR/MAKE/MODEL 03/FORD/F550			DELIVERY DATE	DELIVERY KMS.
	VEHICLE I.D. NO. 1 F D A F 5 6 F 9 3 E A 4 3 0 6 9			SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO. 0440		R.O. DATE 09/12/23	IN SERVICE DATE
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS			

MO: 242231

JOB # 8 TOTAL LABOR & PARTS 725.89

MISC	CODE	DESCRIPTION	CONTROL NO
JOB # A	SS	SHOP SUPPLIES	
			TOTAL - MISC
			25.00
			25.00

COMMENTS

X05NE8179F: created 2023-09-11 10:48:00am taken by Brandi Dobranski

CAN KEEP OVERNIGHT

RECOMMENDED NOT DONE/ DECLINED SERVICES

52FOZZ06 REAR PADS & REPL ROT TECH: 24496 \$1874.57

COMPLAINT: REPLACE REAR PADS AND ROTORS

CAUSE: REAR BRAKE PADS, INNER PADS ARE COMING APART. REAR ROTORS DO NOT HAVE ENOUGH MATERIAL TO REFINISH.

50FOZZ18 SER BATT TERMINALS TECH: 24496 \$90.15

COMPLAINT: SERVICE BATTERY TERMINALS

CAUSE: EXCESSIVE CORROSION ON BATTERY TERMINALS.

51FOZZTIRE3 TIRE CONCERN TECH: 24496 \$474.86

COMPLAINT: RIGHT REAR INNER WHEEL IS DAMAGED AND UNABLE TO SET THE BEAD

CAUSE: ONTO RIM. REQUIRES NEW RIM
NEW RIM REQUIRED

50FOZZ14 REPL AIR FILTER TECH: 24496 \$68.72

COMPLAINT: REPLACE AIR FILTER

CAUSE: DIRTY AND PLUGGED

56FOZZZ6781-A OIL PAN GSKT TECH: 24496 \$3785.22

COMPLAINT: REPLACE OIL PAN GASKET

CAUSE: LEAK, ADDED TIME DUE TO AGE OF UNIT

56FOZZZ6020-A TIMING COVER GSKT TECH: 24496 \$4512.91

COMPLAINT: REPLACE TIMING COVER GASKET

CAUSE: LEAK, ADDITIONAL TIME ADDED DUE TO AGE OF UNIT

18FOZZZ6083-A RR ENG COVER GSKT TECH: 24496 \$2016.70

COMPLAINT: REPLACE REAR ENGINE COVER GASKET

CAUSE: LEAK, ADDED TIME DUE TO AGE OF VEHICLE.

56FOZZZENGINE2 ENGINE LEAK CONCERN TECH: 24496 \$225.37

COMPLAINT: INSPECT FOR POSSIBLE HIGH PRESSURE OIL PUMP LEAKING

CAUSE: UNABLE TO PINPOINT IF THE HIGH PRESSURE OIL PUMP IS LEAKING

56FOZZZCOOL5 COOLANT CONCERN TECH: 24496 \$476.82

COMPLAINT: COOLANT RESERVOIR CRACKED

CAUSE: COOLANT RESERVOIR CRACKED CAUSING LEAK.

TAX SUMMARY

GST 69.54 RT885129155

IMPORTANT

AS A SERVICE CUSTOMER,
YOU MAY RECEIVE A
RANDOM SURVEY FROM
FORD CANADA
REGARDING HOW
SHERWOOD FORD STAFF
TREATED YOU AND MET
YOUR SERVICE NEEDS.

THESE ARE VERY
IMPORTANT TO OUR
SERVICE STAFF AS WE
USE THESE RESULTS
IN OUR PERSONAL
ASSESSMENT PROGRAMS.
ACCORDINGLY, WE
WOULD APPRECIATE
YOU TAKING THE TIME
TO COMPLETE AND
RETURN THE SURVEY.

Thank You

Due to Environmental
Regulations there is a
nominal fee for the
collection and
disposal of hazardous
material such as
oil filters, engine oil,
glycol transmission
fluid, etc.

Sherwood Ford Inspection

Customer Name: RMS LEASING

Vehicle Year/Model: 03 FORD

Phone: (W)

Service Advisor: KAMI CRERAR

VIN: 1FDAF56F93EA43069

Technician: GHADI SALAME

Tag: 7295

Printed: 10/16/2023 11:20:43
Odometer: 242231
RO: 566534

INSPECTION RESULT - OK

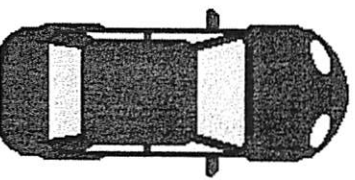
WILL REQUIRE FURTHER ATTENTION

REQUIRES IMMEDIATE ATTENTION

Green Yellow Red

Serviced

☒	☐	☐	Inspect wiper/washer operation including front and rear blades	☐
☒	☐	☐	Inspect exterior lamps/lights/bulbs (operation/damage)	☐
☒	☐	☐	Warning lights	☐
☒	☐	☐	Inspect dash lights/interior lights/horn operation	☐
☒	☐	☐	Interior	☐
☒	☐	☐	Exterior	☐
☐	☐	☒	Inspect engine air filter	☐
NOT APPLICABLE Inspect cabin air filter (if equipped)				
☒	☐	☐	Inspect drive belts and hoses	☐
☒	☐	☐	Check brake fluid level and condition	☐
☒	☐	☐	Check engine coolant level and condition	☐
☒	☐	☐	Check power steering fluid level and condition	☐
☒	☐	☐	Check transmission fluid level and condition (most models)	☐
☒	☐	☐	Inspect front /rear differential and transfer case (leaks)	☐
☒	☐	☐	Inspect exhaust system (leaks/damage/loose parts)	☐
☒	☐	☐	Inspect brake system components (leaks/wear/damage)	☐
☒	☐	☐	Inspect steering system (leaks/wear/damage)	☐
☐	☐	☒	Inspect cooling system (leaks/wear/damage)	☐
☒	☐	☐	Inspect heating and air conditioning operation	☐
☒	☐	☐	Inspect front suspension	☐
☒	☐	☐	Inspect rear suspension	☐
☒	☐	☐	Inspect axles/driveshaft(s)/U-joints/CV joints/boots	☐
☒	☐	☐	Inspect transmission for leaks	☐
☒	☐	☐	Inspect engine (leaks/wear/damage)	☐
☒	☐	☐	Inspect fuel & emission system	☐
☒	☐	☐	Time/mileage requirements	☐
Brake Lining Measurements: LF: 12 mm RF: 12 mm LR: 7 mm RR: 7 mm				
Tire Tread Measurements: LF: 11 mm RF: 11 mm LR: 11 mm RR: 11 mm				
Tire Pressure Measurements: LF: 95psi RF: 95psi LR: 95psi RR: 95psi				

Front / Rear Brake Linings					
LF	☒	Green	RF	☒	Green
	☐	Yellow		☐	Yellow
	☐	Red		☐	Red
					
LR	☒	Green	RR	☒	Green
	☐	Yellow		☐	Yellow
	☐	Red		☐	Red

☐ Inspection Not Taken

More than 50% remaining
20% to 50% remaining
less than 20% remaining

Check Tires / Tread Depth					
LF	☒	Green	RF	☒	Green
	☐	Yellow		☐	Yellow
	☐	Red		☐	Red
					
LR	☒	Green	RR	☒	Green
	☐	Yellow		☐	Yellow
	☐	Red		☐	Red

7/32" or Greater
4/32" to 6/32"
3/32" or Less

Check Battery Performance



☐ Good
☒ Fair
☐ Bad

Actual Cold Cranking Amps

Factory Cold Cranking Amps

TRANSACTION RECORD
SHERWOOD FORD SALES LIMITED
2540 BROADMOOR BLVD
SHERWOOD PARK AB



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca



DATE: 05/19/21
BY: Cole

Purchase

Jul 22, 2021 10:05:05

INVOICE # 512834
TID: IC007124 Entry: Chip (C)
Sequence: 001 912
Auth#: 022284 Response: 01-027
Batch: 001

Amount \$ 2 948.00
Total \$ 2 948.00

Approved

Important: Retain this copy for your record

Cardholder copy

ing texts from us on your cell phone
ve provided. You agree that we may
contact you regarding service updates or offers via text
If you do not agree, you may provide land line

CAUSE:
CORRECTION:

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1 TOTAL PARTS				0.00
JOB # 1 TOTAL LABOR & PARTS				0.00

J# 2 20FOZ VEHICLE INSPECTIONS TECH(S): 36636 199.95
COMPLAINT: PERFORM CVIP INSPECTION
CORRECTION: PERFORMED CVIP INSP

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 2 TOTAL PARTS				0.00
JOB # 2 TOTAL LABOR & PARTS				199.95

J# 3 22FOZMISC SHOP SUPPLY/PPE/ENVI TECH(S): 1 0.00
COMPLAINT: \$10 ENVIRONMENTAL DISPOSAL FEE, \$15 SHOP SUPPLIES/PPE

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 3 TOTAL PARTS				0.00
JOB # 3 TOTAL LABOR & PARTS				0.00

J# 4 12FOZZ14 EXTERIOR MIRROR TECH(S): 144 135.00
Added Operation (SHELLY @ 07/16/2021 14:15)
COMPLAINT: LEFT SIDE MIRROR ASSEM, COVER CRACKES AND MIRROR ASSEM
LOOSE.
CAUSE: P/A LEFT SIDE MIRROR ASSEM
CORRECTION: installed l/f exterior mirror assembly as mirror assembly
was loose and could not be secured.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 4	1	3C3Z-17683-AAA	MIRROR Z00	207.99
JOB # 4 TOTAL PARTS				207.99
JOB # 4 TOTAL LABOR & PARTS				342.99

J# 5 53FOZZ01 REPL FRT SHOCKS TECH(S): 36636 135.00
Added Operation (SHELLY @ 07/16/2021 14:18)
COMPLAINT: REPLACE FRONT SHOCKS
CAUSE: P/A BOTH FRT SHOCKS
CORRECTION: REPLACED BOTH FRONT SHOCKS

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 5	2	ASHV-871	KIT - S D12	103.48
JOB # 5 TOTAL PARTS				206.96

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING /
OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER
DATE _____ SIGNATURE _____

ALL ITEMS ARE SUBJECT TO G.S.T.

ADVISOR	SHELLY HAMILTON	27233	TAG NO.	6684	INVOICE DATE	07/19/21	INVOICE NO.	FCCS512834
LABOUR RATE	LICENSE NO.	KILOMETRES	241,423	COLOUR	/	STOCK NO.		
YEAR/MAKE/MODEL	03/FORD/F550			DELIVERY DATE		DELIVERY KMS		
VEHICLE I.D. NO.	1 F D A F 5 6 F 9 3 E A 4 3 0 6 9			SELLING DEALER NO.		PRODUCTION DATE		
P.T.E. NO.		P.O. NO.		R.O. DATE	07/14/21	IN SERVICE DATE		
HOME	COMMENTS			MO: 241423				

IMPORTANT
AS A SERVICE CUSTOMER,
YOU MAY RECEIVE A
RANDOM SURVEY FROM
FORD CANADA
REGARDING HOW
SHERWOOD FORD STAFF
TREATED YOU AND MET
YOUR SERVICE NEEDS.
THESE ARE VERY
IMPORTANT TO OUR
SERVICE STAFF AS WE
USE THESE RESULTS
IN OUR PERSONAL
ASSESSMENT PROGRAMS.
ACCORDINGLY, WE
WOULD APPRECIATE
YOU TAKING THE TIME
TO COMPLETE AND
RETURN THE SURVEY.

Thank You

Due to Environmental
Regulations there is a
nominal fee for the
collection and
disposal of hazardous
material such as
oil filters, engine oil,
glycol transmission
fluid, etc.



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca



SEE REVERSE OF INVOICE PRI 780Y 907E5842

G.S.T. 88512 9155 RT		ALL ITEMS ARE SUBJECT TO G.S.T.		O U T		INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER.					
CUSTOMER NO.		ADVISOR		TAG NO.		INVOICE DATE		INVOICE NO.			
RMS LEASING		SHELLY HAMILTON		27233		6684		07/19/21		FCCS512834 3	
		LABOUR RATE		LICENSE NO.		KILOMETRES		COLOUR		STOCK NO.	
						241,423		/			
		YEAR, MAKE, MODEL				DELIVERY DATE		DELIVERY KMS.			
		03/FORD/F550									
		VEHICLE I.D. NO.				SELLING DEALER NO.		PRODUCTION DATE			
		1 F D A F 5 6 F 9 3 E A 4 3 0 6 9									
		P.T.E. NO.		P.O. NO.		R.O. DATE		IN SERVICE DATE			
						07/14/21					

RESIDENCE PHONE	BUSINESS PHONE	COMMENTS	MO: 241423
-----------------	----------------	----------	------------

JOB # 5 TOTAL LABOR & PARTS 341.96

J# 6:53FOZZ02 REPL REAR SHOCKS TECH(S):36636 135.00

Added Operation (SHELLY @ 07/16/2021 14:18)

COMPLAINT: REPLACE REAR SHOCKS

CAUSE: P/A REAR BOTH SHOCKS. WEAK

CORRECTION: REPLACED REAR SHOCKS

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 6	2	ASH-23488	SHOCK A D12	157.38
JOB # 6 TOTAL PARTS				314.76
JOB # 6 TOTAL LABOR & PARTS				449.76

J# 7:53FOZZ24 FRONT STEERING SHOCK TECH(S):36636 108.00

Added Operation (SHELLY @ 07/16/2021 14:18)

COMPLAINT: REPLACE FRONT STEERING SHOCK

CAUSE: P/A STEERING SHOCK, WEAK

CORRECTION: REPLACED STEERING SHOCK

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 7	1	ASHV-878	DAMPER D12	71.54
JOB # 7 TOTAL PARTS				71.54
JOB # 7 TOTAL LABOR & PARTS				179.54

J# 8:53FOZZ19 F. STABILIZER LINK TECH(S):36636 108.00

Added Operation (SHELLY @ 07/16/2021 14:18)

COMPLAINT: REPLACE FRONT STABILIZER LINK

CAUSE: P/A LEFT SIDE STAB LINK, BOOT TORN

CORRECTION: REPLACED LEFT SIDE STAB LINK ASSEM

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 8	1	MEF-205	LINK D13	205.88
JOB # 8 TOTAL PARTS				205.88
JOB # 8 TOTAL LABOR & PARTS				313.88

J# 9:52FOZZ24 SERV. FRNT BRKS TRUCK TECH(S):36636 135.00

Added Operation (SHELLY @ 07/16/2021 14:18)

COMPLAINT: SERVICE FRONT BRAKES - TRUCK

CORRECTION: SERVICED FRT BRAKES

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 9 TOTAL PARTS				0.00
JOB # 9 TOTAL LABOR & PARTS				135.00

J# 10:52FOZZ25 SERV. REAR BRKS TRUCK TECH(S):36636 135.00

Added Operation (SHELLY @ 07/16/2021 14:18)

COMPLAINT: SERVICE REAR BRAKES - TRUCK

CORRECTION: SERVICED REAR BRAKES

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 10 TOTAL PARTS				0.00
JOB # 10 TOTAL LABOR & PARTS				135.00

IMPORTANT

AS A SERVICE CUSTOMER, YOU MAY RECEIVE A RANDOM SURVEY FROM FORD CANADA REGARDING HOW SHERWOOD FORD STAFF TREATED YOU AND MET YOUR SERVICE NEEDS. THESE ARE VERY IMPORTANT TO OUR SERVICE STAFF AS WE USE THESE RESULTS IN OUR PERSONAL ASSESSMENT PROGRAMS. ACCORDINGLY, WE WOULD APPRECIATE YOU TAKING THE TIME TO COMPLETE AND RETURN THE SURVEY.

Thank You

Due to Environmental Regulations there is a nominal fee for the collection and disposal of hazardous material such as oil filters, engine oil, glycol transmission fluid, etc.



2540 BROADMOOR BLVD.
SHERWOOD PARK, ALBERTA T8H 1B4
PHONE: (780) 449-FORD (3673)
TOLL FREE: 1-877-424-FORD (3673)
WEBSITE: www.sherwoodford.ca



SEE REVERSE OF INVOICE PRI 780V 907 5842

O U T	INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER.
	DATE _____ SIGNATURE _____

G.S.T. 88512 9155 RT

ALL ITEMS ARE SUBJECT TO G.S.T.

CUSTOMER NO.	ADVISOR	TAG NO.	INVOICE DATE	INVOICE NO.
RMS LEASING	SHELLY HAMILTON	27233	07/19/21	FCCS512834 3
	LABOUR RATE	LICENSE NO.	COLOUR	STOCK NO.
	YEAR/MAKE/MODEL	KILOMETRES	DELIVERY DATE	DELIVERY KMS.
	03/FORD/F550	241,423		
	VEHICLE I.D. NO.	SELLING DEALER NO.	PRODUCTION DATE	
	1 F D A F 5 6 F 9 3 E A 4 3 0 6 9			
	P.T.E. NO.	P.O. NO.	R.O. DATE	IN SERVICE DATE
			07/14/21	
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS		
		MO: 241423		

JOB # 10 TOTAL PARTS		0.00
JOB # 10 TOTAL LABOR & PARTS		135.00
J#11-15FOZ01 BRAKE FLUSH TECH(S):36636		135.00
Added Operation (SHELLY @ 07/16/2021 14:18)		
COMPLAINT: PERFORM BRAKE FLUSH		
CORRECTION: PERFORMED BRAKE FLUSH		
PARTS-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-		
JOB # 11 1 DOT-3 BRAKE F	15.01	15.01
JOB # 11 TOTAL PARTS		15.01
JOB # 11 TOTAL LABOR & PARTS		150.01
J#12-54FOZ01 DRIVE LINE TECH(S):36636		472.50
Added Operation (SHELLY @ 07/16/2021 14:18)		
COMPLAINT: FRT STEADY BEARING WORN.		
CAUSE: P/A STEADY BEARING REAR DRIVESHAFT. 3 PIECE SHAFT		
CORRECTION: REPLACED REAR DRIVESHAFT FRONT STEADY BEARING ASSEM		
PARTS-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-		
JOB # 12 1 E4TZ-4800-A SUPPORT Z00	62.03	62.03
JOB # 12 TOTAL PARTS		62.03
JOB # 12 TOTAL LABOR & PARTS		534.53
MISC-----CODE-----DESCRIPTION-----CONTROL NO-----		
JOB # 3 ET ENVIROMENTAL HANDLING	10.00	
JOB # 3 SS SHOP SUPPLIES	15.00	
TOTAL - MISC		25.00

COMMENTS-----
X05K8493FV:created 2021-07-13 03:43:00pm taken by Brandt Dobranski
RECOMMENDED NOT DONE/ DECLINED SERVICES-----
11FOZ ACCESSORIES TECH: 36636 \$212.63
COMPLAINT: SHIFTER LEVER IS STIFF TO GO THROUGH GEARS, NEED FURTHER
DIAG FOR TRANS TECH
CAUSE: NO PARTS

TAX SUMMARY-----
GST 140.38 RT885129155

IMPORTANT
AS A SERVICE CUSTOMER,
YOU MAY RECEIVE A
RANDOM SURVEY FROM
FORD CANADA
REGARDING HOW
SHERWOOD FORD STAFF
TREATED YOU AND MET
YOUR SERVICE NEEDS.
THESE ARE VERY
IMPORTANT TO OUR
SERVICE STAFF AS WE
USE THESE RESULTS
IN OUR PERSONAL
ASSESSMENT PROGRAMS.
ACCORDINGLY, WE
WOULD APPRECIATE
YOU TAKING THE TIME
TO COMPLETE AND
RETURN THE SURVEY.

Thank You

Due to Environmental
Regulations there is a
nominal fee for the
collection and
disposal of hazardous
material such as
oil filters, engine oil,
glycol transmission
fluid, etc.



HF-10A