



6413 - 50 Avenue
Bonnyville, AB
T9N 2L9
Phone: 780-826-3301
Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#336512

HazeHope Inc.

July 28, 2026

Svc.Adv Sheppard, Jesse

Cust.Ph.

Tag# 6296

Page 1 of 2

08/28/2026 13:08:38

X24-1
SEP

To: HazeHope Inc.

Year: 2012 Veh Id: 35499 Unit #: NT2302
Make: GMC License #:
Model: Sierra SLT 3500 Crew Cab 4v Odo. In: 353,237
Colour: STEEL GREY METALLI Odo. Out:
V.I.N.#: 1GT424C85CF189430 Next Service:
Date In: 07/28/2026 In Service Date: 06/04/2012
Out: 07/31/2026 Cases: 4
Ext. War - - (mo/) - D: \$0.00
Promised Time: 07/27/2026 05:00:00 PM Call When Ready:

Case: 1 **TOW IN, FIT IN** Check cause of SES lite on DIC - vehicle in limp mode

Quantity Description/Correction

Price Total
\$435.00 \$435.00

- Tech Cause: Confirmed truck in limp mode. Scanned and found P0107-"MAP Sensor Circuit Low Voltage". Followed document 2425837 for diagnostic steps. Unplugged MAP sensor and tested ground wire for less than 2 ohms, result was 1.2. Tested 5v reference wire and had a full 5 volt supply. looped the 5v supply with the ECM signal feed and monitored scan tool for a change but the MAP value did not respond. Disconnected ECM and tested the signal circuit end to end, wire did not have continuity indicating an open in the wire. Tested several lengths of the harness and found the signal wire is corroded inside the insulation at the MAP connector. Recommend replacing MAP sensor connector and pigtail

- Tech Comments: Quoted repairs
- Completed by Technician number: 4056
- Shop Charges

\$35.71 \$35.71

Misc \$35.71 Labour \$435.00 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$470.71

Case: 2 Cliff 780-812-6836

Quantity Description/Correction

Price Total

Misc \$0.00 Labour \$0.00 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$0.00

Case: 3 Please Provide Updated KMs

Quantity Description/Correction

Price Total

- Tech Cause: Cause not defined.
- Tech Comments: Updated KMs 353237

Misc \$0.00 Labour \$0.00 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$0.00

If your wheels have been removed, they need to be re-torqued after 150kms.

TERCIER

CHEVROLET - BUICK - GMC

6413 - 50 Avenue
Bonnyville, AB
T9N 2L9

Phone: 780-826-3301

Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#336512

HazeHope Inc.

July 28, 2026

Svc.Adv Sheppard, Jesse

Cust.Ph.

Tag# 6296

Page 2 of 2

08/28/2026 13:08:39

Case: 4 Added Operation: Supply & Replace MAP sensor connector - Tech Cause: MAP sensor connector is corroded internally - Tech Comments: Cut out old MAP sensor connector. Wired in a new connector and pigtail. Cleared codes and test drove vehicle, all good

Quantity	Description/Correction	Price	Total
1.00	13580231 - CONNECTOR,WRG HARN	\$146.99	\$146.99
		\$174.00	\$174.00

- Tech Cause: MAP sensor connector is corroded internally
- Tech Comments: Cut out old MAP sensor connector. Wired in a new connector and pigtail. Cleared codes and test drove vehicle, all good
- Completed by Technician number: 4056

• Shop Charges \$14.29 \$14.29

Misc	\$14.29	Labour	\$174.00	Parts	\$146.99	Prepaid Parts Amt:	\$0.00	Case Total:	\$335.28
									\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order. Terms Net 30 Days. Service charge on all overdue accounts is 2% per month. (24% per annum) All Genuine GM and ACDelco parts are backed by a GM manufacturer warranty. All non GM or aftermarket parts are covered by that specific manufacturers warranty that may vary. Ask for details.		Currency:	Labour:	\$609.00
	Payment Ref:		Parts:	\$146.99	
	Expiry Date:		Misc:	\$50.00	
	P/O#:		Sub Total:	\$805.99	
G/HST Reg # R105175525		G/HST:	\$40.30		
		PST:	\$0.00		
		Tax Adjustment:	\$0.00		
07/31/2026		Payment Type		Total:	\$846.29
Date		Signature			

Payer	Payment Type	Reference	Date	
Outstanding W/O's	Charge		07/31/2026	\$846.29
Balance Owing:				\$846.29

If your wheels have been removed, they need to be re-torqued after 150kms.

TERCIER

CHEVROLET - BUICK - GMC

6413 - 50 Avenue
Bonnyville, AB
T9N 2L9

Phone: 780-826-3301

Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#264231

HazeHope Inc.

September 12, 2022

Svc.Adv Lashbrook, Sean

Cust.Ph.

Tag# 036

Page 1 of 4

08/28/2026 13:10:03

To: HazeHope Inc.

Year: 2012 Veh Id: 35499 Unit #: NT2302
Make: GMC License #:
Model: Sierra SLT 3500 Crew Cab 4v Odo. In: 285,914
Colour: STEEL GREY METALLI Odo. Out:
V.I.N.#: 1GT424C85CF189430 Next Service:
Date In: 09/12/2022 In Service Date: 06/04/2012
Out: 09/21/2022 Cases: 6
Ext. War - - (mo/) - D: \$0.00
Promised Time: 00/00/0000 00:00:00 AM Call When Ready: No

Case: 1 # N212328800 Front Passenger Airbag Takata Inflator - Priority Group 10 -

Quantity		Description/Correction	Retail	Price	Total
1.00	84594241 - AIRBAG ASM-I/P	(SINGLE STAGE INFALTOR - Warranty (FP)	\$93.32	\$0.00	\$0.00
1.00	84594242 - BRACKET-I/P LWR	AIRBAG - Warranty	\$12.59	\$0.00	\$0.00
				\$0.00	\$0.00
		• Tech Cause: # N212328800 Front Passenger Airbag Takata Inflator - Priority Group 10 -			
		• Tech Comments: replaced air bag inflator 07212793805115 good to go - Warranty			
		• Completed by Technician number: 3409		\$0.00	\$0.00
		• Warranty Shuttle - Warranty		\$0.00	\$0.00
		• Warranty Admin - Warranty		\$0.00	\$0.00
Misc	\$0.00	Labour	\$0.00	Parts	\$0.00
				Prepaid Parts Amt:	\$0.00
				Case Total:	\$0.00

Case: 2 SES Light on Dash

Quantity Description/Correction							Price	Total
							\$162.00	\$162.00

Case: 3 Replace Head Gaskets

Quantity	Description/Correction	Retail	Price	Total
2.00	97321295 - GASKET,VLV RKR ARM CVR (LOWER COVER)	\$143.47	\$143.47	\$286.93
2.00	97363570 - Gasket	\$16.18	\$16.18	\$32.36

If your wheels have been removed, they need to be re-torqued after 150kms.

TERCIER

CHEVROLET - BUICK - GMC

6413 - 50 Avenue
Bonnyville, AB
T9N 2L9

Phone: 780-826-3301

Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#264231

HazeHope Inc.

September 12, 2022

Svc.Adv Lashbrook, Sean

Cust.Ph.

Tag# 036

Page 2 of 4

08/28/2026 13:10:04

1.00	12627913 - SEAL-UPR INT MANIF	\$9.42	\$9.42	\$9.42
1.00	12580720 - GASKET-OIL FLTR ADAP (2 SMALLER)	\$5.91	\$5.91	\$5.91
2.00	97223686 - Gasket	\$7.53	\$7.53	\$15.06
2.00	19256465 - SEAL KIT,F/INJR (O RING)	\$49.22	\$49.22	\$98.43
2.00	97192618 - GASKET,EXH TURBO INL PIPE	\$25.53	\$25.53	\$51.05
2.00	97188685 - GASKET,EXH TURBO INL PIPE	\$26.09	\$26.09	\$52.17
1.00	12637218 - Gasket	\$8.32	\$8.32	\$8.32
1.00	94011603 - Seal	\$4.21	\$4.21	\$4.21
1.00	94011602 - Seal	\$4.53	\$4.53	\$4.53
1.00	19385578 - Filter 2232	\$19.38	\$19.38	\$19.38
1.00	12637786 - GASKET-CYL HD (GRADE B)	\$109.40	\$109.40	\$109.40
1.00	12637789 - GASKET-CYL HD (GRADE B)	\$82.77	\$82.77	\$82.77
36.00	11610681 - BOLT/SCREW	\$9.26	\$9.26	\$333.32
1.00	12627897 - Gasket	\$8.32	\$8.32	\$8.32
12.00	11611132 - BOLT/SCREW	\$9.22	\$9.22	\$110.63
1.00	19329449 - FLUID,P/S - 1 LITER	\$14.00	\$14.00	\$14.00
10.00	10953031 - COOLANT,DEXCOOL ACDELCO 1 L	\$10.00	\$10.00	\$99.99
1.00	12644070 - HOSE ASM-PCV	\$136.82	\$136.82	\$136.82
		\$4,066.20	\$4,066.20	\$4,066.20

- Tech Cause: pressure tested cooling system and found it quickly climbs to 25psi replace headgaskets
- Tech Comments: dissassembled and replaced both headgaskets with factory bolts cleaned everything and reassembled filled fluids changed engine oil ok replaced broken pcv pipe started ran engine no leaks washed engine bay road tested all okay fluid levels are good still no leaks although found truck will no get to full operating temp while driving needs thermostats quoted

• Completed by Technician number:
3409

• Environmental Levy	\$0.50	\$0.50
• Freight Charges	\$40.52	\$40.52
• Shop Charges	\$21.06	\$21.06

Misc \$62.08 Labour \$4,066.20 Parts \$1,483.02 Prepaid Parts Amt: \$0.00 Case Total: \$5,611.30

Case: 4 Added Operation:Accessory Wiring disconnection - Tech Cause: time to R&R aftermarket wirring - Tech Comments: removed and reconnected wirring after repairs

Quantity	Description/Correction	Retail	Price	Total
6.00	BLUEBC - Blue Conn	\$0.99	\$0.99	\$5.94
			\$162.00	\$162.00

- Tech Cause: time to R&R aftermarket wirring
- Tech Comments: removed and reconnected wirring after repairs

If your wheels have been removed, they need to be re-torqued after 150kms.



6413 - 50 Avenue
Bonnyville, AB
T9N 2L9
Phone: 780-826-3301
Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#264231

HazeHope Inc.

September 12, 2022

Svc.Adv Lashbrook, Sean

Cust.Ph.

Tag# 036

Page 3 of 4

08/28/2026 13:10:04

- Completed by Technician number:
3409

- Shop Charges

\$0.84 \$0.84

Misc \$0.84 Labour \$162.00 Parts \$5.94 Prepaid Parts Amt: \$0.00 Case Total: \$168.78

Case: 5 Added Operation: Replace Transmission cooler - Tech Cause: Replace Transmission cooler - Tech
Comments: replaced transmission cooler

Quantity	Description/Correction	Retail	Price	Total
1.00	22819356 - COOLER ASM-TRANS FLUID AUX	\$383.80	\$292.52	\$292.52
			\$113.40	\$113.40

- Tech Cause: Replace Transmission cooler
- Tech Comments: replaced transmission cooler
- Completed by Technician number:
3409
- Shop Charges

\$0.59 \$0.59

Misc \$0.59 Labour \$113.40 Parts \$292.52 Prepaid Parts Amt: \$0.00 Case Total: \$406.51

Case: 6 Added Operation: Replace thermostats - Tech Cause: Upon test drive, the technician found the vehicle would not reach operating coolant temp. Technician then inspected the thermostats and found both of them to be sticking open. Will require replacement. - Tech Comments: Replaced both thermostats. Test drove vehicle to confirm operating temp was good. Good to go

Quantity	Description/Correction	Retail	Price	Total
1.00	97241130 - THERMOSTAT,ENG COOL	\$104.80	\$104.80	\$104.80
1.00	97241129 - THERMOSTAT,ENG COOL	\$119.91	\$119.91	\$119.91
2.00	10953031 - COOLANT,DEXCOOL ACDELCO 1 L	\$10.00	\$10.00	\$20.00
			\$324.00	\$324.00

- Tech Cause: Upon test drive, the technician found the vehicle would not reach operating coolant temp. Technician then inspected the thermostats and found both of them to be sticking open. Will require replacement.
- Tech Comments: Replaced both thermostats. Test drove vehicle to confirm operating temp was good. Good to go
- Completed by Technician number:
3409
- Shop Charges

\$1.68 \$1.68

Misc \$1.68 Labour \$324.00 Parts \$244.71 Prepaid Parts Amt: \$0.00 Case Total: \$570.39

\$0.00

If your wheels have been removed, they need to be re-torqued after 150kms.

TERCIER

CHEVROLET - BUICK - GMC

6413 - 50 Avenue
Bonnyville, AB
T9N 2L9

Phone: 780-826-3301

Fax: 780-826-5381

INVOICE ORIGINAL

Work Order

#264231

HazeHope Inc.

September 12, 2022

Svc.Adv Lashbrook, Sean

Cust.Ph.

Tag# 036

Page 4 of 4

08/28/2026 13:10:04

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order. Terms Net 30 Days. Service charge on all overdue accounts is 2% per month. (24% per annum) All Genuine GM and ACDelco parts are backed by a GM manufacturer warranty. All non GM or aftermarket parts are covered by that specific manufacturers warranty that may vary. Ask for details.		Currency:	Labour:	\$4,827.60
			Payment Ref:	Parts:	\$2,026.69
			Expiry Date:	Misc:	\$65.53
			P/O#:	Sub Total:	\$6,919.82
			G/HST Reg # R105175525	G/HST:	\$346.02
			PST:	\$0.00	
			Tax Adjustment:	\$0.00	
09/21/2022					
Date		Signature		Payment Type	Total: \$7,265.84

Payer	Payment Type	Reference	Date	
HazeHope Inc.	Debit Card		09/22/2022	\$4,000.00
HazeHope Inc.	Debit Card		09/22/2022	\$3,265.84
Balance Owing:				\$0.00

If your wheels have been removed, they need to be re-torqued after 150kms.