

F47-1
SEP

Bar J Heavy Mechanical Inc.
261061 Wagon Wheel Crescent
Rocky View County, AB T4A0E2,
CA
403-888-6013



APPROVED
AC

BT0005
wo 2244
line 1
cc 311

Invoice: 9307

Date: 5/6/2026

RECEIVED MAY 06 2026

Bill To
CAN-TRAFFIC SERVICES

Remit Payment To
Bar J Heavy Mechanical Inc.
261061 Wagon Wheel Crescent
Rocky View County, AB T4A0E2, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer
9750	Net 30	6/5/2026	Keelan Brereton		James, David

Unit #

BT0005

Needwork

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: OUTRIGGERS WORK, THEN SELECT SWITCH TO UPPER CONTROLS THE BOOM DNW
- DIAGNOSE AND REPAIR FOR BOOM FUNCTIONS DNW
(Likely a problem with the outrigger proximity switches)

Cause: Customer request

Labor	Correction: Boom / Aerial / May 4, 2026 - Checked operation, outriggers work, boom DNW - Did not hear a change in sound when switching from outriggers to boom at rear switch - Found control panel behind drivers seat. (Nothing labelled) No service manual in the truck - Inspected wiring from selector switch up chassis to enable valve solenoid in tower - No power to enable valve solenoid on pink wire with black tracer - White wire on solenoid goes directly to ground (So rear selector switch needs to send 12V to enable solenoid when outriggers are extended) - Removed covers off of both outrigger leg cylinders for access to limit switches - Verified outrigger switches are aligned and properly adjusted - Verified both switches were closed when outrigger legs are down - Checked for power to both outrigger switches. No power (Need 12V through outrigger switches when closed to send power to selector switch at back. - Tried to follow harness from selector switch (wiring goes into tail light bar, hard to access) - Removed rear lights for access to harness. Harness appears ok. - Chased wiring ahead of outriggers and found breaker tripped under hood - Reset breaker. Boom works now - Retaped all harness that were opened under chassis (Took longer to troubleshoot this because there was nothing was labelled and schematic not available in the Versalift operators manual in truck) - Completed: 5/4 /2026	2.00000	\$172.00	\$344.00
-------	--	---------	----------	----------

Subtotal \$344.00

Unit: BT0005 VIN: 1FDUF5HT9KDA06690
License Plate: (AB) CXL5828
2019 Ford F-550
Chassis: 202,507 Kilometers

Labor	\$344.00
Shop Supplies	\$34.40
Pre-Charge Subtotal	\$378.40
GST (5% of \$378.40)	\$18.92
Total	\$397.32
Payments & Credits	\$0.00
Balance Due	\$397.32

GST#: 795466077 RT0001

A handwritten signature in black ink, appearing to be 'J. B.', is located below the GST number.

Bar J Heavy Mechanical Inc.
 261061 Wagon Wheel Crescent
 Rocky View County, AB T4A0E2,
 CA
 403-888-6013



**HEAVY
MECHANICAL**
 Truck and Trailer Repair Specialists

Invoice: 9142
 Date: 3/22/2026

RECEIVED MAR 31 2026

Bill To
 CAN-TRAFFIC SERVICES

APPROVED

BT0005
 WO 2040

Remit Payment To
 Bar J Heavy Mechanical Inc.
 261061 Wagon Wheel Crescent
 Rocky View County, AB T4A0E2, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
9562	COD	3/22/2026	Keelan Brereton	BT0005	James, David	BT0005 WO # 2040

Item Description

Quantity Rate Amount

PM: PM A

Cause: Customer request

Line 2 cc 300

PM 'A' is attached
 @ the Back.

(PM)

Labor

Correction:

Chassis / Chassis / March 10, 2026
 12611 hour
 202382 kms
 - Drain engine oil
 - Collect oil sample
 - Remove and replace the oil filter
 - Remove and replace the fuel filters
 - Reconnect the fuel filter plug
 - Check the rear diff oil level its good
 - Check the front diff oil level its good
 - Check the tranny oil level its good
 - Top up the coolant
 - Top up the windshield washer fluid
 - Go through Can traffic 12 month inspection list
 - Install the new service decal
 - Grease chassis - Completed: 3/10/2026

2.50000 \$172.00 \$430.00

Parts	OIL FILTER FORD 6.7L	1.00000	\$56.2455	\$56.25
Parts	Fuel Filter	1.00000	\$188.906	\$188.91
Parts	10W30 (Bulk), Petro Duron	12.00000	\$7.77	\$93.24
Parts	Windshield Washer Fluid -40, "TURBO POWER", 3.78L Container	1.00000	\$7.455	\$7.46
Parts	RED GREASE S3 EP2 (SHELL)	1.00000	\$10.6925	\$10.69
Parts	BRAKE CLEAN	1.00000	\$6.00256	\$6.00
Parts	Ford Yellow Anti-Freeze Concentrate	1.00000	\$40.049	\$40.05
	Subtotal			\$832.60

Complaint: ENGINE LIGHT ON - DIAGNOSE AND ADVISE

Cause: Customer request

Line 1 cc 304

Labor

Correction:

5.35000 \$172.00 \$920.20

Engine / ENGINE / Mar 12, 2026

- Connect scan tool, to read faults
- P245A - EGR Cooler bypass control circuit fault - Active
- P0532 - A/C Refrigerant pressure sensor A low - Active
- P245A Troubleshooting
- Disconnect EGRCBV solenoid and test for power with Ignition on - 12.1V
- Disconnect PCM-E connector
- Test resistance from PCM-66 to EGRCBV+ - 0.2 OHM - In spec
- Turn Ignition on and test for voltage at EGRCBV+ with PCM-E disconnected - no voltage
- Test EGRCBV+ for short to ground - no short
- Test EGRCBV solenoid resistance - 22 OHM - 10-40 OHM is spec
- Test valve for binding- no binding
- Connect all components - run engine and monitor
- Valve not moving
- Test vacuum system for leaks - found leak at vacuum supply to EGRCBV solenoid
- Replaced vacuum fitting
- Retest - EGRCBV working properly

- P0532 Troubleshooting

- Connect scan tool to read A/C pressure reading from sensor and compare to manifold gauge set - 561KPA on sensor and 495KPA on manifold set - In spec
- Recover A/C system - low 0.5 LBS in system
- Perform vacuum test - test passed
- Charge A/C system with 1.7 lbs 134A and 2oz pag oil
- Clear all faults and road test - no faults - Completed: 3/20/2026

Parts	Refrigerant, A/C	0.50000	\$20.30639	\$10.15
Parts	8OZ PAG100 OIL WITH DYE	2.00000	\$9.639	\$19.28
Parts	VACUUM ELBOW	21.65000	\$3.00	\$64.95
			Subtotal	\$1,014.58

Complaint: STARTER SOLENOID TERMINALS ARE CORRODED

Cause: Customer request

Line 4 c 304

(Inspection)

Labor	Correction:	0.50000	\$172.00	\$86.00
	Chassis / Chassis / March 11, 2026			
	- Disconnect the negative terminals from both batteries			
	- Clean the solenoid terminals			
	- Spray terminal protector on it			
	- Clean the negative terminal on the battery			
	- Reconnect the battery terminals - Completed: 3/11/2026			
			Subtotal	\$86.00

Complaint: SERVICE FRONT DIFF

Cause: Customer request

Line 5 c 302

(Inspection)

Labor	Correction:	1.45000	\$172.00	\$249.40
	Chassis / Chassis / March 10, 2026			
	- Remove the fill plug			
	- Suck the oil for sample			
	- Suck out the oil from diff			
	- Top it up			
	- Torque the fill plug to 20 ftlbs - Completed: 3/10/2026			
Parts	80W90 GEAR OIL	3.00000	\$12.985	\$38.98
			Subtotal	\$288.36

Complaint: SERVICE REAR DIFF**Cause:** Customer request**(Inspection)**

Labor	Correction:	0.75000	\$172.00	\$129.00
	Chassis / Chassis / March 10, 2026			
	12611 hour			
	202382 kms			
	- Drain diff oil			
	- Torque the drain plug to 55 ftlbs			
	- Top it up			
	- Add friction modifier in the oil			
	- Torque the check plug to 20 ftlbs - Completed: 3/10/2026			
Parts	FRICTION MODIFIER	1.00000	\$14.84	\$14.84
Parts	75W140 GEAR OIL (PER LITRE)	4.00000	\$26.79	\$107.16
Subtotal				\$251.00

Complaint: SERVICE TRANSMISSION**Cause:** Customer request

Line 6 cc 304

(Inspection)

Labor	Correction:	2.85000	\$172.00	\$490.20
	Transmission / Automatic Transmission / March 11, 2026			
	- To drain the oil, oil pan needs to be removed			
	- Remove the oil pan			
	- Take an oil sample			
	- Remove the tranny oil filter			
	- Clean the surface where gasket sits			
	- Clean the oil pan			
	- Install the new filter and torque the bolts to 97 inlbs			
	- Inspect the oil pan			
	- Install the new gasket on oil pan			
	- Reinstall the oil pan with new gasket as assembly to the tranny			
	- Torque the bolts to 80 in-lbs			
	- Fill with new ATF			
	- run truck to get transmission fluid to operating temp			
	- Top up the ATF - Completed: 3/20/2026			
Parts	Mercon LV ATF XT 10	10.00000	\$16.14	\$161.40
Parts	TRANS FILTER	1.00000	\$122.3945	\$122.39
Parts	TRANS PAN GASKET	1.00000	\$111.8385	\$111.84
Parts	BRAKE CLEAN	1.00000	\$6.00256	\$6.00
Subtotal				\$891.83

Complaint: AIR DAM CRACKED AND BROKEN BELOW FRONT BUMPER
- REPLACE WITH SHORTER STYLE AIR DAM

Cause: Customer request

Line 7 cc 304

(Inspection)

Labor	Correction:	0.80000	\$172.00	\$137.60
	Chassis / Chassis / March 19, 2026			
	- Remove the old dam			
	- Align the holes for new air dam			
	- Install the new air dam			
	- Tighten the bolts			
	- Could not get the center of air dam even with the bumper because the bumper is bent upward in the middle. The air dam is secure tho. - Completed: 3/19/2026			

Parts	AIR DAM FOR 2 WHEEL DRIVE (NOT AS DEEP) (EDMONTON)	1.00000	\$249.616	\$249.62
			Subtotal	\$387.22

Complaint: QUALITY CONTROL

Cause: Customer request

Labor	Correction: Chassis / Chassis / Mar 19, 2026 - QC Completed - Completed: 3/20/2026	0.00000		\$0.00
			Subtotal	\$0.00

Complaint: MONITOR

- MASTER CYLINDER HAS SEEPAGE - LEVEL 1 (NO DROPLETS FORMED, JUST A BIT DIRTY)
- OIL SEEPAGE AROUND FRONT AND REAR OF OIL PAN
- FRONT BUMPER BENT UPWARD FROM BOTTOM IN MIDDLE
- RS CAB PILLAR BY WINDSHIELD DAMAGED (COVERED HOLE WITH SILICONE AS PER KEELAN'S REQUEST)
- LS CAB STEP AND REAR BRACKET TWEAKED (LEAVE THIS FOR NOW AS PER KEELAN)
- BACK UP CAMERA MISSING (ELECTRICAL CORD HANGING OUT REAR)

Line 8 cc399

Cause: Customer request

(Inspection)

Labor	Chassis / Chassis / MONITOR - MASTER CYLINDER HAS SEEPAGE - LEVEL 1 (NO DROPLETS FORMED, JUST A BIT DIRTY) - OIL SEEPAGE AROUND FRONT AND REAR OF OIL PAN - FRONT BUMPER BENT UPWARD FROM BOTTOM IN MIDDLE - RS CAB PILLAR BY WINDSHIELD DAMAGED (COVERED HOLE WITH SILICONE AS PER KEELAN'S REQUEST) - LS CAB STEP AND REAR BRACKET TWEAKED (LEAVE THIS FOR NOW AS PER KEELAN) - BACK UP CAMERA MISSING (ELECTRICAL CORD HANGING OUT REAR) - Completed: 3/10/2026	0.25000	\$172.00	\$43.00
			Subtotal	\$43.00

Unit: BT0005 VIN: 1FDUF5HT9KDA06690
 License Plate: (AB) CXL5828
 2019 Ford F-550
 Chassis: 202,382 Kilometers

Labor	\$2,485.40
Parts	\$1,309.19
Shop Supplies	\$248.54
Pre-Charge Subtotal	\$4,043.13
GST (5% of \$4,043.13)	\$202.16
Total	\$4,245.29
Payments & Credits	\$0.00
Balance Due	\$4,245.29

GST#: 795466077 RT0001



**CAN-TRAFFIC SERVICES****PM A****Bar J Heavy Mechanical Inc.**261081 Wagon Wheel Crescent
Rocky View County, AB T4A0E2, CA

BT0005

Completed Date: 3/10/2026
 Unit: BT0005 VIN: 1FDUF5HT9KDA06690
 Year/Make/Model: 2019 Ford F-550
 Chassis Kilometers: 202,382 Kilometers (3/10/2026)
 Engine Hours: No recorded.
 Next Due: 212,382 Kilometers
 Service Order: 9562

Chassis: 1FDUF5HT9KDA06690 2019 Ford F-550

Procedure	Result	Procedure	Result	Procedure	Result
1. CHANGE OIL AND FILTER	Satisfactory	2. CHANGE FUEL FILTER(S)	Satisfactory	3. CHECK ENGINE AIR FILTER AND CABIN FILTERS (INSIDE AND OUTSIDE)	Satisfactory
4. CHECK ALL FLUID LEVELS AND TOP UP AS REQUIRED	Satisfactory	5. CHECK WINDSHIELD WIPERS AND SPRAYER JETS	Satisfactory	6. CHECK TRANSMISSION OIL LEVEL AND LEAKS	Satisfactory
7. CHECK COOLANT SYSTEM	Satisfactory	8. TEST ANTIFREEZE CONDITION	Satisfactory	9. CHECK BLOCK HEATER OPERATION	Satisfactory
10. CHECK BELT CONDITION, TENSIONER, IDLER PULLEYS	Satisfactory	11. CHECK POWER STEERING SYSTEM	Satisfactory	12. CHECK POSITIVE AIR SHUT OFF OPERATION	N/A
13. CHECK OIL LEAKS	Satisfactory	14. MEASURE AND ADJUST BRAKES	Satisfactory	15. CHECK AIR COMPRESSOR MOUNTING AND LEAKS	N/A
16. PERFORM AIR SYSTEM GOVERNER CHECKS	N/A	17. CHECK LOW AIR WARNING SYSTEM	N/A	18. PERFORM COMPRESSOR AIR BUILD UP TIME	N/A
19. CHECK BRAKE APPLICATION AND AIR LEAKS	N/A	20. INSPECT BRAKE PEDAL, AIR TANKS, LINES, VALVES, PARK BRAKE - ON HYDRAULIC SYSTEMS - CHECK HYDRAULIC AND VACUUM ASSISTED BRAKE COMPONENTS - CHECK MECHANICAL COMPONENTS	Satisfactory	21. CHECK SUSPENSION - SPRINGS, AIR BAGS, TORQUE RODS, LEVELING RODS, VALVES	Satisfactory
22. LUBRICATE CHASSIS	Satisfactory	23. CHECK ALL STEERING COMPONENTS - STEERING BOX, LINKAGE, COLUMN - ADVISE IF WHEEL ALIGNMENT IS REQUIRED	Satisfactory	24. CHECK U-JOINTS AND DRIVE LINE	Satisfactory
25. CHECK UNDERCARRIAGE (FRAME, SUBFRAME, CROSSMEMBERS, SUSPENSION)	Satisfactory	26. CHECK DIFFERENTIAL OIL LEVELS	Satisfactory	27. CHECK COMPLETE EXHAUST SYSTEM	Satisfactory
28. CHECK BODY AND DEVICE MOUNTING, CHECK REAR IMPACT GUARDS	Satisfactory	29. CHECK AXLES, WHEELS AND WHEEL NUTS	Satisfactory	30. CHECK TIRE PRESSURE AND CONDITION	Satisfactory
31. CHECK MUD FLAPS	Satisfactory	32. CHECK FUEL TANKS AND PLUMBING	Satisfactory	33. CHECK BATTERY, CABLES AND CONNECTIONS	Satisfactory
34. CHECK HOOD LATCHING AND SECUREMENT	Satisfactory	35. CHECK OPERATION OF ALL LIGHTS, CHECK REFLECTORS	Satisfactory	36. CHECK BACK UP ALARM	Satisfactory
37. CHECK ALL CAB CONTROLS HEATING AND DEFROST SYSTEM, SWITCHES, SEATS, SEAT BELTS, WINDOWS, AND MIRRORS	Satisfactory	38. CHECK AND LUBE ALL DOORS, HINGES, AND SUPPORT ARMS	Satisfactory	39. CHECK 5TH WHEEL COUPLING, HITCHES AND SECONDARY ATTACHMENTS - ADJUST IF REQUIRED	N/A
40. VERIFY FUEL TANK CAP IS INSTALLED, FUEL PORT PLUGS ARE INSTALLED AND OIL FILL CAP IS INSTALLED	Satisfactory	41. INSTALL NEW SERVICE DECAL	Completed		

Bar J Heavy Mechanical Inc.
 261061 Wagon Wheel Crescent
 Rocky View County, AB
 T4A0E2, CA
 403-888-6013



**HEAVY
MECHANICAL**
 Truck and Trailer Repair Specialists

Invoice: **8663**

Date: **10/28/2025**

Bill To
CAN-TRAFFIC SERVICES

APPROVED

BT0005
 WO 1681

Remit Payment To
 Bar J Heavy Mechanical Inc.
 261061 Wagon Wheel Crescent
 Rocky View County, AB T4A0E2, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
9122	COD	10/28/2025	Keelan Brereton		James, David	BT0005

Item	Description	Quantity	Rate	Amount
Complaint: CVIP INSPECTION - SINGLE AXLE TRUCK				
Cause: Customer request				
Line 1 CC 102				

Labor	Correction: CVIP INSPECTION / CVIP INSPECTION / OCT 23,2025	2.00000	\$172.00	\$344.00
	STARTED CVIP INSPECTION			
	OCT 24,2025			
	COMPLETED FULL WHEEL OFF INSPECTION			
	OCT 28,2025			
	FINISHED ALL REPAIRS			
	COMPLETED CVIP PAPERWORK			
	NEW CVIP DECAL NUMBER IS CV8568537 - Completed: 10/28 /2025			

Subtotal \$344.00

Complaint: 2 AXLE DUALY WHEEL PULL FOR REQUIRED BRAKE MEASUREMENTS

Cause: Customer request

Line 1 CC 102

Labor	Correction: CVIP INSPECTION / CVIP INSPECTION / OCT 23,2025	1.75000	\$172.00	\$301.00
	LIFTED UNIT AND SET IT ON STANDS			
	REMOVED WHEELS			
	MEASURED BRAKES			
	OCT 27,2025			

INSTALLED WHEELS

SET UNIT ON GROUND

TORQUED WHEELS TO 140LBFT

INSTALLED LUG NUT MARKERS

SECURITY CHECKED ALL LUG NUTS - Completed: 10/27/2025

Subtotal \$301.00

Complaint: FRONT BEACON LIGHT DNW - DIAGNOSE

Cause: Customer request

(Inspection)

Labor

Correction:

Chassis / Chassis / OCT 27,2025

Line 4
CC 3046

1.25000

\$172.00

\$215.00

REMOVED GRILL AND COVER OVER RADIATOR

FOUND THE LIGHTS TO BE UNPLUGGED

FOUND THE OTHER END OF THE HARNESS BEHIND THE HEADLIGHT

RAN HARNESS TO THE SIDE OF THE HEADLIGHT

PLUGGED IN LIGHT AND TESTED

FRONT BEACON LIGHTS WORK

CLIPPED GRILL BACK INTO PLACE

SET BOLTS BACK INTO TOP OF GRILL

INSTALLED RAD COVER IN AND INSTALLED CLUPS - Completed:
10/27/2025

Parts

5/16 Black Trim Panel Retainer

1.00000

\$1.83

\$1.83

Subtotal

\$216.83

Complaint: RIGHT LOWER LOW BEAM OUT - DIAGNOSE

Cause: Customer request

(Inspection)

Labor

Correction:

Chassis / Lighting & Electrical / OCT 27,2025

Line 5
CC 3046

0.25000

\$172.00

\$43.00

HAD GILL REMOVED TO CHECK OUT BEACON LIGHTS

REMOVED RIGHT SIDE HEADLIGHT

REMOVED ELECTRICAL PLUGS ON LIGHT

REMOVED LOWER HEADLIGHT BULB AND FOUND IT TO BE BURNT

INSTALLED NEW H13 BULB

PLUGGED LIGHT IN

TESTED LOW AND HIGH BEAMS

BOTH WORK

INSTALLED HEADLIGHT - Completed: 10/27/2025

Parts	Halogen H13 65/55W ST Bulbs	1.00000	\$27.54	\$27.54
			Subtotal	\$70.54

Complaint: PARK BRAKE NOT HOLDING, ADJUST PARK BRAKE

Cause: Customer request

(Inspection)

Labor

Correction:

Chassis / Chassis / OCT 27,2025

Line 6
CC 302

1.00000	\$172.00	\$172.00
---------	----------	----------

ADJUSTED PARK BRAKE SHOES

TESTED WITH THE WHEELS OFF AND UNIT STILL IN THE AIR

WILL TEST AGAIN WHEN UNIT IS ON THE GROUND

WITH UNIT ON THE GROUND

THE PARK BRAKE HOLDS TO 1000 RPM

- Completed: 10/27/2025

Subtotal	\$172.00
-----------------	-----------------

Complaint: FAN BELT HEAVILY CRACKED - REPLACE

Cause: Customer request

(Inspection)

Labor

Correction:

Engine / Belt & Pulley / OCT 27,2025

Line 7
CC 304

1.75000	\$172.00	\$301.00
---------	----------	----------

REMOVED INTAKE PIPE FROM FILTER HOUSING TO TURBO

REMOVED BELT

REMOVED FAN BRACKET AND SENSOR

INSTALLED NEW FAN BELT AND CONFIRMED ROUTING

INSTALLED FAN BRACKET AND SENSOR

HAD TO REPLACE ONE OF THE VACUUM LINES FROM THE
EGR VALVE TO THE BASE OF THE INTAKE PLATEHAD BOTH T FITTINGS BREAK ON THE COOLANT HOSES FROM
THE EGR COOLER TO THE RESERVOIR TO THE TOP OF THE RAD

MADE NEW T FITTINGS OUT OF BRASS

INSTALLED FITTING

TIGHTENED NEW GEAR CLAMPS
INSTALLED INTAKE PIPESTARTED ENGINE AND MADE SURE THE BELT WAS TRACKING
RIGHT AND NOT MAKING NOISE - Completed: 10/27/2025

Parts	FAN BELT	1.00000	\$196.91	\$196.91
Parts	5/16 Hose x 1/4NPT Fitting	5.00000	\$1.80	\$9.00
Parts	3/8 Hose x 1/4NPT Fitting	1.00000	\$2.685	\$2.69
Parts	EXTRUDE TEE 1/4" BRASS	2.00000	\$6.94575	\$13.89
Parts	5/16" Synflex Air Brake Hose	5.00000	\$1.71	\$8.55
Parts	5/8" OD Gear Clamp	6.00000	\$3.14838	\$18.89
			Subtotal	\$550.93

Complaint: FRONT SWAY BAR BUSHING CRACKED AND LOOSE ON SWAY BAR

Cause: Customer request

(Inspection)

Line 8

Labor	Correction: Chassis / Chassis / OCT 27,2025	1.00000	\$172.00	\$172.00
-------	---	---------	----------	----------

CC 303

REMOVED SWAY BAR BUSHING MOUNTING NUTS

DROPPED SWAY BAR DOWN

REMOVED BUSHING CUPS AND BUSHINGS

CLEANED OFF SWAY BAR AND CUPS

INSTALLED NEW BUSHINGS

INSTALLED CUPS

SWUNG SWAY BAR INTO PLACE

TIGHTENED DOWN MOUNTING NUTS - Completed: 10/27/2025

Parts	SWAY BUSHINGS (FRONT TO FRAME) (EDMONTON)	2.00000	\$33.57	\$67.14
			Subtotal	\$239.14

Complaint: BACK UP ALARM DNW

Cause: Customer request

(Inspection)

Line 9

Labor	Correction: Chassis / Chassis / OCT 27,2025	0.75000	\$172.00	\$129.00
-------	---	---------	----------	----------

CC 304

CHECKED FOR POWER AND GROUND AT THE BACK UP ALARM

ALARM HAS POWER AND GROUND

REMOVED ALARM

HAD TO DRILL NEW HOLES IN THE PLATE IT WAS MOUNTED
TO

MOUNTED ALARM TO BRACKET

INSTALLED WIRING TO ALARM

TESTED ALARM

ALARM WORKS - Completed: 10/27/2025

Parts	ALARM, BACK-UP, 97Db, 12V/24V	1.00000	\$36.3576	\$36.36
-------	-------------------------------	---------	-----------	---------

Parts	1/4 X 1-1/4 GR8 PL NC BOLT	2.00000	\$0.35	\$0.70
Parts	1/4 GR8 Plated Washers	4.00000	\$0.14703	\$0.59
Parts	1/4 PL NC Stover Lock Nut	2.00000	\$0.24	\$0.48
			Subtotal	\$167.13

Complaint: WIRING TO TRAILER PLUG BROKEN AND CORRODED

Cause: Customer request

(Inspection)

Labor **Correction:** 1.25000 \$172.00 \$215.00
 Chassis / Lighting & Electrical / OCT 27,2025

REMOVED OLD TRAILER PLUG

DISCONNECTED WIRING

DRILL HOLES FOR THE NEW PLUG

OCT 28,2025

WIRED IN NEW TRAILER PLUG

CUT BACK AND EXTENDED THE 12V CHARGE WIRE TO THE
 NEW PLUG

TESTED ALL FUNCTIONS IN THE PLUG

ALL FUNCTIONS WORK

BOLTED TRAILER PLUG INTO BACK OF UNIT - Completed: 10/28
 /2025

Parts	7 WAY RV PLUG	1.00000	\$11.23658	\$11.24
Parts	12GA RED WIRE	1.00000	\$2.1714	\$2.17
Parts	14 GA Seamless Splice	1.00000	\$0.7908	\$0.79
Parts	16-14GA Ring Terminal	1.00000	\$0.88212	\$0.88
Parts	6" PC 1/8 Dual Wall Tubing	1.00000	\$3.84	\$3.84
Parts	1/4 X 1-1/2 GR8 PL NC Bolt	4.00000	\$0.31	\$1.24
Parts	1/4 GR8 Plated Washers	8.00000	\$0.14703	\$1.18
Parts	1/4 PL NC Stover Lock Nut	4.00000	\$0.24	\$0.96
			Subtotal	\$237.30

Complaint: GRAB HANDLE ON REAR DECK LOOSE

Cause: Customer request

(Inspection)

Labor **Correction:** 0.35000 \$172.00 \$60.20
 Chassis / Chassis / OCT 27,2925

REMOVED RIGHT REVERSE LIGHT

REMOVED GRAB HANDLE MOUNTING BOLTS

INSTALLED NEW LONGER BOLTS

TIGHTENED DOWN ALL BOLTS

INSTALLED REVERSE LIGHT - Completed: 10/27/2025

Parts	5/16 X 1-1/4 GR8 PL NC BOLT	3.00000	\$0.777	\$2.33
Parts	5/16 PL NC Stover Lock Nut	3.00000	\$0.31413	\$0.94
Parts	5/16 Plated Washer	6.00000	\$0.36702	\$2.20
			Subtotal	\$65.67

Complaint: HYDRAULIC HOSES RUBBING LEFT REAR SHOCK. COVER AND SECURE HOSES

Cause: Customer request

(Inspection)

Labor	Correction:	0.50000	\$172.00	\$86.00
Chassis / Chassis / OCT 27, 2025				

TIED UP HYDRAULIC HOSES AWAY FROM SHOCK

FOUND A RUSTED OUT EXHAUST BOLT WHILE SECURING THE
HYDRAULIC HOSES

HAMMERED OUT THE BOLT

INSTALLED AND TIGHTENED NEW BOLT AND NUT - Completed:
10/27/2025

Parts	14-1/2 Black Cable Tie	3.00000	\$0.87	\$2.61
Parts	7/16 x 1-1/2 GR8 PL NC BLT	1.00000	\$1.17	\$1.17
Parts	7/16 PL NC Stover Lock Nut	1.00000	\$0.62	\$0.62
Parts	7/16 Plated Washer	2.00000	\$0.26196	\$0.52
			Subtotal	\$90.92

Complaint: LICENSE PLATE MISSING

Cause: Customer request

(Inspection)

Labor	Correction:	0.15000	\$172.00	\$25.80
Chassis / Chassis / OCT 24, 2025				

MOUNTED NEW LICENSE PLATE TO THE BRACKET - Completed:
10/24/2025

Parts	1/4 x 1 GR8 PL NC Bolt	2.00000	\$0.44286	\$0.89
Parts	1/4 PL NC Stover Lock Nut	2.00000	\$0.24	\$0.48
Parts	1/4" Fender Washer	4.00000	\$0.37	\$1.48
			Subtotal	\$28.65

Complaint: QUALITY CONTROL

Cause: Customer request

Labor	Correction:	0.00000		\$0.00
Chassis / Chassis / QC complete - Completed: 10/28/2025				
			Subtotal	\$0.00

Unit: BT0005 VIN: 1FDUF5HT9KDA06690
2019 Ford F-550
Chassis: 200,725 Kilometers

Labor	\$2,064.00
Parts	\$420.11
Shop Supplies	\$206.40
Pre-Charge Subtotal	\$2,690.51
GST (5% of \$2,690.51)	\$134.53
Total	\$2,825.04
Payments & Credits	\$0.00
Balance Due	\$2,825.04

GST#: 795466077 RT0001