

**10609 - 79 Ave
Clairmont, Alberta T8X 5G9
Canada**

Invoice No.: 8013
Date: 2026-10-05
Page: 1

L08-1
NOV

2022401 Alberta Ltd.
8821 - 71 AVE
GRANDE PRAIRIE, AB T8XOE2

2022401 Alberta Ltd.
UNIT T105

Quantity	Unit	Description	Tax	Base Price	Disc %	Unit Price	Amount
		AS PER WORK ORDER #7112					
		LABOR	G				2,852.85
		PARTS	G				692.27
		SHOP SUPPLIES	G				426.45
		SUBLET	G				1,411.69
		HAZARDOUS MATERIALS	G				114.12
		Subtotal:					5,497.38
		G - GST 5%					
		GST/HST					274.86
GST# 721647725RT0001 A charge of 2% per month compounded monthly (26.8 per annum) may be assessed on overdue accounts.							Total Amount 5,772.24 Amount Paid 0.00 Amount Owning 5,772.24

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic #: 0-CP188 Odometer In : 654989
Unit #: T105
VIN #: 1XPTPPEX9 FD271825
Engine Hrs In : 22131.4 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
PTO 8 BOLT GASKET .020" 35P15-2	1.00	2.63	2.63	REMOVED BATTERIES FOR OTHER UNIT - R&I	231.00
18" WIPER BLADE 80181	1.00	12.75	12.75	REMOVE COMPONENTS FOR NEW TRUCK Remove all hydraulic components for new truck.	1,023.00
HEATED CONVEX MIRROR 610676	1.00	60.31	60.31	CVIP LEVEL "C" WHEELS ON Complete inspection.	495.00
LED, 2" CLEARANCE AMBER 3050A	8.00	9.25	74.00	WINDSHIELD BROKEN BOTH SIDES Third party repair.	n/c
DOOR LIGHT 16-09012	2.00	144.04	288.08	REPLACE BOTH WINDSHIELDS	468.00
SEALED BEAM 4411	2.00	9.00	18.00	LEFT WINDSHIELD WIPER BROKEN - R&I Remove and replaced windshield wiper.	57.75
BAND CLAMP 5" 33225	1.00	16.38	16.38	RIGHT CONVEX MIRROR - R&I Removed damaged mirror, wire in and install new mirror.	115.50
75W90 GEAR OIL SL550026915LT	1.00	17.43	17.43	RIGHT AIR CLEANER 5 X 2" AMBER LIGHTS OUT Remove and replace lights with new, function test - good.	56.10
HAIR PIN 5/32 X 3 66309	2.00	1.06	2.12	LEFT AIR CLEANER 3 X 2" AMBER LIGHTS OUT Remove and replace lights with new, function test - good.	74.25
VALVE DRAIN 12105	1.00	7.06	7.06	RIGHT TAIL LIGHT OUT - R&I Found damaged wiring, repaired wiring and tested light - good.	74.25
T HANDLE LATCH HLK2391	1.00	37.75	37.75	D/S DOOR LIGHT OUT - R&I Remove and replace light, function test - good.	57.75
HYDROLIC AIR FILTER FITTING 4401-6	2.00	30.81	61.62	P/S DOOR LIGHT OUT - R&I Remove and replace light, function test - good.	57.75
# MEDIUM PRESSURE HOSE Size: F	2.00	12.04	24.08	BEACON LIGHTS OUT - R&I Cleaned contacts in light and replaced two bulbs, function test - good.	99.00
1503-6				EXHAUST STEP CLAMP LEAKING ON CROSSOVER PIPE	66.00
GREASE SUMMER SRS2000 SL550027634	1.00	8.70	8.70	Remove and replace clamp, no more leak.	
SWITCH - PRESSURE N.C Q27-1038	1.00	61.36	61.36	LEFT HUB LOW OIL STEER AXLE Topped up oil.	57.75
Shop Supplies			426.45	SAFETY PINS FOR REAR MUDFLAPS MISSING - INSTALL	33.00
				Installed missing safety pins.	
				AXLE #3 P/S TIRES ROCK DRILLED - STEEL SHOWING	n/c
				AIR LEAK AT AIR TANK DRAIN VALVE Remove and replace drain valve, verify no more leak.	74.25
				DOOR LATCH ON RIGHT HEADACHE RACK DOOR BROKEN	66.00
				Removed and replaced door handle latch with new.	
				AXLE #4 P/S AIR LINE ON BRAKE POT SHOWING STEEL - R&I	99.00

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

7112

Org. Est. # 008198

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 654989
Unit # : T105
VIN # : 1XPTPEX9 FD271825
Engine Hrs In : 22131.4 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
				Built and installed new air line.	
				GREASE UNIT	115.50
				Grease unit with one tube of summer grease.	
				HOSES BUILT FOR NEW RIG UP	943.69
				SET PTO	n/c
				Found poor connection up in dash. Repaired connection but ESA will not hook up. Used cummins program and set high RPM to 1150.	
				Reassemble dash.	
				Hazardous Material	114.11

Org. Estimate 5,772.24 Revisions 0.00 Current Estimate 5,772.24

Labor:	2,852.85
Parts:	1,118.72
Sublet:	1,411.69
HazMat:	114.11
SubTotal:	5,497.37
Tax:	274.87
Total:	5,772.24
Bal Due:	\$5,772.24

[Payments -]

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6586

Org. Est. # 007520

INVOICE

Printed Date: 09/22/2026 Work Completed: 01/01/-4713

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic #: 0-CP188 Odometer In : 634467
Unit #: T105
VIN #: 1XPTPPEX9 FD271825
Engine Hrs In : 21352.0 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
AIR TO AIR COOLER 2310279	1.00	1,071.43	1,071.43	CHARGE AIR COOLER -R&I Connect unit to laptop and found inactive codes for EGR and exhaust temp. Pressure tested air to air system and found a large crack in the air-to-air cooler. Drained A/C and found it was empty, removed air cooler and installed new. Test system, pressure built to 32 PSI and no more back smoke.	693.00
MOUNT KIT M203076	1.00	71.06	71.06	EGR VALVE - Removal & Installation EGR valve leaking out the valve stem, drained coolant and replaced valve. Filled coolant and inspected for leaks - none found.	554.40
EGR VALVE 2459945	1.00	4,797.58	4,797.58	A/C LEAKING - REPAIR Pressure tested A/C and found lower condenser line was rubbed and leaking. The expansion valve was also leaking, changed the line, valve and receiver dryer. Filled with A/C and had a temp of 46° in cab.	222.75
EXPANSION VALVE 1000463486BSM	1.00	135.36	135.36	Hazardous Material	58.81
#6 SEALING WASHER 730392ATC	3.00	2.11	6.33		
#8 SEALING WASHER 730393ATC	2.00	2.20	4.40		
#10 SEALING WASHER 730394ATC	1.00	5.68	5.68		
#12 SEALING WASHER 730395ATC	1.00	2.84	2.84		
RECEIVER DRYER F37-6016	1.00	153.28	153.28		
HARDLINE F50-6527-040000	1.00	431.29	431.29		
Shop Supplies			147.02		

Org. Estimate 8,772.99 Revisions 0.00 Current Estimate 8,772.99

Labor:	1,470.15
Parts:	6,826.27
HazMat:	58.81
SubTotal:	8,355.23
Tax:	417.76
Total:	8,772.99
Bal Due:	\$8,772.99

[Payments -]

Vehicle Received: -4713-01-01

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

5485

Org. Est. # 006242

INVOICE

Printed Date: 09/22/2026 Work Completed: 01/01/-4713

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 528508
Unit # : T105
VIN # : 1XPTPPEX9 FD271825
Engine Hrs In : 18784.3 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
CLUTCH BRAKE SB200	1.00	65.65	65.65	CLUTCH BRAKE	107.25
3/8" PUSH CONNECT UNION BFPC1462-6	1.00	8.61	8.61	Removed inspection plate and inspected clutch, found no problems and clutch was in spec. Found the clutch brake was broken, removed and replaced.	
3/8 AIRLINE Size: FT C-66-BK Shop Supplies	1.00	2.13	2.13	AIR LEAK - DIAGNOSE	66.00
			17.33	Aired up truck and could not hear leak. Started wiggling air lines and found the leak. Undid the leaking line under the cab and removed. Line would not disconnect from firewall so installed a union and replaced the line from the brake to the treddle valve. Tied up lines and function tested for air leaks - good.	
				Hazardous Material	6.93

Org. Estimate 287.60 Revisions 0.00 Current Estimate 287.60

Labor:	173.25
Parts:	93.72
HazMat:	6.93
SubTotal:	273.90
Tax:	13.70
Total:	287.60
Bal Due:	\$287.60

[Payments -]

Vehicle Received -4713-01-01

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6994

Org. Est. # 008040

INVOICE

Printed Date: 09/22/2026 Work Completed: 08/24/2026

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 651362
Unit # : T105
VIN # : 1XPTPPEX9 FD271825
Engine Hrs In : 21996.0 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
ABS MODULATOR VALVE K128913OR	1.00	460.94	460.94	BRAKES WEAK	742.50
ABS MODULATOR VALVE K128913OR	1.00	460.94	460.94	Checked over all brakes and found axle #3 and #4 P/S slacks have 2-inch brake stroke, and there were lots of gaps between shoes and drum. Adjust the control arms on these 2 slacks and then adjusted brakes. All brakes now applying, did find front brake modulators leaking out exhaust on steer axle. Replaced both modulators and test - no more leaks.	
Shop Supplies			74.25	Hazardous Material	29.70

Org. Estimate 1,856.75 Revisions 0.00 Current Estimate 1,856.75

Labor: 742.50
Parts: 996.13
HazMat: 29.70
SubTotal: 1,768.33
Tax: 88.42
Total: 1,856.75
Bal Due: \$1,856.75

[Payments -]

Vehicle Received: 2026-08-24

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd staff Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

INVOICE

Printed Date: 09/22/2026 Work Completed: 08/05/2026

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 647706
Unit # : T105
VIN # : 1XPTPPEX9 FD271825
Engine Hrs In : 21855.7 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
AIR FILTER RS5287	2.00	123.26	246.52	BLACK SMOKE - DIAGNOSE	660.00
BLADE- FAN 996813502-002	1.00	488.78	488.78	Complete turbo actuator functionality test - actuator sweep fails. Drained coolant and remove actuator from turbo. Retested and still fails. Checked turbo - getting stuck when opening. Removed air to air pipe - turbo is also blowing oil. Pressure tested air to air - good. Gasket on intake horn is blown; engine fan is cracked apart too.	
TURBO S/N T13576 WO284	1.00	4,800.00	4,800.00	TURBO - R&I	815.10
ACTUATOR S/N 1T-STG027095 2411559PRX	1.00	2,650.00	2,650.00	Remove EGR valve, intake horn, EGR cooler and all turbo, coolant/oil lines. Also removed EGR cooler and turbo. Installed new turbo and actuator. Changed oil filter and cleaned out intake. Replaced air filters and filled coolant. Test drive unit and verified repairs.	
GASKET, CHARGE AIR PIPING D42-1003	1.00	12.36	12.36	EXHAUST MANIFOLD GASKET - R&I	198.00
CLAMP-STEEL, EXHAUST 10028-6	1.00	42.18	42.18	Found exhaust manifold leaking removed manifold cleaned surface installed new gaskets and new bolts.	
GASKET, TURBOCHARGER 2386850PE	1.00	40.19	40.19	Hazardous Material	66.92
GASKET 1923003PE	1.00	26.42	26.42		
GASKET, EXHAUST PIPE 1886111PE	1.00	30.71	30.71		
GASKET, COOLANT PIPE 2106218PE	1.00	22.44	22.44		
V-CLAMP, 82MM 1979190PE	1.00	93.44	93.44		
V-BAND CLAMP 75.2MM 1979191PE	1.00	93.36	93.36		
O-RING 22X2 1982776PE	1.00	6.92	6.92		
O-RING 12X2 1961490PE	6.00	9.69	58.14		
O-RING 25X2 1982774PE	3.00	7.10	21.30		
GASKET, EXHAUST 1917870PE	2.00	22.10	44.20		
GASKET-EXHAUST, EGR 2035973PE	4.00	57.52	230.08		
BOLT, FLANGE TURBOCHARGER 1895972PE	4.00	35.63	142.52		
GASKET, EXHAUST MANIFOLD 2138143PE	6.00	39.33	235.98		
FLANGE BOLT, M10X55 2427127PE	18.00	5.89	106.02		
O-RING 12.6X2	1.00	8.75	8.75		

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
 10609 79 Ave
 CLAIRMONT, AB. T8X5G9
 Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6913

Org. Est. # 007943

INVOICE

Printed Date: 09/22/2026 Work Completed: 08/05/2026

2022401 AB LTD
 8821 71ST AVE
 GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
 Lic # : 0-CP188 Odometer In : 647706
 Unit # : T105
 VIN # : 1XPTPPEX9 FD271825
 Engine Hrs In : 21855.7 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
1974191PE					
O-RING 8.1X 1.8	2.00	7.19	14.38		
2007405PE					
O-RING, 9X2	2.00	6.70	13.40		
1982773PE					
SEAL RING, VENTURI	2.00	71.89	143.78		
1924315PE					
GASKET-AIR INLET	1.00	32.65	32.65		
1786103PE					
O-RING 14X2	2.00	10.58	21.16		
1960576PE					
RING, SEAL	2.00	5.24	10.48		
1898204PE					
O-RING 7.4 X2	1.00	9.25	9.25		
2116602PE					
O-RING 9.78X 1.78	3.00	9.56	28.68		
1977943PE					
RING, SEAL 9X16X1.5	4.00	2.81	11.24		
1858035PE					
RING, COPPER 12X17X1.5MM	2.00	2.11	4.22		
0331328PE					
PLUG, W/SEAL	2.00	66.43	132.86		
1863266PE					
15/40 ROTELLA TRIPLE CK4 Size: L	45.00	6.93	311.85		
SL500010048					
50/50 RED ANTIFREEZE Size: L	5.00	3.19	15.95		
WC26-839					
OIL FILTER ELEMENT	1.00	106.56	106.56		
1948921PE					
OIL FILTER	1.00	111.39	111.39		
1922496PE					
Shop Supplies			167.31		

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6913

Org. Est. # 007943

INVOICE

Printed Date: 09/22/2026

Work Completed: 08/05/2026

2022401 AB LTD

8821 71ST AVE

GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL

Lic # : 0-CP188

Odometer In : 647706

Unit # : T105

VIN # : 1XPTPPEX9 FD271825

Engine Hrs In : 21855.7

Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate	12,889.26	Revisions	0.00	Current Estimate	12,889.26
---------------	-----------	-----------	------	------------------	-----------

Labor:	1,673.10
Parts:	10,535.47
HazMat:	66.92
SubTotal:	12,275.49
Tax:	613.77
Total:	12,889.26
Bal Due:	\$12,889.26

[Payments -]

Vehicle Received: 2026-08-05

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6809

Org. Est. # 007810

INVOICE

Printed Date: 09/22/2026 Work Completed: 07/08/2026

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 644704
Unit # : T105
VIN # : 1XPTPPEX9 FD271825
Engine Hrs In : 21741.4 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
BRAKE CHAMBER, FORTIS, 30/30, 3" STR W/CLEVIS FT3030L	1.00	55.44	55.44	AXLE #4 P/S BRAKE POT - R&I Brake pot leaking air out of diaphragm. Remove old brake pot and installed new.	198.00
TIE ROD, RH E4629	1.00	51.06	51.06	D/S TIE ROD END - R&I Remove cotter pin, nut and remove tie rod out of knuckle which was seized and took extra time to free. Found tie rod end was seized so replaced the whole rod. Also replaced lower ackerman arm. Set toe in toe out.	693.00
PITMAN ARM J23-6015 Shop Supplies	1.00	920.14	920.14	PITMAN ARM - R&I Removed and replaced pitman arm.	165.00
			114.55	FREIGHT FOR PITMAN ARM	40.00
				DRAG LINK - R&I Removed and replaced drag link.	49.50
				Hazardous Material	44.22

Org. Estimate 2,447.46 Revisions 0.00 Current Estimate 2,447.46

Labor:	1,105.50
Parts:	1,141.19
Sublet:	40.00
HazMat:	44.22
SubTotal:	2,330.91
Tax:	116.55
Total:	2,447.46
Bal Due:	\$2,447.46

[Payments -]

Vehicle Received: 2026-07-08

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechnical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE**6644**

Org. Est. # 007593

INVOICE

Printed Date: 09/22/2026 Work Completed: 05/20/2026

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 636789
Unit # : T105
VIN # : 1XPTPPEX9 FD271825
Engine Hrs In : 21446.2 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
STEADY BEARING 10094142	1.00	142.56	142.56	DRIVE LINE - REPAIR Remove drive line on both sides of steady bearing. Replaced broken steady bearings. Greased and reinstalled drive lines.	198.00
GREASE SUMMER SRS2000 SL550027634	1.00	8.70	8.70	U-JOINTS - R&I While replacing steady bearing also removed and replaced all three u-joints and straps on drive line.	198.00
STRAP KIT, SPL250 SPL 250 70 18X	3.00	33.50	100.50	Hazardous Material	15.84
U JOINT SPL2503X Shop Supplies	3.00	283.63	850.89		
			39.60		

Org. Estimate 1,631.79 Revisions 0.00 Current Estimate 1,631.79

Labor: 396.00
Parts: 1,142.25
HazMat: 15.84
SubTotal: 1,554.09
Tax: 77.70
Total: 1,631.79
Bal Due: \$1,631.79

[Payments -]

Vehicle Received: 2026-05-20

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

INVOICE

Printed Date: 09/22/2026 Work Completed: 12/17/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 611092
Unit # : T105
VIN # : 1XPTPPEX9 FD271825

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
ABS SENSOR, 90 DEG, (0.94M) DIN 2 PIN ABS955336	1.00	37.38	37.38	CVIP LEVEL "A" WHEELS OFF	695.00
OIL FILTER ELEMENT 1948921PE	1.00	99.04	99.04	SERVICE UNIT Complete oil change, install new oil filter and new oil filter element. Grease unit with 1 tube of grease.	313.50
OIL FILTER 1922496PE	1.00	105.13	105.13	GREASE UNIT	165.00
GREASE WINTER SL550027635	1.00	8.73	8.73	CODES ON DASH - DIAGNOSE Scanned codes, 1 active code for FWD DRIVE P/S incorrect reading, 1 code active STEER P/S gap. Checked ___ at FWD DRIVE AXLE - pass, checked volts 4.5 - good, found crimps from an old repair, replaced. Volts now at 5V, cleared codes with Bendix, no codes returned - good.	165.00
TURBO ACTUATOR 2411559PRX	1.00	2,193.51	2,193.51	TURBO ACTUATOR - R&I Unit came in blowing black smoke informed customer, performed diagnostic test and found actuator for turbo failed. replaced	577.50
STEERING SEAL KIT TAS000001	1.00	37.63	37.63	D/S STEERING BOX SEAL LEAKING - LINE ALSO LEAKING Removed steer shaft and replaced the seal. Had to add 1L of ATF.	123.75
ATF-PENNZOIL DEX/MERC SL550050745	1.50	7.89	11.84	HOOD BUSHINGS DAMAGED - R&I Removed old hod bushings and replaced with new.	82.50
BUSHING-HOOD PIVOT RECTAN L13-6006	2.00	45.93	91.86	REAR D/S BRAKE LIGHT OUT & TURN SIGNAL NOT WORKING - REPAIR Found corrosion at the pig tail and at the butt connectors. Replaced pig tail and butt connectors. Function test light was dim. Further diagnosis there was corrosion found at the plug to the rear. Repaired the corroded areas with butt connectors, tested - good. Wrapped and zip tied all wiring up.	198.00
EXHAUST MOUNT KENWORTH M13109	1.00	22.81	22.81	D/S COOLANT LEAK BY STEP/FRAME - DIAGNOSE Drained coolant and replaced drain plug as it would screw all the way into coolant pipe. Replaced hose and filled back up with coolant.	165.00
HOOD BUSHING M13415	4.00	14.56	58.24	D/S ROUND REAR VIEW MIRROR CRACKED - R&I Removed and installed a new rear view mirror.	82.50
LED, SURESEAL PLUG ASSEMBLY 94707	1.00	5.50	5.50	TOP CAB LIGHT BURNT OUT Diagnose and found light not working. Checked unit for proper voltage and ground. Light has sufficient volts, 11.5V, and has good ground. Remove light, extend wires, install new light. Tested - good.	99.00
COOLANT PIPE 1973433PE	1.00	33.69	33.69	P/S FRONT RUBBER CAP LEAKING - R&I Removed old and replaced with a new cap.	16.50
CONVEX MIRROR 610676	1.00	53.69	53.69	FIFTH WHEEL BUSHING - R&I Remove fifth wheel, remove old bushings. Cleaned area and install new bushings. Assemble fifth wheel and install new pins.	198.00
CAB MARKER LIGHT TLEDPCAB	1.00	29.56	29.56	FIFTH WHEEL ADJUSTMENT Adjusted and greased fifth wheel.	99.00
HUB PLUG, SMALL 3595915	1.00	7.44	7.44	AXLE #4 P/S DUST COVER LOOSE Tighten dust cover.	16.50
NEW STYLE PIN/BUSHING KIT RK069731	1.00	142.31	142.31	P/S WINDOW REGULATOR NOT FUNCTIONING - REPAIR	412.50
WINDOW REGULATOR WNR021000-R	1.00	264.23	264.23		
WASHER 1/7/8 OD 1-17/64 ID 1/16 THICK E1113	4.00	0.46	1.84		
SNAP RING E3234	3.00	1.29	3.87		
CAM SEAL E1416A	8.00	2.13	17.04		
CAM WASHER	6.00	1.54	9.24		

Email Address: reception@anarchymechanical.ca

INVOICE

Printed Date: 09/22/2026 Work Completed: 12/17/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 611092
Unit # : T105
VIN # : 1XPTPPEX9 FD271825

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
E5095				P/S window won't roll up, disassembled door and operated window with direct battery power to the window motor. Had to assist window to go up but no issues going down. Motor failed. Replaced window regulator. It operates up and down as it should, reassembled door.	
BEARING AND SPACER KIT 10081728	1.00	383.56	383.56		
WHEEL SEAL RM-S05	1.00	52.70	52.70	AXLE #4 P/S BRAKE POT LOOSE Tightened bolts on brake chamber - secured.	16.50
6 HOLE BLACK GSK 3303009	1.00	2.69	2.69	AXLE #3 P/S BRAKE POT LOOSE Tightened bolts on brake chamber - secured.	16.50
HUBCAP, 6-HOLE, 5-1/2" BC, W/PIPE PLUG 3434009	1.00	25.25	25.25	AXLE #2 D/S BRAKE POT LOOSE Tightened bolts on brake chamber - secured.	16.50
SHOE KIT 2 SHOES ES11 W/HDW KITFR4709-501FFA	6.00	96.19	577.14	AXLE #2 D/S S-CAM SEAL LEAKING - R&I Remove hub, remove slack adjuster and s-cam. Remove seals and replace with new. Inspected and clean up s-cam. Re install all components.	198.00
SPACER AND SEAL KIT 10081520	3.00	121.44	364.32	AXLE #3 P/S S-CAM SEAL LEAKING - R&I Remove hub, remove slack adjuster and s-cam. Remove seals and replace with new. Inspected and clean up s-cam. Re install all components.	198.00
WHEEL SEAL - 2106 RM-D02	3.00	52.70	158.10	AXLE #2 P/S S-CAM SEAL LEAKING - R&I Remove hub, remove slack adjuster and s-cam. Remove seals and replace with new. Inspected and clean up s-cam. Re install all components.	198.00
GASKET, DRIVE AXLE 3303111	3.00	3.88	11.64	AXLE #3 P/S WHEEL SEAL - R&I Wheel seal is leaking, remove hub and seal. Clean area and install new seal and re-install hub. Torque to spec and fill hub.	123.75
BRAKE DRUM 16.5 X 7 BD16127	6.00	126.06	756.36	AXLE #2 P/S WHEEL SEAL - R&I Wheel seal is leaking, remove hub and seal. Clean area and install new seal and re-install hub. Torque to spec and fill hub.	123.75
EXHAUST STACK BUSHING KIT EM75-69002-HTATR	1.00	90.68	90.68	AXLE #1 P/S WHEEL SEAL - R&I Wheel seal is leaking, remove hub and seal. Clean area and install new seal and re-install hub. Torque to spec and fill hub.	123.75
DRAG LINK 463DS7562	1.00	301.94	301.94	AXLE #2 D/S BRAKE SHOE - R&I Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	66.00
DRAG LINK 463DS7563	1.00	350.06	350.06	AXLE #2 P/S BRAKE SHOE - R&I Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	66.00
Shop Supplies			596.55	AXLE #3 D/S BRAKE SHOE - R&I Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	66.00
				AXLE #3 P/S BRAKE SHOE - R&I Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	66.00
				AXLE #4 D/S BRAKE SHOE - R&I Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	66.00
				AXLE #4 P/S BRAKE SHOE - R&I	66.00

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
 10609 79 Ave
 CLAIRMONT, AB. T8X5G9
 Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6054

Org. Est. # 006887

INVOICE

Printed Date: 09/22/2026 Work Completed: 12/17/2025

2022401 AB LTD
 8821 71ST AVE
 GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
 Lic # : 0-CP188 Odometer In : 611092
 Unit # : T105
 VIN # : 1XPTPEX9 FD271825

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
				Remove worn brake shoes and install new shoes. Adjust and re-install hub, drum and tire. Torque tire to spec.	
				AXLE #2 D/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #2 P/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #3 D/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #3 P/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #4 D/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #4 P/S DRUM - R&I	99.00
				Removed and installed a new brake drum.	
				AXLE #4 D/S SHOCK LOOSE	16.50
				Tightened shock - good.	
				AXLE #4 P/S SHOCK LOOSE	16.50
				Tightened shock - good.	
				P/S EXHAUST STACK MOUNTS WORN OUT	99.00
				Removed cover, removed exhaust mount and installed a new mount, assembled back together. - good.	
				LINES ALL AROUND UNIT NEED TO BE ZIP TIED	49.50
				Zip tied up loose lines all around the unit.	
				D/S DRAG LINK BOOT TORN - R&I	165.00
				Removed cotter pins, removed the drag link and replaced with new.	
				P/S DRAG LINK BOOT WORN -R&I	165.00
				Removed cotter pins, removed the drag link and replaced with new.	
				FREIGHT	40.00
				Hazardous Material	237.02

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

6054

Org. Est. # 006887

INVOICE

Printed Date: 09/22/2026 Work Completed: 12/17/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 611092
Unit # : T105
VIN # : 1XPTPPEX9 FD271825

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate	12,953.72	Revisions	0.00	Current Estimate	12,953.72
---------------	-----------	-----------	------	------------------	-----------

Labor:	5,925.50
Parts:	6,905.57
Sublet:	40.00
HazMat:	237.02
SubTotal:	13,108.09
Tax:	655.40
Total:	13,763.49
Bal Due:	\$13,763.49

[Payments -]

Vehicle Received: 2025-12-17

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

5860

Org. Est. # 006668

INVOICE

Printed Date: 09/22/2026 Work Completed: 10/22/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic #: 0-CP188 Odometer In : 601409
Unit #: T105
VIN #: 1XPTPPEX9 FD271825
Engine Hrs In : 19547.8 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
GEAR PUMP PL1-19-02BPBB-HYD	1.00	1,360.11	1,360.11	HEATER - DIAGNOSE Check cab for heat, front of the cab reaches 51°C but rear of the bunk is cold. Trace heater hose and found not circulating because of dead head with no trailer hooked up. Found hose jumper in bunk, hooked up and function tested - good.	462.00
HYDRAULIC OIL AW22	1.00	99.00	99.00		
CLAMP 38-1520	2.00	6.43	12.86	HYDRAULIC PUMP - REPAIR Remove and replaced hydraulic pump and hose under oil cooler. Fill system and bleed air from hydraulic system. Function test - good.	198.00
1" EXTREME FLEX S&D HOSE Size: 1" EXT-100 Shop Supplies	1.00	17.51	17.51	HYDRAULIC LEAK - REPAIR Unit came back in at 601574 km & 195527 HRs. Unit came back for suspected leak. Rigged up test equipment for hydraulics and used pressure washer to clean system off. Brake cleaned and blow dried. Ran hydraulics with flow meter - no leaks. Suspect leak was from previous hose that blew and was not cleaned.	544.50
			120.45	Hazardous Material	48.18

Org. Estimate 3,362.77 Revisions 0.00 Current Estimate 3,362.77

Labor:	1,204.50
Parts:	1,609.93
HazMat:	48.18
SubTotal:	2,862.61
Tax:	143.13
Total:	3,005.74
Bal Due:	\$3,005.74

[Payments -]

Vehicle Received. 2025-10-22

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd. staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

5849

Org. Est. # 006654

INVOICE

Printed Date: 09/22/2026 Work Completed: 10/10/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic # : 0-CP188 Odometer In : 0
Unit # : T105
VIN # : 1XPTPPEX9 FD271825

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
USED HVAC BOX	1.00	1,312.50	1,312.50	HEATER BOX - REPAIR	2,310.00
HVAC BOX				Removed all plastic in dash, also had to remove windshield to gain access to dash screws. Removed all gauges and dash frame. Drain A/C and remove heater box. Install new heater box and reassemble all components removed. Function test heater box - good. Re charged A/C and added 2.56 LBS of refrigerant because it was low.	
CABIN FILTER	1.00	43.93	43.93	WINDSHIELD REPLACEMENT	468.00
CF19010				Hazardous Material	92.40
Shop Supplies			277.80		

Org. Estimate 4,729.86 Revisions 0.00 Current Estimate 4,729.86

Labor:	2,310.00
Parts:	1,634.23
Sublet:	468.00
HazMat:	92.40
SubTotal:	4,504.63
Tax:	225.23
Total:	4,729.86
Bal Due:	\$4,729.86

[Payments -]

Vehicle Received: 2025-10-10

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd. is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca

Anarchy Mechanical Ltd
10609 79 Ave
CLAIRMONT, AB. T8X5G9
Phone: 780-814-8555 Fax: 780-814-8599

INVOICE

5652

Org. Est. # 006426

INVOICE

Printed Date: 09/22/2026

Work Completed: 08/18/2025

2022401 AB LTD
8821 71ST AVE
GRANDE PRAIRIE, AB T8X 0E2

2015 Peterbilt - 367 - Paccar MX-13 PCI 6 CYL
Lic #: 0-CP188 Odometer In : 590956
Unit #: T105
VIN #: 1XPTPEX9 FD271825
Engine Hrs In : 19127.7 Engine Hours Out : 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
HYDRAULIC OIL AW22	1.00	91.13	91.13	PTO LEAK - REPAIR	280.50
HYDRAULIC FILTER BT8443	1.00	16.46	16.46	Cleaned off hydraulic pump and hydraulic cooler/wet kit. Filled hydraulic oil and ran unit up to temp. Found a leak on the pressure line off of the hydraulic pump, fan motor shaft seal on wet kit.	
FAN C/W HUB MH3 506022206	1.00	623.25	623.25	Drained oil into clean containers, removed high pressure line from pump and resealed fittings. Re installed line and checked for leaks - good.	
MOTOR, FAN COOLER MH3 300001228	1.00	985.88	985.88	HYDRAULIC COOLER - NO OIL	990.00
RETAINING CLIP 482650	2.00	1.25	2.50	Removed all hoses going into wet kit, removed whole assembly. Cleaned off all dirt and oil. Dismantle cooler, fan and motor. Installed new motor, fan hub and reassemble unit onto truck. Re filled with oil and tested system - no leaks.	
Shop Supplies			127.05	Hazardous Material	50.82

Org. Estimate 4,027.12 Revisions 0.00 Current Estimate 4,027.12

Labor:	1,270.50
Parts:	1,846.27
HazMat:	50.82
SubTotal:	3,167.59
Tax:	158.38
Total:	3,325.97
Bal Due:	\$3,325.97

[Payments -]

Vehicle Received 2025-08-18

Customer Number : 355

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts is up to the suppliers discretion or one year which ever applies. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Labor will be charged unless covered by supplier for all warranty claims. Anarchy Mechanical Ltd is only responsible for warranty of parts supplied and installed by Anarchy Mechanical Ltd staff. Any and all progressive damage caused by continued operation, past component failure is the sole responsibility of the customer. Anarchy Mechanical Ltd. will cover workmanship for 30 days or 100 hours, unless otherwise stated on the original invoice.

YOUR WHEELS MUST BE RE-TORQUED AFTER 50KM. FAILURE TO DO SO COULD RESULT IN DAMAGE TO YOUR VEHICLE OR INJURY WHICH ANARCHY MECHANICAL WILL NOT BE HELD LIABLE FOR

Signature _____ Date _____

Email Address: reception@anarchymechanical.ca