

018-1
NW

Northern Trailer and Truck
2210 - 19 Avenue
Wainwright, AB T9W 1L2, CA
northerntrailerandtrucksales@gmail.com
780-842-0080



Invoice: 11819
Date: 8/16/2024

Bill To
CK Trucking

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
7143	COD	8/16/2024			Cornish, Shane	

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Diagnose - Noise when stepping into throttle? Seems to go away as soon as you get levelled out?

Cause: Customer request **Type:** Preventive maintenance

Labor	Correction: Drivetrain / Transmission (Manual) - Service / repair / shifter / controls / Diagnose - Noise when stepping into throttle? Seems to go away as soo as you get levelled out? - Went with customer for test drive - Noise sounds like it coming from the transmission - Did a plug swap and found a lot of debris on the drain plug indicating transmission internal failure happening, unsure of cause at this time - Customer is going to run for a bit and see if noise gets worse but likely requires new transmission - Completed: 8/6/2024	1.00000	\$135.00	\$135.00
-------	--	---------	----------	----------

Subtotal \$135.00

Complaint: Heavy Transmission Replacement

Cause: Customer request **Type:** Unscheduled repair
(Inspection)

Item	Description	Quantity	Rate	Amount
Labor	Correction: Drivetrain / Transmission (Manual) - Service / repair / shifter / controls / Heavy Transmission Replacement Extra Repairs - Remove and install exhaust - Remove and install cross member - Remove and install driveline, torqued to spec and greased - Requires cooler lines replaced and wrapped to protect from exhaust - Speed sensor seized, broke during removal and had to be replaced - Transmission temp sensor connector was corroded, replaced pigtail - Adjusted clutch linkage, had 0 free pedal after install, set to 1-1/2" - Had to remove #1RH tire to remove transmission, installed and torqued to 475ft.lbs - Ran unit up to operating temp and test drive - Inspected for leaks none found, double checked trans oil level was good - Completed: 8/15/2024	16.60000	\$135.00	\$2,241.00
Parts	TRANSMISSION W/HALO STYLE PUMP - RTLO 18918 B-HR	1.00000	\$4,495.00	\$4,495.00
Parts	TRANS COOLER LINES - HOSEASSEMBLY	1.00000	\$97.50	\$97.50
Parts	KIT-ISOLATOR BUSHING REPLACEMENT - K3399	1.00000	\$39.98	\$39.98
Parts	U-JOINT STRAP KIT SPL250 - 250-70-18X	2.00000	\$27.50	\$55.00
Parts	TRANSMISSION SPEED SENSOR - K4148	1.00000	\$59.85	\$59.85
Parts	ISX SENSOR CONNECTOR - 3823256	1.00000	\$29.85	\$29.85
Parts	15" BLACK CABLE TIES - 83-6029	23.00000	\$0.24	\$5.52
Parts	CHEVRON DELO SYN- TRANS XE 75W90 (PER LITER) - 22307905-1L	23.50000	\$16.95	\$398.33
Parts	5/8" X 1-1/2" NC GR8. BOLT - GR8NC58112	2.00000	\$1.55	\$3.10
Parts	8" BLACK CABLE TIES - 83-6019	4.00000	\$0.06	\$0.24
Parts	5/16" X 3/4" NC GR8. BOLT - GR8NC51634	2.00000	\$0.11	\$0.22
Parts	5/16" GR8. FLAT WASHER - GR8FW516	2.00000	\$0.07	\$0.14
Parts	1/2" X 1-1/2" NC GR8. BOLT - GR8NC12112	2.00000	\$0.83	\$1.66
Parts	1/2" GR8. LOCK WASHER - GR8LW12	2.00000	\$0.28	\$0.56
Parts	1/2" NC GR8. HEX NUT - GR8NCNUT12	2.00000	\$0.23	\$0.46
Parts	1/2" GR8. FLAT WASHER - GR8FW12	4.00000	\$0.20	\$0.80
Parts	1-20/64" - 2-16/64" HOSE CLAMP - HS-28	1.00000	\$1.17	\$1.17
			Subtotal	\$7,430.38

Complaint: Clutch Inspection - Inspect Clutch For Reuse When Transmission Is Out

Cause: Customer request **Type:** Preventive maintenance

(Inspection)

Item	Description	Quantity	Rate	Amount
Labor	Correction: Drivetrain / Clutch - Adjustment / Clutch Brake / Linkage / / Clutch Inspection - Inspect Clutch For Reuse When Transmission Is Out - All clutch springs ok - Friction pads have minor glazing - Evidence of clutch slipping, intermediate plate has heat marks - Recommend replacing clutch at this point - Cross shafts and bushings require replacement - Flywheel face runout at 0.005", spec is at .008", recommend refacing Repairs Required 1. Flywheel requires refacing (Sublet) 2. Replace clutch and install new two piece clutch brake 3. Replace cross shafts and ream new bushings - Completed: 8/15/2024	2.00000	\$135.00	\$270.00
Parts	2" CLUTCH BRAKE - SB200	1.00000	\$67.50	\$67.50
Parts	CLUTCH CROSS SHAFT (KENWORTH) - M-1984	1.00000	\$69.85	\$69.85
Parts	6.5" CLUTCH SHAFT - 106C1498	1.00000	\$26.45	\$26.45
Parts	CLUTCH 15.5 X 2 EP 2050TQ - 108925-25AM	1.00000	\$1,250.00	\$1,250.00
Parts	PILOT BEARING - 6306LLUA1C3	1.00000	\$28.34	\$28.34
			Subtotal	\$1,712.14

Complaint: PTO Inspection/ Hydraulic Pump Removal and Replacement to access Transmission

Cause: Customer request **Type:** Unscheduled repair

(Inspection)

Labor	Correction: Drivetrain / PTO - Shafts / Drivelines / Controls / PTO Inspection/ Hydraulic Pump Removal and Replacement to access Transmission PTO Inspection - Includes removal of all hydraulic lines to remove pumps and PTO to access transmission R&R - Found multiple broken gear teeth, shifter jammed? - PTO Requires replacement - Installed new PTO, new PTO mounted with orifice in disengage side of spool - Installed and torqued to spec, measured backlash, was set to .007" - Ran PTO with pump off and inspected for leaks/operation, no noticeable noise or leaks - Mounted pump and hooked up hydraulic lines, primed both hydraulic pumps Extra Repairs Required 1. Had to rotate pump mount flange adapter on PTO 2. Had to remove small amount of material on pump flange bolt holes to line up old transmission as it had been notched **All fittings that had to be removed had O-rings replaced - Completed: 8/15/2024	16.00000	\$135.00	\$2,160.00
Parts	828 PTO - 828S-U6813-R3EG-MUN	1.00000	\$7,450.00	\$7,450.00
Parts	7/16" GR8. FLAT WASHER - GR8FW716	8.00000	\$0.06	\$0.48

Item	Description	Quantity	Rate	Amount
Parts	PTO GASKET 8 HOLE - 35P15-2	1.00000	\$2.52	\$2.52
Parts	1/2" GR8. LOCK WASHER - GR8LW12	4.00000	\$0.28	\$1.12
Parts	1/2" GR8. FLAT WASHER - GR8FW12	4.00000	\$0.20	\$0.80
Parts	1/2" X 1-1/2" NC GR8. BOLT - GR8NC12112	2.00000	\$0.83	\$1.66
Parts	ORB SEAL DURO - OR906	1.00000	\$0.78	\$0.78
			Subtotal	\$9,617.36

Complaint: Post Engine Rebuild - Valve Set - Roughly 1000hr Since Engine Overhaul

Cause: Customer request **Type:** Preventive maintenance

(Inspection)

Labor	Correction: Engine / Engine Overhaul / Post Engine Rebuild - Valve Set - Roughly 1000hr Since Engine Overhaul - Removed intake piping - Cleaned around and removed valve covers - Inspected cam and rockers, all still look brand new - Run overhead adjustment and inspect, tweaked a couple valves to spec - Torque checked all IVA housing mounting bolts, locknuts all torqued to spec - Cleaned mating surfaces and installed valve covers, installed intake piping and ran unit up to operating temp - Completed: 8/15/2024	4.50000	\$135.00	\$607.50
			Subtotal	\$607.50

Complaint: Sublet Flywheel Machined

Cause: Customer request **Type:** Preventive maintenance

(Inspection)

Labor	Correction: Drivetrain / Clutch - Adjustment / Clutch Brake / Linkage / / - Completed: 8/14/2024	0.00000		\$0.00
Parts	FLYWHEEL MACHINING - FLYWHEEL MACHINING	1.00000	\$189.95	\$189.95
			Subtotal	\$189.95

Complaint: Hydraulic Oil Change

Cause: Customer request **Type:** Preventive maintenance

(Inspection)

Labor	Correction: Drivetrain / Hydraulic Components - Pumps / Motors / Hoses / Fittings / Hydraulic Oil Change - Drained oil into pails and counted how much came out - 24 pails came out of tank - Filled tank with 25.5 pails of new oil - Cleaned roof of sleeper and top of tank of any oil residue with soapy water - Cleaned and disposed of pails - Completed: 8/15/2024	3.00000	\$135.00	\$405.00
Parts	ANTI-WEAR HYDRAULIC OIL AW22 - 1123837	25.50000	\$79.50	\$2,027.25
			Subtotal	\$2,432.25

- While dampener was off, removed the old mounts and replaced with new mounts and hardware - Completed: 2/7/2024

Parts	KENWORTH MOTOR MOUNT KIT - M203039K2H	1.00000	\$107.98	\$107.98
Labor	Correction: Engine / Engine Oil Lubrication System / Front Crank Seal Leaking - Removed dampener bolts, dampener was seized to the crank, had to heat and work free - Removed old seal, cleaned surfaces, installed new seal - Cleaned dampener mating surfaces, installed and torqued bolts to OEM spec - Completed: 2/7/2024	2.00000	\$135.00	\$270.00
Parts	FRONT CRANKSHAFT SEAL - CAT142-5867/2W1733	1.00000	\$318.50	\$318.50
			Subtotal	\$52,320.40

Complaint: Cut Engine Deck

Cause: Customer request

(Inspection)

Labor	Correction: Engine / Engine Overhaul / - Completed: 2/5/2024	0.00000		\$0.00
Labor	CUT ENGINE DECK	1.00000	\$3,225.00	\$3,225.00
			Subtotal	\$3,225.00

Complaint: Remove and Replace Marker Light

Cause: Customer request

(Inspection)

Labor	Correction: Truck Chassis / Lighting & Electrical / Remove and Replace Marker Light - Replaced marker light with clear red - Completed: 2/7/2024	0.00000		\$0.00
Parts	2.5" RND LED SS CLR/RED LENS M/C LAMP - 1051	1.00000	\$14.89	\$14.89
			Subtotal	\$14.89
	Freight	1.00	\$80.00	\$80.00

Unit: VIN: 1NKDXBEX06J983892

2006 Kenworth T8 Series

Engine: 0 Hours

Truck Chassis: 320,550 Kilometers

Labor	\$14,281.50
Parts	\$43,445.27
Shop Supplies	\$663.39
Pre-Charge Subtotal	\$58,390.16
Freight	\$80.00
GST (5% of \$58,470.16)	\$2,923.51
Total	\$61,393.67
Payments & Credits	\$61,393.67
Balance Due	\$0.00

Northern Trailer and Truck
 2210 - 19 Avenue
 Wainwright, AB T9W 1L2, CA
 northerntailerandtrucksales@gmail.
 com
 780-842-0080



Invoice: 10225
Date: 2/7/2024

Bill To
 CK Trucking

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
6193	COD	2/7/2024	Chris Charters		LaPierre, Zane	

Item	Description	Quantity	Rate	Amount
Complaint: Customer Request - Remove and Replace Steering Wheel *Customer picked one out from Raney's and sent link to shop phone Cause: Customer request (Inspection)				
Labor	Correction: Truck Chassis / Cab Interior Components - Seats / Windows / Door Latches / Components / Customer Request - Remove and Replace Steering Wheel - Removed and replaced steering wheel - Put additional parts/old steering wheel in the cab - Completed: 1/30/2024	1.00000	\$135.00	\$135.00
Parts	18" CHROME LADY STEERING WHEEL - 600004XX	1.00000	\$435.50	\$435.50
Subtotal				\$570.50

Complaint: Recommended Repairs Required To Repair Jake Actuation Issue - Remove and replace ECM to Head Harness and Internal Harness' in head (Time Depending on head removal and repair) Cause: Wiring Harness' are all oil wicked and ECM Signal for Jake is faulty (Inspection)				
Labor	Correction: Engine / Engine Electrical Sensors and Wiring / Recommended Repairs Required To Repair Jake Actuation Issue - Removed and replaced Jake harness' at time of overhaul - Completed: 2/7/2024	0.00000		\$0.00
Parts	FRONT INJECTOR HARNESS - 3214323	1.00000	\$499.98	\$499.98
Parts	REAR INJECTOR HARNESS - 3214324	1.00000	\$425.00	\$425.00
Subtotal				\$924.98

Complaint: Driver Side Window - Requires replacement (Unable to be completed last service as we had received the wrong window the first time) Cause: Customer request (Inspection)				
Labor	Correction: Truck Chassis / Cab Interior Components - Seats / Windows / Door Latches /	3.60000	\$135.00	\$486.00

Components / Driver Side Window - Requires Replacement
 - Took the door apart and had a bolt break on the window crank, requires repair
 - Tap out the regulator and used a machine screw
 - Removed and replaced window, cleaned seals, cleaned window and reinstalled door skin
 - Performed decal replacement on Efacility (customer copy in cab) - Completed: 1/30/2024

Parts	DRIVER SIDE DOOR WINDOW - DT04774 GTNATI	1.00000	\$185.00	\$185.00
			Subtotal	\$671.00

Complaint: Head Removal and Rebuild - Previously diagnosed with issues

#6 Intake Valve Spring broken

All valves worn into head over twice the limit

Rear Jake Head was loose and #5 Injector rocker worn quite badly

Cause: Worn

(Inspection)

Labor	Correction: Engine / Engine Overhaul / POWER PLANT - CYLINDER HEAD ASSEMBLY AND /OR GASKET, R&R IN FRAME, CONVENTIONAL, LONG, CATERPILLAR ENGINE I INCLUDES: ADJUST VALVES. (045-007) - Removed all the components necessary to remove the cylinder head and inspect for repairs - Completed: 2/7/2024	26.30000	\$135.00	\$3,550.50
-------	---	----------	----------	------------

Labor	Correction: Engine / Engine Cooling System / COOLING SYSTEM - RADIATOR, R&R I INCLUDES: THE REMOVAL OF COMPONENT AND ALL NECESSARY COMPONENTS FOR ACCESS. TIME TO ADD COOLANT. DOES NOT INCLUDE: SYSTEM DIAGNOSIS AND TESTING, REFRIGERANT RECOVERY, EVACUATE, RECHARGE OF THE AC SYSTEM, OR A VEHICLE ROAD TEST. (042-002)	8.00000	\$135.00	\$1,080.00
-------	---	---------	----------	------------

Over/above

1. Fan shroud is broken out in a couple places

- Rotated and drilled new mounting holes

2. Pressure tested charge air cooler - started leaking at 3psi - requires replacement

- Removed and replaced

3.

Fan blades are broken in multiple spots/was seized onto the fan hub and took more time to break free

- Removed and replaced engine fan

4. Fan hub clutch lining is cracked in a couple spots - requires repair

- Removed and replaced fan hub

5. Replace two winter front retaining clips

- Replace two clips

6. Install plug ends on headlight wiring

- Swapped and tested wiring, everything working except LH turn, found some corrosion in the harness

- Cut, spliced and tied up wiring, good - Completed: 2/7/2024

Parts	BLADE-FAN - 4735-44003-14	1.00000	\$295.00	\$295.00
Parts	FAN CLUTCH REMAN - 79A9437RMAN	1.00000	\$1,575.00	\$1,575.00
Parts	BELT (4060578) - 578K6BLT	1.00000	\$39.98	\$39.98
Parts	AS HOSE - 207-8130	1.00000	\$179.98	\$179.98
Parts	COOLER-CHARGE AIR KW K100/T3-8 88-18 - 4401-2507	1.00000	\$965.00	\$965.00
Parts	BUSHING-RADIATOR - M200-70EP	4.00000	\$27.85	\$111.40

Parts	5/16" X 1-1/2" NC GR8. BOLT - GR8NC516112	1.00000	\$0.40	\$0.40
Parts	5/16" GR8. FLAT WASHER - GR8FW516	12.00000	\$0.08	\$0.96
Parts	5/16" GR8. LOCK WASHER - GR8LW516	1.00000	\$0.14	\$0.14
Parts	6" BLACK CABLE TIES - 83-6007	10.00000	\$0.05	\$0.50
Parts	3/4" SILICONE HEATER HOSE - 5526-075X50	12.00000	\$7.05	\$84.60
Parts	BLUE HEAT SHRINK BUTT CONNECTOR - 83-2350-1	1.00000	\$0.75	\$0.75
Parts	15" BLACK CABLE TIES - 83-6029	35.00000	\$0.30	\$10.50
Parts	12" BLACK CABLE TIES - 83-6021	45.00000	\$0.14	\$6.30
Parts	52/64" - 1-48/64" HOSE CLAMP - HS-20	1.00000	\$1.22	\$1.22
Parts	3/8" GR8. FLAT WASHER - GR8FW38	3.00000	\$1.02	\$3.06
Parts	5/16" NC GR8. NYLOC NUT - NYLOCKNC516	7.00000	\$0.07	\$0.49
Parts	3/8" GR8. LOCK WASHER - GR8LW38	1.00000	\$0.38	\$0.38
Parts	3/8" X 1-1/2" NC GR8. BOLT - GR8NC38112	1.00000	\$0.55	\$0.55
Parts	4.06"-4.37" TORQUE SEAL CLAMP - HC19-425	2.00000	\$16.73	\$33.46
Parts	5/16" X 2" NC GR8. BOLT - GR8NC5162	1.00000	\$0.60	\$0.60
Parts	5/16" X 3/4" NC GR8. BOLT - GR8NC51634	2.00000	\$0.14	\$0.28
Parts	5/16" X 1" NC GR8. BOLT - GR8NC5161	4.00000	\$0.29	\$1.16
Parts	1" SILICONE HEATER HOSE - 5526-100	3.00000	\$11.89	\$35.67
Parts	1/4" X 1" NC GR8. BOLT - GR8NC141	4.00000	\$0.10	\$0.40
Parts	1/4" NC GR8. NYLOC NUT - NYLOCKNC14	4.00000	\$0.15	\$0.60
Parts	1/4" GR8. FLAT WASHER - GR8FW14	8.00000	\$0.06	\$0.48
Parts	3/8" X 3/4" NC GR8. BOLT - GR8NC3834	2.00000	\$1.07	\$2.14
Parts	5/8" SILICONE HEATER HOSE - 5526-062X50	1.00000	\$6.60	\$6.60
Parts	90-0012 - V-BAND CLAMP 4"	1.00000	\$26.22	\$26.22
Parts	HARDWARE 10 STD TURNBTN TABS/WA - 75700AU0	2.00000	\$3.97	\$7.94
Labor	Correction: Engine / Engine Overhaul / POWER PLANT - ENGINE, OVERHAUL IN FRAME, CONVENTIONAL, LONG, CATERPILLAR ENGINE I AFTER ENGINE IS REMOVED. INCLUDES: TRANSFER ALL NECESSARY COMPONENTS. (045-020)	40.00000	\$135.00	\$5,400.00

- Stripped engine down for rebuild

1. Recorded liner protrusion and found all below spec

- Need a new spacer plate and liners to remeasure, may require cutting the counter bores
- Cleaned scale off the walls, installed new liners and torqued down a thinner spacer plate, all the liners are over max spec but to low with the old spacer plate, required cutting and shimming the counterbores
- Once cut, cleaned the surfaces and reinstalled the liners, measured all liners at .006", good

2.

Found corrosion in liner bores - requires cleaning and repair

- Built up corroded areas on #1 cylinder with JB Weld and hone down to spec to ensure liner O-rings have proper sealing surface
- All connecting rod and main bearing journals had scoring but measured within spec with new bearings
- Crankshaft end play .015"

- Oil pump back lash .008"
- Cam gear backlash .009"
- Camshaft, rockers, rocker shafts, and rear most IVA head replaced due to damage /wear
- Oil pump replaced
- All components installed and torqued to OEM spec

- Ran unit up to operating temp, no leaks found
- Test drove unit, good - Completed: 2/7/2024

Parts	AIR FILTER - RS3539	2.00000	\$94.98	\$189.96
Parts	CAT CAMSHAFT - 10R3323	1.00000	\$1,650.00	\$1,650.00
Parts	JAKE ACTUATOR HEAD - CAT20R0271	1.00000	\$2,995.00	\$2,995.00
Parts	INFRAME ENGINE C-15 KIT - IB Engine Overhaul Kit	1.00000	\$6,390.00	\$6,390.00
Parts	CAT C15 CYLINDER HEAD - Rebuilt Head	1.00000	\$6,850.00	\$6,850.00
Parts	OIL PUMP - Oil Pump	1.00000	\$985.00	\$985.00
Parts	VALVE ROCKER ARM - CAT20R3317	12.00000	\$335.00	\$4,020.00
Parts	VVA STUD - CAT304-9553/288-4109	9.00000	\$134.95	\$1,214.55
Parts	STUD - CAT8T7062	3.00000	\$39.85	\$119.55
Parts	HEAD BOLT KIT - 462-MCBC15HBK	1.00000	\$549.98	\$549.98
Parts	ROCKER SHAFT - 462-307-8322	3.00000	\$535.00	\$1,605.00
Parts	CONNECTING ROD - 337-10R2117	6.00000	\$279.98	\$1,679.88
Parts	OIL FILTER - 1R-1808	1.00000	\$69.85	\$69.85
Parts	CHEVRON DELO 400 15W40 CK-4 BULK OIL - 22229055B	49.00000	\$6.10	\$298.90
Parts	H.D. EXT LIFE RED PREMIXED 50/50 COOLANT - 16-834	13.50000	\$13.50	\$182.25
Parts	FUEL FILTER - BF7587	1.00000	\$22.50	\$22.50
Parts	FUEL FILTER - BF1259	1.00000	\$24.50	\$24.50
Parts	REBUILT INJECTORS - 337-228-10R1273	1.00000	\$5,350.00	\$5,350.00
Parts	INJECTOR ROCKER ARM - CAT20R3319	6.00000	\$539.98	\$3,239.88
Parts	OIL DOWEL - 6I1055	1.00000	\$14.09	\$14.09
Parts	EXHAUST STUD KIT - 337-3406ESK	1.00000	\$263.99	\$263.99
Parts	CAT REGULATOR (THERMOSTAT) - 462-247-7133	2.00000	\$74.46	\$148.92
Parts	T BOLT CLAMP 2.06 X 2.31 - HC3-225	1.00000	\$10.14	\$10.14
Parts	5/16" X 1" FENDER WASHER - FENDR5161	14.00000	\$0.18	\$2.52
Parts	44/64" - 1-16/64" HOSE CLAMP - HS-12	4.00000	\$1.22	\$4.88
Parts	HOSE ASSEMBLY - HOSEASSEMBLY	1.00000	\$49.82	\$49.82
Parts	3.06" - 3.37" TORQUE SEAL CLAMP - HC19-325	1.00000	\$18.40	\$18.40
Parts	2.56" - 2.87" TORQUE SEAL CLAMP - HC19-275	2.00000	\$17.07	\$34.14
Parts	2-1/2" SILICONE HEATER HOSE - 5515-250	1.00000	\$4.06	\$4.06
Parts	3" SILICONE RADIATOR HOSE - 5515-300	1.00000	\$4.09	\$4.09
Parts	1/4" ORTAC HOSE (RED) - ORT-25-1	1.00000	\$3.72	\$3.72
Parts	1" SILICONE HOSE CLAMP - CLET16	3.00000	\$2.18	\$6.54
Parts	COOLANT FILTER - WF2077	1.00000	\$27.03	\$27.03
Parts	6 CONN. 16-14 WEATHERPAK - 2179-15	2.00000	\$18.76	\$37.52
Labor	Correction: Engine / Engine Mounts / Remove and replace front engine mounts	1.00000	\$135.00	\$135.00

Item	Description	Quantity	Rate	Amount
Complaint: Fan Running All The Time				
Cause: Customer request Type: Unscheduled repair				
(Inspection)				
Labor	Correction: Engine / Engine Cooling System / Fan Running All The Time - On test drive hit a bump and fan started running constantly - Checked wiring to AC fan switch, found wires for fan switch corroded right at the jumper harness plug, they are broken to close to the plug to splice requires replacing pins -remove and replace pins and reinstall harness on truck -run unit up fan works as intended - Completed: 8/16/2024	0.80000	\$135.00	\$108.00
Parts	WIRING PIGTAIL - 2501047C1	2.00000	\$5.03	\$10.06
Parts	BLUE HEAT SHRINK BUTT CONNECTOR - 83-2350-1	2.00000	\$0.52	\$1.04
Parts	8" BLACK CABLE TIES - 83-6019	4.00000	\$0.06	\$0.24
Parts	3/8" WIRE LOOM - 83-8000	5.00000	\$0.53	\$2.65
Subtotal				\$121.99
	Freight	1.00	\$450.00	\$450.00
Unit: VIN: 1NKDXBEX06J983892			Labor	\$5,926.50
License Plate: (AB) K-69695			Parts	\$16,320.07
2006 Kenworth T8 Series			Shop Supplies	\$355.59
Engine: 30,165 Hours			Pre-Charge Subtotal	\$22,602.16
Truck Chassis: 328,857 Kilometers				