

Work Order History Report

20-Aug-2026

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repair time (hours)	Cost
Mobile Equipment Heavy Vehicles Dozers DZ03		Mobile Equipment Heavy Vehicles/Equipment Dozers DZ03 Komatsu D375A-8 Dozer						
	16396	fabbed brackets & fitted 2 x UHF Radiosgenuine 24-12V inverter was faulty, replaced & re-wired with one of ours from stock.Fit unit stickers check over	27/08/2020			0.0	4.0	\$0.00
	16437	armour up cheek inside & outside with arrow bar & stripsarmour up push arms with strips armour up track motor guardsweld on tilt ram protection platesstrip 32 plate for strips to weld onto cheek	2/09/2020	19	Hours	109.5	109.5	\$0.00
	16571	Adjusted tracks and checked over machine.	5/10/2020	218	Hours	1.0	1.0	\$0.00
	16564	250 Hour Dozer service and PM clinic completed, carried out smoke test on cab seals, could not fault.	8/10/2020	245	Hours	12.0	12.0	\$0.00
	16638	Steering problem , calibrate l/h steering paddle	15/10/2020	288	Hours	0.0	1.5	\$0.00
	16631	Steering Fault , L/h steering lever has delay , calibrated levers no change , checked pressures l/h & r/h both good , Komatsu looking into problem further (warranty) (Rohan , Anthony)	16/10/2020	293	Hours	0.0	3.0	\$0.00
	16622	Investigate l/h steering fault	16/10/2020	293	Hours	0.0	3.5	\$0.00
	16725	slow response in reverse access monitor - no active or logged codesR&R Engine air filtertested okayWARRANTY	3/11/2020	445	Hours	0.0	1.0	\$0.00
	16713	500 Hour Dozer service completed, topped up coolant, topped up hydraulic oil, greased stairs, blew dust out of cab, reversed fan and cleaned coolers.	8/11/2020	482	Hours	7.0	7.0	\$0.00
	16771	Remove & repair broken hand rail on stairs (chris damage check point alpha job)	15/11/2020	515	Hours	0.0	3.0	\$0.00
	16760	Removed exhaust flappers & sanded holes & sides , anti seized pivots , refitted & ok , (flaps were sticking in open	16/11/2020	521	Hours	0.0	1.0	\$0.00

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repairtime (hours)	Cost
		position when engine turned off)						
	16840	topped up coolant 10L checked for leaks	10/12/2020	701	Hours	0.0	0.5	\$0.00
	16912	250 Hour Dozer service completed, replaced u/s breathesafe a/c filter.	18/12/2020	753	Hours	2.5	2.5	\$0.00
	17007	low coolant filled with 5L water as no blue coolant on site.	7/01/2021	917	Hours	0.0	1.0	\$0.00
	17030	Walk machine over rom go line , coolant leak , pressure tested & found bottom radiator hose leaking tighten up clamp .	11/01/2021		Hours	0.0	2.0	\$0.00
	17070	1000 Hour Dozer service	16/01/2021	975	Hours	9.0	9.0	\$0.00
	17075	Repair blade push arm hand rails	20/01/2021	1009	Hours	2.5	2.5	\$0.00
	17080	Modify RHS grab rail to miss access stairs (moved it forward)	21/01/2021	1019	Hours	1.5	1.5	\$0.00
	17244	Installed top con GPS receivers , powered up unit , not working , checked wiring , rang & talked to top com bloke , trouble shoot & found control unit faulty , replaced control unit with temporary loan unit , reprogramed to suit site radio , test run ok .	18/02/2021	1201	Hours	0.0	7.0	\$0.00
	17268	250 Hour Dozer service completed, adjusted track tensions.	24/02/2021	1280	Hours	1.0	1.0	\$0.00
	17289	Dug mud dirt out of tracks / rollers	6/03/2021	1342	Hours	0.0	0.5	\$0.00
	17313	Remove tree root caught in tracks had to cut with saw to get out	7/03/2021	1344	Hours	0.0	0.5	\$0.00
	17332	Repaired broken grease line ripper box	8/03/2021	1358	Hours	0.0	1.0	\$0.00
	17407	Removed bent steps, fabricated new steps and welded to machine.	20/03/2021	1466	Hours	14.0	14.0	\$0.00
	17397	500 Hour Dozer service , wash , Replaced cutting edges ,	21/03/2021	1468	Hours	0.0	12.0	\$0.00
	17585	250 Hour Dozer service , cleaned out tracks of dirt	4/05/2021	1748	Hours	0.0	1.0	\$0.00
	17680	ladder fault , found limit switch sticky , cleaned & lubricated , tested ok .	29/05/2021	1947	Hours	0.0	0.5	\$0.00
	17728	Washed , 2000 Hour Dozer service , replaced fire extinguisher bracket & strap , replaced coolant with cummins PGXL , replaced fan belt , feversed fan & blew coolers out ,	7/06/2021	2012	Hours	0.0	24.0	\$0.00
	17762	Squealing belt , replaced faulty tensioner & fitted new belt . (tensioner Warranty)	13/06/2021	2051	Hours	0.0	4.0	\$0.00
	17843	Tighten push arm bolts	6/07/2021	2213	Hours	0.0	1.0	\$0.00
	17899	Installed Gps system.	7/07/2021	2218	Hours	1.0	1.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	17856	250 Hour Dozer service, blew out all air filters ,	9/07/2021	2237	Hours	0.0	2.0	\$0.00
	17862	Flipped 3 x centre edges & replaced 2 x outers , fitted all new bolts .	10/07/2021	2244	Hours	0.0	5.0	\$0.00
	18041	500 Hour Dozer service , washed , reversed fan to clean out coolers . replaced doser isolator & cleaned dosers ,	16/08/2021	2513	Hours	0.0	5.0	\$0.00
	18059	Check and adjust track tensions	20/08/2021	2547	Hours	0.0	1.0	\$0.00
	18143	Cut out & remove stick wedged in track idlers	6/09/2021	2705	Hours	0.0	0.5	\$0.00
	18188	250 Hour Dozer service , blew out all filters ,	13/09/2021	2764	Hours	0.0	1.0	\$0.00
	18228	Grease fault , checked operation & found no discharge , fitted new solenoid & valve stem for dump valve , test run ok .	19/09/2021	2814	Hours	0.0	1.5	\$0.00
	18230	adjust tracks , lift machine & check all rollers & idlers , pins , bushes , pads for wear , all seam good (Took photo's of track & sprocket wear)	21/09/2021	2824	Hours	0.0	2.0	\$0.00
	18365	1000 Hour Dozer service , washed , Straightened cannon guards l/h & r/h , secured fire extinguisher with another strap , removed belly guards & hosed out as well , reversed fan to get rubbish out .	23/10/2021	3018	Hours	0.0	14.5	\$0.00
	18357	1000 Hour Dozer service completed. straightened cannon guards on both sides, secured fire extinguisher, removed belly guards and hosed out, welded strip underneath blade to protect cutting edge bolts.	23/10/2021	3018	Hours	6.0	6.0	\$0.00
	18382	grease alarm , repaired grease leak , filled grease pod , bleed system	27/10/2021	3037	Hours	0.0	2.5	\$0.00
	18422	Removed and replaced work cutting edges with new, tensioned bolts.	2/11/2021		Hours	4.5	4.5	\$0.00
	18411	Removed quick fill pipe to tank, pulled apart and cleaned wiggins fitting, refitted and tested.	4/11/2021	3085	Hours	1.5	1.5	\$0.00
	18416	Fabricated wear plates and welded onto push arms, gouged 50mm off blade goanna wear plates and welded on new wearplate.	5/11/2021		Hours	15.5	15.5	\$0.00
	18431	KPAR Repairs (Komatsu Mitch)	9/11/2021		Hours	0.0	3.0	\$0.00
	18492	Welded on chocky bar to the underside of final drives to protect drain bungs	21/11/2021		Hours	2.0	2.0	\$0.00
	18496	Removed and replaced turbo (Factory Recall) Kris Komatsu	21/11/2021	3145	Hours	30.0	18.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	18509	Replaced blown radiator hose , top up coolant & bleed system	25/11/2021	3148	Hours	0.0	2.5	\$0.00
	18541	Refitted Kapar controller, Mitch Komatsu	2/12/2021		Hours	3.0	3.0	\$0.00
	18582	Play in stairs latching mechanism & striker , cut bent plate off striker mechanism & welded on new plate & welded to spacer plate to strengthen , built up worn section of locking mechanism with weld & reshaped , reassembled & test run ok .	13/12/2021	3210	Hours	0.0	5.5	\$0.00
	18605	250 Hour Dozer service completed, topped up coolant, blew out air filters, replaced wiper blades, replaced rhs fire extinguisher strap, tightened loose grease line, topped up engine oil (8L)	18/12/2021	3222	Hours	0.0	0.0	\$0.00
	18725	General check over blew out all filters engine & a/c , topped up eng oil (20 litres) checked lights , checked belt , topped up washer fluid	19/01/2022	3367	Hours	0.0	1.0	\$0.00
	18797	loose arm rest,Inspected arm rest, missing nut off quick release.sourced nut and secured arm rest and quick releaseensure other were also tight	3/02/2022	3376.1	Hours	0.0	1.0	\$0.00
	18886	500 Hour Dozer service completed	22/02/2022	3484	Hours	11.0	11.0	\$0.00
	18969	fit & set up repaired top com unit to dash & install radio frequency , test ok	15/03/2022	3590	Hours	1.5	1.5	\$0.00
	19118	Wash down with cannon	16/04/2022	3742	Hours	0.5	0.5	\$0.00
	19140	250 Hour Dozer service completed. filled up washer bottle, topped up engine oil 8L, topped up battery water, topped up coolant 10L.	17/04/2022	3742	Hours	2.0	2.0	\$0.00
	19190	DPF light coming up , Preform dpf / soot accumulation correction , fit [REDACTED] top con screen & remove hire unit & set up (DPF code still coming up) order new dpf filter	28/04/2022	3823	Hours	5.0	3.0	\$0.00
	19199	Cut out wear blocks to weld onto track plates to protect bolts (82) , weld blocks onto plates	3/05/2022	3841	Hours	0.0	14.5	\$0.00
	19221	Walked to workshop, washed machineCut off worn strips on side of bladeReplace strips with H/F pieces	10/05/2022	3862	Hours	9.0	9.0	\$0.00
	19251	LO1 CB2639 KDPF soot accumulation high - Code was on and asked to do manual burnTried to do manual burn but soot bars dropped back to 3n and it started auto burn, Machine was hunting in this process Let it run for awhile and it came goodGave back to operator to test After that it asked for	16/05/2022	3882	Hours	2.0	2.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		manual burn again, found LO1 CB2639 code againAQ00N3 KDPF system imbalance soot accumulation , CB2777 inhibit_switch_H1_soot_err_2Perform manual burn and gave to operator to test again						
	19293	Carry out soot test (DPF warranty job)(Scotty)	21/05/2022	3914	Hours	0.0	0.0	\$0.00
	19350	Investigate DPF fault	3/06/2022	3957	Hours	9.5	9.5	\$0.00
	19497	Fabricate cable roller holder frame on back of dozer	5/06/2022		Hours	64.5	64.5	\$0.00
	19436	Fit left over coversRetap holes that had been stripped Put in missing boltsRerouted coolant overflow hose	15/06/2022		Hours	2.5	2.5	\$0.00
	19420	2000 Hour Dozer service completed.	17/06/2022	3962	Hours	32.0	32.0	\$0.00
	19512	Main feed hose to blade U/S, hole in itRemove and turn grease off so machine can be used Make up new hose, spiral wrap, refit new hose, prime upTest run greaser	8/07/2022	4150	Hours	2.5	2.5	\$0.00
	19548	250 Hour Dozer service , blew out all air filters , & reversed cooling fans	25/07/2022	4233	Hours	4.0	4.0	\$0.00
	19747	Check fire suppression, low on pressure, jumped out of harnessWash unit for tracks maintenance, C/O tracks and sprockets. Adjusted and checkedReturned to site	24/08/2022	4403	Hours	21.0	21.0	\$0.00
	19828	500 Hour Dozer service , replaced r/h drive sprockets & bolts with new ones , reversed fan to clean out coolers , topped up battery fluids & hosed out box , washed machine , inspected for coolant leak but could not find , adjusted track tensions , replaced blocked hyd breather ,	13/09/2022	4500	Hours	24.0	9.0	\$0.00
	19875	Pull out full set of cutting edges, clean up, weld on cutting lugsGo to site - 4x centre cutting edges only require flipping. Remove all cutting edges, needle gun and wire wheel mull board and 4xcentre edgesFit 2x new corner edges and 4x inner old edges, used new bolts, nuts and washers. Torque up	24/09/2022	4549	Hours	7.5	7.5	\$0.00
	20068	Checked over, found faulty E-stop RHR removed. Cut back wires. Still shut down fault, check fire suspension, found sensor RHF faulty. Made up jump plug and fit. Tested ok	2/11/2022	4682	Hours	3.5	3.5	\$0.00
	20188	250 Hour Dozer service completed, inspected ladder fault and found switch contact faulty, cleaned and adjusted switch. Repaired Gps aerial plug.	27/11/2022	4774	Hours	8.0	8.0	\$0.00
	20283	Found two fault codes logged. AQOON3-KDPF system imbalance soot accumulation. 1Hr prior was code; CB2639-	19/12/2022	4925	Hours	1.5	1.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		Manual stationary Regan request_2. Was doing auto burn straight up this morning, cancelled and carried out manual burn and soot accumulation correction test. Erased codes						
	20346	Check over all connections and plugs. Check over settings. Pack up for repairs.	27/12/2022	4983	Hours	2.5	2.5	\$0.00
	20386	Installed GPS module and tested. Blade sensors not connecting properly. Machine position not showing correct position.	10/01/2023	5030	Hours	6.0	2.5	\$0.00
		GPS not picking up local GPS tower. Found incorrect settings in menu. Change settings, Everything's working.						
	20543	Inspected fault codes, DB92KK, DD14KA, DBE2KK, D19JKZ, DB2QKR, DB2RKR, DY2HKA. Used trouble shooting and found battery solenoid voltage low and intermittently switches on and off. Further investigation found switching terminal wire U/S, corroded and broken off after cleaning all mud out from under solenoids. Removed both solenoids, repaired damaged wiring, cleaned all terminals and replaced broken solenoid. Connected back together and tested. System now working correctly with no faults. However, UHF's were not operational. Carried out diagnostic and found voltage reducer and fuses fried. Replaced voltage reducer and fuses. UHF's now operational. Replaced voltage reducer fuse with 3amp to avoid frying reducer and UHF's. Carried out check over. Blew out all air filters and checked all fluid levels. Checked lights and E-stops. Found one light out. Removed and replace faulty light	6/02/2023	5162	Hours	10.0	10.0	\$0.00
	20557	Topped up coolant (check for leaks but could not see any) (water fill point)	18/02/2023	5234	Hours	0.0	0.5	\$0.00
	20608	250 Hour Dozer service as per sheet , Pressure test cooling system (ok) , reversed fan & blew out coolers ,	22/02/2023	5267	Hours	4.0	2.0	\$0.00
	20653	Check over, found LHS tilt cylinders hoses blown in push arm. Remove all covers. Remove blown hoses, sent to town to get new ones. Clean out push arm bolts and covers. Fit new hoses, wrap with rubber hoses. Top up hydraulic oil and tested. Fit covers, sent back to work	9/03/2023	5295	Hours	22.5	6.0	\$0.00
	20673	Inspected push arm leak on left side. Removed covers and cleaned out build up of mud and oil. Ran machine, but could not find leak. Advised hoses were replaced and may have just been residual oil. Advised operator to monitor	18/03/2023	5357	Hours	2.5	2.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	20716	Remove hoses to go to town to be made up. Fit new hoses, put rubber protector on them at corners. Degrease and wash down cavity. Check pivot oil level. Check recoil spring case oil, top up 7ltrs. Send back to work. Leak could possibly be recoil spring pin cover leaking, need to monitor	20/03/2023	5372	Hours	26.5	3.5	\$0.00
	20751	Tightened all coolant hose clamps. Topped up coolant level and pressure tested. Inspected ladder fault, removed limit switch, cleaned and regreased, fitted and adjusted. Working fine, no fault. Replace cooler hoses and clamps	23/03/2023	5378	Hours	23.5	5.0	\$0.00
	20757	Diagnose fault. 24v - 12v converter U/S. Replace converter and test UHF's	30/03/2023	5407	Hours	1.5	1.5	\$0.00
	20763	Top up hydraulic oil 20Ltrs	31/03/2023	5410	Hours	1.0	1.0	\$0.00
	20767	Removed GPS poles	31/03/2023	5410	Hours	1.0	1.0	\$0.00
	20820	Refit GPS poles, check operation of GPS	16/04/2023	5436	Hours	1.0	1.0	\$0.00
	20878	Washed , 500 Hour Dozer service , replaced missing bolt on fire suppression bottle ,	26/04/2023	5503	Hours	8.0	6.5	\$0.00
	20997	DPF fault - Checked Egr coolers for leaks, checked MAF sensor, cleaned dosers, removed and cleaned differential pressure sensors, found sensor had liquid blocking sensor, checked boost pressure, pressure test radiator, carried out soot test.	21/05/2023	5630	Hours	4.0	4.0	\$0.00
	21024	GPS not picking up a height, picks up position and satellites and blade location. Check all connections. Call precision partners, ran through diagnostic. R/H cable running from cab to front is U/S. L/H cables plug at front is U/S as well	24/05/2023	5648	Hours	3.0	3.0	\$0.00
	21098	Run new GPS cable. Remove all covers. Run both down LHS, drilling and fitting a second bulk head fitting. Remove floor in cab and seat to gain access. Run cable through to seat/AC ducting base. Remove A/C vent, fabricate alloy plate to suit. Fitting two bulk heads running cables through and D-clamping beside seat and behind seat. Fit on UHF connectors. Replace all covers, floor and seat. Tested Unit, ok.	4/06/2023	5690	Hours	30.0	18.0	\$0.00
	21086	250 Hour Dozer service , blew out all air filters , greased , adjusted tracks .	11/06/2023	5742	Hours	2.0	2.0	\$0.00
	21113	250 Hour Dozer service , blew out all air filters . adjusted tracks	11/06/2023	5742	Hours	2.0	2.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	21213	Checked power sources, found faulty. 24v-12v converter faulty. Replaced converter	28/06/2023	5850	Hours	3.0	3.0	\$0.00
	21211	Checked over, found batteries were dry. Topped up, wash out battery box, jump started and sent to work	29/06/2023	5850	Hours	2.0	2.0	\$0.00
	21237	Found LH arm rest trim coming off. Has missing scrivots. Will insert nutserts when Rohan comes in with a tool for them. RH armrest lever loose and wont lock up on it. Replace x1 lever. Adjust both levers to work.	4/07/2023	5894	Hours	1.0	1.0	\$0.00
	21242	Machine was ok when I got there. Found codes in computer. System imbalance soot accumulation. Outlet pressure sensor low error. Diff pressure sensor low	6/07/2023	5910	Hours	1.0	1.0	\$0.00
	21247	Removed LH arm rest. Inserted smm rive nuts and bolts. Assembled	10/07/2023	5932	Hours	1.0	1.0	\$0.00
	21266	Machine de-rating. Found codes in computer	10/07/2023	5934	Hours	1.0	1.0	\$0.00
	21249	Removed and cleaned sensors and pressure sensors on both DPF systems. Ran test, ok.	11/07/2023	5936	Hours	3.0	3.0	\$0.00
	21315	Dpf fault , found hose clip on rear diff press sensor broken , swapped to front . (Komatsu (Derick)	17/07/2023	5963	Hours	0.0	0.0	\$0.00
	21310	2000 Hour Dozer service as per sheet	20/07/2023	5968	Hours	22.0	20.5	\$0.00
	21434	Inspected for fault codes, found CB3133, CB1879, AQ00N3 most resent, DPF related. Checked over differential pressure sensor and lines. Isolated and re-tried, fault had cleared itself	18/08/2023	6133	Hours	1.0	1.0	\$0.00
	21439	Inspected engine derate. Found same codes from earlier in the week. Shut down and restarted, fault self cleared	22/08/2023	6149	Hours	0.5	0.5	\$0.00
	21520	250 Hour Dozer service completed.	3/09/2023	6241	Hours	3.0	3.0	\$0.00
	21509	Replaced breathe safe housing and tested operation. Mounted new fire extinguisher bracket and secured extinguisher. Replaced missing bolt in LH door latch, adjusted both latched and tested. Lubricated open position latches, but RH still not latching correctly. Adjusted door stops and ensured latch working.	5/09/2023	6253	Hours	4.5	4.5	\$0.00
	21571	Removed worn GET. Cleaned mating surfaces. Installed new GET with new bolts, nuts and washers. Remove worn HF strips on cheek underside edge. Weld on new HF strips	17/09/2023	6324	Hours	8.0	8.0	\$0.00
	21636	C/O batteries with new ones. Clean out dirt piled up. Test batteries, correct Amp rating	2/10/2023	6364	Hours	1.5	1.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	21714	Adjust tracks	17/10/2023	6392	Hours	0.5	0.5	\$0.00
	21738	Alarming fault codes x2 and wouldn't erase even with isolation. Gathered test procedures to check wiring for DPF, ground fault. All wires had continuity and correct voltage. Disconnected x6 electrical connectors, full of dirt, cleaned. Once work was carried out, codes had self erased. Test run up and down Bucks reef ramp with no fault emerging	21/10/2023	6406	Hours	1.5	1.5	\$0.00
	21771	Topped up engine oil level	26/10/2023	6451	Hours	0.5	0.5	\$0.00
	21815	Washed , 500 Hour Dozer service	8/11/2023	6527	Hours	8.0	6.5	\$0.00
	21839	Bring back to W/shop and washed. Remove and re-Armour all 12 roller guards and refit. Weld on blocks to grouser bars. Armour up travel motor guards. Remove grab rails and steps. Remove dirt from in and around hydraulic hoses. Replace damaged steps on top of the arms with checker plate and seal	13/11/2023	6544	Hours	51.0	19.0	\$0.00
	21919	Remove GPS poles	29/11/2023	6651	Hours	1.0	1.0	\$0.00
	21924	Check over fire suppression, found RH bottle was low on charge. Bypass switches, still alarming. Had to go back to work shop to make up more plugs to bypass other side. Alarm stopped. Sent back to work	2/12/2023	6681	Hours	2.0	2.0	\$0.00
	21962	250 Hour Dozer service , blew out all filters , Reversed fan to blow out coolers & radiator ,	10/12/2023	6745	Hours	2.0	2.0	\$0.00
	22103	Check over, removing all levers for outside door hinges. Found jammed up with Teetyl spray. Removed locks, cleaned up and sprayed with dry lube, fit and tested. LH adjustable arm rest was jammed with console trim, pull down console, straighten trim, refit and tested	28/12/2023	6911	Hours	3.0	3.0	\$0.00
	22124	Inspected connectors on U-link controller, ok. Contacted position partners and followed instructions given. Full reset on system. Recommends pulling off hats every now and then to retrain hardware. May also be deteriorating from harsh weather, but still working fine Atm. Test and move to make sure it still worked	10/01/2024	6950	Hours	1.0	1.0	\$0.00
	22162	Wash for service	19/01/2024	7000	Hours	1.5	1.5	\$0.00
	22133	Washed , 1000 Hour Dozer service as per sheet , remove grab hand rails on push arms & clean out & refit & weld on ,	20/01/2024	7016	Hours	18.0	15.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	22343	cleaned dpf screen & biscuits , carry out dpf & soot burn , Remove and clean rear DPF. Differential pressure sensor, cleaned code. Tested machine	4/03/2024	7190	Hours	2.0	2.0	\$0.00
	22387	250 Hour Dozer service , removed l/h engine door handle (welded up striker & refitted) , blew out all filters ,	16/03/2024	7275	Hours	2.5	2.5	\$0.00
	22422	Checked/cleaned E-stops, caused fire suppression to fault. Cleaned ladder switched. Investigate banging noise, found LH and RH front and rear rollers severely worn, 10mm off touching chain. Loosened LH track within spec	20/03/2024		Hours	2.0	2.0	\$0.00
	22546	500 Hour Dozer service completed, unblocked rear washer nozzle, tightened fire extinguisher mount brackets, adjusted track tension	10/04/2024	7512	Hours	19.0	16.0	\$0.00
	22532	C/O RH trunnion/push arm hoses and O-rings. Topped up hydraulic oil. Wash down	11/04/2024	7534	Hours	1.5	1.5	\$0.00
	22588	Remove covers on Trunnion/pivot and inspected hoses, all good. Remove front cover/hand grabs, was welded on and had to cut it off. Needle gun out all built up dirt from housing. Replace x2 tilt cylinder hoses at cylinder. Damaged fittings on bulkhead plate when removing, Chris welded new fittings to plate. Remove and replace tilt hoses in push arm. Fit new gasket to bulkhead plate. Test run for leaks. Top up hydraulic oil. Refit covers and hand grab. Chris welded hand rail back on. Check over all oils and coolant	16/04/2024	7542	Hours	29.5	22.5	\$0.00
	22601	Fitted GPS poles. LH side clamp thread stripped, used bolt and nut. LH side wingnut that holds wiring to bonnet snapped	3/05/2024	7639	Hours	1.0	1.0	\$0.00
	22694	Diagnose fault with fire suppression, all gouges in green and low pressure fault present. Bypass pressure fault present. Bypass pressure switch to eliminate fault. Stairs switch faulty. Cleaned and working for now	20/05/2024	7674	Hours	1.5	1.5	\$0.00
	22797	Run through settings, all good. Topcon not picking up GPS receivers. Inspect cables from receivers to monitor/control. Swap around cables/receivers, no change. Call Aptella and talk to tech support. He kept saying there was something wrong with the cables and would need to send a Tech out and if it wasn't the cables it could be the controller. OHMS test antenna cables and check all connections again. Remove box and give to Matt to send away	21/05/2024	7687	Hours	4.5	4.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	22754	250 Hour Dozer service , gps fault , checked all cables & plugs (Still fault)	9/06/2024	7757	Hours	2.5	2.5	\$0.00
	22906	Trammed back to w/shop , Washed , 2000 Hour Dozer service , Replaced worn equalizer top wear pads , topped up coolant , Replaced all worn armour , Replaced both arm steps , replaced armour on rock deflector , replaced battery box lid hinges , repaired handrail grabs on arm .	15/07/2024	7966	Hours	46.0	39.5	\$0.00
	22970	Check over, found grease pump not building pressure. Found main grease line on blade damaged and leaking. Remove grease line and made new one, fitted and tested. Check over fault code, ask to do manual burn. Carry out manual burn, checked, Ok. Rev fan to clean out coolers, very blocked with grease and dirt	6/08/2024	8069	Hours	3.0	3.0	\$0.00
	23009	Recover from cone. Bypass and get ready for use. Wash	10/08/2024	8140	Hours	2.0	2.0	\$0.00
	23051	250 Hour Dozer service , topped up engine oil (12litres) , blew out all filters ,	27/08/2024	8258	Hours	4.0	4.0	\$0.00
	23094	Look into the DPF issue. Found that bank A's temperatures are abnormal when completing a burn. Also found that doser pump A pressure falls away to 600/700Kpa. Also bank A KDOC is face plugging. Therefore I suggest that Pump A requires replacing as pressure to low causing incorrect doser injection. Pump A requires replacement or swap out DZ40 or EX492's pump to fault find. Doser also misses and doesn't run smooth when carrying out Regen	3/09/2024	8266	Hours	3.0	3.0	\$0.00
	23124	Diagnose DPF pressure sensor fault. * Front DPF sensor faulty	17/09/2024	8317	Hours	80.5	4.0	\$0.00
	23219	500 Hour Dozer service completed. Carried out Midlife. Washed and removed engine covers, removed exhaust stacks and intakes. Removed both DPF's and base plates. Removed and replaced water pump and hoses, o'rings and seals. Removed rocker cover covers and gaskets, carried out valve set following OEM procedures and specs, cleaned rocker covers and refitted with new gaskets, torqued covers to spec. Refit DPF base plates, fitted new reman dpf's. Refitted associated hoses and wiring. Run up and test machine.	14/10/2024	8468	Hours	82.0	36.0	\$0.00
	23359	Sample and replace engine oil	8/11/2024	8564	Hours	1.0	1.0	\$0.00
	23519	250 Hour Dozer service , blew out all filters , tighten loose	3/12/2024	8725	Hours	5.0	5.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		engine oil filter , Top con fault inspected wiring & carried out factory reset on rover box (Rang topcon support line)						
	23565	Check all leading cables for cuts or breaks. Could not fault	10/12/2024	8769	Hours	1.5	1.5	\$0.00
	23650	Diagnose issue. Test system fault with compressor. Removed compressor from DZ04. Removed panels from DZ03. Installed compressor. Vacuumed down system. Re-gassed and reinstalled all panels. A/C is now cycling and working correctly. Charged system with 900g R1341A	1/01/2025	8859	Hours	24.5	12.5	\$0.00
	23749	Change engine oil and filters, sample. Replace air filters and breath safe filters	16/01/2025	9024	Hours	2.0	2.0	\$0.00
	23725	1000 Hour Dozer service completed	20/01/2025	9094	Hours	9.0	9.0	\$0.00
	23732	Removed and replaced faulty low pressure switch on fire suppression system (East West Fire)	22/01/2025		Hours	2.0	2.0	\$0.00
	23779	250 Hour Dozer service completed, replaced rhs track with 2nd hand one, topped up engine oil 20L, repaired rhr E-stop and stair switches (Damaged from track breaking)	4/02/2025	9240	Hours	12.0	12.0	\$0.00
	23818	250 Hour Dozer service , topped up engine oil (20L) repaired r/h rear e/stop & stair switches damaged when track broke on cone , replaced r/h track (Master link broke while on cone) with s/hand one off DZ40 .	4/02/2025	9240	Hours	36.0	12.0	\$0.00
	23833	Pump up seat and inspect underneath. Check hoses and switches. No leaks.	17/02/2025	9332	Hours	1.5	1.5	\$0.00
	23905	Replace tracks and sprockets. Remove LH track guards. Remove seat and LH rollers. Evaporator blocked, lack of air flow. Tension chains.	4/03/2025		Hours	29.0	17.0	\$0.00
	23938	Replaced strips of amour on blade with new. Amour bar with Hard ox vertical strips and wear block pieces. Labelled new tracks with ID numbers. Repair emergency/fire suppression panel and paint	10/03/2025	9440	Hours	149.0	39.0	\$0.00
	23980	R&R damaged bolts on load rollers x7. Fit new roller LHS and 2nd hand one LHS. Refit chain guilds LH and RH with new bolts. Remove damaged roller cap bolts. Remove A/C Evap. Refit Evap and put cab back together. Fit new bolts to roller caps and torque up. Regas A/C system. Tension tracks. Fit GPS poles. Tram to site. Seat going down, replace compressor, hoses and fittings (Suspect switch leaking) UHF's	15/03/2025	9444	Hours	178.0	28.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	24019	not working, found circuit breaker tripped, reset Washed , 500 Hour Dozer service , topped up coolant , (9505 hrs)	24/03/2025	9500	Hours	10.0	10.0	\$0.00
	24037	Replace hydraulic hose. Repair heater line leak.	26/03/2025		Hours	12.0	12.0	\$0.00
	24050	Check over GPS, everything looks good. Surveyors checked site Rover/Base side of things and recon its good. Call Topcon number, He can't connect to machine as the U-link has not transmitted in 5 months. Verbally ran through all the settings, he thinks it's good, but the program has been diagnosed wrong. The surveyor has taken USB to reload program. Hès going to Email photos to Flemming in T/ville office	1/04/2025	9550	Hours	2.5	2.5	\$0.00
	24082	Change out LH tilt hoses	7/04/2025	9560	Hours	2.5	2.5	\$0.00
	24128	Cleared fire suppression fault, bottles low pressure, bridged out switch, replaced seat switch.	18/04/2025	9654	Hours	3.0	3.0	\$0.00
	24159	L01 DPF codes coming up. Followed wire diagram and tested, performed loaded diagnostics and reset.	27/04/2025	9689	Hours	4.0	4.0	\$0.00
	24190	250 Hour Dozer service completed	4/05/2025	9756	Hours	2.0	2.0	\$0.00
	24226	Machine fault codes, replaced faulty maf sensor, still faulting dpf blocked (High soot) removed dpf mufflers x 2 & washed out refitted & preformed burn & test run ok.	11/05/2025		Hours	19.5	15.0	\$0.00
	24232	Dpf codes , Carry out manual burn , removed broken unit number to be repaired , checked why am/fm radio not working	13/05/2025		Hours	5.0	3.0	\$0.00
	24248	Removed and replaced DPF pressure differential sensor and MAF sensor	16/05/2025	9843	Hours	2.5	2.5	\$0.00
	24304	Washed , removed belly plate , 2000 Hour Dozer service , filled middle r/h roller full of grease .	4/06/2025	10030	Hours	19.0	19.0	\$0.00
	24401	250 Hour Dozer service , topped up hyd oil 20 litres `	23/06/2025	10261	Hours	1.0	1.0	\$0.00
	24462	500 Hour Dozer service asper service sheet.	5/07/2025	10539	Hours	6.0	6.0	\$0.00
	24471	Replace cutting edges.	7/07/2025	10572	Hours	3.0	3.0	\$0.00
	24540	250 Hour Dozer service , unblocked rear window washer squirter , l/h track idler collapsed , split both tracks & replaced both front idlers with S/h ones out of DZ40 ,	19/07/2025	10811	Hours	0.0	0.0	\$0.00
	24577	Replace LH tilt cyl hosesRemove guards clean out dirt Remove hoses off DZ40 and fit Tested machine	27/07/2025	10996	Hours	0.0	0.0	\$0.00
	24569	1000 Hour Dozer service completed	28/07/2025	11009	Hours	8.5	8.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	24649	250 Hour Dozer service completed, replaced lhs cab light	9/08/2025	11289	Hours	2.0	2.0	\$0.00
	24745	500 Hour Dozer service completed, Replaced 5 wear strips on blade, removed inside travel motor guards and replaced with new. armoured up track guides, replaced 4 belly guard bolts. Komatsu carried out recalls, replaced water pump, trans cooler hose, welded in new sensor to radiator.	25/08/2025	11447	Hours	57.0	29.0	\$0.00
	24784	Inspected tracks and found idler bogie pins had failed, Stripped track assembly and removed broken pins and bushes, Replaced pins and bushes with new. Built up LH bogie frame bore faces from excessive wear, remove Track guards for boily to repair, cut 600 cutting edge to size Gouge and replace worn section on front track guides, armour 2 track guards. Removed bash plates, removed and replaced Jack shaft uni joints with new, replaced leaking coupling on trans suction pipe. Refitted idlers, replaced front track rollers on both sides, refitted tracks and tensioned, refitted bash plates and blade assembly, replaced tilt hoses that run through trunion, washed and sent to work.	7/09/2025	11465	Hours	96.0	80.5	\$0.00
	24824	Parts and service news upgrade fuel feed pump replacementKomatsu Mads	8/09/2025	11465	Hours	72.0	36.0	\$0.00
	24876	Leaking track pin LHS removed track pin rubber plug to fill with grease & fit new pin plug.Cleaned ladder switches & testes.	18/09/2025	11600	Hours	2.0	2.0	\$0.00
	24885	LH blade tilt hose leaking found leaking o-ring C/O & tested.Unit would not start checked over electrical system found tutbo timer plug under dash that the pins weren't pushed all the way in repaired plug.Tighten up wires on back of ignition tested unit was ok sent back to work .	20/09/2025	11593	Hours	6.5	6.5	\$0.00
	25005	Drilled out leaking track chain pin bung and filled with grease.	2/10/2025	11711	Hours	2.0	2.0	\$0.00
	24943	250 Hour Dozer service completed, filled leaking track pin with grease, replaced bottom roller lhs 3rd from rear	6/10/2025	11787	Hours	9.0	9.0	\$0.00
	24994	Replaced missing track guide	16/10/2025	11976	Hours	1.0	1.0	\$0.00
	25032	(20219 hrs) Washed , 2000 Hour Dozer service , Replaced l/h/f roller (1 x bolt damaged thread , 1 x bolt snapped) replaced second from rear l/h roller .	21/10/2025	12000	Hours	32.5	32.5	\$0.00
	25078	let off track tensionRaised machine unbolted and removed roller	22/10/2025	12046	Hours	2.0	4.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	25067	salte up fab dowel for LHF bogie rollers fit roller torque to space adjusted track sent to work	29/10/2025	12060	Hours	3.0	9.0	\$0.00
	25147	250 Hour Dozer service completed, removed Dpf's and washed out, carried out manual regen and soot correction, replaced track guide, lubed up stair switches.	15/11/2025	12261	Hours	3.0	3.0	\$0.00
	25179	Removed and cleaned up cutting edges, flipped edges and replaced corner tips	19/11/2025	12330	Hours	8.5	8.5	\$0.00
	25243	500 Hour Dozer service as per sheet	30/11/2025	12475	Hours	12.0	12.0	\$0.00
	25266	Rewired fire suppression harness to the sensors, Rewired E-Stop.	1/12/2025	12474	Hours	11.0	11.0	\$0.00
	25304	Replace fuel doser inspected engine fan Carrier out manual burn.	11/12/2025	12567	Hours	4.0	4.0	\$0.00
	25320	A/C blowing hot air checked over top up with gas tested ok high & low side caps were missing valves full of dirt & weeping out low side abit.	15/12/2025	12620	Hours	2.5	2.5	\$0.00
	25338	Check A/C fault found plug pin faulty c/o & tested. C/O flashing light.	17/12/2025	12630	Hours	5.0	5.0	\$0.00
	25390	L03 code CB1881 dpf fault, removed and cleaned DPF 2 pressure switch plugs, carried out manual regeneration.	24/12/2025	12663	Hours	4.0	4.0	\$0.00
	25407	No startReplace batteries and test charge rate	31/12/2025	12666	Hours	1.0	2.0	\$0.00
	25424	Diagnose grease controller fault Removed controller off DZ40 with recip timer Made jump harness & fitted to DZ03	4/01/2026		Hours	9.0	9.0	\$0.00
	25431	Broken grab rail around fire suppression tank-Tack handrail back togetherRemove handrail to weld outWeld handrail, clean and paintInstall handrail back to original position	6/01/2026	12713.8	Hours	1.0	1.0	\$0.00
	25459	250 Hour Dozer service completed, topped up eng oil and coolant	6/01/2026	12713	Hours	1.5	1.5	\$0.00
	25467	Shutdown on cone - found trouble codes DB92KK/D19JKZ/D014KA- 'Store Ladder' alarm going off. Check over all oils & fluids and underneath - decided that all codes are related-found that half fuses had no power and trouble shooting for the codes have circuit breaker 1 has power supply.Tried to get to CB1 but machine covered in finesWash down machine with water cart -check machine, codes have gone away-Test run up onto ROM-shutdown &restart and move ladder up and down --No Faults --send	12/01/2026	12821	Hours	4.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		back to work						
	25489	Remove air conditioner unitClean and inspect evaporator - clear A/C unit box - fit new TX valve - Fit new driver - regas A/CReplace both cabin filtersTop up engine oil (10 litres)	19/01/2026	12884	Hours	16.5	0.0	\$0.00
	25523	L04 FaultsGo to feeder 5, look over machine to find faultFound half the fuses not getting powerTraced back to ignition relay terminal rusted offReplaced ignition relay (solenoid)	21/01/2026		Hours	11.0	0.0	\$0.00
	25505	Broken down on cone SW fault Check over removed all e-stops to jump, out still no goodRemove all covers in cab checking fuse found blown fuse replaced fuse tested unit started Went through wiring all e-stop back togetherChecked all wiring on e-stop circuit found rub through wiring could be fault. refit all covers & A/C ducting in cab Do latter switch Removed all cover on RHS of engine to tighten up leaking coolant hose clamps test run all good,Refit covers sent to work	22/01/2026	12895	Hours	14.0	14.0	\$0.00
	25547	Fuel pressure fault tested in pile found fuel pressure drops off instantly removed rail pressure sensor from DZ40 fit to DZ03 to test didn't fix.PCV Test found pump 1 not making any pressure. Remove master link bolts to remove broken bolt fit back together with 4 new bolts.	31/01/2026	12949	Hours	96.0	28.0	\$0.00
	25537	1000 Hour Dozer service as per service sheet.(12950hrs)	2/02/2026	12950	Hours	7.0	7.0	\$0.00
	25589	Fuel fault - machine not faulting at timeChecked PCV resistances Checked all wiring for pumps & Rail pressure sensor to ecuCleaned all fuel feed screens & check valvesChecked for leaks /restrictions Run machine while monitoring fuel pressure - could not fault	4/02/2026	12950	Hours	12.0	0.0	\$0.00
	25664	Fuel injector pump failure, removed covers and hoses/ piping to pumps, removed both injector pumps. Fitted new diesel injector pumps, refitted pipes, brackets, hoses and panels. Refitted belly guards, Removed and weld on new armour to blade and push arms, welded cutting edge over edge bolts to protect bolt heads, removed and replaced worn track guides with new and new bolts.	11/02/2026	12956	Hours	54.5	26.5	\$0.00
	25658	Welded blocks to grouser plates to protect bolts.	12/02/2026	12956	Hours	28.0	0.0	\$0.00
	25854	250 Hour Dozer service - completedUnblock windscreen washer nozzlereplace breath safe blower housingFound breath safe has no power - tracked power supply and had to	3/03/2026	13213	Hours	22.0	20.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		remove panels behind seat. Found power supply wire missing at fuse in comms box behind seat. pulled cab and couldn't find wire.top up transmission oil, took 40L pulled belly inspection plate to grease UNIS and looked for oil leak - no signs of leak. Adjust both tracks						
	25803	A/C not blowingRemove everything needed to get to the evaporatorEvap full of breathsafe filterFitted new evaporator fitted all cab panels and put back togetherRegas and made sure was working correctlyMade a mesh screen of the Breathsafe pipe to prevent further issues	18/03/2026	13396	Hours	36.0	0.0	\$0.00
	25756	Updated Komtrax controller (Komatsu) Carried out 500hr mining inspection	22/03/2026		Hours	0.0	0.0	\$0.00
	25787	Breathsafe not working , found wire had come off fuse in komtrax box behind seat , am/fm stereo not working , could not fault . found load roller u/s & replaced with new one .	26/03/2026	13451	Hours	8.0	8.0	\$0.00
	25785	Washed , 500 Hour Dozer service , adjusted tracks , circuit breaker had tripped for breath safe reset & could not get to fault , unblocked windscreen washer squirters .	30/03/2026	13536	Hours	12.0	12.0	\$0.00
	25891	Low pressure in fuel railWalk back to workshopCarry out PCV tests - okCheck fuel pressures - now good - high only reading 80 m/a maxReplaced rail pressure sensorTested machineWalk back to site	2/04/2026	13566	Hours	21.5	18.0	\$0.00
	25892	C/O cutting edgesSwap out DZ40 with DZ30 on coneCut old cutting edge bolts and remove old edgesClean mounting surface on blade and new cutting edgesFir new bolts, washers and nuts - anti seize boltsTorqued bolts to spec with Rad Gun Cleaned up work area, threw old bolts + edges in steel bin	5/04/2026	13592	Hours	4.0	4.0	\$0.00
	25968	250 Hour Dozer service , blew out all filters ,	21/04/2026	13758	Hours	1.0	1.0	\$0.00
	25944	Track bolt snappedRemoved other bolt from truck plate RHSFitted new boltsTensioned bolts	24/04/2026	13787	Hours	4.0	4.0	\$0.00
	26079	Arm repairs4 strips off 100 hardox x 1M4 bits of plate Bis 2x2M	21/05/2026		Hours	9.0	9.0	\$0.00
	26091	2000 Hour Dozer service completed.	21/05/2026		Hours	27.0	15.0	\$0.00
	26102	Check over steering paddles/wiring + plugsCarry out steering paddle calibrationRepaired broken door mech RHS	31/05/2026	14112	Hours	2.5	2.5	\$0.00
	26132	Fuel pressure fault- Removed side panels - inspected and tested all wires on fuel pumps and fuel rail - all okay- Removed	4/06/2026		Hours	8.5	8.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		and cleaned all screens on fuel pumps and screen after fuel tank- Removed all check/relief valves and cleaned/checked operation - all ok- Carried out leak off test on fuel rail relief- Carried out injector leak off test - during second stall test - machine started rattling pumps while smoking and running rough - stopped machine- Attempted to start again while monitoring fuel pressure - not making pressure - blowing lots of unburnt fuel out of stacks and rattling- Believe machine has dropped injector						
	26147	Injector FaultRemoved bonnet and wiringRemoved DFS and DPF mounting plateRemoved air cleaner housings and mounting bracketsRemoved oil filters & housings - Removed secondary filters and housings and all fuel pipesRemoved brackets for injector harness and other mounting brackets around rocker coverRemoved rocker covers - pulled injectors and found #5 injector had blown solenoid offFitted new injectors - injector harnesses - tensioned injectors and coded injectors - refitted rocker covers with new sealsReassembled in reverse orderBled system - checked for seal oil leaks -ok - checked for smoke from exhaust or any engine noise - all okay	7/06/2026	14196	Hours	60.0	36.0	\$0.00
	26194	Replace sprockets with ones off DZ40Replace L/H track	12/06/2026	14196	Hours	10.0	10.0	\$0.00
	26191	Replace sprocket with ones off DZ40Replace L/H track with one off 40Komatsu replace R/H master linkReplace R/H trackReplace engine oil & filterReplace load roller RHS	20/06/2026	14196	Hours	100.5	13.5	\$0.00
	26202	CA452, CA2249 Fuel CodesCA 452 still active - perform diagnosis as per manual Swapped rail press - switch with one from 492 engineCode cleared	21/06/2026	14212	Hours	4.5	4.5	\$0.00
	26207	250 Hour Dozer service completed, replaced flashing light	23/06/2026	14253	Hours	3.0	3.0	\$0.00
	26250	Turbo, Coolant and Track Tension- Brought machine back from site- Washed and removed all panels from turbo side- Drained coolant and removed all oil and coolant lines off turbo and wiring- Removed all heat shields and unbolted turbo from manifold and exhaust- Removed turbo and swapped over all parts- Refitted to manifold and exhaust with new gaskets- Refitted all coolant and oil lines with new washers and O-Rings - Refitted all electrical plugs- Refitted head shields- Filled with water and ran machine to check for any leaks - all okay- Found	30/06/2026	14372	Hours	32.0	24.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		replacement O-Rings for intercooler joiner that was leaking- Filled machine with water and drained 4 times until water came out with no signs of coolant- Filled machine with new Radicool coolant- refilled all panels - tension track - washed and took back to site						
	26256	- Complete forced regen- Complete ash in soot correction	3/07/2026	14397	Hours	2.0	2.0	\$0.00
	26283	500HR Service- Pull breath safe apart to clean out filter that had fallen apart	8/07/2026	14488	Hours	11.0	11.0	\$0.00
	26285	Washed , 500 Hour Dozer service as per sheet , replaced breathsafefilter & cleaned out screen as filter had fallen apart .	8/07/2026	14488	Hours	11.0	11.0	\$0.00
	26293	Remove 3rd gear from drive and repair operators seat belt, burnt off fray- Tighten up loose grease line P-Clamp on tipper box	12/07/2026	14571	Hours	48.0	3.0	\$0.00
	26306	Bring back from siteRemoved Evaporator due to blockageReplaced & refitted A/C boxOn start up EStop code appeared - tested all EStop - acc ok - checked fuses - found work controller blown (14660 hrs)Replaced fuse & Estop code turned into Lo4 DID5KA, LO3 DB2QKR, LO3 DB2RKRCarried out diagnostics, found wire from EStop circuit had been removed from OEM harness & floating.Wire was key ACC power to W/C ECM for factory EStop bypassWire must have shorted on frame when assembling arm rest & shorted W/C ECM. Taped up wire &replaced ECM with DZ40 ECM - Tested ok	18/07/2026	14659	Hours	56.0	32.0	\$0.00
	26377	Checked over for sale. Removed belly plates and cleaned machine. Repaired transmission leak. Repaired breath safe pressuriser. Replaced equalizer bar bump stops. Tapped out belly guard threads. Re- fitted belly guards.	30/07/2026	14697	Hours	28.0	15.0	\$0.00
No of W/O for DZ03 :			226	Asset Total:	DZ03	2678.0	1723.5	\$0.00
No of W/O for :			226	Parent Total:		2678.0	1723.5	\$0.00
Grand Total			226			2678.0	1723.5	\$0.00