

Work Order History Report

20-Aug-2026

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repair time (hours)	Cost
Mobile Equipment Heavy Vehicles Dozers DZ04		Mobile Equipment Heavy Vehicles/Equipment Dozers DZ40 Komatsu D375A-8 Dozer						
	18265	Fill grease pod , check over machine ,put cleaner spray and banister brush in cab .	21/09/2021	49	Hours	1.0	1.0	\$0.00
	18266	Armour blade , weld top guard on blade	22/09/2021	49	Hours	24.0	24.0	\$0.00
	18508	low coolant light on , topped up coolant , checked for leaks ok	24/11/2021	143	Hours	0.0	0.5	\$0.00
	18534	Adjusted both tracks to spec.	27/11/2021	170	Hours	1.5	1.5	\$0.00
	18612	Inspected machine for coolant leak, found cooling hose to trans cooler had moved, re positioned hose and tightened clamps.	19/12/2021		Hours	4.0	4.0	\$0.00
	18726	general check over , blew out all filters engine & a/c , checked lights , topped up hyd oil 20 litres , checked belt ,	19/01/2022	396	Hours	0.0	1.0	\$0.00
	18738	Replaced broken uhf aerial	20/01/2022	396	Hours	0.0	2.0	\$0.00
	18769	UHF fault - C/O UHF & tested ok	22/01/2022	439	Hours	0.0	0.0	\$0.00
	18766	Grease alarm - inlet on dump valve o-ring leaking C/O & tested	24/01/2022	435	Hours	0.0	0.0	\$0.00
	18887	500 Hour Dozer service completed.	23/02/2022	476	Hours	9.0	9.0	\$0.00
	19031	H/F strips to outer edges of blade and underside of cheeks Rock deflectors over ram mountsWeld on rock deflector on top of bladeStrips to outside of cheeks Prep and paintPut up on go line	15/03/2022		Hours	32.5	32.5	\$0.00
	19156	250 Hour Dozer service , replaced air filter , Replaced Blade assembly with new semi U blade , manually greased , welded stauff clamps to hold grease lines	23/04/2022	742	Hours	36.0	24.5	\$0.00
	19266	Carried out track adjustment, adjusted tracks to spec	18/05/2022	845	Hours	0.5	0.5	\$0.00
	19442	1000 Hour Dozer service completed.	19/06/2022	1072	Hours	49.5	18.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	19478	Top up hydraulic oil levelCleaned breath safe filtersInspected system faultCarried outfilter reset on unit for breath safe	29/06/2022	1132	Hours	1.5	1.5	\$0.00
	19610	Inspect cabin pressure fault, found system to be on max fanSet system to normal operation, but pressure was still highRemoved filter and system dropped back to normal, tried to blow out filter, but filter damaged in process Installed new filter, but pressure was still highInspected over rest of system and found a hose that had not been installed correctly and was damaged Secured section of hose, but system still the same Blew out cab filter, but no difference, tried to adjust system settings, but no code	9/07/2022	1252	Hours	2.5	2.5	\$0.00
	19534	250 Hour Dozer service completed, Checked breathsafe fault and found water in plug, cleaned plugs and tested, ok.	13/07/2022	1272	Hours	1.5	1.5	\$0.00
	19590	Tightened and checked all bolts on push arms and blade	23/07/2022	1358	Hours	1.5	1.5	\$0.00
	19643	Washed , 500 Hour Dozer service , top up coolant , cleaned cab , (Emeil)	6/08/2022	1523	Hours	12.0	9.5	\$0.00
	19645	Grease pod mount crackedPre level mount, add in more bolts for support Weld up cracked bracket	9/08/2022	1526	Hours	2.0	2.0	\$0.00
	19679	Repair/re-design pipe on cable roller	12/08/2022		Hours	6.0	6.0	\$0.00
	19692	Adjust both tracks into spec	18/08/2022	1588	Hours	1.0	1.0	\$0.00
	19791	C/O blade and cleaned up igloo	28/08/2022	1666	Hours	24.0	24.0	\$0.00
	19781	Remove roof triangle, modify bracket, refit triangle. Test	5/09/2022	1728	Hours	2.0	2.0	\$0.00
	19799	250 Hour Dozer service completed	9/09/2022	1772	Hours	1.0	1.0	\$0.00
	19985	Topped up coolant, tightened loose drain bung	17/10/2022	1973	Hours	1.0	1.0	\$0.00
	19990	Go and check code in the computer. L03 DDk4KA T/m system abnormality for switch open circuit or hot short circuit.Give details to Eddie. Isolate machine and restart. Problem gone away, send back to work	17/10/2022	1978	Hours	1.0	1.0	\$0.00
	20020	2000 Hour Dozer service as per service sheet & tighten up all coolant hoses, drained & flushed coolant system,Replace Komatsu coolant with Tec coolant bleed system, Replace wiper blades remove belly plates & cleaned & refit.	23/10/2022	2000	Hours	20.5	20.5	\$0.00
	20018	Found E-stop full of water and wires broken. C/O E-stop and tested	24/10/2022	2004	Hours	1.0	1.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	20132	Adjusted axle grease injectors due to under greasing axel. Inspected arm rest fault, found jammed in up position. Forced down and system started working correctly, until it went full down and got stuck. Suspect motor or drive damage	10/11/2022	2160	Hours	75.0	2.0	\$0.00
	20192	250 Hour Dozer service completed, replaced GET, repaired coolant leaks, repaired cabin pressurizer fault, topped up coolant.	28/11/2022	2230	Hours	17.5	17.5	\$0.00
	20208	Installed new rod cap	29/11/2022	2257	Hours	0.5	0.5	\$0.00
	20227	Check hydraulic oil, level ok. Blown hose an hour later. Remove guards ect.. Remove right hand tilt cylinder hoses. Thoroughly cleaned dirt out of push arm where hoses run through. Fitted new hoses and O-rings. Put guards back on. Run up, check for leaks, degrease and wash. Top up hydraulic oil	7/12/2022	2321	Hours	25.5	5.0	\$0.00
	20355	500 Hour Dozer service as per sheet ,	4/01/2023	2500	Hours	20.0	11.5	\$0.00
	20382	Inspected logged faults, found FNR switch fault. Removed switch and inspected, found neutral micro switch U/S. Removed switch assembly from DZ03 to get DZ40 going, DZ40 working correctly with no faults. Disassembled WA600 FNR switch, found circuit board and switches the same. Soldered plug onto 600 switch board, installed onto DZ03 and tested. Operates correctly with no faults	9/01/2023	2496	Hours	9.0	6.0	\$0.00
	20395	Removed and replaced armrest motor	13/01/2023	2540	Hours	1.0	1.0	\$0.00
	20435	Replaced UHF handpiece. Inspected oil leak from grease pod filter, ensured filter secured. Removed hoses and resealed fittings into filter housing. Tested system for leaks, no leaks present.	19/01/2023	2604	Hours	22.0	2.5	\$0.00
	20480	Hydraulic filter on grease pod from seal C/O filter, tested ok	28/01/2023		Hours	1.0	1.0	\$0.00
	20548	250 Hour Dozer service completed	13/02/2023	2750	Hours	0.0	0.0	\$0.00
	20585	Replace R/H UHF handpiece, old one missing clip. Test	21/02/2023	2780	Hours	0.5	0.5	\$0.00
	20588	Check over and found water in plugs. Cleaned and filled with dielectric grease. C/O seals on plugs and tested. Ok	21/02/2023	2781	Hours	2.0	2.0	\$0.00
	20813	1000 Hour Dozer service , installed new adjuster onto ripper grease injector (damaged) & adjusted , welded new hatch lid mounting nuts to secure broken off , Fault with blade float	1/04/2023	2981	Hours	36.0	29.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	20831	traced wiring & found pinched wiring & repaired . Check over, found wiring on blade joy stick has been repaired before poorly. Cut wiring harness out and made new one, refit and tested, good.	9/04/2023	3005	Hours	8.0	8.0	\$0.00
	20949	Checked over for leaks. Grease pod not building pressure. Checked vent return. Grease bypassing. Remove all plugs, check and clean. Remove pressure switch and electric vent valves, cleaned and refit, tested ok. Blew out air cleaners and cab filters	10/05/2023	3137	Hours	4.0	4.0	\$0.00
	21023	Replace tracks. Cutting edges require replacing, none onsite. Remove bottom idler guards, Chris fit wear strips to them. Remove rear drive motor wear guards, Chris fit wear package to them. Remove damaged Evac housing, Chris repair and paint. Refit it with new E-stop.	23/05/2023		Hours	56.0	27.0	\$0.00
	21131	Set edges up to weld on lifting lugs. Packed up ute and trailer, used digger to unload stands. Set up dozer, had to oxy cut off all bolts. Cleaned up dozer blade, grind all bars, needle gun and wire buff. Use digger to pack up and load old edges into trailer. Took over new edges, use digger to lift new edges into place and fit. Packed up area, sent back to site	6/06/2023	3247	Hours	26.5	14.5	\$0.00
	21087	250 Hour Dozer service , blew out all air filters , greased , adjusted tracks .	11/06/2023	3300	Hours	2.0	2.0	\$0.00
	21190	Topped up engine oil 5L, still 1/2 inch under full. Tightened grease injector lines	25/06/2023	3398	Hours	1.0	1.0	\$0.00
	21260	Found LH final drive level bung O-ring damaged. Replaced O-ring.	12/07/2023	3474	Hours	0.5	0.5	\$0.00
	21300	Washed , 500 Hour Dozer service , adjusted both tracks , replaced missing bolts in grease hose clamps ,	18/07/2023	3500	Hours	12.0	9.0	\$0.00
	21354	Re-install ripper	25/07/2023	3515	Hours	2.5	2.5	\$0.00
	21525	250 Hour Dozer service completed	8/09/2023	3737	Hours	1.0	1.0	\$0.00
	21587	Lose tracks - Tension tracks to spec	20/09/2023	3754	Hours	0.0	1.0	\$0.00
	21597	Adjusted tracks check over track guides	24/09/2023	3756	Hours	0.0	0.5	\$0.00
	21610	C/O broken E-stop on RHR C/O broken grease pod mounting bolt	27/09/2023	3785	Hours	0.0	1.0	\$0.00
	21679	Inspect loader assembly. Adjust micro switches and test	12/10/2023	3830	Hours	0.5	0.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	21715	Adjust tracks	17/10/2023	3868	Hours	0.5	0.5	\$0.00
	21734	Inspection of RHS cannon and idler found cannon laying over one side of track frame wearing 15mm out of it. Removed side cover, 3 bolt plate to inspect pin and bush, missing completely. Trammed back to depot and park up	24/10/2023		Hours	4.5	2.0	\$0.00
	21831	Released track. Gas oxy out old bogie pin outer race. Clean up track frame and bogie ready for new pin. Fit new bogie pin. Made press tool. Fitted new cover in press. Adjust track. Walked back to site. Double check over bogie set up	4/11/2023	3871	Hours	44.5	10.5	\$0.00
	21800	Found CB2639 manual stationary regeneration request. Machine was performing regen when I got there. Told operator to keep using and let us know if it faulted again. Regen figures all in spec	7/11/2023	3883	Hours	1.0	1.0	\$0.00
	21889	Removed cover. Boily straightened, removed broken bolt and rewelded together. Refitted to dozer and painted	21/11/2023	3962	Hours	3.0	3.0	\$0.00
	21887	Washed , 2000 Hour Dozer service , Removed grab rails & step , covered in area with checker plate & refit grab rails ,	25/11/2023	3988	Hours	12.0	12.0	\$0.00
	21964	Replace worn ripper boot	10/12/2023		Hours	1.5	1.5	\$0.00
	22014	Done ash in soot correction, was over 5.7g/l, extremely high. Done forced manual burn. Tracked Komtrax wiring, found reducer disconnected and no power, plugged in and powered up. Faulty DC/ DC converter, C/O. Tripped fuse in LH side panel. Blown UHF fuses, C/O. Front washer motor U/S, swapped with rear one and unblocked washer nozzles	15/12/2023	4129	Hours	16.5	4.5	\$0.00
	22029	Carry out manual DPF burn	24/12/2023	4161	Hours	1.0	1.0	\$0.00
	22084	Adjust tracks	5/01/2024	4242	Hours	1.0	1.0	\$0.00
	22059	250 Hour Dozer service, carry out regeneration of dpf.	8/01/2024	4278	Hours	6.0	3.0	\$0.00
	22068	Flip blades	9/01/2024	4278	Hours	5.0	5.0	\$0.00
	22213	Test ladder, all working. Remove limit switch's and clean. Re assemble and test	1/02/2024	4349	Hours	1.0	1.0	\$0.00
	22214	Carry out Regen. x1 DPF at 5mg. x1 DPF at 0. When carrying out Regen x1 DPF not getting hot enough	2/02/2024	4353	Hours	1.0	1.0	\$0.00
	22316	Komtrax not transmitting , carry out test procedure from komatsu to carry out & sent them results .	14/02/2024	4396	Hours	4.0	4.0	\$0.00
	22292	Refit Ripper	19/02/2024	4418	Hours	1.5	1.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	22348	Removed proximity switched and cleaned contacts. Greased shaft on switched. Reassembled and tested	25/02/2024		Hours	1.0	1.0	\$0.00
	22324	Replaced DPF mufflers x 2 (Komatsu Colleen / Lachland)	27/02/2024	4457	Hours	0.0	0.0	\$0.00
	22318	Washed , 500 Hour Dozer service ,(DPF Mufflers changed by komatsu) walked back to site .	29/02/2024	4459	Hours	10.0	8.5	\$0.00
	22334	Check over engine and test run. No notable issues.* RG using machine	2/03/2024	4476	Hours	1.0	1.0	\$0.00
	22398	Replace blown hoses for tilt Rams on LHS trunnion. Test for leaks. Reinstall covers. Top up hydraulic oil. Adjust tracks and wash down LHS	17/03/2024	4589	Hours	15.5	3.5	\$0.00
	22500	Repair roof triangle mounts	2/04/2024	4761	Hours	2.5	2.5	\$0.00
	22513	250 Hour Dozer service completed, topped up engine oil, topped up hydraulic oil, adjusted tracks, tightened fire extinguisher brackets, straightened washer bottle hatch	3/04/2024	4781	Hours	2.0	2.0	\$0.00
	22527	Found no power to anywhere. Battery negative terminal burnt off on rear batteries. Found all terminals loose, RG fitted batteries two weeks ago. Fit new battery and tightened all clamps. Clear LO4 code. Reset breath safe hours as it wasn't reset at service	15/04/2024	4400	Hours	1.0	1.0	\$0.00
	22619	1000 Hour Dozer service completed	27/04/2024	5041	Hours	24.5	12.5	\$0.00
	22743	250 Hour Dozer service, replaced engine oil and filters, unblocked washer nozzles.	30/05/2024	5328	Hours	2.0	2.0	\$0.00
	22798	Repair roof triangle mounts and wiring	22/06/2024	5483	Hours	3.0	3.0	\$0.00
	22793	Washed , 500 Hour Dozer service , adjusted track tensions .	23/06/2024	5540	Hours	8.0	7.0	\$0.00
	22880	250 Hour Dozer service completed, removed KPAR controller to be repaired, replaced uhf aerial.	11/07/2024	5774	Hours	3.0	3.0	\$0.00
	22988	Remove the equalising pin. Separate the tracks. Remove and assemble the drive sprockets. Reinstall the tracks and tension to spec. Clean the bosses and hone. Cook the bearings. Repair grease injectors and fix the grease controller issue. Install new bushes and equaliser pin. Reinstall grease line and purge. Test grease system. Install belly plates and x5 belly plate holes. Check fluids and tension track. Remove and install rear inner drive guards	2/08/2024	5892	Hours	197.0	77.5	\$0.00
	22965	Fit drive motor guards. Tension tracks. Breathe safe U/S, alarm had power disabled. Blew out pressure line. Reset	5/08/2024	5892	Hours	25.5	13.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		alarm had power disabled. Blew out pressure pipe. Reset alarms. Fast fill fuel system U/S. Dismantle system. Make up new pilot hose. Test system, all good. Wash and check fluids. Tram to site						
	23021	Replace rear vision mirror	10/08/2024	5939	Hours	0.5	0.5	\$0.00
	22999	Washed , 2000 Hour Dozer service , replaced equalizer bar wear pads , inspected & found coolant leak (parts orded) (5990hrs)	18/08/2024	6000	Hours	24.0	15.5	\$0.00
	23028	Replace blown hydraulic hose	19/08/2024	6323	Hours	12.0	12.0	\$0.00
	23062	Replace x2 cannon-draft arm hoses in RHS	30/08/2024	6015	Hours	3.5	3.5	\$0.00
	23115	250 Hour Dozer service	13/09/2024	6234	Hours	2.0	2.0	\$0.00
	23239	Loosened track tension and found broken bolts on drive sprocket, oxy cut broken bolts and replaced with new, tension all lh and rh drive sprocket bolts to 1900Nm. adjusted track to spec, checked over and topped up engine oil.	1/10/2024	6358	Hours	7.0	7.0	\$0.00
	23247	Hydraulic leak on lhs blade tilt cylinder, removed guards, dig out dirt from around cylinder and hoses, replaced both hoses and reassemble.	4/10/2024	6367	Hours	7.5	7.5	\$0.00
	23287	Washed , 500 Hour Dozer service as per sheet carry out dpf burn , (L/h track adjuster blew seal track loose) removed blade assembly , disassembled idler & cushion , adjuster , rebuild adjuster cushion , assembled & refitted blade assembly , (Boilermaker replaced broken hinge on rear oil extraction points ,	25/10/2024	6504	Hours	53.0	38.0	\$0.00
	23360	Sample and replace engine oil	8/11/2024	6611	Hours	1.0	1.0	\$0.00
	23478	Cleaned off dirt and rocks, had to grind off grab rail to remove. Had to needle gun and dig out hard dirt and rocks to remove hoses. Use EX451 to pull hoses out then went to look for hoses. none in stock. Went to RG, they also had none. Fit new RH tilt hoses and tested Ok	18/11/2024	6658	Hours	20.5	8.5	\$0.00
	23442	Replace blade strips. Replace RH wiper blades. Replace front screen washer motor	23/11/2024	6691	Hours	10.0	10.0	\$0.00
	23522	250 Hour Dozer service , blew out all filters , carry out manual dpf burn , adjusted track tensions ,	4/12/2024	6732	Hours	2.0	2.0	\$0.00
	23655	Remove the belly plates and wash	29/12/2024		Hours	3.5	3.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	23748	Removed front blade and set up in workshop. Remove LH track assembly to remove track adjuster. Inspect, found pressure seal damage and not holding pressure. Remove A/C compressor for DZ03. Inspected A/C compressor from DZ03, found damage wiring to clutch. Repair wiring and fit to DZ04, run up and tested, Ok	1/01/2025		Hours	144.0	30.0	\$0.00
	23747	Remove all old seals and bushes. Clean out track frame and track adjuster. Check all parts. C/O sprockets and hocks	15/01/2025		Hours	196.0	22.5	\$0.00
	23731	Refill and recharged fire suppression system. (East west fire)	22/01/2025		Hours	6.0	6.0	\$0.00
	23723	1000 Hour Dozer service completed. Removed cab and replaced all 4 mounts, refitted cab. Removed blade, removed lhs track adjuster. Honed out adjuster piston and replaced adjuster seals, refitted adjuster. Replaced both tracks and all sprocket segments with brand new set.	23/01/2025	6954	Hours	600.0	135.0	\$0.00
	23808	Tension tracks. Wash out coolers and check lights	10/02/2025	7216	Hours	3.0	3.0	\$0.00
	23819	250 Hour Dozer service , (Topped up eng oil (20L) , Found r/h master link cracked (S/hand one that was fitted to new tracks when ned stuffed the threads (Walked machine back to workshop) (7258 hrs)	13/02/2025	7247	Hours	2.5	2.5	\$0.00
	23836	Remove master link RHS. Replace links on both sides of chain. Filled pins with 85w140, pressed in old pins.	17/02/2025	7262	Hours	50.5	26.5	\$0.00
	23845	Removed main grease supply hose, cleaned and fitted joiner. Refit and tested	23/02/2025	7319	Hours	2.0	2.0	\$0.00
	23880	Replaced both dps with reman ones , inspected inlet of egr coolers (ok), removed doser nozzles & inspected & cleaned, Ran machine & done soot accumulation reset, & reset the dpf & doc count.	24/02/2025	7320	Hours	12.0	9.5	\$0.00
	23877	Test unit found fan not working. Check fuses, all good. Check wiring found Deutz plug burnt out. Replace Deutz plug.	26/02/2025	7346	Hours	2.0	2.0	\$0.00
	23914	500 Hour Dozer service completed. Inspected grease fault, found electrical connectors dirty, cleaned connectors and tested.	8/03/2025	7538	Hours	26.5	12.0	\$0.00
	23946	Replace wipers. Clear all blockages	18/03/2025	7741	Hours	1.5	1.5	\$0.00
	23978	250 Hour Dozer service , topped up coolant	19/03/2025	7745	Hours	2.5	2.0	\$0.00
	24034	Clean tracks out, inspect rollers for Noice and report of overheating from operator. Track chains were not visible	27/03/2025	7836	Hours	9.0	9.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		through the mass amount of mud and rock						
	24046	Ripper dropped out by operator, so stood up in hole and refit to machine. Found hydraulic oil filter leaking. Removed and clean mounting surfaces. Fit new filter and checked, Ok. Removed UHF handle clip, handpiece fell off. Fabbbed up a bit of angle line and bolted to position. Refit clip and tested, all works	31/03/2025	7888	Hours	2.5	2.5	\$0.00
	24091	2000 Hour Dozer service , Metal found on final drive plugs both sides , internals lining of rubber hose found inside return hyd filter .	12/04/2025	8008	Hours	9.0	9.0	\$0.00
	24191	250 Hour Dozer service completed.	4/05/2025	8280	Hours	1.5	1.5	\$0.00
	24250	500 Hour Dozer service completed, found both final drives overfull, rhs drive sprocket missing tooth, topped up low trans oil 20l. minimal metal on final drive plugs.	14/05/2025	8503	Hours	6.0	6.0	\$0.00
	24258	Removed and replaced batteries with new, replaced faulty E-stop	21/05/2025	8586	Hours	3.0	3.0	\$0.00
	24297	250 Hour Dozer service completed, cleaned washer motors.	30/05/2025	8759	Hours	1.5	1.5	\$0.00
	24396	Washed , 1000 Hour Dozer service , carry out 1000 hr service , dig out & clean around tilt hoses on blade & replace leaking hose , tighten weeping coolant hoses , tighten loose bonnet led loose lights , repaired inspection cover on belly plates , re gassed air con . fit belly plates , charge fire suppression	21/06/2025	9013	Hours	69.0	51.0	\$0.00
	24382	Install coolant low water sensor & wire in buzzer , replaced out let hose of rower trans oil cooler , replaced all cab cushion mounts & modifications (Recall , field campaigns from komatsu) (Dan , Brayden) (17,18,19,20th June)	22/06/2025	9036	Hours	0.0	0.0	\$0.00
	24435	Drained trans oil, removed scavenger pump coupling, replaced seals and refitted, refilled trans oil	28/06/2025	9036	Hours	4.0	4.0	\$0.00
	24615	Replace water pump under warrantyReplace KPAR computerBrayden Komatsu	31/07/2025	9036	Hours	9.5	9.5	\$0.00
	24623	Remove final drives and replace bull gear bearings and seals due to seals leaking trans oil into finals and refit finalsSpin R/H idler in mount due to excessive wear.Replace rear boggie impact pads both sidesReplace L/H track tensioner piston, sleeve, seals and cannon bush and seals and reassemble into machineRemove all front idler boggie pins and bushes due to	1/08/2025	9036	Hours	696.0	120.0	\$0.00

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repairtime (hours)	Cost
		excessive wear- all were broken when removedFit 2x new front idlersRefit tracks Refit bladeReplace tilt cyl hosesTest and walk to site						
	24642	Fill LH rear carrier roller with grease	3/08/2025		Hours	0.0	0.0	\$0.00
	24703	Replace centre edgesRemoved shims from push arms	16/08/2025	9204	Hours	4.0	4.0	\$0.00
	24676	250 Hour Dozer service , blew out all air filters ,	18/08/2025	9224	Hours	1.5	1.5	\$0.00
	24767	Tighten track adjuster grease nutTension tracks	26/08/2025	9315	Hours	1.0	1.0	\$0.00
	24762	Repair broken seat belt wire	30/08/2025	9359	Hours	1.0	1.0	\$0.00
	24785	Sample and Change Engine oil	31/08/2025	9367	Hours	1.5	1.5	\$0.00
	24765	Tension tracks	1/09/2025	9392	Hours	1.0	1.0	\$0.00
	24798	Fitted emergency glass hammer to cab	6/09/2025	9456	Hours	0.5	0.5	\$0.00
	24826	500hr inspection Komatsu Dan	10/09/2025	9511	Hours	7.0	7.0	\$0.00
	24844	500 Hour Dozer service CompleteC/O uni jointsC/O outter edges	11/09/2025	9511	Hours	27.0	30.0	\$0.00
	24834	CA2777 CB2777 CA2639 CB2639 CA1921 CB1921 CA1922 CB1922Inspect DPFs for any external faults inspected wiring and sensors no faults found both were reading 8g/l Removed DPDs on site and brought to W/S to cleanStripped DPFs and found both excessively blocked Washed and blew out both DPFs and reassembledRefitted DPFs Removed fuel dosers and found 1 doser had no insulator disc and both nozzles excessively dirty cleaned and replaced both insulatorsCarried out manual regen and soot accumulation correction	14/09/2025	9575	Hours	13.0	13.0	\$0.00
	24879	C/O seized carrier roller RHS.	18/09/2025	9650	Hours	5.0	5.0	\$0.00
	24898	Removed turbo and dismantled VVT Found piston stuck and bore scored Swapped parts to new turbo and fitted to machineChecked trans wiring	23/09/2025	9653	Hours	89.0	23.5	\$0.00
	24927	250 Hour Dozer service CompletedTightened grease gauge and testedRemoved interior panels Replace both UHF antennasRefitted interior panels	28/09/2025	9742	Hours	6.0	6.0	\$0.00
	24977	RnR trans filters	7/10/2025	9928	Hours	1.0	1.0	\$0.00
	24988	2000 Hour Dozer service completed	11/10/2025	10000	Hours	20.0	20.0	\$0.00
	25026	Replace RHS bottom roller , filled roller next to it with grease (	22/10/2025	10227	Hours	3.0	3.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		leaking oil)						
	25027	Tensioned tracksRnR grease fitting to blade	23/10/2025	10243	Hours	1.0	1.0	\$0.00
	25031	250 Hour Dozer service , replaced trans filter clogging sensor (Light been coming on) blew out all air filters	23/10/2025	10247	Hours	1.5	1.5	\$0.00
	25056	A/c not blowing very hard, checked over, found rags shoved in air ducts and in front of cabin filter, cleaned out cab. pulled apart evap box and found evaporator blocked, recovered ac gas, removed evap and cleaned. Refitted evap and vacced down. Re gassed a/c system and tested.	30/10/2025	10361	Hours	60.0	34.0	\$0.00
	25103	500 Hour Dozer service Completed	6/11/2025	10455	Hours	3.0	3.0	\$0.00
	25140	C/O leaking roller LHS 3rd from rear had to Qxy cut of worn bolt head then heat to remove studs fit roller with new bolts tension caps adjusted tracks sent to work.	16/11/2025	10677	Hours	5.0	5.0	\$0.00
	25154	250 Hour Dozer service ,	20/11/2025	10758	Hours	3.0	3.0	\$0.00
No of W/O for DZ04 : 148			Asset Total:		DZ04	3221.5	1285.0	\$0.00
DZ40		DZ40 Komatsu D375A-8 Dozer						
	25271	Rewired new fire suppression harness.	23/11/2025	10790	Hours	4.0	4.0	\$0.00
	25249	A/C not blowing inspected found breath safe filter had been blown out & damaged filter causing evaporator to block up. Remove covers in cab evac a/c gas R&R evap regas a/c & tested.Check over komtrax fault found aerial unplugged. Plug back in & tested ok. removed all track guides for boily to rebuild then refit. Remove all breath safe piping & cleaned out dust. Cleaned all door latches & lube.lube up ladder. sent back to work. blade boily work gouge off strips welded on new ones welded on grader blade over cutting edge bolts. (10804hrs)	27/11/2025	10804	Hours	50.0	29.0	\$0.00
	25332	1000 Hour Dozer service as per service sheet push arm pin & bushes have movement.	9/12/2025	11010	Hours	25.0	13.0	\$0.00
	25363	Sample engine oil & replace engine oil & filters. Cut open filters in inspect. (11181hrs)	18/12/2025		Hours	1.5	1.5	\$0.00
	25355	Grease fault system was running at 4300pis replace solenoid tested ok.	19/12/2025	11151	Hours	1.5	1.5	\$0.00
	25378	250 Hour Dozer service completed, replaced cutting edges and corner tips with new, welded wear strips to cutting edge,	23/12/2025	11270	Hours	12.0	12.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		side and rear of blade, replaced led light.						
	25448	AC fan not working, Evap drain was blocked due to dirt, Water from Ac flooded ac fan, Removed and fitted new fan, Reinstall Kpar Box & tidy up wiring. Installed seat & interior parts. Replaced breathsafe filters & blow out tube, Gas Ac system, Replaces grease system controller box & test run, Replace timer on/off on pump, Found grease pump bolts missing & mount falling off, Replace bolts & reposition. Found crack on one of the mount plates - Brent welded up	10/01/2026	11388	Hours	34.0	34.0	\$0.00
	25466	Seatbelt light stayed on and missing track guide- Replace missing track guide with 2x new bolts & washersFound seatbelt harness unplugged	12/01/2026	11405	Hours	2.5	0.0	\$0.00
	25490	NO START(E-Stop) & TRACK ROLLERDozer no start, throwing e-stop fault code on dash - tested all E-Stop fault code on dash - Tested all E-Stop switches - all okChecked and tested all fuses - all ok - Pulled up wiring schematic for corresponding areas - Tested continuity between rear switches & plug in cab - all okFound relay panel and tested correlated relay for circuit - all ok. Tested continuity of main signal wire from work module to relay and found split. Found split behind module plug - repaired and tested - all ok - machine starting.Carrier roller failed. Supported tracks. Removal old roller cleaned surfaces, fit new and tightened - sent back to work.	18/01/2026	11417.9	Hours	20.5	0.0	\$0.00
	25496	Transmission hose leakingRemoved floor covers & clampsLocated Tranny hose on top of trans- removed hose & made new hose at RG w/shop	22/01/2026	11495.4	Hours	5.5	5.5	\$0.00
	25583	Hot A/C + KomtraxCheck over found circuit breaker popped, reset checked over wiring-did not find any problemKomtrax not working - check over - found wires pulled out of harness going to Kapar box blowing the fuseRepaired wiring C/O fuse + tested ok	25/01/2026	11535	Hours	6.5	0.0	\$0.00
	25557	500 Hour Dozer service completed.	26/01/2026	11538	Hours	9.0	9.0	\$0.00
	25661	Fuel injector pump failure, removed covers and hoses/ piping to pumps, removed both injector pumps. Fitted new diesel injector pumps, refitted pipes, brackets, hoses and panels. Replaced batteries with new, replaced fuel filters and washed	1/02/2026	11584	Hours	147.0	33.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		machine, test ok. Split track, removed broken bolt in master link, cleaned up and replaced track master link bolts, torqued to spec.						
	25660	DPF doser low pressure fault, machine was due to have recall done on doser pumps. Komatsu came and replaced both doser pumps, hoses and brackets etc as per recall.	11/02/2026	11664	Hours	6.0	6.0	\$0.00
	25662	CB2881 Doser code, carried out diagnostics as per book, swapped solenoids from left to right, swapped manifolds, doser pumps. Load tested harness fuse, timer, checked engine harness and ECM, found broken earth on controller, repaired. Removed fuel screen from tank and found completely blocked, cleaned screen and housing, refitted and washed machine. Tested and walked back to site.	23/02/2026	11704	Hours	218.0	40.5	\$0.00
	25646	Washed , 250 Hour Dozer service , Replaced missing bolts door catch , & in fuel doser guard & platform rear of cab , blew out all windscreen washer lines & nozzles , & cleaned bottle out , adjusted tracks both sides ,	27/02/2026	11782	Hours	11.0	8.0	\$0.00
	25731	DPF Fault (11723 HOURS)Machine would not do regen + derated but no faults Monitored DPF, pressure sensor nol reading rear DPF - removed covers checked all plugs - okRemove plugs off front DPF - machine faults - remove off rear - no fault. Removed side panels Removed all ECU plugs off both ECU's - checked all pins & plugs made sure everything connected - all ok - refitted all plugs & covers - started machine - all returned to normal - carried out RegenLikely to be fault within ECM and having machine isolated/moving around ECM plug & covers has given time for ECM to return to normal state/reset	28/02/2026	11782	Hours	10.5	0.0	\$0.00
	25752	2000 Hour Dozer service completed, fuel leak from lhs engine, removed covers and found leak on fuel relief valve, replaced dowty washers on relief valve. tightened hose clamps on leaking rad hose from trans cooler, repaired wiring to exhaust temp sensor.	12/03/2026	11966	Hours	36.0	24.0	\$0.00
	25793	DPF Clean + Broken Master Link and Belly platesRemoved Bonnet - Removed DPF's and cleaned - Refit bonnet - Carry out regen + accumulation resetSplit LH track - cut off old boltsRemoved broken boltcleaned master linkRetentioned track - Refill belly plates	15/03/2026	11972	Hours	51.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	25808	Grease faultInspect machine for obvious leaksTested for power at all plugs/solenoidsRemoved dump valve spool (blocked) with plasticCleaned and made sure all holes were clearFitted and ran cycles	20/03/2026	12040	Hours	2.5	0.0	\$0.00
	25755	Updated Komtrax controller (Komatsu)	22/03/2026		Hours	0.0	0.0	\$0.00
	25823	Replace LH sprocket segmentsReplace R/H sprocket segmentReplace R/H lower rollerRemove 4x broken roller cap boltsReplace R/H track	28/03/2026	12124	Hours	72.0	46.5	\$0.00
	25859	250 Hour Dozer service Complete	7/04/2026	12284	Hours	1.5	1.5	\$0.00
	25884	Found and repaired broken wire on flashing light	13/04/2026		Hours	1.0	1.0	\$0.00
	25897	Melted Battery TerminalRemoved old batteriesFit new batteries and clamped downClean battery terminals and clampsJoining battery lead, has crack insulation	17/04/2026	12359	Hours	1.0	1.0	\$0.00
	25908	Washed , 500 Hour Dozer service , adjusted tracks , changed dpf biscuits & cleaned nozzle , replaced worn fan belt	25/04/2026	12510	Hours	11.0	11.0	\$0.00
	25970	250 Hour Dozer service , added 20 litres engine oil , checked inside fuel tank with camera for rust , removed fuel screen & cleaned	10/05/2026	12822	Hours	4.0	4.0	\$0.00
	26043	Blown tilt cyl hose- Investigated fault & found blown hose- Removed cover and cleaned mud from area- Removed old hoses- Fit new hoses- Refit covers- Topped up hydraulic oilTested and okay	21/05/2026	12901	Hours	3.0	3.0	\$0.00
	26105	1000 Hour Dozer service completed. Removed and replaced both tracks (Lhs broken joining link) fitted tracks that had pin and bush turned from komatsu, torqued to spec. Welded nuts to broken belly guard bolts and removed, cleaned up threads and replaced missing bolts. Tightened loose coolant hose clamps. Manual regen and ash soot correction completed.	30/05/2026	12970	Hours	58.0	58.0	\$0.00
	26145	Replace sprockets with 2nd hand setTorque R/H platesFinal torque L/H plates	11/06/2026	12975	Hours	40.0	16.0	\$0.00
	26361	Refit work equipment controller- Removed panels around controller- Removed controller into mounting bucket- Refitted controllers- Refitted all Panels- Initialised work controller memory- Checked operation of machine - all okay	29/07/2026	12975	Hours	3.0	3.0	\$0.00
No of W/O for DZ40 : 31			Asset Total:	DZ40		848.5	366.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading	Downtime (hours)	Repairtime (hours)	Cost
No of W/O for [REDACTED] :			179	Parent Total: [REDACTED]	4070.0	1651.0	\$0.00
Grand Total			179		4070.0	1651.0	\$0.00