

Work Order History Report

20-Aug-2026

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repairtime (hours)	Cost
Mobile Equipment Heavy Vehicles Excavators 350		Mobile Equipment Heavy Vehicles/Equipment Excavators 2005 SH250HD-3 Sumitomo Excavator						
	4920	(MINERAL S9) WATER IN FUEL SYSTEMREPLACED FUEL FILTERS, DRAINED WATER FROM TANK, FUEL TRAP, BLEW OUT CONTAMINATED FUEL OUT OF LINES & BLEED SYSTEMSTARTED MACHINE	19/05/2017	12163	Hours	0.0	0.0	\$0.00
	4919	GREASED 23,24,25,26,28,29 MAY	23/05/2017	12179	Hours	0.0	0.0	\$0.00
	4921	FUEL LEAK AT MINERAL OREREPLACE SPLIT FUEL FILTER	30/05/2017	12240	Hours	0.0	0.0	\$0.00
	4922	SLEW FAULTING FOUND SOLENOID IN PUMP BAY WITH BROKEN WIREREPAIR WIRE AND ORDER NEW SOLENOID	30/05/2017	12241	Hours	0.0	0.0	\$0.00
	4923	RESEALED STICK 7 BUCKET RAMSREMOVED LEAKING HYD CYLINDERS STICK & BUCKET SO COULD BE SENT TO TOWN TO GET REBUILT, (406017) REFITTED STICK & BUCKET HYD CYLINDERS TO MACHINEGREASED, TOPPED UP HYD OIL AND TEST RUN, RESEALED BUNG ON SWING MOTORDRAINED WATER OFF WATER SEPERATOR	1/06/2017	12245	Hours	0.0	0.0	\$0.00
	4924	COMPLETE 250 HR SERVICEWIPERS NOT WORKING SPINDLE LOOSE AND JUMPED SPLINEREALIGN AND TIGHTEN	5/06/2017	12246	Hours	0.0	0.0	\$0.00
	4925	REPLACED FAILED BATTERIES AT MINERAL ORE	9/06/2017	12258	Hours	0.0	0.0	\$0.00
	4926	GREASED	11/06/2017	12277	Hours	0.0	0.0	\$0.00
	4927	GREASED MACHINE	13/06/2017	12286	Hours	0.0	0.0	\$0.00
	4928	(S9 WASTE) REPLACED ALL GREASE SEALS IN H LINK, REPLACED FAULTY SOLENOID COIL FOR HYD	15/06/2017	12297	Hours	0.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		LOCKFITTED SET OF TEETH X5						
	4929	GREASED	15/06/2017	12297	Hours	0.0	0.0	\$0.00
	4930	(S9 WASTE) CARRY OUT GENERAL CHECK	20/06/2017	12297	Hours	0.0	0.0	\$0.00
		OVERREPLACED 2 X BOOM ARCH HOSES AND O						
		RINGSREFITTED TOP COVER THAT HAD BEEN REMOVED						
	4931	REPLACED FAILED HYD PUMP REPLACE BOOM HOSES	20/07/2017	12300	Hours	0.0	0.0	\$0.00
		AND FIT LIFE SAVERS TO FITTINGSREFILLED HYD OIL						
		AND TEST WASH AND REFIT COVERS						
	4932	MADE UP HYD LOCK OUT LEVER OUT IN CAB OF STEEL	27/07/2017	12301	Hours	0.0	0.0	\$0.00
		(OLD ONE BROKEN)ADJUSTED A/C AND ALT						
		BELTSADJUSTED TRACK TENSIONS						
	4933	GREASED	29/07/2017	12301	Hours	0.0	0.0	\$0.00
	4934	REPLACED BROKEN PANEL IN CAB	30/07/2017	12304	Hours	0.0	0.0	\$0.00
	4935	FILL GREASE POT	2/08/2017	12307	Hours	0.0	0.0	\$0.00
	4936	GREASED	11/08/2017	12329	Hours	0.0	0.0	\$0.00
	4937	(MILL) REPLACED BLOWN TRAVEL MOTOR HOSES ON	13/08/2017	12329	Hours	0.0	0.0	\$0.00
		LEFT & REPLACED ALL HOSES BOTH SIDESTOPPED UP						
		HYD OIL(50 LITRES)						
	4938	REPLACED INTERNAL BROKEN PLASTIC COVERS	18/08/2017	12332	Hours	0.0	0.0	\$0.00
	4939	GREASED	22/08/2017	12339	Hours	0.0	0.0	\$0.00
	4940	(MINERAL ORE) TRACK PIN WALKING OUTREWELD	23/08/2017	12343	Hours	0.0	0.0	\$0.00
		PLATES ON TO RETAIN PINS IN HOLES TO STOP						
		WALKING OUT						
	4941	REPAIRED CRACK IN SIDE OF BOOM, REPAIRED BENT	26/08/2017	12346	Hours	0.0	0.0	\$0.00
		BELLY GUARDS, MAKE NEW BELLY GUARDREPAIR						
		CRACK IN QUICK HITCHPANEL BEAT RHS CORNER ROCK						
		DAMAGE, REPLACED AND REPAIRED BENT FRONT						
		WINDOW SHIELDSREALIGN REAR HYD DOOR						
	4942	(MINERAL ORE) DRAINED, FLUSHED AND REPLACED	7/09/2017	12357	Hours	0.0	0.0	\$0.00
		COOLANT WITH TEC INFINITY						
	4943	WELD CRACKS IN BUCKET, RE WELD CRACKED WEAR	21/09/2017	12382	Hours	0.0	0.0	\$0.00
		STRIPSREPAIR WORN SIDE HEAL BLOCKS, WELD						
		CRACKED ADAPTERS & ARMOR						
	4944	GREASED	21/09/2017	12387	Hours	0.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	4945	TAKE BUCKET TO ROM AND FIT TO MACHINE	22/09/2017	12382	Hours	0.0	0.0	\$0.00
	4946	(MINERAL ORE) HYD OIL LEAK, IMPLEMENT CONTROL VALVEREMOVED AND SENT TO TOWN TO GET MADEREFITTED AND TEST RUN OKTOPPED UP HYD OIL	27/09/2017	12391	Hours	0.0	0.0	\$0.00
	4947	GREASE MACHINE	30/09/2017	12391	Hours	0.0	0.0	\$0.00
	4948	GREASED	20/10/2017	12406	Hours	0.0	0.0	\$0.00
	4949	(MINERAL ORE) HYD LEAK DELIVERY HOSE TO PUMP HOLE IN LIFE SAVED FITTING ON HOSEBROUGHT BACK TO W/SHOP AND WELDED, REFITTED AND TOPPED UP HYD OIL AND TESTED	24/10/2017	12413	Hours	0.0	0.0	\$0.00
	4950	GREASED	24/10/2017	12413	Hours	0.0	0.0	\$0.00
	4951	GREASE MACHINE	28/10/2017	12413	Hours	0.0	0.0	\$0.00
	4952	REPAIR WIRING TO FLASH LIGHT	1/11/2017	12424	Hours	0.0	0.0	\$0.00
	4953	GREASED	1/11/2017	12424	Hours	0.0	0.0	\$0.00
	4954	GREASED	5/11/2017	12427	Hours	0.0	0.0	\$0.00
	4955	(OPERATOR COMPLAINED HYDRAULICS SLOW) CHECKED OPERATION TOPPED UP HYD OIL COULD NOT FAULT	6/11/2017	12428	Hours	0.0	0.0	\$0.00
	4956	GREASE MACHINE	14/11/2017	12434	Hours	0.0	0.0	\$0.00
	4957	LOCATED HYD LEAK ON PILOT PRESSURE FILTER HOUSING REPLACE O RING AND TEST	15/11/2017	12445	Hours	0.0	0.0	\$0.00
	4958	(MINERAL ORE) TRACK PIN WALKING REPOSITION AND WELD PLATES TO STOP COMING OUT	16/11/2017		Hours	0.0	0.0	\$0.00
	4959	GREASED	18/11/2017	12449	Hours	0.0	0.0	\$0.00
	4960	GREASE MACHINE	26/11/2017	12450	Hours	0.0	0.0	\$0.00
	4961	(MINERAL ORE) DRAINED AND FLUSHED REPLACED COOLANT WITH TEC INFINITY	28/11/2017	12455	Hours	0.0	0.0	\$0.00
	4962	(MINERAL ORE) HYD OIL LEAK OUT OF PUMP DELIVERY HOSE REMOVED SO [REDACTED] TO TAKE TO TOWN	30/11/2017	12476	Hours	0.0	0.0	\$0.00
	4963	GREASED	30/11/2017	12476	Hours	0.0	0.0	\$0.00
	4964	HYD HOSE REMOVED FOR REPLACEMENTCHANGE OUT OLD HYDRAULIC HOSE WITH NEWTESTED FUNCTION	2/12/2017	12476	Hours	0.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		TEST OK CHECKED HYDRAULIC OIL LEVEL, SLIGHTLY OVER BUT WITHIN RANGE						
	4965	GREASE RUN	3/12/2017	12476	Hours	0.0	0.0	\$0.00
	4966	GREASED	7/12/2017	12476	Hours	0.0	0.0	\$0.00
	4967	GREASED	11/12/2017	12483	Hours	0.0	0.0	\$0.00
	4968	CARRIED OUT 500HR SERVICE, TOPPED UP HYDRAULIC OIL	13/12/2017	12490	Hours	0.0	0.0	\$0.00
	4969	GREASED	19/12/2017	12490	Hours	0.0	0.0	\$0.00
	4970	REMOVED AND REPLACED FUEL PRIMER PUMP	22/12/2017	12490	Hours	0.0	0.0	\$0.00
	4971	GREASED	27/12/2017	12490	Hours	0.0	0.0	\$0.00
	236	(MINERAL ORE) (LEE) ENGINE POWER DOWN , ENGINE AUTO IDLE NOT REVING UP QUICK ENOUGH WHEN FUNCTIONED , COULDN'T TURN AUTO IDLE OFF AS SWITCH ON R/H JOY STICK AS NOT WORKING PULLED PLUG ON HARNASS & BRIDGED WIRES TO GET AUTO IDLE TO TURN OFF , CHECKED L/S PRESSURE SENSORS & STEP MOTOR WIRING SEEMED ALL GOOD , TEST RUN OK . (CHRIS) GOUGE OUT OLD WELD & WELDED IN TRACK JOINER PIN THAT HAD STARTED WALKING OUT .	13/01/2018	12494	Hours	0.0	0.0	\$0.00
	581	(BUCKS REEF) REPLACED BROKEN DOOR HANDLE (INNER)	8/02/2018	12520	Hours	0.5	0.5	\$0.00
	644	(S9 WASTE) CARRY OUT GENERAL CHECK OVER , CHECKED SEAT BACK ADJUSTER (U/S) , GREASED , CAB WINDOW SLIDE WONT SLIDE CLEANED OUT WINDOW TRACKS ,	13/02/2018	1542	Hours	0.0	2.0	\$0.00
	637	GREASED	13/02/2018	12543	Hours	0.0	0.0	\$0.00
	821	Grease Machine	22/02/2018	12557	Hours	0.0	0.0	\$0.00
	799	(MINERAL ORE) GENERAL CHECK OVER , GREASE BUCKET .	22/02/2018	12557	Hours	0.5	0.5	\$0.00
	896	Grease Machine	28/02/2018	12597	Hours	0.0	0.0	\$0.00
	927	Grease Machine	2/03/2018	12602	Hours	0.0	0.0	\$0.00
	937	Drained and cleaned out fuel/ water seperator bowl, sealed up holes in air precleaner bowl lid and ordered new lid. Topped up	4/03/2018	12602	Hours	2.0	2.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		washer bottle.						
	1007	Grease Machine	7/03/2018	12613	Hours	0.0	0.0	\$0.00
	2102	Removed and replaced all 5 bucket teeth with new.	17/03/2018	12659	Hours	0.8	0.8	\$0.00
	2101	Found master link pin had walked out on lhs. Pulled track back together and refitted pin, welded on keeper plates over pin, adjusted track.	17/03/2018	12660	Hours	1.5	1.5	\$0.00
	2124	Grease Machine	18/03/2018	12671	Hours	0.0	0.0	\$0.00
	2172	(S9 WASTE) BROKEN BOLT IN QUICK HITCH PIN , REMOVED PIN BROUGHT BACK TO W/SHOP & DRILLED & TAPPED OUT , REFITTED PIN & NEW BOLT .	21/03/2018	12692	Hours	3.0	3.0	\$0.00
	2186	(MOP) TRACK LINK PIN COMING OUT , RELOCATE & CLEAN UP WELDS & FIT BUSH & RE WELD , DONE BOTH SIDES .	24/03/2018	12695	Hours	2.0	2.0	\$0.00
	2258	Grease Machine	26/03/2018	12729	Hours	0.0	0.0	\$0.00
	2244	GREASE & GENERAL CHECK OVER	27/03/2018	12739	Hours	0.0	0.5	\$0.00
	2354	Removed and replaced pre cleaner bowl lid. topped up engine oil 3L.	29/03/2018	12750	Hours	1.0	1.0	\$0.00
	2454	Grease Machine	30/03/2018	12750	Hours	0.0	0.0	\$0.00
	2404	Excavator 250hr service completed	31/03/2018	12750	Hours	1.3	1.3	\$0.00
	3054	Grease Machine	8/04/2018		Hours	0.0	0.0	\$0.00
	5784	(Mop) Greased machine, grease seal had come out off slew ring cleaned up & refitted, found crack on boom r/h/s (Boilermaker gouged out & welded up) welded up broken hand rail leg rhs, (a/c intermittent problem) could not fault but had rag over daylight cab sensor .	14/06/2018	12850	Hours	5.5	5.5	\$0.00
	5962	investigate squeling noise in engine bay and found belt idler had seized and fallen off. Replaced bearing and refitted idler, adjusted belt.	25/06/2018	12881	Hours	2.0	2.0	\$0.00
	6244	1000 Hour Excavator service , Tighten a/c belt (ordered new one) weep top radiator hose tighten clamps, removed muffler so boilermaker can repair hole in it (needs new muffler)	14/07/2018	12940	Hours	12.0	10.5	\$0.00
	6305	(Mop) a/c belt worn , replaced with new one .	17/07/2018	12957	Hours	1.5	1.5	\$0.00
	6668	Removed and replaced engine fan	24/07/2018	12966	Hours	1.5	1.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	6789	Investigate bad engine oil sample. Pressure tested cooling system, did not drop pressure over 5 mins, run up engine to get hot, pressure test again. ok. re sampled engine oil.	1/08/2018	12971	Hours	1.5	1.5	\$0.00
	7722	Inspect faulty seat back and found broken release cable brackets, re assembled cables and zip tied in place.	30/08/2018	13054	Hours	0.5	0.5	\$0.00
	No of W/O for 350 : 81		Asset Total:		350	37.0	38.0	\$0.00
EX350	2005 SH250HD-3 Sumitomo Excavator							
	8394	Machine slow to slew to right, swapped reliefs and still the same, swapped hose at pilot control and machine came good, swapped hoses back and couldn't fault. Drained coolant, removed turbo, exhaust manifold and intake, removed tappet cover, camshaft rocker and piping. Removed head and sent to twines to be crack tested. Refitted reconditioned head and tensioned. Replaced all associated gaskets and o'rings, replaced thermostats, seals and housing. primed fuel system and refilled coolant. Ran machine and found cam lobes sliding on the cam shaft. Ordered new camshaft. fitted covers to machine.	17/09/2018	13054	Hours	648.0	29.0	\$0.00
	8128	(Coolant in engine oil, reconditioned head had been fitted) (Problem with cam shaft lobe moving on shaft) Fit new cam shaft to engine, set valves to specs, test run machine, replaced engine oil & filter, (slew problem) machine slow to swing to r.h.s, changed pilot lines fault moved to other side on hand piece, removed & checked spool & springs, removed swing reliefs & inspected, one internal piston was hard to move in cleaned up & blew out, refitted & fault was gone, test run could not fault will monitor .	23/09/2018	13051	Hours	13.5	13.5	\$0.00
	8171	Digger stalling out while operating under load . proportional solenoid not working on pump , replaced with s/hand one off old pump set , test run ok , resealed relief valves on swing motor (leaking oil)	24/09/2018		Hours	4.0	4.0	\$0.00
	8598	(Bucket) Gouge off old wear package & cut out new & weld on .	22/10/2018	13049	Hours	15.5	15.5	\$0.00
	9067	Hydraulics slow. Functions have power but are slow, checked boosting solenoid and manifold, has 4.5 - 5 volts when working. Could not find specs in book, pump pressures are	18/11/2018	13072	Hours	8.0	8.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	9125	within spec. No debris found in pilot filter or solenoid valves. Hydraulics slow. Pressure tested pilot circuit, ok. Tested proportional solenoid on pump and found getting power but not magnetising coil. ordered parts.	24/11/2018	13094	Hours	6.0	6.0	\$0.00
	9241	(Crusher) Hydraulics slow , replaced boosting solinoid with new one (Hydraulics still slow) Need more testing .	30/11/2018	13094	Hours	1.0	1.0	\$0.00
	9890	Testing slow hydraulics as per attached job cards.	11/12/2018	13094	Hours	20.0	20.0	\$0.00
	9853	Removed and replaced hydraulic pumps, replaced hydraulic filters and oils with new. Engine stalling under load with new pumps, diagnosed and found new pumps overloading engine, capped 2 stage relief, ran overland wiring for boosting solenoid and backed pumps off slightly.	15/01/2019	13098	Hours	175.5	27.5	\$0.00
	12129	Fitted new uhf, replaced connector on aerial	23/06/2019		Hours	1.5	1.5	\$0.00
	13062	Grease & general check over , topped up hyd fluid , tighten fan belts .	4/09/2019	13158	Hours	2.5	2.5	\$0.00
	13119	Removed & resealed center joint (topped up hyd oil 15 liters)	9/09/2019	13159	Hours	16.0	16.0	\$0.00
	13224	A/C filter blocked, cleaned filter and tested	21/09/2019	13169	Hours	0.5	0.5	\$0.00
	13282	Found low gas pressure in system. will require parts.	23/09/2019	13170	Hours	2.5	2.5	\$0.00
	13451	Checked over a/c system, topped up gas and added dye to find leak.	10/10/2019	13170	Hours	1.5	1.5	\$0.00
	13555	Hydraulic fault lacking power , operated & adjusted regulators on pump back 1/4 turn back , pump 1 down on pressure in comparison to pump 2 , adjusted pump 1 back 1/8 turn , machine not dying in hyd works well	20/10/2019	13172	Hours	3.5	3.5	\$0.00
	14538	track roller leaking oil , filled with grease (2nd roller from front l/h/s)	11/01/2020	13187	Hours	0.0	1.0	\$0.00
	15150	250 Hour Excavator service ,	10/03/2020	13231	Hours	0.0	1.5	\$0.00
	15516	Refitted windscreen protector, washed machine and checked over for sale.	25/04/2020	13235	Hours	1.0	1.0	\$0.00
	15711	Remove bucket & quick hitch & removed leaking ram sent to twines to overhaul, tried to press pin out of ram eye to tongue press maxed out & heated could not get out (told twines to remove), bolt snapped in pin drilled out bolt tapped new thread & made new washer to suit .	15/05/2020		Hours	0.0	7.5	\$0.00
	15814	Removed quick hitch from machine & fitted resealed ram &	28/05/2020	13236	Hours	0.0	3.5	\$0.00

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repairtime (hours)	Cost	
		new hoses , test run ok & fitted bucket back on .							
	16501	Manually grease over unit, Adjusted track tension, Replace leaking heater & clamps, top up engine oil	23/09/2020	13256	Hours	0.0	2.5	\$0.00	
	16700	front screen guard come loose re-secured front screen guard.	3/11/2020	13282	Hours	0.0	1.0	\$0.00	
	16759	Track master link pin walked out put back in & rewelded retaining plate over & welded up broken plate on other side .	15/11/2020	13295	Hours	0.0	2.0	\$0.00	
	16809	Flashing light not working , repaired broken wires , tested ok	28/11/2020	13312	Hours	0.0	1.0	\$0.00	
	16845	beacon not workingchecked power supply found wires had broken rear of plugcut & wired new plug inline tested PASS	28/11/2020		Hours	0.0	1.0	\$0.00	
	17350	Removed pin, drilled out snapped bolts, fabricated retaining washers, refitted pin with new bolts and washers. Cleaned out tracks and machine.	9/03/2021	13347	Hours	5.0	5.0	\$0.00	
	21483	500 Hour Excavator service , Washed , topped up coolant & hyd oil , adjusted track tensions ,	24/08/2023	13491	Hours	24.0	11.5	\$0.00	
	23377	R&R starter motor tested ok	15/11/2024	13559	Hours	1.0	1.0	\$0.00	
	26378	Machine had no power. Connected jumper leads, still no power in cab. Checked fuses, found blown key fuse. Replaced fuse, still no power. Bridged battery relay, power now in cab and machine starts. Changed battery relay fuse. Drove machine up hill and blew a joystick hose. Parked and removed hose, capped off lines. Machine wouldn't start again. Pulled seat console apart, checked key operation, ok. Checked turbo timer outputs, not putting out power. Removed turbo timer and fixed broken ignition wires. Machine starts again.	1/08/2026	13609	Hours	29.0	8.0	\$0.00	
No of W/O for EX350 :			30	Asset Total:		EX350	979.5	200.0	\$0.00
No of W/O for [REDACTED] :			111	Parent Total:		[REDACTED]	1016.5	238.0	\$0.00
Grand Total			111				1016.5	238.0	\$0.00