

Work Order History Report

20-Aug-2026

Asset	W/O No	Description	Finished	Done	Reading	Downtime (hours)	Repairtime (hours)	Cost
Mobile Equipment Heavy Vehicles Excavators EX85		Mobile Equipment Heavy Vehicles/Equipment Excavators PC850-8EO Komatsu Excavator						
	10003	Drove ewp for loadrite, Measure, design, fabricated and fitted brackets for load rite printer, cut and welded on block between bucket and stick, Fabricated and welded on cover for grease injector block on stick.	27/01/2019	22	Hours	15.0	15.0	\$0.00
	10061	(Sarsfield) (get ready for site work) Fitted & wired up new u/h/f to machine , fitted aerial , moved grease fill point from pump room to cat walk under side so can fill grease from out side , wrapped load rite pressure sensor wiring near h/link with spiral wrap to protect , checked fuel tank over to see if can fit bulk fuel wiggins anywhere could not find anywhere (will contact komatsu)	29/01/2019	22	Hours	8.0	8.0	\$0.00
	10110	(Sarsfield) fit ch 11 uhf head unit to r/h/s side off cab , put rags , first aid kit , run machine for while to charge batteries (as not being used)	11/02/2019	22	Hours	1.5	1.5	\$0.00
	10083	(Sarsfield) Purge newly fitted grease line from quick fill to pod & fill pod with grease , make sure auto greaser worked .	14/02/2019	22	Hours	0.5	0.5	\$0.00
	10385	Fit unit with stickers Applied Tectyl to fittings and clamps	6/03/2019	22	Hours	6.0	6.0	\$0.00
	10398	Grease issue on stick/bucket pivot, Check system for function working fine manually grease injectors on bucket and stick,took a lot of grease in cavity, was not done on delivery of machine. R&R broken grease fitting on H-link	7/03/2019	25	Hours	3.0	3.0	\$0.00
	10446	hyd oil leak at lift pressure port loose fitting and damage O-ringR&R O-ring tighten fitting and tested	17/03/2019	78	Hours	1.0	1.0	\$0.00
	10538	(Sandy creek) Fuel gauge not working correctly , tested fuel gauge ok, problem must be in sender unit (Fuel was down 300	19/03/2019	83	Hours	1.0	1.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		litres still reading full), tighten loose a/c belt (squealing) .						
	10647	Greased all grease injectors (squeaky pin)	26/03/2019	99	Hours	0.5	0.5	\$0.00
	10753	(Top level s9) Hyd oil leak , found to be leaking from load rite fitting in center of belly off machine behind boom (removed fitting (loose) o'ring damaged , replaced with new o'ring , tighten all other fittings on block & test run ok .	4/04/2019	116	Hours	1.5	1.5	\$0.00
	11053	Tightened loose belly plate bolts, sanded and polished mark on bucket cylinder rod.	29/04/2019	295	Hours	0.5	0.5	\$0.00
	11135	(Mineral ore) Belts Squealing , tighten a/c & alternator belt .	3/05/2019	340	Hours	1.0	1.0	\$0.00
	11141	(Mineral ore) topped up hyd oil (30 litres) topped up engine oil (10 litres)	4/05/2019	347	Hours	1.0	1.0	\$0.00
	11183	Removed and replaced bucket teeth with new.	5/05/2019	360	Hours	1.5	1.5	\$0.00
	11269	Checked over and removed damaged steel grease line on h-link, repaired grease line and refitted, pin not taking grease so manually greased, still not taking grease, removed fitting and found fitting bottoming out on pin, removed fitting and cut end off to shorten fitting.	12/05/2019	435	Hours	4.0	4.0	\$0.00
	11387	Removed halogen lights and replaced with led's. Wiring on cab is back to front (black is power and red is earth)	20/05/2019	469	Hours	3.0	3.0	\$0.00
	11406	500 Hour Excavator service completed. (mitch Komatsu)	21/05/2019	475	Hours	0.0	0.0	\$0.00
	11483	(mineral waste) Inspected lip shrouds, found 2 shrouds loose but ok to use.	26/05/2019	504	Hours	1.0	1.0	\$0.00
	11750	Inspect and found dry pin on h-link/ bucket, adjusted injector and manually greased bucket pins.	4/06/2019	537	Hours	1.5	1.5	\$0.00
	11904	Fabricated and fitted wear pads to heel blocks.	12/06/2019	608	Hours	4.0	4.0	\$0.00
	12011	Replaced worn teeth x 5 with new ones .	14/06/2019	651	Hours	1.5	1.5	\$0.00
	12127	Cut and fitted wear plates to heel blocks and adaptors, strips inside and outside bucket	23/06/2019	682	Hours	20.0	20.0	\$0.00
	12588	Broken grease line & re weld broken stauff clamp & injector block back onto boom . replaced leaking grease injector .	30/07/2019	770	Hours	1.5	1.5	\$0.00
	12729	Removed all bucket teeth & replaced all worn jewelry 5 x top adapter plates , 2 x goanna bars , 4 x lip shrouds . Had to weld plates over tops off lip shrouds as did not have new locks , swapped teeth to diffrent positions .	8/08/2019	821	Hours	4.0	4.0	\$0.00
	12799	Removed and replaced all bucket teeth with itr brand	15/08/2019	859	Hours	1.0	1.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	12885	Bucket teeth kept coming out removed & replaced with new ones . (had to use oxy to get old ones out)	19/08/2019	865	Hours	2.0	2.0	\$0.00
	12906	topped up engine oil (8 litres)	22/08/2019	887	Hours	1.0	1.0	\$0.00
	12832	(Komatsu Mitch) Replaced faulty fuel gauge sender (new one warranty)	22/08/2019	876	Hours	0.0	0.0	\$0.00
	13000	Gouged off and replaced wear pads underneath adaptors, heel blocks and lip edge.	29/08/2019	918	Hours	29.0	29.0	\$0.00
	13067	(bucks reef) Armored up bucket side goanna bars on out side lip x 2	6/09/2019	983	Hours	0.0	4.5	\$0.00
	13071	1000 Hour Excavator service (Mitch)	7/09/2019	983	Hours	0.0	0.0	\$0.00
	13215	Swapped bucket teeth around for wear.	19/09/2019		Hours	0.5	0.5	\$0.00
	13216	Fit set of bucket teeth and locks	19/09/2019	1100	Hours	0.5	0.5	\$0.00
	13352	Cut blocks and welded onto top of ears and bucket	1/10/2019	1123	Hours	3.0	3.0	\$0.00
	13522	Blew out air filter	15/10/2019	1169	Hours	0.5	0.5	\$0.00
	13526	Rear slew motor oil level not on dipstick. topped up oil with tfc430 as we didn't have TO30 komatsu oil. (2-500mls of oil)	17/10/2019	1179	Hours	0.5	0.5	\$0.00
	13550	Blew out air filter , topped up rear slew motor oils (17 pumps) removed cover plate on slew to see if could see leak into grease , could not see anything . will monitor	18/10/2019	1186	Hours	1.0	1.0	\$0.00
	13650	250 Hour Excavator service completed	25/10/2019	1255	Hours	1.5	1.5	\$0.00
	13705	250 Hour Excavator service (Mitch)	31/10/2019	1287	Hours	0.0	0.0	\$0.00
	13713	wrapped worn grease line on end boom stick .	31/10/2019	1290	Hours	0.0	0.5	\$0.00
	13707	Topped up engine oil (5 litres)	1/11/2019	1290	Hours	0.0	0.5	\$0.00
	13735	Topped up rear swing oil (1 litre) , blew out engine air filter .	2/11/2019	1302	Hours	0.0	1.0	\$0.00
	13927	tighten AC & alt belts. Alt belts needs replacing.	21/11/2019	1379	Hours	1.0	1.0	\$0.00
	13930	remove and replace bucket teeth and locks	21/11/2019	1380	Hours	0.5	0.5	\$0.00
	14076	grease lines broken & crushed & manifold broken off , Made new grease lines changed from steel lines to rubber lines , h/link pin coming out tighten loose bolts , grease manifold broken off re welded mounting block & made up 2 x new grease lines installed swivel to delivery line ,	2/12/2019	1476	Hours	0.0	6.5	\$0.00
	14104	500 Hour Excavator service completed	6/12/2019	1486	Hours	6.0	6.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	14101	Fit and weld 16mm strips underneath bucket, weld wear blocks to bucket.	6/12/2019	1496	Hours	24.0	24.0	\$0.00
	14107	Re fitted gum guard and replaced lock.	8/12/2019	1507	Hours	1.5	1.5	\$0.00
	14167	(OCA) Loose bucket pin cover retaining bolts (tightened)	12/12/2019	1544	Hours	0.0	1.5	\$0.00
	14187	Bucket / boom pivot pin bolts loose , 2 x shims missing from bottom half of shim (replaced & tighten all bolts) checked end / side play ok .	13/12/2019	1547	Hours	0.0	1.5	\$0.00
	14241	weld new blocks to heel blocks weld 2x strips underside of bucket armour up side adapters	16/12/2019	1575	Hours	19.5	0.0	\$0.00
	14360	Blow out engine & a/c filters .	24/12/2019	1641	Hours	0.0	0.5	\$0.00
	14358	(OCA) Replaced teeth x 5 & locks (bradken) & replaced 5 x adapter protectors	26/12/2019	1652	Hours	0.0	1.0	\$0.00
	14383	Alternator belt broken , replaced with new ones	28/12/2019	6608	Hours	0.0	1.0	\$0.00
	14400	Air cleaner light coming on , blew out engine & a/c air filters .	31/12/2019	1693	Hours	0.0	0.5	\$0.00
	14535	Wear package bucket , armor up plates on top of adapters , armor up side goanna 7 lip guards , weld on 6 x heal block pads	10/01/2020	1769	Hours	0.0	6.5	\$0.00
	14560	swapped worn teeth around	14/01/2020	1803	Hours	0.0	0.5	\$0.00
	14572	250 Hour Excavator service completed (Mitch Komatsu)	17/01/2020	1832	Hours	2.0	2.0	\$0.00
	14647	replace missing tooth wear protector	22/01/2020	1867	Hours	1.0	0.0	\$0.00
	14666	Gouge off old wear package from side lip adapters & underside , weld on new wear package	23/01/2020	1875	Hours	0.0	8.0	\$0.00
	14659	Swapped teeth around & replaced top l/h adapter plate , had to cut off tooth & fit s/hand one as lock was half out & would not go back in .	25/01/2020	1896	Hours	0.0	1.0	\$0.00
	14716	topped up engine oil 5L (75 hrs till service due)	28/01/2020	1925	Hours	0.5	0.0	\$0.00
	14708	removed and replaced broken grease fitting in H link pin	30/01/2020	1942	Hours	1.0	0.0	\$0.00
	14741	Removed and replaced wear plates underneath adapters. Welded on wear blocks to gum guards.	31/01/2020	1951	Hours	12.0	12.0	\$0.00
	14825	Replaced o'ring seal on air filter lid , gouge off old teeth locks & replaced 5 x teeth (new ones) .	6/02/2020	2000	Hours	0.0	2.0	\$0.00
	14906	Checked over machine, topped up rear swing motor. Removed blocks from side of bucket and welded on strips, removed all	10/02/2020	2012	Hours	32.0	32.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		jewelry and replaced with new hard faced set, replaced goanna bars, removed and welded on new adapter pad and wear blocks						
	15202	250 Hour Excavator service , replaced 3 x missing cover bolts under side car body blew out all filters	19/03/2020	2241	Hours	0.0	1.0	\$0.00
No of W/O for EX85 : 67			Asset Total:		EX85	224.0	240.0	\$0.00
EX851		PC850-8EO Komatsu Excavator						
	15343	repair grease line/ fitting on bottom boom rams	1/04/2020	2378	Hours	1.0	0.0	\$0.00
	15333	removed broken R/H side lip goanna bar weld on new Goanna bar remove R/H outer worn tooth & replaced with second hand toothchange out broken L/H outer lip gum guard	3/04/2020	2402	Hours	4.5	0.0	\$0.00
	15383	R&R faulty A/C belt adjusted to spec, works well rechecked belt tension.	5/04/2020		Hours	1.5	0.0	\$0.00
	15349	Topped up engine oil (10 litres)	7/04/2020	2439	Hours	0.0	0.5	\$0.00
	15436	(Mineral ore west)500 Hour Excavator service , adjusted fan belts , replaced bulb flashing light , replaced teeth with new ones x 5	12/04/2020	2492	Hours	0.0	8.0	\$0.00
	15503	Inspected engine for miss, couldn't fault. (Komatsu)	16/04/2020		Hours	0.5	0.5	\$0.00
	15462	inspected and lubed seat runners inspected for broken grease line.	20/04/2020	2549	Hours	0.5	0.0	\$0.00
	15483	C/O lip shroud	22/04/2020	2557	Hours	1.0	0.0	\$0.00
	15638	250 Hour Excavator service completed	8/05/2020	2740	Hours	3.0	3.0	\$0.00
	15653	R&R bucket teeth	9/05/2020	2750	Hours	1.0	1.0	\$0.00
	15695	removed grease line & made new one assembled grease line bleed up LH stick pin line	14/05/2020	2808	Hours	1.5	0.0	\$0.00
	15731	Gouge off 4 x old wear strips from under side bucket & cut out & welded on wear package	17/05/2020	2839	Hours	0.0	6.5	\$0.00
	15843	1000 Hour Excavator service , replaced revolving light on roof with led one , dig mud / dirt out tracks , clean inside cab , fit new set teeth , gouge off old plates under adapters & weld hard faced ones on x 5 , armor up adapters with wear blocks , gouged off old wear strip underside of bucket behind adapters & welded on piece 32mm strip . armor up gum guards .	31/05/2020	2998	Hours	0.0	12.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	15892	General check over , cleaned all filters engine & a/c , checked all fluids , adjusted grease injectors to boom , topped up coolant	10/06/2020	3092	Hours	0.0	2.0	\$0.00
	15916	Repair crack in strip on back of bucket , weld on wear pads onto out side lip guards	10/06/2020	3092	Hours	0.0	3.0	\$0.00
	15942	Engine code Check engine harness Remove & clean ECM plugs fault was not active has been intermittent fault since 2594hr	13/06/2020	3114	Hours	2.5	2.5	\$0.00
	15937	Engine shut down found fire suppression plug was at fault cleaned plug refit and tested ok	14/06/2020	3120	Hours	4.5	0.0	\$0.00
	15923	R/h joystick stiff found add button cable for load rite tight loosen off & was ok then , could not see out of windscreen bottom move wiper blade assembly so went further down bottom .	15/06/2020		Hours	0.0	1.0	\$0.00
	16002	Weld on chock bar on to worn area's off drive motor housings	23/06/2020	3202	Hours	0.0	1.5	\$0.00
	16047	R&R bucket teeth fit new locks & weld in	27/06/2020	3250	Hours	2.0	2.0	\$0.00
	16035	250 Hour Excavator service completed, fitted 2nd hand gum protector as back broken out of one. tightened loose hydraulic grease filter.	30/06/2020	3276	Hours	2.0	2.0	\$0.00
	16121	Topped up engine oil 15L	11/07/2020	3388	Hours	1.0	1.0	\$0.00
	16123	Repaired broken gum guard and refitted to machine.	13/07/2020	3392	Hours	2.0	2.0	\$0.00
	16175	(S9) 500 Hour Excavator service , tighten up suction hose clamps , repaired oil leak l/h/s engine . wound boom grease injectors back 1 turn too much grease	21/07/2020	3464	Hours	0.0	7.0	\$0.00
	16181	(S9) Removed & replaced underside strips x 6 , removed & replaced 6 x heal blocks , armor up side wings .	23/07/2020	3463	Hours	0.0	32.0	\$0.00
	16233	Removed and replaced bucket teeth.	28/07/2020	3502	Hours	3.5	3.5	\$0.00
	16485	250 Hour Excavator service , topped up engine oil 10 litres	21/09/2020	3767	Hours	0.0	1.0	\$0.00
	16536	Replaced 5 x bucket teeth	1/10/2020	3870	Hours	0.0	1.0	\$0.00
	16740	Armor up bucket , floor , sides , back , cheeks , outer skin	3/10/2020		Hours	0.0	82.0	\$0.00
	16548	Went to swap bucket but couldn't get off as stick bush had walked out , refitted pins & sent back to work till get new parts	4/10/2020	3899	Hours	0.0	5.5	\$0.00
	16615	Bucket repairs , remove & replace old wear package , cut out new wear package & weld on . weld on all new heal blocks	11/10/2020		Hours	0.0	69.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	16605	*Rear main leaking into PTOcheck over reverse fan Blown out cooler packs top up engine oil 10L	15/10/2020	3963	Hours	0.0	1.5	\$0.00
	16633	Replaced teeth x 5 & locks	16/10/2020	3967	Hours	0.0	1.5	\$0.00
	16676	2000 Hour Excavator service , Removed old bucket & removed pin that had walked in , prepared stick & h/link to fit new bushes & seals refit bucket & shim , checked grease system (ok) adjusted grease injectors to give bucket more grease ,	25/10/2020	3998	Hours	0.0	36.0	\$0.00
	16693	armour up top adapter where "GET" is missing weld on adapter get so doesn't fall off	27/10/2020	4017	Hours	0.0	1.5	\$0.00
	16757	Replaced u/s am / fm radio with new one , fitted voltage reducer	15/11/2020	4135	Hours	0.0	1.5	\$0.00
	16803	250 Hour Excavator service , blew out engine & a/c filters	29/11/2020	4250	Hours	0.0	1.0	\$0.00
	16919	Removed and replaced bucket teeth, had to gouge away some of the gum guards to get locks out.	21/12/2020	4381	Hours	2.0	2.0	\$0.00
	16972	check over blow out air filter top up oil	30/12/2020		Hours	0.0	0.5	\$0.00
	16997	500 Hour Excavator service completed, removed wire from track.	3/01/2021	4499	Hours	8.0	8.0	\$0.00
	17033	topped up slew motor oil rear 1 litre (TSF tailings dam)	11/01/2021	4509	Hours	0.0	1.0	\$0.00
	17145	Removed and replaced section of blown grease supply hose, relocated p-clamp.	27/01/2021	4596	Hours	3.5	3.5	\$0.00
	17150	Replaced teeth & one x missing top cap	28/01/2021	4607	Hours	0.0	2.0	\$0.00
	17163	General check over , blew out all filters engine / a/c , cleaned out track frames of dirt , replaced a/c belt , tighten goanna bars on bucket , checked for cracks on boom .	3/02/2021	4662	Hours	0.0	5.5	\$0.00
	17222	250 Hour Excavator service , blew out a/c & engine air filters , topped up engine oil reversed cooler fan to clean out coolers	16/02/2021	4749	Hours	0.0	1.0	\$0.00
	17251	(Pit E)Armor up sides of adapters & bottoms	18/02/2021	4775	Hours	0.0	4.0	\$0.00
	17271	Fitted 2nd hand bucket tooth to bucket with new lock	2/03/2021	4851	Hours	1.0	1.0	\$0.00
	17285	Replaced 5 x teeth (hard faced tips)	5/03/2021		Hours	0.0	1.0	\$0.00
	17330	Removed old chocky block on top of adapters , re armor up top & sides of adapters , weld crack in side wear plate , armor up cheek with chocky block .	7/03/2021		Hours	0.0	12.0	\$0.00
	17335	Bucket gum guard come off pos 2 , fitted new lock & secured	8/03/2021	4933	Hours	0.0	1.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	17355	Manually greased lift arm and cylinder pivot pins.	10/03/2021	4975	Hours	0.5	0.5	\$0.00
	17372	1000 Hour Excavator service ,	15/03/2021	5037	Hours	0.0	8.0	\$0.00
	17388	tighten gum guards & goanna bars , had to remove section of wear strips goanna bars to get sockets in to tighten , topped up slew box oils ,	18/03/2021	5063	Hours	0.0	4.5	\$0.00
	17425	Removed and replaced worn strip on underside of bucket.	30/03/2021	5196	Hours	2.0	2.0	\$0.00
	17421	Replaced damaged grease fitting on bottom of H-link.	31/03/2021		Hours	1.0	0.5	\$0.00
	17440	Bucket repairs (remove and replace wear strips)	2/04/2021	5216	Hours	8.0	8.0	\$0.00
	17469	250 Hour Excavator service completed	6/04/2021	5245	Hours	1.0	1.0	\$0.00
	17559	A/c hot , low gas , visually checked could not see leaks , could not see any , added die to system & charged , will monitor , order compressor , receiver dryer & evaporator .	20/04/2021	5353	Hours	0.0	3.5	\$0.00
	17550	Removed broken grease fittings near h/link & replaced , tested ok .	29/04/2021	5424	Hours	0.0	1.0	\$0.00
	17630	500 Hour Excavator serviceFound Cracked Exhaust, Removed, Boily welded and Re-FitWash Cab and Radiator	14/05/2021	5501	Hours	0.0	9.5	\$0.00
	17666	Replaced fuel return hoses from pump / block to fuel tank & cooler , washed down & test run ok . Investigate boom mount pin walking out - slid pin out 3" & worked boom up & down to see if grabbed at ang point but ok , play in pins & bushes ,	22/05/2021	5569	Hours	0.0	5.5	\$0.00
	17699	Bucket work , removed old blocks from side of bucket lip & re Armor with h/f strips , Armor tops of adapters , armor cheek with chocky block , cut out & replaced 2 x outer strips with 32mm .	31/05/2021	5639	Hours	0.0	10.0	\$0.00
	17707	load wire crushed & hanging off boom , removed & replaced section of wiring , refitted to machine .	1/06/2021	5639	Hours	0.0	2.0	\$0.00
	17710	A/c not cold , topped up gas (leaking evaporator)	1/06/2021	5647	Hours	0.0	1.0	\$0.00
	17739	A/c repairs , replaced evaporator , receiver dryer , compressor & belt , gassed up & test run ok .	4/06/2021	5661	Hours	0.0	9.5	\$0.00
	17777	250 Hour Excavator service completed.	15/06/2021	5733	Hours	2.5	2.5	\$0.00
	17812	general check over , topped up engine oil , blew out all filters , replaced broken grease fitting on h/link , replaced 3 x work lights with led ones ,	25/06/2021	5812	Hours	0.0	3.0	\$0.00
	17810	L/h main boom pin broke retaining plate & walked pin out ,	26/06/2021	5803	Hours	0.0	4.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		refitted pin & rewelded .						
	17825	Refit LH boom foot pin and replace keeper bolts	29/06/2021	5820	Hours	3.0	3.0	\$0.00
	17832	Shim boom foot pin , fit new grease vent valve solinoid valve	1/07/2021	5844	Hours	3.0	3.0	\$0.00
	17861	Replaced bucket teeth x 5 with new hard faced ones , tighten l/h goanna bar , replaced broken grease fitting on h/link	9/07/2021	5890	Hours	0.0	2.5	\$0.00
	17895	Fire suppression fault, found low bottle pressure fault but gauges still in green, replaced deutsch plugs on sensors. ok.	11/07/2021	5899	Hours	2.0	2.0	\$0.00
	17877	Fire suppression fault / alarm , gauge low on pressure , bypassed both switches . gas needs top up .	12/07/2021	5917	Hours	0.0	0.5	\$0.00
	17919	Armor bucket , top of adapters , top edge under pivot , bottom side and on stick	20/07/2021	5981	Hours	0.0	9.0	\$0.00
	17925	2000 Hour Excavator service as per sheet , blew out all coolers , tighten all fan belts ,	21/07/2021	5992	Hours	0.0	13.5	\$0.00
	17929	topped up front slew box oil (2 litres)	23/07/2021	6017	Hours	0.0	1.0	\$0.00
	17936	weld chocky block & hard faced strip to bucket mount ears & stick end , remove bent step & make new one & weld on , remove bent hand rail & make new one & weld on .	24/07/2021	6022	Hours	0.0	9.0	\$0.00
	17937	general check over , blew out filters , replaced faulty light on boom	25/07/2021	6011	Hours	0.0	2.0	\$0.00
	18048	Change Out Teeth	16/08/2021	6200	Hours	0.0	1.0	\$0.00
	18058	replace boom pinfit shims and new keeper plate	20/08/2021	6233	Hours	0.0	4.0	\$0.00
	18080	250 Hour Excavator serviceoil leak at control valve	21/08/2021	6239	Hours	0.0	1.0	\$0.00
	18086	Removed & replaced worn both out side bottom adapter wear plates ,	21/08/2021	6239	Hours	0.0	4.0	\$0.00
	18161	Removed & replaced wear strips on back bucket	26/08/2021	6274	Hours	0.0	12.0	\$0.00
	18224	Broken Grease line , replaced .	20/09/2021	6362	Hours	0.0	1.0	\$0.00
	18233	Investigate swing noise . No issue found (sampled swing oils)	21/09/2021	6375	Hours	1.5	1.5	\$0.00
	18271	Load up refirbed bucket & take to site , replaced bucket with old one , had to gouge out bush on bucket as had walked in , had to pull bush in stick l/h/s & grind flat as had broken out bush flange . fitted bucket & shimmed	29/09/2021	6391	Hours	0.0	18.0	\$0.00
	18343	(Hensley bucket) Repaired cracks in bucket ears, replaced worn wear strips.	13/10/2021		Hours	0.0	0.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	18347	Removed main grease hose at H-link and cut out damaged section, refitted hose.	20/10/2021	6406	Hours	1.0	1.0	\$0.00
	18698	500 Hour Excavator service , blew out coolers , dug dirt out tracks , topped up hyd oil (20 litres	10/01/2022	6486	Hours	0.0	10.0	\$0.00
	18729	Repaired broken hand rail mount behind cab	12/01/2022	6494	Hours	0.0	2.5	\$0.00
	18865	Topped up both slew oils	19/02/2022	6563	Hours	0.0	0.5	\$0.00
	18970	Would not start , batteries flat , checked & topped up all fluids , jump started & left running for while , started again (will monitor)	15/03/2022	6585	Hours	2.0	2.0	\$0.00
	19120	Tooth fell off on N/S, found tooth but no adapter padFit second hand adapter padInstalled tooth and shim with washersAll tooth are lose on locks	15/04/2022	6633	Hours	1.0	1.0	\$0.00
	19161	Wiper fault return , cleaned , removed & realigned (motor seam to be not strong enough)	26/04/2022	6695	Hours	0.0	0.5	\$0.00
	19180	Replaced missing tooth & adapter guard , refitted with new locks .	27/04/2022	6704	Hours	0.5	0.5	\$0.00
	19299	250 Hour Excavator service , adjusted all engine fan belts , reversed fan & cleaned out coolers ,	17/05/2022	6750	Hours	2.0	2.0	\$0.00
	19310	Found supply line on boom had come undone at joint, clean up fitting and connectTest grease system and hose clearance	26/05/2022	6770	Hours	0.5	0.5	\$0.00
	19319	Bent stepStraiten step using 120 digger, clean mud from steps	27/05/2022	6772	Hours	1.0	1.0	\$0.00
	19298	Replaced 5 x teeth & locks , had to shim with washers to get teeth tight .	28/05/2022	6772	Hours	0.0	1.0	\$0.00
	19832	Replace batteries- N200 x 2Check batteries are charging = 28.7 vIts	16/09/2022	6817	Hours	1.5	1.5	\$0.00
	19881	Made brackets for triangle ID numbers and drilled holes. Move UHF/radio aerial. Removed flashing light on top of triangle and fitted ID numbers to triangle	23/09/2022	6818	Hours	2.5	2.5	\$0.00
	20271	Prep for hire Checked over unit's fluids blow out Air cleaners & cab filters Unit would not start Checked over found low pressure in fire suppression,Bypassed Replace missing RH mirror Wash down control valve residual leaks run up &test all function.	17/12/2022	6819	Hours	3.5	3.5	\$0.00
	20313	Boom pins squealing. Manually grease and check operation of grease unit	25/12/2022	6837	Hours	1.0	1.0	\$0.00
	20563	Diagnose grease fault. Remove and make new grease line	17/02/2023	6903	Hours	1.5	1.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		from H-link to bucket. Refit and retest for other leaks. Fill grease tank						
	20626	Inspected broken grease line. Had to re-tap thread due to damage. Installed new fittings and reconnected line. Tested operation, checked for leak	5/03/2023	6927	Hours	1.5	1.5	\$0.00
	20622	Inspected coolant levels, found radiator level ok, but overflow low and missing cap. Topped up coolant. Replaced cap. Checked operation and checked for leaks. System working correctly with no alarms and no leaks	6/03/2023	6929	Hours	2.0	2.0	\$0.00
	20671	Fit new lock to tooth. Rotate outer teeth to inner positions. Fit new adaptor to adaptor	20/03/2023	6931	Hours	1.0	1.0	\$0.00
	20746	Went down into pit. Brett from R.G was pre-starting EX851 and found damage to front of cab. Front grab handle is dented in and front front side grab handle has been broken off. Small dent to bottom corner of cab. Take photo of damage and pre-start book. Send photos to Eddie	31/03/2023	6959	Hours	0.5	0.5	\$0.00
	20801	Remove goanna bar locks and replace with new ones. Require building up. Has a lot of play in bar.	8/04/2023		Hours	1.0	1.0	\$0.00
	20885	1000 Hour Excavator service , adjusted all fan belts , washed down control bank & checked for leaks will monitor , boiler maker repaired damaged front grab hand rail cab ,	20/04/2023	6985	Hours	24.0	14.0	\$0.00
	20923	Gouge out crack and re-weld on grease pod mount	1/05/2023	6997	Hours	2.0	2.0	\$0.00
	21050	C/O bucket teeth. Repair fire extinguisher bracket	19/05/2023	7049	Hours	1.5	1.5	\$0.00
	21065	Replaced missing adaptor pad. Replaced gum guard locks. Bucket lip worn and needs work. Gouged tooth lock free and replaced lock. Rewelded in position	30/05/2023	7082	Hours	2.0	2.0	\$0.00
	21102	Adjusted track tensions. Run and readjusted couple times.	9/06/2023	7099	Hours	2.0	2.0	\$0.00
	21284	250 Hour Excavator service completed	4/07/2023	7339	Hours	2.5	2.5	\$0.00
	21239	Cut lock out off tooth. Fit 2nd hand tooth. Weld lock in	5/07/2023	7356	Hours	1.5	1.5	\$0.00
	21243	Replace teeth, weld in locks. Tighten alternator belts.	6/07/2023	7563	Hours	2.0	2.0	\$0.00
	21311	500 Hour Excavator service as per sheet , replaced all fan belts , topped up hyd oil , adjusted both track tensions , replaced 2 x u/s work lights , (Boilermaker Armor bottom adapters , Armor up lip edges , reweld broken handrail on hyd tank , reweld broken floor cover panel beside engine cover .	19/07/2023	7521	Hours	15.0	14.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	21327	R&R teeth, weld in locks	22/07/2023	7521	Hours	1.5	1.5	\$0.00
	21365	Checked pressure, PM clinic. Found pump 1 pressures below low side figures and strong arm function not working. Wound up main relief pressure to the high side figures. Looked at strong arm power function switch and solenoid. Cleaned plug and gave solenoid and loosen up tap. Tested functions again, seems a lot more responsive then before	29/07/2023	7539	Hours	4.0	4.0	\$0.00
	21420	250 Hour Excavator service completed, replaced leaking orings on control valve, replaced bucket teeth	13/08/2023	7774	Hours	7.0	7.0	\$0.00
	21533	Pulled hose off and replaced. Degreased and washed excess oil off	26/08/2023	7819	Hours	4.0	4.0	\$0.00
	21516	Strip and reseal control valve. Replace hoses, check for leaks. Change hydraulic oil filters* All hoses need replacing.	30/08/2023		Hours	166.5	66.0	\$0.00
	21512	Weld out new wear strips. Replace broken/missing gum guards. Repair armour on x2 gum guards. Repair cracks in cheeks into adaptors	5/09/2023	7825	Hours	23.0	15.0	\$0.00
	21531	Remove gum guard adaptors and installed further back on the lip for a tight fit. Took digger up top and run up, digging for 20min and oil leak appeared x2 pilot hoses on control valve. Remove hoses, made new ones at Sarsfield. Refitted new hoses and ran machine back up for another 45min, no leaks. Brought down to wash pad, degreased and washed. Put panels back on. Operators took digger back to Sarsfield.	6/09/2023		Hours	47.0	9.0	\$0.00
	21638	Inspect damage and get plan with supervisor. Remove all damaged components. Made new fire suppression frame, check fit and paint. Make new handrails, test fit and paint. Fit up all new components.	26/09/2023	7878	Hours	58.0	34.0	\$0.00
	21639	Clean machine, locate leaks, change hoses and check for leaks at operating temp.	27/09/2023		Hours	49.0	8.5	\$0.00
	21700	Replace blown hose. Wash oil off machineHose from RG	15/10/2023	7983	Hours	4.0	4.0	\$0.00
	21732	C/O teeth, weld out locks. C/O x2 top adaptor pads. Swap cheek protectors from left to right and vice versa. Inspect rest of bucket for wear. Adaptors have a fair amount of play	19/10/2023	8000	Hours	3.0	3.0	\$0.00
	21723	2000 Hour Excavator service completed, tightened loose grease lines for power bars, adjusted track tension, adjusted drive belts, washed out coolers, washed whole machine.	20/10/2023	8007	Hours	5.5	5.5	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	21941	Replace cab side rear vision mirror	5/12/2023	8099	Hours	0.5	0.5	\$0.00
	22200	Blew out old locks. C/O teeth and locks and welded up locks. Welded chocy block on top of adaptor, missing pad, had none in stock	1/02/2024	8196	Hours	2.0	2.0	\$0.00
	22287	250 Hour Excavator service , tighten fan belts , fitted bung in missing filter restriction gauge , topped up hyd oil 20 litres ,	20/02/2024	8258	Hours	2.5	2.5	\$0.00
	22350	C/O tooth and lock. Missing cap, welded on chocky block for armour. Welded up x2 locks, broken welds	28/02/2024	8272	Hours	2.0	2.0	\$0.00
	22405	Fix roof lights. C/O stereo. C/O A/C vent. C/O rear cab light. Carry out diagnostics on LH track slow fault. Adjusted 5 spool high/low relief valve. front pump down 60mpa, below spec. Adjust pilot control pressure 150mpa above spec. Test run digger, LH track still slow and combination of functions cause hesitation. Adjusted Q min and max on both pumps, no noticeable difference. Adjusted front pump VC valve within track time spec. Adjusted rear pump VC valve to match front pump, reassembled covers and test run.	13/03/2024	8323	Hours	75.0	15.0	\$0.00
	22487	Replace LH rear upper roller	29/03/2024	8359	Hours	2.5	2.5	\$0.00
	22529	Alarming due to low pressure. Bypass sensors at bottle, alarm still active. Bypass alarm box/controller and loop E-stop cables running to box. Machine now starts, Fire suppression will still go off auto or manually, it just wont alarm or shut down.	15/04/2024	8413	Hours	1.0	1.0	\$0.00
	22645	Replace L/H boom cylinder hose with a WA600 tilt Ram hose. Grease block sheared mounting bolts. Remove mounting plate from boom. Take to depot and extract broken bolts. Tap out threads. Reweld plate to boom. Refit grease block	7/05/2024	8456	Hours	3.5	3.5	\$0.00
	22662	Gouge off old locks. Replace all teeth and locks. Weld in locks. Tighten bolts on plate protecting hoses in H-link. Tension tracks. Bypass fir suppression	9/05/2024	8466	Hours	1.0	1.0	\$0.00
	22726	500 Hour Excavator service , removed grease cover on h/link & replaced grease line ,	24/05/2024	8485	Hours	6.0	6.0	\$0.00
	22842	Diagnosed leaks. C/O boom hoses at back of boom foot. C/O shuttle valve hose on control valve. Removed covers. Topped up hydraulic oil. Thoroughly washed. Ran up and checked over	31/05/2024	8531	Hours	5.5	5.5	\$0.00
	22979	Remove and remake hose, replace	30/07/2024	8695	Hours	3.0	3.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
	23015	Investigate boom hose leak. Make a new hose and replace	9/08/2024		Hours	1.5	1.5	\$0.00
	22992	250 Hour Excavator service completed, topped up final drive oils.	12/08/2024	8782	Hours	1.5	1.5	\$0.00
	23089	Remove remaining worn materials. Replace x2 heel blocks and weld out. 4-6 other heel blocks require attention shortly when we have blocks to replace them. Replaced x2 outer adaptor pads and weld out	28/08/2024	8805	Hours	21.0	21.0	\$0.00
	23230	Removed squashed/ broken loadrite wiring near bucket, fabricate new wire and protection, refitted.	5/10/2024	8868	Hours	3.0	3.0	\$0.00
	23340	Fitted run out tooth to bucket. Weld on all locks	31/10/2024	8918	Hours	1.5	1.5	\$0.00
	23327	Fitted new boom hose and topped up hydraulic oil	4/11/2024	8946	Hours	1.5	1.5	\$0.00
	23365	Remove x5 worn strips and x2 heel blocks. Grind up and cut strips. Tack on strips and blocks. Pre heat and weld out	6/11/2024	8946	Hours	12.0	12.0	\$0.00
	23483	1000 Hour Excavator service completed	27/11/2024	8981	Hours	7.5	7.5	\$0.00
	23538	Fitted new hydraulic pipe and replaced O-rings. Engine hood latch missing pivot rivet, replace with bolt and nut. Found bucket cylinder pipe leaking hydraulic oil out of steel line where it has been damaged	5/12/2024	9008	Hours	13.5	1.5	\$0.00
	23528	Pulled off, greased and lubricated bolt. Honed out bushing slightly, refitted and moves freely	7/12/2024		Hours	0.5	0.5	\$0.00
	23647	Replace leaking boom cylinder hose. Replace teeth. Replace RH hand piece	7/01/2025	9083	Hours	2.5	2.5	\$0.00
	23810	Checked over and found coolant bleed off hose from top tank blown. Unit was still running rough, check fuel filters, found water in filters. C/O filters and run unit up, ok. Drain water from fuel tank	10/02/2025	9114	Hours	16.5	4.5	\$0.00
	23847	Tested battery voltage. Check power to starter motor and check start relays. Tapped starter solenoid to start machine. * Ordered new starter motor	23/02/2025	9115	Hours	1.0	1.0	\$0.00
	23979	Found fuel leaking from Banjo bolt fitting. Removed and replaced copper washer seals and refit. Found hydraulic slew motor hose leaking, removed broken hose and made new one. Fit new hose and O-rings. Topped up hydraulic oil. Tested, Ok.	14/03/2025	9134	Hours	23.0	11.0	\$0.00
	23947	Replaced starter motor	18/03/2025	9134	Hours	3.0	3.0	\$0.00
	24013	Check over and found fan motor hose leaking. Removed all	23/03/2025	9142	Hours	51.0	12.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		covers and removed leaking hose.						
	24009	Replace missing tooth. Replace x2 locks on other teeth. Weld in all locks	25/03/2025	9148	Hours	2.0	2.0	\$0.00
	24164	Replaced broken grease fitting on fill hose, strengthened bracket	27/04/2025	9217	Hours	0.5	0.5	\$0.00
	24269	250 Hour Excavator service , topped up engine oil & pump transmission oil ,	24/05/2025	9259	Hours	1.5	1.5	\$0.00
	24337	Heated step and bent out, grind out cracks on wear strips and re welded.	28/05/2025	9266	Hours	2.0	2.0	\$0.00
	24466	Leaking oil from Dampener too inline filter C/O & tested.	8/07/2025	9393	Hours	6.0	6.0	\$0.00
	24513	leaking boom hose C/O tested wash down machine.	12/07/2025	9393	Hours	3.0	3.0	\$0.00
	24539	Machine broken down on cone , failed alternator & ran out of fuel at same time , replaced battery's to get off cone , replaced alternator , belts , replaced fuel filters , made new gasket for fuel pump , refitted boom pin & replaced retaining bolt .	19/07/2025	9422	Hours	15.0	14.0	\$0.00
	24631	Replace main fuel primerReplace fuel level sender	3/08/2025	9458	Hours	2.0	2.0	\$0.00
	24669	500 Hour Excavator service , topped up hyd oil , replaced final drive & pump trans & slew oils .	18/08/2025	9472	Hours	8.5	7.5	\$0.00
	24695	Replace hyd hose from pump to hyd tank	18/08/2025	9476	Hours	2.5	2.5	\$0.00
	24868	Carried out bucket work, replaced gum guard armour, adaptor pads and lip edge protection	16/09/2025	9491	Hours	11.0	11.0	\$0.00
	24932	Hyd leaks wash down to inspect found relief valves leaking removed to C/O damage O-rings,C/O leaking boom hoses. C/O Hyd oil. C/O front windscreen. C/O leaking pilot hose. wash unit down & tested.One relief still leaking new one on order.	5/10/2025	9530	Hours	33.0	21.0	\$0.00
	25076	gouge old locks and removed old teethfit new teeth and locks weld new locks into place	25/10/2025	9643	Hours	1.0	2.0	\$0.00
	25094	Checked A/C found broken belt. Assembled new A/C belt. Checked gas pressure	4/11/2025	9707	Hours	2.0	2.0	\$0.00
	25105	250 Hour Excavator service Completed	6/11/2025	9747	Hours	1.5	1.5	\$0.00
	25115	Engine running rough. Replaced fuel filters, air cleaners & found fuel primer pump was installed upside-down, swapped & tested.C/O 2 leaking boom hoses topped up hyd oil.	8/11/2025	9754	Hours	27.0	25.0	\$0.00
	25174	Engine bogging down, carried out complete PM clinic and	18/11/2025	9807	Hours	12.0	12.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		hydraulic tune (Komatsu Rocco & Dan)						
	25246	Hydraulic leak on bucket cylinder remove return steel pipe boily welded up refit pipe with new o-rings topped up hyd oil & tested.	3/12/2025	9866	Hours	2.0	2.0	\$0.00
	25410	Replace missing tooth and cap	27/12/2025	9907	Hours	1.0	2.0	\$0.00
	25428	Grease leakInspected leak, found damaged fittingRemove hose Brought R hing back to shedFound new fitting Fitted to machineRefitted cover and hose	5/01/2026		Hours	2.0	2.0	\$0.00
	25548	C/O LHF carrier roller tensioned it down & tested.	30/01/2026	9943	Hours	3.5	3.5	\$0.00
	25606	Bad Hydraulic LeakIt turned out by being a heater hoseWashed down the hydraulicsRemoved all covers, found coolant leak, Put an internal sleeve to which failed(the hose was too far gone)So under Mathews direction discounted the heater and re diverted the coolant back into the engineTested & assembled	5/02/2026	9943	Hours	11.5	0.0	\$0.00
	25631	2000 Hour Excavator service completed.	21/02/2026	9997	Hours	26.0	20.5	\$0.00
	25729	Replace TeethRemoved old teethClean all adaptersFit teeth locks - weldCheck complaint of being slow	26/02/2026	10037	Hours	2.0	0.0	\$0.00
	25733	Missing tooth + cracked teeth lock weldsFind a good run out toothTravel to siteClean adapter + fit toothFit lock + weld lock top + bottom to the toothInspect + clean locks on the other teethMost are cracked so re-welded locks to teeth	8/03/2026	10097	Hours	2.5	0.0	\$0.00
	25798	Broken grease lineRepair broken grease line on H-Link	18/03/2026	10225	Hours	1.0	0.0	\$0.00
	25802	Replace R/H front top roller	18/03/2026	10230	Hours	0.5	0.0	\$0.00
	25760	250 Hour Excavator service completed, removed and replaced 3 leaking hoses on control valve (Fabricated hoses at HV workshop) Replaced leaking engine oil filter housing hoses, replaced 6 x ORFS o'rings, topped up oils, degreased and washed machine.	19/03/2026	10240	Hours	8.0	8.0	\$0.00
	25845	Hyd Leaks - Removed floor + hand rail degrease and washed machineDiagnose Hyd leaks and marked with marking paint 4xcontrol valve relief valves and all pilot lines on control valvesOrderd Relief valves and hosesRemoved all hoses and sent to town to be made - covered all fittings in tape and fitted spill plugsFitted all new hoses with new o'rings and spiral	29/03/2026	10246	Hours	167.0	68.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading		Downtime (hours)	Repairtime (hours)	Cost
		wrapped - followed Hyd Schenatic due to hoses/fittings not being marked and hoses that arrived w/o coloured zip tiesFixed all leaning fittings and tested digger and got hot - fitted all panels and washed.						
	25895	MID LIFEReplace water pump + seals and gasketsReplace thermostats+ seals and gasketsReplace turbo + gasketsReplace injectors & lines + new clampsReplace injection pumpDo valve set + valve cover gasketsReplaced coolantReplaced engine oil + filtersReplaced fuel filtersReplace AC lines to cabReplace TX valveReplace receiver drierReplaced upper radiator hoseA/C HosesRemove and replace heater hosesRemove and replace Ac hosesR&R Tx valve -R+R receiver dryer - Regas run + testFit all Belly plates - Fit fire wall and all top coversChange oil fuel and air filters - changed Eng oil - wash + test	16/04/2026	10253	Hours	240.0	80.0	\$0.00
	25964	Remove grease fill stopper & unseize fill grease podtest	7/05/2026	10258	Hours	1.5	1.5	\$0.00
	26133	Fit missing bucket tooth and welded in locks	3/06/2026	10275	Hours	1.0	1.0	\$0.00
	26239	Leaking hoses/ suspected coolant loss- Washed machine- C/O selected hoses - spinal wrapped and neatly run- Diagnosed other leaks and ordered parts- Removed exhaust side of EGR and pressure tested cooling system hot and cold and did not drop pressure- Washed and fitted all panels- Adjusted tracks	30/06/2026	10360	Hours	72.0	24.0	\$0.00
	26294	Hose and relief valves- Remove all panels- Remove and replace leaking hoses- Remove and replace 3x control valve reliefs- Run and test- Tighten A/C belt- A/C compressor noisy- Wash down and walk to - A/C compressor noisy- Wash down and walk to site- Adjust track	12/07/2026	10362	Hours	42.0	18.0	\$0.00
	26327	Weld mounts for grease guard plateClean up broken tab mountsTack weld + check positioningWeld out + bolt guard plate back into positionAdjusted tracksReplace damage grease line on H link + manual greaseRemove broken cover on Hlink for grease injectorsRepaired + refit	22/07/2026	10497	Hours	3.0	3.0	\$0.00
	26334	500 Hour Excavator service completed, tightened alternator belts.	25/07/2026	10501	Hours	40.5	40.5	\$0.00
	26370	Checked over for hire. Topped up with hydraulic oil. Both swing motors, coolant. C/O cracked windscreen.	7/08/2026	10545	Hours	5.0	5.0	\$0.00

Asset	W/O No	Description	Finished	DoneReading	Downtime (hours)	Repairtime (hours)	Cost		
No of W/O for EX851			:	195	Asset Total:	EX851	1547.5	1265.0	\$0.00
No of W/O for [REDACTED]			:	262	Parent Total:	[REDACTED]	1771.5	1505.0	\$0.00
Grand Total				262			1771.5	1505.0	\$0.00