

2024

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-11-01	912	vehicle			driver complained of rattling in front end. Found drivers side lower front fender loose. Also struts were out of position on right side torque rod when bolts broke off Labour 3 hrs		Jeanette Hrechka	141144	3424
2024-10-24	912	vehicle			Remove wabasto assembly and clean thoroughly. Check all wiring on it. Check wiring in right side for codes coming up with orange light. 1/2 hr/1 hr		Jeanette Hrechka	142167	3469
2024-10-17	912	vehicle			Repair 2 audible air leaks in W/washer compartment. One was air switch leaking and other was a sharp bite connection. Top up coolant. Removed parts from 920. Test all duct sensors as heat not working properly. Found sensor in heater comp. broken L labor 3 hrs 5 L - coolant 1- duct sensor		Jeanette Hrechka	137269	3342
2024-09-23	912	vehicle			Remove a/c compressor and install used on from 916. Install new seals except outer one. Remove clutch assembly from original one. 1 seal unit- G 1011 558 Labor 8 hrs		Jeanette Hrechka	137483	3346
2024-09-18	912	vehicle	180 day inspection	Mb Safety inspection	Gov't Safety K 1. Broken head rests on seats 10+33 2. Rear left side marker out. 3. hinges on luggage bay doors #1 and #3 loose. 4. Muffler cracked 5. left tag air bag leaking 6. left tag mud flap melted 7. left tag top support 8. 2 o/h lights out on left side		Jeanette Hrechka	135194	3298
2024-08-19	912	vehicle			Install new water valve for coach. Check fluids. Remove wiring harness from old valve to use on new valve. Install rear door hatch right door latch off 922 1 water valve M L7984A4009 labour - 2 hours		Jeanette Hrechka	134223	
2024-08-10	912	vehicle	Oil Change	oil change	Oil Change and filter. Top up diff oil. Check coolant. 2 oil filters 51971 3 8L 15/40 oil		Shari Leshchyshyn (Deactivated)	132463	3198
2024-08-07	912	vehicle			Repair entrance door, top lock not dropping down enough. Adjust and check lights. Rear center clearance light out. Top up engine oil 5L. 5L-15/40 oil 1 bulb 194 Labor 1.5 hrs		Shari Leshchyshyn (Deactivated)	132463	3198
2024-07-22	912	vehicle			LH Steer retorqued		Shari Leshchyshyn (Deactivated)	130705	3146
2024-07-17	912	vehicle			Fill (WELD) Bracke U/Rod .17 hr - labour	19.04	Natalie Hrechka	130705	3139

2024-07-15	912	vehicle			Lift on hoist and check over. Front left sway bar link bushing loose. Front left radius rod bolt broken on rear mount housing. Install new bushings and hardware. Top up fluids. Change out leaking front leveling valve. Change air filter on engine and check compartment for rust holes. Rear left post rusted through at bottom, wrap to repair. Parts- 2 Bushing 630021 1 - Valve 630120 1 Oil 15/40 Engine Oil 8L Coolant 1 air filter 46623 3L 75/90 gear oil Labor 1hr /4hrs/4hrs/2hrs	Shari Leshchyshyn (Deactivated)	130704	3139
2024-04-26	912	vehicle			Clean out Coach air filter and hear core and evaporator. Repair condenser door E-latch by welding it. Evacuate and recharge. Labor-3hrs	Shari Leshchyshyn (Deactivated)	124088	2965
2024-04-17	912	vehicle			Replace high pressure hose and o-rings off compressor. 1 hose 2 O-rings 507345 Labor - 1 hr	Shari Leshchyshyn (Deactivated)	123790	2956
2024-03-27	912	vehicle	180 day inspection	Mb Safety inspection	1- Broken arm rest rear left seat 2- Broken arm rest cushion 3-Front left sway bar link loose 4- Right tag shock leaking 5- Right tag mud flap missing 6- Battery posts corroded Oil Change and filters Grease Check diff oil Adjust brakes 38L 15/40 Oil 2 oil filters 1971 Labor 10 hrs	Shari Leshchyshyn (Deactivated)	123227	2935
2024-02-27	912	vehicle			Repair front door, to lock doesn't drop down enough to open. Check front tires for cupping. Labor 1 hr	Shari Leshchyshyn (Deactivated)	121046	2877
2024-02-07	912	vehicle			Replace front right shock and replace all 4 bushings in front sway bar links. Replace knuckle on steering damper. 1 shock 85736 2 Bushings 630062 4 Bushings 2350908 1 Knuckle Labor 4 hrs	Shari Leshchyshyn (Deactivated)	117666	2806
2024-02-01	912	vehicle	Oil Change	oil change	Check fluids and install 3 fan belts from 918. 12L 15/40 Oil 8L Coolant	Shari Leshchyshyn (Deactivated)	116980	2786
2024-02-01	912	vehicle	Oil Change	oil change	Oil change and filters. 38L 15/40 Oil 2 oil filters 51971	Shari Leshchyshyn (Deactivated)	116896	2786
2024-01-25	912	vehicle	Tires, Tires, Tires	Tire Inspection Required - steers, Tire Inspection - drives, Tire Inspection - Tags	Remove left drives to change out all inner studs, center nuts and inside steel rim. Swap over drive tires. 10 Center nuts 10 Inner Studs Labor 4 hrs	Natalie Hrechka	116327	2761

2024-01-23

912

vehicle

Jan 21 - nuts on drivers side drives came loose. worked their way into rim as was on way back from edmonton (sas katoon) Quality tire placed a tire on rim on outer drive (as supplied by charlie s charters) studs not replaced, new nuts were, advised to check hub for signs of wear.

Jeanette Hrechka 116453

2760

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-03-07	912	vehicle			check why engine pushes coolant and loses front heat. Do pre-inspection for safety Pull wheels, check all brakes Steering dampener knuckle seized. Air dryer mount bracket rusted needs drive tires needs muffler replaced		Jeanette Hrechka	151885	3773
2025-03-03	912	vehicle			driverside lower windshield replaced, stone mark, home own autoglass		Jeanette Hrechka		
2025-02-25	912	vehicle	Oil Change	oil change	oil change and filter s greas front end and change both front shocks change front right brake caliper , old one seized on slides. Adjust and seat. Pulled both front wheels to check both brakes. retorque done at 150,132 km 2 X filler 51971 38l oil 15/40 2 shocks 58736 5 hours		Jeanette Hrechka	149634	3721
2025-01-15	912	vehicle			Denray installed new steer tires and right tag tire. Michelins. Water pump failed. Replaced with water pump from 916; sold engine on Stand in shop 2 - steers -Mich X Line energy z coach 1 - tag - recap from our stock (retorqued Jan 20, 2025 @ 144,204 km Labour -(pump) 4 hrs BH		Jeanette Hrechka	143565	3505
2025-01-15	912	vehicle	Tires, Tires	Tire Inspection Required - steers, Tire Inspection - Tags	replace the tag tire/ rear right with stock; and both steer tires	2698.21	Jeanette Hrechka	143565	3505

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-06-17	912	vehicle			service transmission change filters and fluid 34 litres trans and oil Unit still has "service" on transmission pad, and active codes.		Jeanette Hrechka	846418	18879
2025-05-06	912	vehicle	Tires, Tires, 90 day inspection, Tires, Oil Change	Tire Inspection - Tags, Tire Inspection Required - steers, push out window log, Tire Inspection - drives, oil change	Oil and filter change 2 X oil filters 519 71 38 L 15w40 oil charge with 11 additional pounds R134 A ( 13 recovered, charged to 24 pounds) Installed reprogrammed ECM R&R left tag airbag 1 X 1R 12-631		Jeanette Hrechka	837268	18713
2025-05-01	912	vehicle	180 day inspection, 90 day inspection, Tires, Tires, Tires	Mb Safety inspection, push out window log, Tire Inspection - drives, Tire Inspection Required - steers, Tire Inspection - Tags	MB SAFETY 4 drive tires replaced - Michelin's installed 9 Michelin invoice 010551738) engine replaced with Pilot Mound engine...serial 06RO518123 (1 2.7L)		Natalie Hrechka	154040	3835
2025-04-16	912	vehicle	Tires	Tire Inspection - drives	R & R engine - install 12.7 L engine from pilot mound coach. Switch over all sensors, install manifold, air compressor and starter etc. oil change and filters. Clean coolant filter. Swap over transmission. Install new coolant hoses and trans. cooler. Install new fuel filters. Install new turbo and gaskets. Use same ECM from 11.1 L Pulled all wheels and checked brakes and adjust. Install used bumper off 922, as original was rusted through framing. Side apart diff to re seal banjo. Fill new oil. Will burn new ECM. Drain coolant to change hose, R&R muffler 2 X oil filters - 51971 1 x fuel filter 3118 1 x fuel filter 3120 1 x turbo and gaskets (R235 28065) 1 x v-clamp 56129481 24L 75/90 gear oil 4 drive tires (Micheline XDN 2) Labor 36 hours		Jeanette Hrechka	837463	18717

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-09-30	912	vehicle			Retorqued 851,308 km		Susan Agland	851308	19114
2025-09-25	912	vehicle			km Install new block heater plug on rear hatch and test. Repair lag left and low air alarm not working in dash.		Susan Agland	850344	19098
2025-09-24	912	vehicle			Km Change out rear right drive air bag. Repair front left signal light. Change bearings on fan belt tensioner and idler for A/C belts. 1 -1-R11243 Air bag 2-bearings - 3304=2 RS Labor: 5 hrs/ 1 hrs		Susan Agland	850344	19098
2025-09-11	912	vehicle			KM Repair air leak on left targe supply hose fitting to air bag. Install and adjust right leveling valve right drive side. Install dent door used control valve to repair air leak. Pull both drive fenders. Labor 3 hrs		Susan Agland	850005	19067
2025-09-09	912	vehicle			See attached file	219.71	Susan Agland	850005	19067
2025-09-04	912	vehicle			See attached file	21.97	Susan Agland	849982	19065
2025-09-03	912	vehicle	180 day inspection	Mb Safety inspection	Push rod pins seized in clevis. Right rear air bag post on drive rusted through. right rear sway bar mount bushings loose and broken bolts. Right walking beam rusted through. Both bushings on lower torque rod for drives. Change both bushings on right dog bone. diagonal cross member rusted though on drives. Differential broken installed new one. Right drive E brake not holding, broken spring in brake pot install new one. One inner wheel stud stripped, changed it out. Remove broken bolt from gear box tensioner and install one bracket from 919 and A73 belts. Straighten out air bag tensioner. parts- 1 brake pot 1- A73 bolt 1- diff vet- KIT 2 902 1- Ex. Clamp 3 3970 (5" only) labor 8 hrs/12 hrs/4 hrs		Susan Agland	849982	19065

2025-08-08	912	vehicle	<p>km install new drivers light, led, and change out step well light as it's melted. One broken foot rest. 3 broken head rests. Drivers visor rail loose and seat 50/51 recline stuck down position. Remove broken foot rest. install both new signal bulbs in front. Changed out left signal bulb assembly (shorting). Used one from 922. When head lights are turned on it mutes flasher indicator. Found right turn signal socket shorting. Labor 8 hrs/ 4hrs 2-bulbs 1157 A 2-bulbs 623 2-bulbs 6429 1-644 6619</p>	Jeanelle Hrechka 849112	19000	
2025-07-22	912	vehicle	<p>see attached... service light on transmission pad, and communications error from trans to ecm</p>	739.6	Jeanelle Hrechka 849231	19011
2025-07-08	912	vehicle	<p>coach damaged by Brian B. (June 25) RH mirror and bracketed off, all marker lights ripped off, rear fender damaged, engine door twisted Fibreglassed and painted by Stuart 1 x RH mirror (920) 1 X RH mirror support (920) 1 x Rh fender trim (922) 6 X Clearance lights 1 X engine door hinge (920) flex pipe between turbo and muffler rusted through. flex pipe and clamps replaced. Gearbox found to be leaking oil 1 X flex pipe 2 x stepped exhaust clamp 1 X gearbox (used0</p>	Jeanelle Hrechka 847627	18937	

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-11-27	912	vehicle			km Loosen up ent. door on hinges and shock cyl pins. Rep air arm rest in rear left and front left. labor 2 hrs		Susan Agland	858230	19270
2025-11-20	912	vehicle			858,092 km 19256 hrs Install new engine air filter 1x4662 3 air filter		Susan Agland	858235	19271
2025-11-07	912	vehicle			Retorque Complete Repair webasto wiring and clean head. Found RT shock broke apart and lower shock pin welded to bus and rusted. Weld in new lower shock block for pin. Found 1 wheel stud broken on Rt ag. Install new stud and nut. Parts 1- shock 85736/ 1 shock pin -131424/ 1 shock block/ 1- wheel stud and nut/ 1 clearance light front Labor 6 hrs		Susan Agland	856974	19229
2025-10-31	912	vehicle			Change out leaking belt tensioner reg valve A/C belt idler has loose pulley on gear box belts. also re-align it and install shield from belts. Replace broken arm rest on seat # 1- airbag-950208 1- regulator- 640938 labor 3 1/2 hrs		Susan Agland	856952	19225
2025-10-20	912	vehicle	90 day inspection, Oil Change	push out window to g.oil change	oil and filter change change fuel filters 3 8l 15w40 oil 2 x 51 791 oil filters 1 X 31 18 fuel filter 1 x 31 20 fuel filter		Jeanette Hrechka	855153	19185

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-11-27	912	vehicle			km Loosen up ent. door on hinges and shock cyl pins. Rep air arm rest in rear left and front left. labor 2 hrs		Susan Agland	858230	19270
2025-11-20	912	vehicle			858,092 km 19256 hrs Install new engine air filter 1x4862 3 air filter		Susan Agland	858235	19271
2025-11-07	912	vehicle			Retorque Complete Repair webasto wiring and clean head. Found RT shock broke apart and lower shock pin welded to bus and rusted. Weld in new lower shock block for pin. Found 1 wheel stud broken on Rt ag. Install new stud and nut. Parts 1- shock 85736/ 1 shock pin -131424/ 1 shock block/ 1- wheel stud and nut/ 1 clearance light front Labor 6 hrs		Susan Agland	856974	19229
2025-10-31	912	vehicle			Change out leaking belt tensioner reg valve A/C belt idler has loose pulley on gear box bells. also re-align it and install shield from belts. Replace broken arm rest on seat # 1- airbag-950208 1- regulator- 640938 labor 3 1/2 hrs		Susan Agland	856952	19225
2025-10-20	912	vehicle	90 day inspection, Oil Change	push out window log oil change	oil and filter change change fuel filters 3 8l 15w40 oil 2 x 51 791 oil filters 1 X 31 18 fuel filter 1 x 31 20 fuel filter		Jeanelle Hrechka	855153	19185
2025-09-30	912	vehicle			Retorqued 851,308 km		Susan Agland	851308	19114
2025-09-25	912	vehicle			km Install new block heater plug on rear hatch and test. Repair tag left and low air alarm not working in dash.		Susan Agland	850344	19098
2025-09-24	912	vehicle			Km Change out rear right drive air bag. Repair front left signal light. Change bearings on fan belt tensioner and idler for A/C belts. 1 -1-R11243 Air bag 2-bearings - 3304=2 RS Labor: 5 hrs/ 1 hrs		Susan Agland	850344	19098
2025-09-11	912	vehicle			KM Repair air leak on left luge supply hose fitting to air bag. Install and adjust right leveling valve right drive side. Install ent door used control valve to repair air leak. Pull both drive fenders. Labor 3 hrs		Susan Agland	850005	19067
2025-09-09	912	vehicle			See attached file	219.71	Susan Agland	850005	19067
2025-09-04	912	vehicle			See attached file	21.97	Susan Agland	849982	19065

2025-09-03	912	vehicle	180 day inspection	Mb Safety inspection	<p>Push rod pins seized in clevis. Right rear air bag post on drive rusted through. right rear sway bar mount bushings loose and broken bolts. Right walking beam rusted through. Both bushings on lower torque rod for drives. Change both bushings on right dog bone. diagonal cross member rusted through on drives. Differential broken installed new one. Right drive E brake not holding, broken spring in brake pot install new one. One inner wheel stud stripped, changed it out. Remove broken bolt from gear box tensioner and install one bracket from 919 and A73 belts. Straighten out air bag tensioner. parts- 1 brake pot 1- A73 belt 1- diff vet- KIT 2 902 1- Ex. Clamp 3 3970 (5" only) labor 8 hrs/12 hrs/4 hrs</p>		Susan Agland	849982	19065
2025-08-08	912	vehicle			<p>km install new drivers light, led, and change out step well light as it's melted. One broken foot rest. 3 broken head rests. Drivers visor rail loose and seat 50/51 recline stuck down position. Remove broken foot rest. Install both new signal bulbs in front. Changed out left signal bulb assembly (shorting). Used one from 922. When head lights are turned on it mutes flasher indicator. Found right turn signal socket shorting. Labor 8 hrs/ 4hrs 2-bulbs 1157 A 2-bulbs 623 2-bulbs 6429 1-644 6619</p>		Jeanelle Hrechka	849112	19000
2025-07-22	912	vehicle			<p>see attached... service light on transmission pad, and communications error from trans to ecm</p>	739.6	Jeanelle Hrechka	849231	19011
2025-07-08	912	vehicle			<p>coach damaged by Brian B. (June 25) RH mirror and bracketed off, all marker lights ripped off, rear fender damaged, engine door twisted Fibreglassed and painted by Stuart 1 x RH mirror (920) 1 X RH mirror support (920) 1 x Rh fender timer (922) 6 X Clearance lights 1 X engine door hinge (920) flex pipe between turbo and muffler rusted through. flex pipe and clamps replaced. Gearbox found to be leaking oil 1 X flex pipe 2 x stepped exhaust clamp 1 X gearbox (used)</p>		Jeanelle Hrechka	847627	18937

2025-06-17	912	vehicle			service transmission change filters and fluid 34 litres trans and oil Unit still has "service" on transmission pad, and active codes.	Jeanette Hrechka	846418	18879
2025-05-06	912	vehicle	Tires, Tires, 90 day inspection, Tires, Oil Change	Tire Inspection - Tags, Tire Inspection Required - steers, push out window log, Tire Inspection - drives, oil change	Oil and filter change 2 X oil filters 519 71 38 L 15w40 oil change with 11 additional pounds R134 A ( 13 recovered, charged to 24 pounds) Installed reprogrammed ECM R&R left tag airbag 1 X 1R 12-631	Jeanette Hrechka	837268	18713
2025-05-01	912	vehicle	180 day inspection, 90 day inspection, Tires, Tires	Mb Safety inspection, push out window log, Tire Inspection - drives, Tire Inspection Required - stores, Tire Inspection - Tags	MB SAFETY 4 drive tires replaced - Michelin's installed 9 Michelin Invoice 010551738) engine replaced with Pilot Mound engine...serial 06RO518123 (1 2.7L)	Natalie Hrechka	154040	3835
2025-04-16	912	vehicle	Tires	Tire Inspection - drives	R&R engine - install 12.7 L engine from pilot mound coach. Switch over all sensors, install manifold, air compressor and starter etc. oil change and filters. Clean coolant filter. Swap over transmission. Install new coolant hoses and trans. cooler. Install new fuel filters. Install all new turbo and gaskets. Use same ECM from 11.1 L. Pulled all wheels and checked brakes and adjust. Install used bumper off 922, as original was rusted through framing. Slide apart diff to re seal banjo. Fill new oil. Will burn new ECM. Drain coolant to change hose. R&R muffler 2 X oil filters - 51971 1 x fuel filter 3118 1 x fuel filter 3120 1 x turbo and gaskets (R235 28065) 1 x v-clamp 56129481 24L 75/90 gear oil 4 drive tires (Michelin XDN 2) Labor 36 hours	Jeanette Hrechka	837463	18717
2025-03-07	912	vehicle			check why engine pushes coolant and loses front heat. Do pre-inspection for safety Pull wheels, check all brakes Steering dampener knuckle seized. Air dryer mount bracket rusted needs drive tires needs muffler replaced	Jeanette Hrechka	151885	3773
2025-03-03	912	vehicle			driverside lower windshield replaced, stone mark, homelown autoglass	Jeanette Hrechka		
2025-02-25	912	vehicle	Oil Change	oil change	oil change and filter greas front end and change both front shocks change front right brake caliper, old one seized on slides. Adjust and seat. Pulled both front wheels to check both brakes, relorque done at 150,132 km 2 X filter 51971 38l oil 15/40 2 shocks 58736 5 hours	Jeanette Hrechka	149634	3721

2025-01-15	912	vehicle	Denray installed new steer tires and rh tag tire. Michelins. Water pump failed . Replaced with water pump from 916; s old engine on Standard in shop 2 - steers -Mich X Line energy z coach 1 - tag - r ecap from our stock (retorqued Jan 20, 2025 @ 144,204 km Labour -(pump) 4 hrs BH	Jeanette Hrechka	143565	3505			
2025-01-15	912	vehicle	Tires, Tires	Tire Inspection Required - steers, Tire Inspection - Tags	replace the tag tire/ rear right with stock; and both steer tires	2698.21	Jeanette Hrechka	143565	3505

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-01-15	912	vehicle			Denray installed new steer tires and rh tag tire. Michelins. Water pump failed , Replaced with water pump from 916;s old engine on Stand in shop 2 - steers -Mich X Line energy z coach 1 - tag - recap from our stock (retorqued Jan 20, 2025 @ 144.204 km Labour -(pump) 4 hrs BH		Jeanelle Hrechka	143565	3505
2025-01-15	912	vehicle	Tires, Tires	Tire Inspection Required - steers, Tire Inspection - Tags	replace the tag tire/ rear right with stock; and both steer tires	2698.21	Jeanelle Hrechka	143565	3505

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-12-01	510	vehicle			wheel alignment re move and replace both front struts re move and replace f ront sway bark link s remove and repla co both inner and o uter tie rod ends re move and replace r ear sway bar links r emove and replace failed transmission support bushing ke lleher ford invoice 1 36785	5755.33	Jeanelle Hrechka		
2025-10-22	510	vehicle			hankook RH12 Dy napro HT1211/119 R 10 Ply BSW 235/ 65R16C Tire Levy - PLT Light Truck ch ange over 5281 Oct 22, 25 Replace Re ar tires Left Rear, Right Rear 74 PSI 150FT/LBS Torque Light Truck Balanc e 5281		Susan Agland		

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-03-27	912	vehicle	90 day inspection, 180 day inspection	push out window logs, Mb Safety inspection	safety inspection front right wheel seal leaking front right hub cap leaking 2 back rests broken in rear steering dampener boot ripped a part, rear right side glass cracked, 1 x hub cap 343-4009 1 x seal 46300x1 1 x boot 1 x hometown glass in stall		Jeanette Hrechka	879588	0
2026-03-18	912	vehicle			change out entrance door lock from 923, had broken key in it, change out entrance door handle grab bar from 923. Remove drive tires.		Jeanette Hrechka	879137	19740
2026-03-11	912	vehicle			repair front left corner signal light and check lo beams, repair entrance door by changing out top door lock cylinder from 920, change out lo beam headlights from 923.		Jeanette Hrechka	878168	19709
2026-02-26	912	vehicle	Oil Change	oil change	oil and filter change 2 x 51791 oil filters 38 L 15w40 oil		Jeanette Hrechka	871516	19572
2026-02-23	912	vehicle			still no defrost heat, coolant not circulating, install temp bypass hose in spare tire compartment, repair front right clearance light and repair wiring on rear right side marker, lube up key locks and disengage right fuel door lock. Diagnose heating system. Close bumper up, had to straighten latch and adjust, oil and filter change, 2 x 51971 oil filters 38 L 15w 40 oil 8 l coolant		Jeanette Hrechka	871516	19571
2026-02-11	912	vehicle			no defrost heat Found aux water pump not working and bypass valve not working, take pump and valve from 916, found sensor in stairwell corroded, 1 x aux water pump (916) 1 x bypass valve 1 x temp sensor 064651 8 l coolant		Jeanette Hrechka	869236	19520
2026-01-24	912	vehicle			remove batteries from 926 and install in 912		Jeanette Hrechka	861096	19344

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-04-23	912	vehicle			repair entrance door wiring on external switch. prep and paint rear right fender .		Jeanelle Hrechka	879589	19757
2026-04-16	912	vehicle			Remove fender from 923 rear right and rebuild for 912. (Fender ripped off by David Young) Fibreglass and paint (Stuart) install and adjust 3 clips.		Jeanelle Hrechka	879588	