

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-03-04	918	vehicle			both lower windshields replaced by hometown glass		Jeanette Hrechka		
2025-03-03	918	vehicle			1,967,390 kms 35988 hrs change oil and filters Grease R & R top left/middle marker light		Jeanette Hrechka	1967390	35988
2025-03-03	918	vehicle	Oil Change	oil change			Jeanette Hrechka	1967390	35988
2025-02-06	918	vehicle			1,958,229 kms 35791 hrs -Boost pressure fault active. -found broken connector on Harnesses no matching connector on harnesses in shop re-wired with updated plug for updated boost pressure sensor 1x pressure sensor (premium truck)		Jeanette Hrechka	1958223	35791
2025-02-05	918	vehicle	Tires	Tire Inspection - drives	1,957,843 Kms 35776 Hrs Install 4 drive tires (Denray) on the RH Wheel stud not all the way through hub replaced stud (denray) 4x Michelin xdn2 tires 1x RH stud 621633 Michelin Inv 0367929na361890 Rotorqued @ 1,958,229		Jeanette Hrechka	1957961	35786
2025-02-04	918	vehicle			19587837 kms 35769 hrs No start. Until frozen. Starter would not jump. Remove starter. Replace starter, with one from stock. Replace batteries Replace RH fuel cap (original lost/used one from 920) 4x 31-1250S batteries 1x starter 201-42202		Jeanette Hrechka	1957837	35774
2025-01-30	918	vehicle			1,956,807 Webasto not working. Runs but doesn't fire. Switched out fuel nozzle, ignition electrode and cleaned photo disk and eye. Still not working. Replaced Fuel filter. Issued 1x inline fuel filter - 5048717A		Jeanette Hrechka	1956807	35748
2025-01-05	918	vehicle			1,948,580 kms 35496 hrs change bath room exhaust fans		Jeanette Hrechka	1948580	35495

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-07-24	918	vehicle	90 day inspection, Tires, Tires, 180 day inspection	push out window lock, Tire Inspection - Tags, Tire Inspection - drives, Tire Inspection - Required - Safety inspection	safety inspection repair air bag support, weld small crack in cross member replace damper boot right front signal light performed by jim		Jeanelle Hrechka	1970237	36055
2025-07-21	918	vehicle			R134 A recharged 15 lbs recovered. winter loss		Jeanelle Hrechka	1970237	36055

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-12-12	918	vehicle	Tires	Tire Inspection - T	brake seized, small fire change out right lag rotor, caliper, brake house and r1 2 valve. remove inversion valve and install tr3 updated valve. Weld up condenser door frame and install new coolant pump (used on 914) Test drive and retorqued both lag wheels.		Jeanette Hrechka	1979935	
2025-11-26	918	vehicle			See attached file	306.37	Susan Agland	1978184	36267
2025-11-24	918	vehicle			See attached file	59.03	Susan Agland	1978150	36267
2025-11-21	918	vehicle			See attached file	1207.38	Susan Agland	1978150	36266
2025-11-20	918	vehicle			check why right lag brakes hoasting and change wheel seal. found bearings rough so changing out all. Caliper not proper operation so install new one and pads. Brake pot rusted badly so install new service pot and e brake pot together. check why pop license plate light back in place. recharge fire extinguisher. 1 hub cap 3 43-4009 cone 611220 cone 611221 bearing 611219 bearing - ? seal 46300 caliper xkn35957p test drove and retorqued right lag		Jeanette Hrechka	1978150	36266
2025-11-13	918	vehicle			went to start bus and no ignition power on dash or to F2. Diagnose wires found back connection in engine cradle. cleaned up all 3 connections and zip tie together. Found rt left not working properly. change air bag fill valve installed new one. checked out rt brake release as well.		Jeanette Hrechka	1977172	36240
2025-11-04	918	vehicle			change out ent door lock from 920. Change out 2-4 window lights and clean lenses. Washout 1/2 filters and change 6 aisle light bulbs. Swap out one right side rear arm rest. repair air leak on seat. Repair battery hold down has broken bolt labor 4 hrs		Susan Agland	1974989	36183

2025-10-15	918	vehicle	<p>Change out broken dash cowling and wire in USB ports on dash. Change out signal switch and delay module from 919. Repair duct for drivers floor heat lever fell off. Re-Install humidity sensor in drivers compartment and re-configure air lines to steering wheel lift valve. Re-wire and install step well light from 919 and test O/H defrost fan. Replace A/C hose (silver braided off compressor) (373372) charge with 24 lbs B137A 95 lbs recovered) Bypass fuse holder block with inline for F19. Open up all harness's for webasto and repair. Remove head and clean out. run + tested good! Test batteries needs new ones. both battery clamp downs off. one has broken bolt in it 4-batteries labor/8hrs, 9 hrs, 4 hrs</p>	Susan Agland	1975602	36191
2025-10-02	918	vehicle	<p>Missing nuts on bottom front air bag and loose brake hose. Lower bolts on caliper missing on right hand drive. Inner drives rubbing on drive tires and right drive shock leaking oil. Install new sway bar and 4 bushings. Install new dog bone bushings, 4 of them. Remove both front air tanks and weld up both front posts and sway bar mounts. Install new shock pin on front right lower pin. Install both new shocks on rear drives. Repair audio/video breakers connections in battery box. Weld up all top supports on air bag. Install new tag lift valve. Install 4 new drive tires. 2 shocks 85736 4 sway bar bushings 630021 4 dog bone bushings 630062 1 shock pin 131424 1 Norgren valve 641357 1 sway bar/stabilizer bar 131359 4 drive tires (Denroy) labor 7 hrs/6 hrs/8+8</p>	Susan Agland	1970238	36056

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-02-26	918	vehicle	Tires,Tires	Tire Inspection - Tags,Tire Inspection Required - steers	Install L tag tire and rim from 926 (down for engine repairs) Install brand new rim on LH steer (tire was ok) Put sparo back in compartment, Change steer shock (LH side) Replace 4 wheel nuts. 4 X wheel nut 610175 1 shock 85736 1 rim 229367B - Denray - stud pilot (BIN141766)		Jeanelle Hrechka	1993858	36817
2026-02-24	918	vehicle	90 day inspection, Tires,Tires,Tires,Oil Change	push out window log,Tire Inspection - Tags,Tire Inspection - drives,Tire Inspection Required - steers,oil change	oil and filter change . visual inspect tires test all e windows . 28 1 14w40 2 X wi x 51791 filters		Jeanelle Hrechka	1993049	36802
2026-02-24	918	vehicle	90 day inspection, Tires,Tires,Tires,Oil Change	push out window log,Tire Inspection - Tags,Tire Inspection - drives,Tire Inspection Required - steers,oil change	oil and filter change . visual inspect tires test all e windows . 28 1 14w40 2 X wi x 51791 filters		Jeanelle Hrechka	1993049	36802
2026-02-07	918	vehicle	Tires	Tire Inspection Required - steers	loft steer tire low. k al tire service call in Regina. Found rim cracked. installed spare tire. Denray found tire to still be good. new rim ordered from Denray feb 11. Rim should arrive feb 16. will do change over then		Jeanelle Hrechka	1987024	36604
2026-01-26	918	vehicle			repair belt tensioner air lines, damaged when a/c clutch bearing seized and blew belts. repair safety chain and install all new air bag tensioner. Shim up act ensioner 1 air bag 950208		Jeanelle Hrechka	1983160	36498
2026-01-19	918	vehicle			change out rei part from 922. swap over face plates		Jeanelle Hrechka	1980905	36383
2026-01-13	918	vehicle	180 day inspection	Mb Safety inspection	front left brake caliper seized right drive caliper seized lic plate light out of position 1 broken foot rest rear right side 3 headrests broken 2 rear right o/h aisle lights out RE1 - video not working 2 bulbs 830152 1 caliper left xkn35957p 1 caliper right xkn35958p grease		Jeanelle Hrechka	1980156	36325

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-04-28	918	vehicle			Top up trans oil, evacuate A/C system and remove A/C compressor and dress up and install from 919. Install one condensor fan motor from 920 as old one seized. Repair of H grill above engine it's falling down. Repair air leaks on left steering, ent. door valve and change out E-brake switch from 923. Torque right steer tire. Evacuate and fill with freon labor 8 hrs/8 hrs.8 hrs "needs retorque on R. S. Tire"		Susan Agland	2006400	37140
2026-04-13	918	vehicle			Washroom door handle broken. Driver's seat air leaks and control broken., fuel door on right side wont open. windshield washer not working. installed seat from 923. replace air leak in WW compartment. changed out one fitting. change panels on condenser door. and luggage door behind it. change entrance door valve from 919 as its leaking. change 4 panels. condenser door, battery door, 3rd right luggage door and 3 left luggage door. strip down cornering in luggage bays and redo with new edging. install reflector on left rear side. install all new mouldings on panels with conspicuous reflector tape. Lubed up all doors and found 2 luggage doors missing hardware. Change out entrance valve from 919. Adjust condensor door latch. install battery door lock from 923. Cleaned out. front left fender loose. cleaned coach filter.		Jeanelle Hrechka	2005851	37113
2026-04-10	918	vehicle			repair 2 right side window lights. repair 2 right side aisle lights. change right rear ballast for aisle lights. installed used one. 2 bulbs 830182		Jeanelle Hrechka	2005381	37100
2026-04-07	918	vehicle			Installed new a/c clutch bearing. order clutch assembly unit. just pulled pulley and clutch off.		Jeanelle Hrechka	2004272	37084