

Maintenance History Detail

921

2024

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-12-15	921	vehicle			KM Brakes won't release. Found right tag fire hanging "up". Removed wheel. Found brake pot to be wrong one, so installed used one proper size. Check to make sure all other 3 brakes released. Install new tag shock and install used tag lift pot, from 920 and unseize left cam. Tire needs retorque after a trip. Labor 8 hrs		Jeanelle Hrechka	1107030	21084
2024-12-09	921	vehicle			change and check wiring on trans speed sensor. Found exhaust pipe cracked from muffler to turbo. Change out completely with one from 920. Tighten up drivers left side visor. Change tensioner "brg" on fan belt pulley Labor - 8 hrs 1- speed sensor - 2 9544139 - ox. step clamp 1- BRG. 330 4 2 hrs		Jeanelle Hrechka	1106590	21077
2024-11-30	921	vehicle			KM Install new drivers defrost motor. Had to pull complete heater box until from coach and remove spare tire to cut rusted bolt from bottom. Run test 1 - motor 25-0135 1 - blower wheel 25-0094 labor 9 hrs		Jeanelle Hrechka	1103950	20998
2024-11-21	921	vehicle	Oil Change	oil change	oil and filter change		Jeanelle Hrechka	1101484	20928
2024-11-20	921	vehicle			Oil change and filters. Clean both air filters Repair wiring on webasto and clean. Test 38 L 15/40 oil 2 oil filters 51971 labor 4 hrs		Jeanelle Hrechka	1101484	20924
2024-11-01	921	vehicle	Tires	Tire Inspection - drives	DENRAY INVOICE BIN124611 FEB 14 2024 - CUSTOMER SUPPLIED TIRE OFF SCRAP - CHANGE OVER		Natalie Hrechka	1097990	20845
2024-10-29	921	vehicle	Tires, 180 day inspection, 90 day inspection, Tires, Tires	Tire Inspection - Tires, Mb Safety inspection, push out window log, Tire Inspection - drives, Tire Inspection Required - steers	Gov't Safety 1. 3 right side window cracked 2. Trans temp gauge light out 3. 2 4 v gauge light out 4. 1 - right side (??) light out 5. 1- rear right lense popped out of aisle light 6. Entry door opens very rapidly 7. both rear drives shocks leaked out oil 8. cross member above drives half with holder bent down. 9. tail pipe step clamp burnt thought 10. Rear engine oil filter loose change both fuel filters "adjust drive brakes "grease "oil change + filters 2-oil filters 51971 1-step clamp-33970 39 L - 15/40 oil 1- fuel filter 3120 4-bushings 630062. 1- fuel filter 3118 2- shocks 85736 1- shock pin 131424 Labor 5 hrs/ 6hrs/1 hrs		Jeanelle Hrechka	1097990	20845

2024-10-28	921	vehicle			defrost fans switch toggle broke off. in stall new switch. 1/ 2 hr labor	Jeanette Hrechka	1097990	20843
2024-10-11	921	vehicle			Change ext door window, fogged Change out both windshields 1 window 2 windshields	Jeanette Hrechka	1094049	20773
2024-10-10	921	vehicle			change front left air valve for kneel system, leaking. Repair front center right clearance light. parts - 641274 1 bulb 194 labor 2 hrs	Jeanette Hrechka	1094049	20773
2024-10-04	921	vehicle			KM Install new washroom fan motor assembly. Install key assembly for wheelbarrow door and check front end for air leak. Assemble new motor on shroud. Front left air bag valve leaking. (ordered) 1 - 24V motor - 562167 labor - 4hrs	Jeanette Hrechka	1093100	20752
2024-08-27	921	vehicle			Disassemble entrance door cylinders and covers for Milco to weld up both cylinder mounts to frame. Install new front right corner signal lens and bulb. Retorque R Drives	Jeanette Hrechka	1087251	
2024-06-25	921	vehicle	Oil Change	oil change	oil and filler change brett hassard	Jeanette Hrechka	1077530	20375
2024-06-18	921	vehicle			Repair air valve - Front 1 - 641274 Air valve (3 way, 2 position) Labor 2 hrs (Brett Hassard)	Shari Leshchyshyn (Deactivated)	1076927	20396
2024-05-14	921	vehicle			Repair front right clearance light. Check all lights int and ext. Labor - 30 mins	Shari Leshchyshyn (Deactivated)	1073252	20300
2024-05-07	921	vehicle			Repair air leaks in dash on gauges. Change 2 bulbs in brake and hi/lo indicator. run new wire harness from ECU to transmission for trans speed sensor. Labor-4hrs	Shari Leshchyshyn (Deactivated)	1072299	20271
2024-04-18	921	vehicle			Check out heat system in coach. Does n't shut off. Water valve stays open all the time. check control system all good. Found water valve failed on bus. Honeywell valve. Installed one from 920 after repairing. Labor - 10 hrs	Shari Leshchyshyn (Deactivated)	1072298	20270
2024-04-01	921	vehicle	180 day inspection	Mb Safety inspection	1 3rd luggage bay lights out 2 4th luggage bay switch broken 3 right drive brake pot spring broken. 4 Right tag shock pin broken off 5 Washroom light out 6 weld on top tag shock pin mount Parts 1 light switch 562303 1 bulb 6429 1 Brake pot G3036 Labor 10 hrs	Shari Leshchyshyn (Deactivated)	1072297	20260
2024-03-22	921	vehicle			Replace broke arm rest on rear left seat. Labor 1 hr	Shari Leshchyshyn (Deactivated)	1072280	20253
2024-03-11	921	vehicle			Repair passenger side tag axle hub cap, old one was leaking. Labor 1 hr - Brett Hassard	Shari Leshchyshyn (Deactivated)	1069694	20148

2024-03-11	921	vehicle			Remove and replace right side tag axle hub cap. Current one leaking 1 X hub cap 3434098 -Brett Hassard 1 hr	Jeanelle Hrechka	1069694	20148
2024-02-06	921	vehicle			Repair air leak on rear right air bag hose fitting. Install new wheel seal on left drive and top up diff oil 1 Seal 486 90 2L 75/90 gear oil	Shari Leshchyshyn (Deactivated)	1064241	19938
2024-01-31	921	vehicle	Oil Change	oil change	Oil change and filters. Install new mud flap on right tag. Fix rear right side clearance light, 39 L 1 5/40 Oil 2- oil filters 51971	Shari Leshchyshyn (Deactivated)	1063593	19899

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-03-04	921	vehicle	Oil Change	oil change	1,116,795 kms 21, 353 hrs Change oil and filters, grease, check brakes, re-adjust LH Drive brakes install 2 drive tires (RH side) xDN2's (Denray) install 2 tag tires (from recap stock) Denray Check all lights, 38L 15/40 oil 2x oil filter 51971 2x XDN@ drive tires 2x petros tag tires		Jeanelle Hrechka	1116945	21368
2025-03-04	921	vehicle	Tires, Tires, Tires, Oil Change	Tire Inspection Required - steers, Tire Inspection - drives, Tire Inspection - Tags, oil change	change oil and filters grease check brakes, re-adjust LH drive brakes install 2 drive tires on rh side (xdns from Denray) install 2 tag tires (recaps from stock at denray) check all lights 28L 15/40 oil 2 x oil filters 51971 2 X XDN2 tires (Michelin Account - 03 67929na361838) 2 X recap tags		Jeanelle Hrechka	1116795	21353
2025-02-19	921	vehicle			Unit throws on Don Not Shift when Webasto Fires. Batteries also being run down as unit sitting. Found Webasto to be wired incorrectly. New harness (bus side) needs to be wired on Disconnect ed for the time being		Jeanelle Hrechka	1119019	21417
2025-02-07	921	vehicle			1,110,216 kms 21, 234 hrs New batteries installed 2x 8D battery (Autoparts)		Jeanelle Hrechka	1110216	21234
2025-01-15	921	vehicle			Webasto wiring harnesses fixed lot of broken wires/rotten wires.		Jeanelle Hrechka	1107229	21099

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-06-27	921	vehicle			unit blows heat with A/C...water valve does not seem to be closing...Art to come diagnose...found water valve to have unthreaded it self..		Joanelle Hrechka	1134684	21737
2025-06-02	921	vehicle	Tires,180 day inspection,90 day inspection.Tires,Tires	Tire Inspection - Tags, Mb Safety inspection, push out window log. Tire Inspection - drives, Tire Inspection Required - steers	1. drivers windshield cracked (replaced by hometown) exhaust pip off turbo cracked One clearance light on front left out side left rear marker light out.		Joanelle Hrechka	1129834	21637
2025-05-26	921	vehicle	Oil Change	oil change	remove engine install all new cylinder head and camshaft (purchased from sask) install new injector #4 install new turbo, turbo oil feed pipe and return install new exhaust pipe from turbo (turbo from Western turbo, winnipeg) install used rocker arm (from trailer) replace engine oil and filters replace fuel filters		Jeanelle Hrechka	1128829	21588
2025-05-08	921	vehicle			Homestown glass repaired - install window		Natalie Hrechka	1128829	21588

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-09-22	921	vehicle			Km Install new alt and belt tensioner. Install new alt belt. Run and test A/C heat side. labor 4 hrs 1- Belt 25-120738 1- alt. 100-30201 / 50 DN 330A-24V 1 - tensioner-235330 15		Susan Agland	1141234	22189
2025-09-15	921	vehicle			Km Repair seat 21, back rest is bent forward. Change out seat frame podesta l on rear left seat. Check why A/C condenser fans not kicking in. Round motor solenoid post melted. Change out from 922 and cable. Labor 6 hrs		Susan Agland	1141089	22175
2025-09-10	921	vehicle			km Install new right defrost motor. Repair boot ducting, wire glass ducting damaged. Run A/C to check for high pressure light? Worked as it should. 1- defrost motor labor 4 hrs		Susan Agland	1141003	22165
2025-09-02	921	vehicle	180 day inspection	Mb Safety inspection	Gov't Safety km Install new shocks on tags. (2) Weld in place new top shock pin in bolt block. Remove broken shock pin on bottom of right tag. Install 4 new dog bone bushings on front sway bar. Install front right mud flap. install new front right air bag and air fitting. Install brake pot type 36 from 919 on left tag lift. Install new tag air bag fill valves. Repair floor in bay 2 on left side. grease until and adjust brakes. Coolant leak on webasto supply hose. Re-adjust tag chain left setting. Test and compare tag bag air pressure to 923. Also lower rear leveling valves 2" lower. Install new shock on front of drives left side. Reconnect trans mount. Install new tail pipe. 3- shocks 85736 1- tail pipe labor 16 hrs/4hrs/4hrs		Susan Agland	1140831	22145

2025-08-18	921	vehicle	180 day inspection	Mb Safety inspection	<p>km losing air in front on right side. Change out front right bag leaking. Install 14 new bushings on both dog bones. Install new sway bar arm with 2 new bushings. Found ear mounts for sway bar rusted out so welded in new ones. Up right post left side rusted through. Couple cracks in frame to weld up. Install rubber grommets on ECM. Change out 3 cylinders on rear hatch. Hard to lift. Replace fender front right mount clip. Repair air leak in back right side on leveling valve. Install new hub cap on left tag.</p>	Jeanelle Hrechka	1113994	22070
2025-08-13	921	vehicle			<p>km E-brake panel loose. Drivers light out and right rear hi bay light switch broken. Ent door sticking. Step well mostly panel loose. A/C door latch seized and out of adjustment. Water temp gauge light out. Lock e mechanism seized on A/C door bay lock. Washroom night light out. Broken back rest on 2 seats. Swap frames out. Left side center grill panel falling off. Re-fibre glass nuts for fasteners. Honeywell valve not working. Rebuilt one from parts bin. Washed out coach filter and cleaned out coolant filter. Re-do weather stripping around condenser door. Top up coolant. 4 bulbs 7511 1 bulb 6429 10 L Coolant lab or 8 hrs/8 hrs/4hrs</p>	Jeanelle Hrechka	11139491	22059
2025-07-16	921	vehicle			<p>Entrance door dove tail and top pin defaulting to closed position when should be open. Remove and replace relay RLV (24v) issue seems to be solved</p>	Jeanelle Hrechka	11136796	21837

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-12-02	921	vehicle			See attached file	2680.34	Susan Agland	1141835	22227
2025-11-27	921	vehicle			transmission not shifting correctly - see uploaded notes		Natalie Hrechka	1141835	22227
2025-10-30	921	vehicle			km Repair wiring on trans and sensors. Labor 9/8/9/8/9/7/8 hrs Parts 2 suspension - 630021 1-fuel filter 3118 1-fuel filter 3120 1-muffler 1-banjo ex.pipe 1-turbo flange pipe 5-ex clamps 5" 1-trans output seal 2-trans cooler hoses 1-trans filter kit 29558328 1-dispatch seal 1-tag tire 33L - Trans synd oil 4L-Coolant		Susan Agland	1141810	22227
2025-10-30	921	vehicle					Susan Agland		
2025-10-17	921	vehicle	Tires	Tire Inspection - Tires	Medium Truck Change over 5062 Oct 17, 25 Michelin invoice da0010688965 Loose marked at Bay 5 Cust Supplied Tire 110 PSI	467.47	Jeanelle Hrechka	1141802	22220
2025-10-10	921	vehicle			Service call to Dauphin to check out trans could not figure out. towed home pulled engine and trans to swap out trans from 922 with retarder. install new trans cooler hoses, filters and oil. Change out 2 bushings on tag sideways torque rod. Install new RT tire and muffler. New banjo pipe and clamps on exhaust. had milco weld up new flange for turbo pipe.		Susan Agland	1141835	22227