

926  
2024

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-12-17	926	vehicle			Change out broken center armrest on 3rd right seat. Remove broken footrest. Repair 3rd. Repair 3rd O/H luggage door on left side. Install new spray nozzle on drivers wiper labor 1 1/2 hrs		Jeanelle Hrechka	1210009	22536
2024-12-09	926	vehicle			Top up coolant 4 L coolant		Jeanelle Hrechka	1209343	22501
2024-11-29	926	vehicle			KM Remove S Bar coolant heater and install webasto from 919 complete unit. Run and test. Treat fuel with conditioner. Remove condenser door lock mechanism and repair. Clean out both coach and drivers air filters out. labor 8 hrs/2 hrs no parts needed		Jeanelle Hrechka	1205538	22434
2024-11-29	926	vehicle	Tires, Tires, Tires, 90 day inspection, 180 day inspection	Tire Inspection Required - steers, Tire Inspection - drives, Tire Inspection - Tags, push out window log, Mb Safety inspection	GOV't Safety 1/3 drive shocks leaking oil 2. sway bar links loose on drives 3. gross member in front of drives cracked 4. changed bushing on 3 torque rods on drives 5. drivers wiper blade bent parts 3- shocks 85736 6 bushings 630021 L labor 12 hrs		Jeanelle Hrechka	1205538	22434
2024-11-18	926	vehicle			KM check fluids and lights 1- rear center right clearance light out 3L - 15/40 oil 3L - coolant Put supplies in bin and chains. Move spare tire to rear left side of bin. Labor 2 hrs		Jeanelle Hrechka	1200876	22349
2024-11-13	926	vehicle			alignment - performed by lucky star invoice WI064293		Jeanelle Hrechka	1199372	
2024-11-05	926	vehicle	Tires, Tires, Tires, 180 day inspection, 90 day inspection	Tire Inspection - drives, Tire Inspection - steers, Mb Safety inspection, push out window log	Gov't Safety Ramp rear of bus, remove drives to cut out cross-member in front of drives. Changed out 3 shocks on drives. Changed bushings on rear sway bar links. Changed all bushings on 3 torque rods. Adjust all air pressure on tires. 6-Bushings 630021 4-bushings 630062 3 shocks 85736 labour 5 hrs. 6 hrs. 7 hrs. 3 hrs		Jeanelle Hrechka	1198444	22296
2024-11-01	926	vehicle			DENRAY INVOICE BIN124402 JAN 22 2024 - TIRE OF MESSED UP RIMGOS ON GOOD RIM. TIRE OFF GOOD RIM FOE RECAP; LOOSE, DAMAGE D RIM RETURN TO SUST.		Natalie Hrechka	1196777	22258
2024-11-01	926	vehicle			DENRAY INVOICE BIN125171 - VSTR 573 - TUBLESS TRUCK STEM ONT O NEW RIM DONE MAR 22 2024	57.7	Natalie Hrechka	1196777	22258

2024-10-16	926	vehicle			lighten up grab handle in step well, old window lights on left side not working. Weld up left railing under heater compartment. Repair 3 light on right hand side. Change out one floor lens. Labor 3 hrs 1 lens 312501	Jeanelle Hrechka	1191491	22167
2024-10-11	926	vehicle			Change out both front air tanks. Change out bushings on front left sway bar link. Thanks from 920. Weld up front right tow hook. 2 bushings 630062	Jeanelle Hrechka	1190971	22156
2024-09-27	926	vehicle	Oil Change	oil change	754173 Oil Change and filter. Repair. 1 window light aisle lights upper and lower changed out 2 ballasts from 920 and aisle bulbs 2 oil filters 51971 40 L - 1 5/40 oil 1- floor bulb 360024 Labor 4 hrs	Jeanelle Hrechka	1188677	22106
2024-09-23	926	vehicle			Repair rear bumper on left side, driver hooked fence and pulled apart Labor 2 hrs	Jeanelle Hrechka	1187929	22089
2024-09-06	926	vehicle			Check over and install tail bunk. Change out both front sway bar dog bone bushings. Change out rear right luggage bay light from 920, sensor cracked. Daytime running light on left out, found wire connection on right side corroded. 4 Bushings-2320339 Labor 4 hrs/ 2 hrs	Jeanelle Hrechka	1182228	21983
2024-08-27	926	vehicle	Tires	Tire Inspection Required - steers	INSTALL NEW STEERS ON TO NEW RIMS, TIRES OFF RECAP AS TAFF TIRES, 1 RIMS IS MARKED FOR WARRANTY, PLACE INTO BOX TO BE RETURNED FOR WARRANTY, MOUNT NEW TAG TIRE ONTO OTHER USED RIM	Natalie Hrechka	1179777	21258
2024-08-27	926	vehicle			Install both new steer tires and rims (one rim was cracked and covered under warranty) grease front end and install new brake pads on right steer. 2 X tires - Pelfas SH100 2 x rims (supplied by denray) 1 pair brake pads 3 hours labor retorque done JH	Jeanelle Hrechka	1180134	0
2024-08-27	926	vehicle	Tires	Tire Inspection Required - steers	Denray installed two new steer tires on two new rims BIN129369 invoice 90.0	Natalie Hrechka	1180134	21939
2024-08-21	926	vehicle	Tires	Tire Inspection - Tags	1 medium truck tire change over, took from stock at Denray invoice BIN128930 61.9	Natalie Hrechka	1178243	21914
2024-08-19	926	vehicle			Install both new rubber connectors on rear right side leveling valve, and check left side	Jeanelle Hrechka	1177806	
2024-08-09	926	vehicle	Tires	Tire Inspection - Tags	invoice BIN128930/DENRAY TAKE FROM STOCK (RECAP)- CHANGE OVER 61.9	Natalie Hrechka	1170777	21258

2024-08-09	926	vehicle			windshield replaced - hometown (passenger side)	Jeanelle Hrechka	1171835	21815
2024-08-07	926	vehicle	Oil Change	oil change	Check starting system, falls randomly, no power to dash? Oil change and filters. Check over. Changed out F1 and F2 fuse block from 920, had melted fuse holder. Clean up all fuses and harnesses in compartment. Clean wiring posts in battery compartment and load test batteries. Install fuses and 1 fuse holder for right O/H floor lights. Check wiring at drivers master switch. Change out 2 bushing on top tag axle torque rod and replace 1 broken bolt on rear mount of tag. Replace right tag tire and shock. Replace all 10 wheel studs, nuts and wheel gasket. Check all lights, repair right middle marker light. Labor - 4 hrs/14hrs Parts - 2 oil filters 51971 48L 15/40 oil 2 bushings - 630021 2 bolts and nuts 4 metric bolts 1 shock 85736 4 shock bushings - 630062 1 wheel gasket	Shari Leshchyshyn (Deactivated)	1171835	21814
2024-05-16	926	vehicle			Install hub mounts style wheel hubs on drives removing steel mount style. Labor - 8hrs/7hrs/4hrs Parts - 2 - Seals 47697 1 - Hub Assembly 2 - Rotors SSR-926	Shari Leshchyshyn (Deactivated)	116314	21778
2024-05-15	926	vehicle			Removed wheel hubs from 920 and install both new brake rotor and wheel studs. Install new rotor bolts. Assemble 1 new hub and rotor with new bearing cup and all bolt hardware for drives. Parts 1 hub cap assembly 621617 2 Rotors SSR 926 Labor 6 hrs	Shari Leshchyshyn (Deactivated)	1169161	21778
2024-05-07	926	vehicle			Rotor Complete	Shari Leshchyshyn (Deactivated)	1165237	21715
2024-05-06	926	vehicle			Replace right tag tire - tire off of 920 Labor-1hr	Shari Leshchyshyn (Deactivated)	1165057	21714
2024-05-06	926	vehicle			May 6 2024 Dismount and mount loose commercial tire yard call - 2 tires 315/80r22.5 mount 1 nad set to 110 psi 172.44	Natalie Hrechka		

2024-04-30	926	vehicle	180 day inspection	Mb Safety inspection	1- Front sway bar links loose. 2- Steering "dampener" knuckle loose 3- Was hroom door handle broken 4- Left rear window light out. 5- 2 over head aisle lights out. 6- 1 front right luggage bin light out 7- 4 broken head rest in back. * Greased *checked coolant and oil level *Loosen up both rear side door locks, Parts- 8 bushings 2350908 1 Steering Knuckle CW1 2 14-830/52 Bulbs Labor-8 hrs/4hrs	Shari Leshchyshyn (Deactivated)	1163095	21661
2024-04-19	926	vehicle			Repair headrest on rear right side. tighten up condenser door. Labor-30 mins	Shari Leshchyshyn (Deactivated)	1157667	21576
2024-04-12	926	vehicle			Mounting Commercial Tires at BBL yard by Fountain Tire	Natalie Hrechka	1154738	21521
2024-04-03	926	vehicle			Change out 2 broken wheel studs on right drive, change bushings on right sway bar link on drives. Inner drive valve stem as wrong one rubbed on brake caliper Parts 1 Valve stem 4 bushings 2350908 2 studs	Shari Leshchyshyn (Deactivated)	1152714	21466
2024-03-22	926	vehicle			Medium Truck Change over onto new rim TR 573 tubeless truck stem 57.7	Natalie Hrechka		
2024-03-05	926	vehicle	Oil Change	oil change	Oil change and filters. Check over. Top up coolant. Adjust drag link knuckle. Grease unit. 2 - oil filters 51971 38L 1 5/40 oil 4L Coolant Labor 3 hrs	Jeanette Hrechka	1149642	21389
2024-02-21	926	vehicle	Oil Change	oil change	Oil change and filters. Test batteries/ failed all 4. Install 4 new batteries. 4 - Batteries 51930 2 - Oil filters 1971 38L 15/40 Oil Labor: 4 hrs	Shari Leshchyshyn (Deactivated)	1146878	21328
2024-02-12	926	vehicle			Install new tag tire in right side. Adjust front bumper as to open easier. Shock on tag. Labor: 2hrs 1 - Tire and Rim 1 - shock 85736	Shari Leshchyshyn (Deactivated)	1145123	21299
2024-02-12	926	vehicle			Graham McConnell, Bus 926, tire blow out, call out. 326.29	Shari Leshchyshyn (Deactivated)	1146040	21299
2024-02-10	926	vehicle			6 -w/wl-45/3.78L Oil bought at Coop in Thompson by Graham McConnell	Shari Leshchyshyn (Deactivated)	1145120	21267
2024-01-23	926	vehicle			passenger side steering tire nuts came loose while coming back from Edmonton (Saskatoon) nuts worked their way almost through the rim. Quality Tire was called out, spare was put on to get back to Brandon. Once in Brandon spare tire was removed and placed back in the spare tire compartment. new rim and nuts installed. Denray tire put pre-installed tire onto brand new rim. keep an eye on drivers side Re torque done Jan 23	Jeanette Hrechka	1137841	21137

2024-01-08	926	vehicle	Oil Change	oil change	1- overhead door off luggage compartment. Batteries were dead, needed a boost. 50 load test on batteries. Check keys not working properly. Clean battery post and do oil change and filters. 2 oil filters- 5197 38 L 15/40 oil Labor- 4 hrs	Shari Leshchyshyn (Deactivated)	1131997	21013
------------	-----	---------	------------	------------	--	------------------------------------	---------	-------

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-12-17	926	vehicle			Change out broken center armrest on 3rd right seat. Remove broken footrest. Repair 3rd O/H luggage door on left side. Install new spray nozzle on drivers wiper labor 1 1/2 hrs		Jeanelle Hrechka	1210009	22536
2024-12-09	926	vehicle			Top up coolant 4 L coolant		Jeanelle Hrechka	1209343	22501
2024-11-29	926	vehicle			KM Remove S Bar coolant heater and install wellbasto from 919 complete unit. Run and test. Treat fuel with conditioner. Remove condensor door lock mechanism and repair. Clean out both coach and drivers air filters out. labor 8 hrs/2 hrs no parts needed		Jeanelle Hrechka	1205538	22434
2024-11-29	926	vehicle	Tires, Tires, Tires, 90 day inspection, 180 day inspection	Tire Inspection Required - steers, Tire Inspection - drives, Tire Inspection - Tags, push out window log, Mb Safety inspection	GOV't Safety 1/3 drive shocks leaking oil 2. sway bar links loose on drives 3. gross member in front of drives cracked 4. changed bushing on 3 torque rods on drives 5. drivers wiper blade bent parts 3- shocks 85736 6 bushings 630021 L labor 12 hrs		Jeanelle Hrechka	1205538	22434
2024-11-18	926	vehicle			KM check fluids and lights 1- rear center right clearance light out 3L - 15/40 oil 3L - coolant Put supplies in bin and chains. Move spare tire to rear left side of bin. Labor 2 hrs		Jeanelle Hrechka	1200876	22349
2024-11-13	926	vehicle			alignment - performed by lucky star invoice W1064293		Jeanelle Hrechka	1199372	
2024-11-05	926	vehicle	Tires, Tires, Tires, 180 day inspection, 90 day inspection	Tire Inspection - drives, Tire Inspection - Tags, Mb Safety inspection, push out window log	Gov't Safety Ramp rear of bus, remove drives to cut out cross-member in front of drives. Changed out 3 shocks on drives. Changed bushings on rear sway bar links. Changed all bushings on 3 torque rods. Adjust all air pressure on tires. 6-Bushings 630021 4-bushings 630062 3 shocks 85736 labour 5 hrs. 6 hrs. 7 hrs. 3 hrs		Jeanelle Hrechka	1198444	22296
2024-11-01	926	vehicle			DENRAY INVOICE BIN124402 JAN 22 2024 - TIRE OF MESSED UP RIMGES ON GOOD RIM . TIRE OFF GOOD RIM FOE RECAP ; LOOSE, DAMAGE D RIM RETURN TO SUST.		Natalie Hrechka	1196777	22258
2024-11-01	926	vehicle			DENRAY INVOICE BIN125171 - VSTR 573 - TUBLESS TRUCK STEM ONT O NEW RIM DONE MAR 22 2024	57.7	Natalie Hrechka	1196777	22258

2024-10-16	926	vehicle			lighten up grab handle in step well. old window lights on left side not working. Weld up left railing under heater compartment. Repair 3 light on right hand side. Change out one floor lens. Labor 3 hrs 1 lonso 312501		Jeanelle Hrechka	1191491	22167
2024-10-11	926	vehicle			Change out both front air tanks. Change out bushings on front left sway bar link. Thanks from 920. Weld up front right tow hook. 2 bushings 630062		Jeanelle Hrechka	1180971	22156
2024-09-27	926	vehicle	Oil Change	oil change	754173 Oil Change and filter. Repair. 1 window light a/c lights upper and lower changed out 2 ballasts from 920 and a/c bulbs 2 oil filters 51971 40 L - 1 5/40 oil 1- floor bulb 360024 Labor 4 hrs		Jeanelle Hrechka	1188677	22106
2024-09-23	926	vehicle			Repair rear bumper on left side, driver hooked fence and pulled apart Labor 2 hrs		Jeanelle Hrechka	1187929	22089
2024-09-06	926	vehicle			Check over and install bunk. Change out both front sway bar dog bone bushings. Change out rear right luggage bay light from 920, sensor cracked. Daytime running light on left out, found wire connection on right side corroded. 4 Bushings-2320339 Labor 4 hrs/ 2 hrs		Jeanelle Hrechka	1182228	21983
2024-08-27	926	vehicle	Tires	Tire Inspection Required - steers	INSTALL NEW STEERS ON TO NEW RIMS, TIRES OFF RECAP AS TAFF TIRES, 1 RIMS IS MARKED FOR WARRANTY, PLACE INTO BOX TO BE RETURNED FOR WARRANTY, MOUNT NEW TAG TIRE ONTO OTHER USED RIM		Natalie Hrechka	1179777	21258
2024-08-27	926	vehicle			Install both new steer tires and rims (one rim was cracked and covered under warranty) grease front end and install new brake pads on right steer. 2 X tires - Pelfas SH100 2 x rims (supplied by Denray) 1 pair brake pads 3 hours labor retorque done JH		Jeanelle Hrechka	1180134	0
2024-08-27	926	vehicle	Tires	Tire Inspection Required - steers	Denray installed two new steer tires on two new rims BIN129369 invoice 90.0		Natalie Hrechka	1180134	21939
2024-08-21	926	vehicle	Tires	Tire Inspection - Tags	1 medium truck tire change over, took from stock at Denray invoice BIN128930 61.9		Natalie Hrechka	1178243	21914
2024-08-19	926	vehicle			Install both new rubber connectors on rear right side leveling valve, and check left side		Jeanelle Hrechka	1177806	
2024-08-09	926	vehicle	Tires	Tire Inspection - Tags	invoice BIN128930/ DENRAY TAKE FROM STOCK (RECAP)- CHANGE OVER 61.9		Natalie Hrechka	1170777	21258

2024-08-09	926	vehicle			windsheid replaced - hometown (passenger side)	Jeanelle Hrechka	1171835	21815
2024-08-07	926	vehicle	Oil Change	oil change	Check starting system, fails randomly, no power to dash? ? Oil change and filters. Check over. Changed out F1 and F2 fuse block from 920, had melted fuse holder. Clean up all fuses and harnesses in compartment. Clean wiring posts in battery compartment and load test batteries. Install fuses and 1 fuse holder for right O/H floor lights. Check wiring at drivers master switch. Change out 2 bushing on top tag axle torque rod and replace 1 broken bolt on rear mount of tag. Replace right tag tire and shock. Replace all 10 wheel studs, nuts and wheel gasket. Check all lights, repair right middle marker light. Labor - 4 hrs/14hrs Parts - 2 oil filters 51971 48L 15/40 oil 2 bushings - 630021 2 bolts and nuts 4 metric bolts 1 shock 85736 4 shock bushings - 630062 1 wheel gasket	Shari Leshchyshyn (Deactivated)	1171835	21814
2024-05-16	926	vehicle			Install hub mounts style wheel hubs on drives removing steel mount style. Labor - 8hrs/7hrs/4hrs Parts- 2 - Seals 47697 1 - Hub Assembly 2 - Rotors SSR-926	Shari Leshchyshyn (Deactivated)	116314	21778
2024-05-15	926	vehicle			Removed wheel hubs from 920 and install both new brake rotor and wheel studs. Install new rotor bolts. Assemble 1 new bulb and rotor with new bearing cup and all bolt hardware for drives. Parts 1 hub cap assembly 62161 7 2 Rotors SSR 926 Labor 6 hrs	Shari Leshchyshyn (Deactivated)	1169161	21778
2024-05-07	926	vehicle			Retorque Completed	Shari Leshchyshyn (Deactivated)	1165237	21715
2024-05-06	926	vehicle			Replace right tag tire - tire off of 920 Labor-1hr	Shari Leshchyshyn (Deactivated)	1165057	21714
2024-05-06	926	vehicle			May 6 2024 Dismount and mount loose commercial tire yard call - 2 tires 315/80R22.5 mount 1 nad set to 110 psi 172.44	Natalie Hrechka		

2024-04-30	926	vehicle	180 day inspection	Mb Safety inspection	1- Front sway bar links loose. 2- Steering "dampener" knuckle loose 3- Was hroom door handle broken 4- Left rear window light out. 5- 2 over head aisle lights out. 6- 1 front right luggage bin light out 7- 4 broken head rest in back. * Greased *checked coolant and oil level *Loosen up both rear side door locks. Parts- 8 bushings 2350908 1 Steering Knuckle CW1 2 14-830/52 Bulbs Labor-8 hrs/4hrs	Shari Leshchyshyn (Deactivated)	1163095	21661
2024-04-19	926	vehicle			Repair headrest on rear right side. light en up condenser door. Labor-30 mins	Shari Leshchyshyn (Deactivated)	1157667	21576
2024-04-12	926	vehicle			Mounting Commercial Tires at BBL ya 96.32 rd by Fountain Tire	Natalie Hrechka	1154738	21521
2024-04-03	926	vehicle			Change out 2 broken wheel studs on right drive, change bushings on right sway bar link on drives. Inner drive valve stem as wrong one rubbed on brake caliper Parts 1 Valve stem 4 bushings 2350908 2 studs	Shari Loshchyshyn (Doactivated)	1152714	21466
2024-03-22	926	vehicle			Medium Truck Change over onto new rim TR 573 tubeless 57.7 s truck stem	Natalie Hrechka		
2024-03-05	926	vehicle	Oil Change	oil change	Oil change and filters, Check over. Top up coolant. Adjust drag link knuckle. Grease unit, 2 - oil filters 51971 38L 1 5/40 oil 4L Coolant Labor 3 hrs	Jeanette Hrechka	1149642	21389
2024-02-21	926	vehicle	Oil Change	oil change	Oil change and filters. Test batteries/ failed all 4. Install 4 new batteries. 4 - Batteries 515930 2 - Oil filters 1971 38L 15/40 Oil Labor: 4 hrs	Shari Leshchyshyn (Deactivated)	1146878	21328
2024-02-12	926	vehicle			Install new tag tire in right side. Adjust front bumper as to open easier. Shock on tag. Labor: 2hrs 1 - Tire and Rim 1 - shock 85736	Shari Leshchyshyn (Deactivated)	1145123	21299
2024-02-12	926	vehicle			Graham McConnell, Bus 926, tire blow out, call out. 326.29	Shari Leshchyshyn (Deactivated)	1146040	21299
2024-02-10	926	vehicle			6 -w/w-45/3.78L Oil bought at Coop in Thompson by Graham McConnell	Shari Leshchyshyn (Deactivated)	1145120	21267
2024-01-23	926	vehicle			passenger side steer tire nuts came loose while coming back from Edmonton (Saskatoon) nuts worked their way almost through the rim. Quality Tire was called out, spare was put on to get back to Brandon. Once in Brandon spare tire was removed and placed back in the spare tire compartment. new rim and nuts installed. Denray tire put pre-installed tire onto brand new rim. keep an eye on drivers side Re torque done Jan 23	Jeanette Hrechka	1137841	21137

2024-01-08	926	vehicle	Oil Change	oil change	1- overhead door off luggage compartment. Batteries were dead, needed a boost. 50 load test on batteries. Check keys not working properly. Clean battery post and do oil change and filters. 2 oil filters- 5197 38 L 15/40 oil Labor- 4 hrs	Shari Leshchyshyn (Deactivated)	1131997	21013
------------	-----	---------	------------	------------	--	------------------------------------	---------	-------

926

-2025

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-03-16	926	vehicle	Oil Change	oil change	oil and filter change grease 2 X 51971 filters 38 l 15/40 oil		Jeanelle Hrechka	1228778	23203
2025-02-21	926	vehicle			1222,207 kms 230 29 hrs R+R engine to install rebuilt eng ine head with new gasket set. Install n ew starter. 1. Rema n head 1. head ght set 1. valve cover g asket 1. rocher cov er gasket 6. injector lowr seals 6L cool ant labor 45 hrs		Jeanelle Hrechka	1226380	23121
2025-01-14	926	vehicle			Ken Penner looked at Webasto wiring. Auxiliary pump not turning on with web asto. Could not fix properly. Jumped t o relay to turn pum p on . Will still need a proper Fix		Jeanelle Hrechka	1212941	22612
2025-01-02	926	vehicle			1,210,653 oil chan ge and filters Repai r broken wire at sta rter 38L 15/40 oil 2 - oil filters 51971 la bor 2 hrs (BH)		Jeanelle Hrechka	1210653	22556
2025-01-02	926	vehicle	Oil Chango	oil change	38 l 15/ 40 oil 2 X fil lers 51971 (bh)		Jeanelle Hrechka	1210653	22556

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-05-07	926	vehicle	Tires,Tires	Tire Inspection - Tags, Tire Inspection Required - steers	Fountain tire came and switch tires from 921 to 926 RH steer tire installed on 926 LH tag replaced, inner edge worn tighten first window on drivers side, back bracket loose. 1 X recap tire		Jeanelle Hrechka	1248580	23562
2025-05-01	926	vehicle	Oil Change	oil change	oil and filter change (Jim)		Jeanelle Hrechka	1245907	23518
2025-04-09	926	vehicle			leak of some type of fluid in the drivers area, smells like coolant on heater core. Opened up dash to find windshield fluid being sprayed from capped off hose, disconnected fluid pump.		Jeanelle Hrechka	1234739	23327

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-09-25	926	vehicle			1,271,337km Change 2 x4' bulbs RH window lights Change ballast for RH window lights Change 2x 2' bulbs, RH side 2x360024 bulbs 2x 830/52 bulbs 1x ballast (from 919) MBR 263224 PVT change out relay block door window lights and bypass fuse block for reading lights. Washroom fan not working, clean up fuse holder and relay. Labor: 6 hrs		Susan Agland	1271337	24042
2025-09-22	926	vehicle			change over from stock by Fountain tire (RR)	165.22	Natalie Hrechka		
2025-09-20	926	vehicle			1270,66 km change left tag tire, (fountain) used new recap from shop		Susan Agland	1270402	24017
2025-08-26	926	vehicle			km Pull both steers and right drives to check operation of front brakes. Install both front brake pots and change out front left brake caliper from 919. Do air pressure test on front brakes. Repair air leak in rear right on tag left valve. Install new drivers docking light. Install brake treadle from 920. parts: 2- brake pots K-021997 Type 22 10 light H9406 labor - 16 hrs		Susan Agland	1267314	23946
2025-08-26	926	vehicle			Km Pull both steers and right drives to check operation of front brakes. Install both front brake pots and change out front left brake caliper from 919. Do air pressure test on front brakes. Repair air leak on rear right on tag left valve. Install new drivers docking light. Install brake tread from 920. parts 2-brake pots K-021997 Type 22 Labor 16 hrs 1- light H9406		Jeanelle Hrechka	1257079	23203
2025-07-21	926	vehicle	Oil Change	oil change	change oil and filter grease clean air filter 2 X 51917 filters 38 L 15w40 oil		Jeanelle Hrechka	1260985	23805

2025-07-04

926

vehicle

180 day inspection,  
Tires,90 day inspec  
tion,Tires,Tires

180 day inspection,  
Tires,90 day inspec  
tion,Tires,Tires

Front right Steer tire worn front right brake rotor cracked 2 seats broken frames Right tage tire work inside emergency air valve missing 4 interior lights out drivers defrost fan not working air leak , front left LH tag radius rod bolts loose RH tag wheel seal Pinion seal leak Muffler rotted Steering damper boot LH and RH tag air bag support mounts cracked 1 X michelin mulit tsa recap 1 X Michelin Safety inspection, Tire Inspection - 551890) ! X wheel bearing outer 6101 dow tag, Tire Inspection - Tags, Tire Inspection Required - steers

Jeanette Hrechka 1256576

23728

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-12-16	926	vehicle			Install all four batteries. Replace all tested weak. Repair webasto (only cycles once). Found pin pushed out of connector. 4 batteries MS31-12505 Labor 4 hours.		Jeanelle Hrechka	1284249	24312
2025-11-30	926	vehicle			See attached file	1344.0	Susan Agland	1284248	24311
2025-11-27	926	vehicle			KM Install coolant reservoir but found rear hatch wouldn't close as tank was too deep. Re-installed original tank. Adjust both rear leveling valves after welder, re-installed new cross member change out O/H storage door from 920. 5 hrs labour		Susan Agland	1283744	24300
2025-11-19	926	vehicle	90 day inspection	push out window log	KM Retorque RT L T and front left steer. Remove drive shaft to change differential/ Weld in pre-fabricated cross member Parts - 1-Brg 39581 1- brg 39520 1- brg KJ415647A 1- Brg KJ415610 1- brg 611219 1- brg 611220 1- brg -611221 1- brg 611222 2- seals 46300 2- hub caps 343-4098 1- set brake pads - SS P1203 HD 4-bushings - 630021 1- diff seal - R945010 Labor - 8/8/8/4 hrs		Susan Agland	1282802	24277
2025-11-03	926	vehicle			Check front left steer brake, pulls to right when applying brakes. repair air valve for airing up coach was loose on wall. Install new front left brake rotor, bolts, bags and seal. Also change wheel seal on right tag and brgs and races. Remove cross member in front of drivers and torque rod. Install new brake pads on front left caliper. Repair hole in walking beam left side. Change out 4 bushings on both lower tag axle rods/		Susan Agland	1280618	24231
2025-10-27	926	vehicle			change out drivers side window because fogs up and can't see mirror. Change out 6 aisle light bulbs and 3 ballasts from 919. Change out 4 window light bulbs. 1- side glass labor 4 hrs		Susan Agland	1280165	24222
2025-10-24	926	vehicle			both sets of drive tires replace with new 12R22.5. Michels (Denray) -Denray had to cutoff one stud (RH side) replaced stud and nut with one from 919 Retorque done Oct 25 @ 1,279,376 km		Susan Agland	1279376	24207

2025-10-23	926	vehicle			Mich ZDN@- LRH Takeoff 12 R22.5 Medium Truck cha ngeover 5062 Oct 23, 25 100 PSI 500 FT/LBS Torque Tir es off to be retread ed (XMTSA)	Susan Agland	1278939	24195
2025-10-21	926	vehicle	O.I Change	oil change	1,278,934 kms oil a nd filter change ch ange both fuel filter s 38L x 15W40 oil 2x 51971 oil filters 1x 33118 Fuel Filt er 1x 33120 Fuel Filt er Labour 1 hr	Susan Agland	1278934	24194
2025-10-21	926	vehicle	90 day inspection, Oil Change	push out window lo g,oil change	oil and filter change change fuel filters 3 8 L X 15W40 oil 2 x 51971 oil filter 1 X 33118 fuel filter 1 x 33120 fuel filter	Jeanelle Hrechka	1278934	24194
2025-10-08	926	vehicle			KM Low beams not working or front ma rker lights. W/wash er lowers not worki ng. Lift coach and c heck over unit. Rig ht front drive stone guard cowling loos e and right drive m ud flap loose. To u p diff oil level. Tran sfer over ballasts a nd low beam light b ulbs from old spare set of lights. labor 7 hrs	Susan Agland	1274195	24097

926

2026

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-03-30	926	vehicle	Tires	Tire Inspection - Tags	retorque drives and tags. found right tag tire one wheel stud stripped. replace all wheel studs and nuts on right side. repair v/a change out broken plug socket on battery door. 10 wheel studs 10 wheel nuts 4 coolant		Jeanelle Hrechka	1287702	24468
2026-03-23	926	vehicle			Change over external sensor harness on trans from original trans. take to premier for setting with computer for shifts. (had to clear shift memory to relearn new transmission) install engine and trans from 923. change all coolant hoses. remove diff from 923 and install in 926.		Jeanelle Hrechka	1287167	24454
2026-02-20	926	vehicle	90 day inspection, 180 day inspection, Tires	push out window log, Mb Safety inspection, Tire Inspection - Tags	install new rim on left hand tag. install engine and transmission from 923 replace both front sway bar link bushings. replace both front shocks. replace both tag shocks. replace both rear drive shocks. replace right drive wheel seal. replace pinion seal. replace front right side axle lights. right tag brake seized. left tag hub cap leaking. Both tag lift pins seized and rods bent. Left tag rim wheel nut holes worn. left lower tag shock pin rusted apart, weld in new mounting block. Drivers windshield cracked. both tag lift pots push rods bent. Parts: 2 brake chambers 641425 1 wheel seal 47697 1 bearing W5206LLU?C1 Turbo R23528065 turbo oil pipe 23505038 2 shock pins 85736 4 bushings 630062 1 brake caliper XKN35957P 1" of 3" silicone hose 1" of 2 3/4" silicone hose 1 hub cap 1 stud mount rim install coolant pump from 923 and differential. install new bearing on A/C idler pulley. install engine and transmission from 923 Labour 42 hours		Jeanelle Hrechka	1287079	24448
2026-01-26	926	vehicle			Replace all 4 batteries (removed for 912, Edmonton trip)		Jeanelle Hrechka	1287145	24452
2026-01-12	926	vehicle			repair loose front left window bolts loose. repaired 2 headrests and tighten up window. re-attach duplex plug on wall on rear left side. labour 2.5 hours. install all new rad cap. (3979593)		Jeanelle Hrechka	1286130	24384