



W/O: 6496



WO #: 6496

Customer: 258209 - SMITH, HUGH
 Address: 9508 100 AVE
 GRANDE PRAIRIE, AB
 T8V 0T1

Home Phone:
 Work Phone:
 Author: JINNES
 Location: SQ12/3
 Invoice #: 246213

Stock #:
 Stock Desc: 1999 AG TRIPLE E CANADA
 COMMANDER A3505GS
 Model: A3505GS
 Serial #:
 Chassis #:
 Mileage:
 Key #: 09
 Req'n #: 20197,20175
 License #:
 Trim:

Purchase Date:
 Date In: 07 NOV 24
 Promise Date:
 Promise Time:
 Schedule Date:
 Completed: 19 JUN 25
 Warr. Date:

Job #1 - External

COMPLAINT: ESTIMATE FOR REPAIR. WATER LEAK AT THE AIR CONDITIONER. PLEASE NOTE THAT THE LADDER IS UNFIT TO USE UNDER ANY CIRCUMSTANCES

CAUSE: AIR CONDITIONER SEAL LEAKING, FRIDGE VENT COVER BROKEN, GRAY TANK VENT SEALED OVER, ROOF MEMBRANE DAMAGED ALONG DOOR SIDE

CORRECTION: INSPECTED FOR POSSIBLE LEAKS. FOUND AIR CONDITIONER SEAL WORN, COVER BROKEN, FRIDGE VENT COVER BROKEN, ROOF MEMBRANE DAMAGED ALONG DOOR SIDE, GREY TANK VENT SEALED OVER. WOULD REQUIRE 1 HOUR TO R+R AIR CONDITIONER SEAL. INCOMPLETE

REMOVED MOUNTING BOLTS FOR AIR CONDITIONER. TRIED PULLING UP A/C UNIT. FOUND UNIT TO BE SIKA FLEXED TO ROOF. PULLED UP AND GENTLY CUT SIKA FLEX. REMOVED EXCESS OLD SEAL. INSTALLED NEW SEAL. REINSTALLED AIR CONDITIONER. REINSTALLED MOUNTING BOLTS. COMPLETE

Labor

Code	LaborDesc	Total
Z990	MISC LABOUR CODE (EXTERNAL)WATER LEAK	3,441.50

Parts

Part #	Description	Qty	Price	Total
9045-480	A/C GASKET SEAL KIT HIGH DENSITY	1.00	35.95	35.95

Other Services

Code	Description	Qty	Price	Total
ES	ENVIRONMENTAL SURCHARGE	1.00	8.00	8.00
HF	HANDLING FEE	1.00	6.00	6.00
SS	SHOP SUPPLIES	1.00	412.98	412.98

Subtotal for Job #1: 812.93

Job #2 - External

COMPLAINT: ONE COMPARTMENT DOOR HINGE IS BROKEN PLEASE MATCH THE REST OF THE HINGES

CAUSE: BROKEN HINGE

CORRECTION: MEASURED FOR NEW HINGE. FILLED OUT PARTS CARD FOR REPLACEMENT AS CUSTOMER REQUESTED. 1 HOUR INSTALL. INCOMPLETE

Customer #: 258209
 SMITH, HUGH



CUT HINGE TO SIZE. INSTALLED HINGE. ADJUSTED DOOR TO OPEN AND CLOSE PROPERLY BEFORE SECUREMENT. SECURED HINGE TO DOOR. COMPLETE

Parts				
Part #	Description	Qty	Price	Total
1000770022	BRASS PIANO HINGE 1 2/5 X 72"	1.00	37.88	37.88
Subtotal for Job #2:				296.88

Job #3 - External

COMPLAINT: ESTIMATE FOR REPAIR. MICROWAVE DOES NOT WORK ALSO CHECK OPERATION OF CENTRAL VAC

CAUSE: TRANSFER SWITCH DOES NOT WORK

CORRECTION: CHECKED FOR PROPER POWER. NO POWER GETTING TO PLUGS IN UNIT. CHECKED POWER AT SHORE POWER CORD. SHORE POWER CORD SUPPLYING PROPER POWER TO TRANSFER SWITCH. TRANSFER SWITCH NOT LETTING POWER GO THROUGH. INTERNAL MALFUNCTION. RECOMMEND NEW 30 AMP TRANSFER SWITCH. WOULD REQUIRE 1 1/2 HRS TO R+R. INCOMPLETE

REMOVED AND REPLACED TRANSFER SWITCH. TESTED FOR PROPER FUNCTION. STILL NO POWER TO UNIT. REMOVED BRAKER PANEL TO CHECK FOR PROPER CONNECTION. FOUND SQUIRRELS NEST BEHIND PANEL. REMOVED 90% OF SQUIRRELS NEST. FOUND WIRE CONNECTIONS ARE CONNECTED. CHECKED FOR CONTINUITY THROUGH WIRES. CONTINUITY INTERMITTENT. RAN NEW WIRE FROM TRANSFER SWITCH TO BRAKER PANEL TESTED FOR PROPER FUNCTION. POWER TO UNIT NOW. CHECKED MICRO WAVE. MICROWAVE GEST POWER BUT DOES NOT WORK. NEEDS NEW MICROWAVE. CHECKED FOR PROPER FUNCTION OF VACUUM. DOES NOT FUNCTION PROPERLY. MOST OF THE TUBES EATEN BY SQUIRRELS. UNIT IS POWERED PROPERLY NOW. COMPLETE

Parts				
Part #	Description	Qty	Price	Total
C51111	TRANSFER SWITCH 30 AMP TRC SURGE GUARD #41300	1.00	278.82	278.82

Sublet

Description	Total
WIRE	197.64
LOOM	68.51

Other Services

Code	Description	Qty	Price	Total
FRT	FREIGHT INV# 0711651	1.00	19.68	19.68

Subtotal for Job #3: 1,614.65

Job #4 - External

COMPLAINT: LIGHT ABOVE DINETTE NEEDS TO BE REASSEMBLED. PARTS ARE IN CABINET

CAUSE: LIGHT FIXTURE MISSING PIECES TO REASSEMBLE

CORRECTION: CHECKED CUPBOARD FOR LIGHT FIXTURE PIECES. FOUND PIECES MISSING TO ASSEMBLE LIGHT FIXTURE. RECOMMEND NEW LIGHT FIXTURE. WOULD REQUIRE 3/4 HOUR TO R+R FIXTURE. INCOMPLETE

Parts				
Part #	Description	Qty	Price	Total
20670	LED DOUBLE OPTIC LIGHT BW	1.00	54.95	54.95

Subtotal for Job #4: 229.95

Job #5 - External

COMPLAINT: CHECK OPERATION OF ONBOARD GENERATOR ADVISE IF SERVICE NEEDED



Customer #: 258209
SMITH, HUGH



CAUSE: GENERATOR INSPECTION

CORRECTION: GENERATOR PRIME DOES NOT WORK. TESTED FOR PROPER STARTING FUNCTION. STARTER GRINDS AGAINST FLYWHEEL. GENERATOR NEEDS OVERHAUL OR REPLACEMENT.

Subtotal for Job #5: 0.00

Job #GOLD - External

COMPLAINT: GOLD PACKAGE KEEP WINTERIZED

- FLUSH WATER SYSTEM _____
- PRESSURE TEST WATER SYSTEM FOR LEAKS _____
- LPG LEAK TEST _____
- CHECK ALL APPLIANCES FOR OPERATION _____
- CHECK ALL INTERIOR LIGHTS FOR OPERATION _____
- CHECK ALL EXTERIOR LIGHTS FOR OPERATION _____
- CHECK TIRES FOR WEAR AND PRESSURE _____
- ELECTRONIC BATTERY TEST _____
- CHECK BATTERY FLUID LEVELS AND CONNECTIONS _____
- CHECK AWNING OPERATION _____
- VISUAL CHECK OF EXTERIOR AND ROOF SEALANTS _____
- CHECK AND LUBRICATE STEP IF NEEDED _____

Battery(s)

_____ VOLTAGE _____ CCA

_____ VOLTAGE _____ CCA

Tires

_____ WEAR % _____ PSI

CAUSE: GOLD PACKAGE INSPECTION

CORRECTION: PERFORMED INSPECTION ON UNIT. PERFORMED TESTS THAT COULD BE PERFORMED AS SOME CHECKS COULD NOT BE PERFORMED AS PARTS DO NOT FUNCTION. WOULD NEED TO PERFORM REPAIRS TO FINISH CHECKLIST. INSPECTION COMPLETE

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	39.60	39.60
HF	HANDLING FEE	1.00	6.00	6.00
ES	ENVIRONMENTAL SURCHARGE	1.00	8.00	8.00

Subtotal for Job #GOLD: 383.60

Job #6 - External

COMPLAINT: CHECK AND ADVISE OPERATION OF LEVELING SYSTEM

CAUSE: LEVELLING SYSTEM NEEDS MULTIPLE PARTS REPLACED

CORRECTION: CHECKED FOR PROPER VOLTAGES AT ALL CONNECTIONS. ALL CONNECTIONS GETTING PROPER VOLTAGE. FOUND BROKEN CIRCUIT BOARD. CONNECTED CIRCUIT TO TEST SYSTEM FOR PROPER FUNCTION. FOUND SYSTEM WILL NOT FUNCTION. NEEDS MULTIPLE PARTS REPLACED. I.E. CONTROLS, CIRCUIT BOARD. ETC.

Subtotal for Job #6: 0.00

Job #7 - External

COMPLAINT: OFF DOOR SIDE WINDOW AWNING DAMAGED

CAUSE: DAMAGED/CROOKED AWNING

CORRECTION: STRAIGHTENED AWNING BEST AS POSSIBLE WITHOUT REPLACING. COMPLETE

W/O: 6496



Customer #: 258209
SMITH, HUGH



Job #8 - External

COMPLAINT: KITCHEN VENT BROKEN

CAUSE: BROKEN FRIDGE VENT

CORRECTION: FILLED OUT PARTS CARD FOR REPLACEMENT. INCOMPLETE

REMOVED BROKEN FRIDGE VENT. CLEANED OFF ROOF SURFACE. INSTALLED NEW VENT WITH NEW SEALANT. INSTALLED NEW COVER FOR NEW VENT. COMPLETE

Parts				
Part #	Description	Qty	Price	Total
3311236.000	KIT, REF ROOF VENT, POLAR WHT	1.00	89.44	89.44

Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT INV#4550901453	1.00	21.90	21.90

Subtotal for Job #8: 128.84

Job #9 - External

COMPLAINT: MOST INTERIOR LIGHTS NOT WORKING

CAUSE: MULTIPLE FIXTURES NOT FUNCTIONING/BROKEN, NO POWER TO BATHROOM FIXTURES

CORRECTION: FILLED OUT PARTS CARD FOR REPLACEMENT PARTS. REMOVED BROKEN LIGHTS, INSTALLED NEW LIGHTS. TESTED FOR PROPER FUNCTION. FOUND BATHROOM LIGHTS DO NOT HAVE POWER. WOULD REQUIRE 4 HRS TO DIAG.

PULLED DOWN LIGHTS CHECKED FOR POWER. NO POWER TO LIGHTS. TRACED CICUIT THROUGH UNIT. FOUND CIRCUIT IS BRANCHED MULTIPLE TIMES. FOUND THERE IS DEAD SHORT IN BATHROOM FAN. DISCONNECTED FAN WIRES. CHECKED FOR PROPER FUNCTION OF LIGHTS. BATHROOM LIGHTS FUNCTION PROPERLY NOW. REASSEMBLED ALL FIXTURES. COMPLETE

Parts				
Part #	Description	Qty	Price	Total
20670	LED DOUBLE OPTIC LIGHT BW	4.00	72.76	291.04

Subtotal for Job #9: 326.04

Job #10 - External

COMPLAINT: THERMOSTAT WILL NOT SWITCH TO FURNACE

CAUSE: THERMOSTAT WILL NOT FUNCTION PROPERLY, WIRING DOES NOT COMMUNICATE PROPERLY, WIRES CUT OFF WITH INTERRUPTED CIRCUIT

CORRECTION: FILLED OUT PARTS CARD FOR REPLACEMENT. REMOVED AND INSTALLED NEW THERMOSTAT AND TESTED FOR PROPER FUNCTION. NEW THERMOSTAT DOES NOT FUNCTION FURNACE PROPERLY. FOUND WIRES CUT OFF AND NOT COMMUNICATING. FOUND BEDROOM THERMOSTAT REMOVED AND WIRES CUT OFF. WOULD NEED TO DIAGNOSE WIRING. WOULD REQUIRE 6 HRS TO PERFORM.

TESTED COMMUNICATION CABLES, NO COMMUNICATION TO REAR A/C, TESTED SYSTEM WITH NEW THERMOSTAT, GOT FRONT A/C AND FURNACE TO FUNCTION PROPERLY, RE-WIRED REAR A/C, TESTED FOR PROPER FUNCTION, REAR A/C WILL NOT NOT OPERATE, REMOVED COVER, CYCLED DIP SWITCHES ON CIRCUIT BOARD, TESTED FOR PROPER FUNCTION, REAR A/C AND FURNACE WILL NOT OPERATE. RECOMMEND NEW THERMOSTAT TO HAVE FRONT FUNCTION PROPERLY, NEW COMMUNICATION CABLE FOR REAR UNIT, OUTSIDE TEMP SENSOR, INSIDE TEMP SENSOR, AND TEST. MIGHT NEED NEW CIRCUIT BOARD FOR REAR UNIT. WOULD REQUIRE ADDITIONAL 4 HRS TO PERFORM TASKS. INCOMPLETE



Customer #: 258209 SMITH, HUGH



Parts				
Part #	Description	Qty	Price	Total
1096-16	DOMETIC THERMOSTAT	1.00	244.80	244.80
9V	9 VOLT BATTERY	1.00	6.00	6.00

Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT INV# 0729201	1.00	17.52	17.52

Subtotal for Job #10: 1,318.32

Job #11 - External

COMPLAINT: VANITY FAUCET LEAKS

CAUSE: BROKEN FAUCET CARTRIDGE

CORRECTION: FILLED OUT PARTS CARD FOR REPLACEMENT.
REMOVED AND REPLACED FAUCET. COMPLETE

Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT INV# 0735751	1.00	17.25	17.25

Subtotal for Job #11: 104.75

Customer Work Order

Parts Total: 1,038.88
 Labour Total: 3,441.50
 Sublet Total: 266.15
 Extras Total: 556.93
 Tax Total: 265.23
WORK ORDER TOTAL: 5,568.69

Date Vehicle dropped off: _____
 Date of appointment: _____
 Completion date: _____
 Notified of Completion: Time _____ Date _____
 Date Released: _____

I/We the undersigned acknowledge the forgoing as factual and I/we hereby acknowledge receipt of completed copy.

Signature of owner: _____

GST Reg No: R882936669

#####

#####

#####

Customer Signature : _____

Date: 19 Jun 2025



Customer #: 258209
SMITH, HUGH

