Unit Information

Unit: 441913 Year: 2019

Manufacturer: International

Model: LT625 6x4

VIN: 3HSDZAPR6KN130187 Build Date: 10/26/2018

GVWR: 52350 lbs Wheelbase: 236.0"

Engine: Cummins X15 6 Cylinder 15L Diesel 450hp @ 1800rpm / 1650lb-ft @ 1000rpm

Transmission: Eaton Fuller FRO-16210C - 10-Speed Manual

Gear Ratio: 325

5th Wheel: Holland FW35A824XL00 with 24" Air slide, Left Hand Release

Front Wheels: Aluminum - 295/75R22.5

Front Brakes: 22.5" Meritor EX+L Air Disc Brakes

Front Axie: Meritor MFS-12-143A - Wide Track, I-Beam Type, 12,350-lb Capacity

Rear Wheels: Steel - 295/75R22.5

Rear Brakes: 22.5" Meritor EX+L Air Disc Brakes

Rear Axle: Meritor MT-40-14X-3CFR - Single Reduction, 40,000-ib Capacity

Fuel Capacity: 240 US Gal (909L) Dual Tanks - 140 US Gal (530L) Left, 100 US Gal (379L) Right

Features:

Air Ride Cab, 73" in Hi-Rise Sleeper Cab, Bunk Beds, Bunk Heater, Air Ride Suspension

Repair History

Jul 15, 2025 - Replaced Aft NOx Sensor

Jul 03, 2025 - Replaced Hanger Bearing Assembly

Jun 13, 2025 - Replaced Starter

Mar 06, 2025 - Replaced Windshield

Feb 21, 2025 - Replace All Tires

Sep 19, 2024 – Replaced Radiator

Apr 11, 2024 - All Wheel Alignment

Nov 22, 2023 - Replace Turbo Actuator

Oct 02, 2023 - Replace Inlet NOx Sensor





Truck & Equipment Service inc. 29 Commercial Court Napanee, Ontario K7R 4A2

PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





invoice: 01R66044

Date / Hour: 7/15/2025 10:26:17AM

Repair Order: 66044 Customer: 02344

Branch: 1

Total invoice: \$1,956.05

Charge

Page 1 of 2

Bill To:



Ship To:

Fax:

Work

Customer P/O:

Add User: MIKEC

Unit Number: 441913

Type: HWY

Model Year: 2019

VIN: 3HSDZAPR6KN130187

Open Date: 07/09/2025

Completion Date: 07/15/2025

Salesperson: TRACEY

Make/Model: INTERNATIONAL LT825 6x4

Meter: 1152144 Kilometers

Tank:

SCAN PERFORM DIAGNOSTIC SCAN.

Compleint: PERFORM DIAGNOSTIC SCAN.

Diagnostic Scan

Department: Service

CEL ON.

Correction: DIAGNOSE.

NOx IN Sensor Fault

0-8PN3216-10 (supplier fault: 3725)

NOx IN Sensor Circuit Fault

0-SPN3216-4 (supplier fault: 1885)

Supp.

Task:

Part

Description / Ref Number

U/M Task 1 Subtotale Quantity

Parts:

Extended Price \$0.00

Labor Tesk 1 Subtotals \$114.00 \$114.00

AFT 01

Aftertreatment - Diagnose

Department: Service

Price

Complaint: DIAGNOSE,

NOx IN Sensor Fault

0-SPN3216-10 (supplier fault: 3725)

NOx IN Sensor Circuit Fault

0-SPN3216-4 (supplier fault: 1885)

Correction: CONNECTED EST AND VERIFIED FAULT CODES

BEGAN CUMMINS TROUBLESHOOTING GUIDE AND FOUND THE ECM CALIBRATION REVISION MUST BE UPDATED

PERFORMED ECM CALIBRATION UPDATE AND VERIFIED.

FOUND THE NATURE OF THE PRESENT FAULT CODES INDICATE AN INTERNAL CIRCUIT FAULT WITHIN THE INLET NOX SENSOR

P&A SUMBMITTED.

Supp. Part Description / Ref Number Extended Quantity U/M Price Price Task 2 Subtotals Parts: \$0.00 Labor \$228.00 Task 2 Subtotals \$228.00

^{**} See Last Page for Invoice Total **





Truck & Equipment Service inc. 29 Commercial Court Napanee, Ontario K7R 4A2

PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





invoice: 01R86044

Date / Hour: 7/15/2025 10:28:17AM

Repair Order: 66044 Customer: 02344 Branch: 1

Total Invoice: \$1,956.05

 
Charge

Page 2 of 2

Bill To:



Ship To:



Work:

Customer P/O:

Task:

Add User: MIKEC

3

Open Date: 07/09/2025

Completion Date: 07/15/2025

\$1,956,05

Department: Service

Salesperson: TRACEY

Aftertreatment - Repair/Renew Correction; REPLACED THE AFT INLET NOX SENSOR

ROAD TESTED AND VERIFIED FAULT CODES DID NOT RETURN, AND NOX SENSOR READINGS WITHIN SPECIFICATION AT

OPERATING TEMPERATURE.

AFT 02

Supp.	Part	Description / Rat Number			Our-th.		Extended
	4326670RXCUM-C	NITROGEN OXIDE SENSOR -Core	U/M	Quantity	Price	Price	
	4326870RXCUM	_	EA	-1.0	\$269.47	\$(289.47)	
		NITROGEN OXIDE SENSOR	EA	1.0			
	4326870RXCUM-C	NITROGEN OXIDE SENSOR -Core	F.4		\$1,217.45	\$1,217.45	
			EA	1.0	\$269.47	\$289.47	
		Tinek 3 8	Task 3 Subtotals	Parts:		\$1,217.45	
				Core Chg:			
				Core Ret:		\$289.47	
						(\$289,47)	
			Labor:		\$142.50		
				Teak 3 Subtotals		\$1,359.95	

Customer Tax ID:

126028372RT0001

GST/HST Number: 870325958

Defail Tax Info:

HST

\$225.03 Total: \$225.03

Total Parta: \$1,217,45 **Total Core Charge:** \$269.47 **Total Core Ret:** \$(269.47) Total Labor: \$484,50 **Total Shop Supply:** \$29.07 Invoice Subtotal: \$1,731.02 **Total Tax:** \$225.03

Total Involce:

Payment Method ***Charge***

Terme **NET 30 DAYS**

Due Date 8/15/2025





Truck & Equipment Service Inc. 29 Commercial Court Napanee, Ontario K7R 4A2

PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





Invoice: 01R65920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344

Branch: 1 Total Invoice: \$4,740.46

Charge

Page 1 of 6

Bill To:



Ship To: /
E
E
C
S
N
E
n
ri
Fex: 6

Work
Customer P/O:

Add User: MIKEC

Unit Number: 441913

Type: HWY

Model Year: 2019

VIN: 3HSDZAPR6KN130187

Open Date: 08/23/2025

Completion Date: 07/03/2025

Salesperson: TRACEY

Make/Model: INTERNATIONAL LT625 8x4

Meter: 1154534 Kilometers

48K: 1 PMB AWCLARI PMB A.W.CLARK
Compleint: PERFORM A.W. CLARK B SERVICE

10W30 OIL

OIL SAMPLE REQUIRED

Correction: PERFORMED A.W CLARK B SERVICE

Department: Service

Supp.	Part	Description / Ref Number	1104	Quantity	D.	Extended
	10W30BULK FL EP2 FF6826NN FLT FS20040 LF14000NN LF OSB	Description / Ref Number 10W30 BULK FLUIDS GREASE TUBE FUEL FILTER SPIN- ON FILTERS FILTER,PAC, FS FILTER LUBE OIL FILTERS >8" KENDALL OIL SAMPLE BOTTLES	L EA EA EA	40.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0	\$6.28 \$10.00 \$8.85 \$138.68 \$1.20 \$101.74 \$104.48 \$1.20	\$251,20 \$10.00 \$8.65 \$138.68 \$1,20 \$101,74 \$104,48 \$1,20
	WWG33W501	CHROME HEX DOME VALVE CAP	EA Taek 1 Subtotals	1.0	\$5.58 \$1.15	\$5.56 \$1.15
fask;				EHC: Labor: Task 1 Subtotals		\$811.46 12.40 \$285.00 \$908.86

zsk: 2 Brakes 11 Air Leak - Repair/Renew

Complaint: CUSTOMER STATES PRIMARY AIR TANK DRAINS IN APPROX 2 HRS WHEN PARKED.

Department: Service





Truck & Equipment Service Inc. 29 Commercial Court Napanee, Ontario K7R 4A2

PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





Invoice: 01R85920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344

Branch: 1 Total Invoice: \$4,740.46

Charge

Page 2 of 6

BIH To:



Ship To:

Work

Customer P/O:

Add User: MIKEC

Open Date: 08/23/2025

Completion Date: 07/03/2025

Salesperson: TRACEY

Correction: SOAPED UNIT DOWN FOR SMALL AIR LEAKS.

FOUND TANK DRAINS BUBBLING.

FOUND SOLENOIDS LEAKING ON FRAME RAIL.

REMOVED AND REPLACED SOLENOID VALVE.

AIRED UP.

BLEW ORINGS OUT.

WONT SEAL PROPERLY.

LATCH ON TOP OF OLD SOLENOID NEXT TO NEW ONE IS WORN THAT IT IS ALLOWING ORING TO SPLIT.

NEED ANOTHER SOLENOID VALVE TO REPAIR LEAK.

REMOVED SOLENOID BLOCK

REPLACED AFFECTED SOLENOID.

INSTALLED SOLENOID BLOCK.

CHECKED FOR LEAKS.

TWO FITTINGS STILL LEAKED OUT OF THE CONNECTING PORTION SO I REPLACED THEM

NO LEAKS FOUND.

RE SEALED UP TANKS.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended
	2024440C1	Fitting, Air Brake, Elbow, Pue	EA	2.0		Price
	2506712C91	KIT	EA		\$27.91	\$55.82
	2506712C91	KIT	EA	1,0	\$123.28	\$123.28
	3564247C1	Valve Assy, Double Check, Brak		1.0	\$123.28	\$123.28
	6131601C1		EA	1.0	\$57.90	\$57.90
	010100101	ELBOW, 90 DEG M22 X 5/8 PTC	EA	2.0	\$30.97	\$61.94
			Task 2 Subtotals	Parts:		\$422.22
				Labor;		\$552.90
				Teak 2 Subtotals		\$975.12

Task

Misc 02

Miscellaneous - Repair/Renew

Department: Service

Complaint RENEW WIPERS.

RENEW D/S MUDFLAP HANGER

Correction: INSTALLED NEW WIPERS.

STRAIGHTENED HANGER

Supp. Extended Part Description / Ref Number Quantity U/M Price Price





29 Commercial Court Napanee, Ontario K7R 4A2



PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





Invoice: 01R65920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344

Branch: 1

Total Invoice: \$4,740.46

Charge

Page 3 of 6

BIII To:



Ship To:

Task 3 Subtotals



Work:

Customer P/O:

Add User: MIKEC

FLTS24

SUMMER 24IN WIPER BLADE

Open Date: 06/23/2025

Completion Date: 07/03/2025

Salesperson: TRACEY

EA

Parts:

\$7.05 \$14,10 \$14.1D

Labor: Task 3 Subtotals

\$28.50 \$42.60

Task: Wheels 02 Wheels, Tires - Repair/Renew

Department: Service

Complaint: L2 INNER VALVE STEM MISSING

TOP UP STEER TIRES

Correction: INSTALLED VALVE STEM CAP

TOP UP STEERS TO 120 TO EVEN OUT TIRE PSIS

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
			Task 4 Subtotala	Parts:		\$0.00
				Labor:		\$0.00
				Teek 4 Subtotale		\$0.00

Task: Lighting 02

Lighting - Repair/Renew

Department: Service

Complaint: L/8 & R/S HEADLIGHT MARKERS OUT

Correction: PULLED LIGHTS OUT AND FOUND P/S ONE WAS MISSING AND SOCKET WAS ROTTED

D/S ONE WAS EPOXIED INTO HEAD LIGHT ASSEBLY

LOOK UP SOCKET FOR P/S AND TOOK THE EPOXY OUT OF THE D/S ONE AND REPLACED BULB.

PULLED LOWER MIRROR OFF TO FIND ISSUE WITH MIRROR SIGNAL NOT WORKING FOUND THAT PIG TAIL WAS ROTTED IN

MULTIPLE SPOTS

PULLED CONECTOR OUT OF LIGHT AND IT BROKE THE LIGHT

INSTALLED NEW LIGHT SOCKET FOR HEADLIGHT MARKER AND GOT NEW LIGHTS FOR BOTH SIDES

WENT TO INSTALL NEW MIRROR AND HAD TO CHANGE THE CONECTOR END

INSTALLED NEW CONNECTOR AND INSTALLED

TESTED AND WORKS PROPERLY

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	2514727C3	MIRROR, KIT, CONVEX GLASS, LEFT	EA	1.0	\$268.24	\$268.24
	2522843C91	SOCKET, BULB	EA	1.0	\$114.46	\$114.46
	6215	#194 MINI BULB	EA	2.0	\$2.07	\$4.14
	TXT126870266	PIGTAIL WIRE	EA	2.0	\$9.03	\$18.06
	TXT126870262	CONN. DEF RETURN	EA	1.0	\$55.90	\$66.90
		Te	isk 5 Subtotals	Parts: Labor:		\$460.80 \$199.50





29 Commercial Court Napanee, Ontario K7R 4A2



PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958



Invoice: 01R65920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344 Branch: 1

Total invoice: \$4,740.46

Charge Page 4 of 6

BIII To:

Ship To:

Work:

Customer P/O:

Add User: MIKEC

Open Date: 08/23/2025

Completion Date: 07/03/2025

Department: Service

Salesperson: TRACEY

Teak 5 Subtotals

\$860.30

Task: Suspension02 Suspension System - Repair/Renew

Complaint: R1 SHOCK LOOSE AND LEAKING

HANGER BEARING WORN OUT

D/S CAB MOUNT BUSHING WORN OUT

Correction: REMOVED DRIVE SHAFT FROM UNIT AND REPLACED HANGER BEARING ON BENCH

REINSTALLED SHAFT AND UJOINTS

REPLACED R1 SHOCK

BOLTS WERE SEIZED TO SLEEVES SO I HAD TO GUT THEM OFF

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	4050443C2	ABSORBER, SHOCK,	EA	1.0	\$134.34	\$134.34
	782258	3/4" X 5-1/2" BOLT	EA	1.0	\$7.16	\$7.16
	PER26200	THREADLOCKER - RED	EA	1.0	\$7.88	\$7.88
	SPI10094142	BEARING ASSY	EA	1.0	\$130.71	\$130.71
			Task 6 Subtotels	Parts:		\$280.09
				Labor:		\$399.00
				Tesk 6 Subtotals		\$879.09

Brakes 11 Air Leak - Repair/Renew

Complaint: AIR LEAK AT D/S FIRE WALL. Correction: SEARCHED FOR FIRE WALL LEAK. FOUND FAN VALVE WAS LEAKING

Supp.	Part	Description / Ref Number U/M	Quantity	Extended Price Price
		Tack 7 Subtota	ls Parts:	\$0.00
			Labor:	\$57,00
			Task 7 Subtotals	\$57.00

Engine Asy02 Engine Assembly - Repair/Renew

Complete: RENEW ENGINE FAN ŞOLENOID

Correction: PULLED VALVE OFF

INSTALLED FAN VALVE NO MORE LEAKS

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	2313929000	FITTING	EA	1.0	\$15. 58	\$15.56
	3611896C1	VALVE SOLENOID	EA	1.0	\$216.69	\$216.69

Department: Service

Department: Service





29 Commercial Court Napaneo, Ontario K7R 4A2







Invoice: 01R65920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344 Branch: 1

Total invoice: \$4,740.46

Charge

Page 5 of 6

Task: 9

SCAN

Diagnostic Scan

\$403.25

Department: Service

Task 8 Subtotels

PERFORM DIAGNOSTIC SCAN.

Compleint: PERFORM DIAGNOSTIC SCAN, CEL, DEF READS EMPTY.

Correction: SCANNED UNIT USING CUMMINS INSITE.

RETRIEVED FOLLOWING FAULTS-

2771- AFTERTREATMENT 1 OUTLET NOX SENSOR- ABNORMAL UPDATE RATE

4151- AFTERTREATMENT DIESEL PARTICULATE FILTER TEMPERATURE SENSOR MODULE- ABNORMAL UPDATE RATE.

6668- AFTERTREATMENT 1 PARTICULATE SENSOR- ABNORMAL UPDATE RATE.
3232- AFTERTREATMENT 1 INTAKE NOX SENSOR- ABNORMAL UPDATE RATE.

3888- AFTERTREATMENT 1 DIESEL EXHAUST FLUID QUALITY- ABNORMAL UPDATE RATE.
4877- AFTERTREATMENT 1 DIESEL EXHAUST FLUID TANK LEVEL- ABNORMAL UPDATE RATE.

4572- AFTERTREATMENT 1 DIESEL EXHAUST FLUID TANK TEMPERATURE- ABNORMAL UPDATE RATE.

DEF LEVEL LOW FAULT WAS ON DASH.

NEED DIAGNOSE TASK TO CONTINUE.

Supp. Part Description / Ref Number U/M Quantity Price Price
Tank 9 Subtotals Parts: \$0.00
Labor: \$114.00
Task 9 Subtotals \$114.00

Task: 10 AFT 01

Aftertreatment - Diagnose

Department: Service

Compleint: DIAGNOSE.

2771- AFTERTREATMENT 1 OUTLET NOX SENSOR- ABNORMAL UPDATE RATE.

4151- AFTERTREATMENT DIESEL PARTICULATE FILTER TEMPERATURE SENSOR MODULE- ABNORMAL UPDATE RATE.

6688- AFTERTREATMENT 1 PARTICULATE SENSOR- ABNORMAL UPDATE RATE.

3232- AFTERTREATMENT 1 INTAKE NOX SENSOR- ABNORMAL UPDATE RATE.

3888- AFTERTREATMENT 1 DIESEL EXHAUST FLUID QUALITY- ABNORMAL UPDATE RATE.
4877- AFTERTREATMENT 1 DIESEL EXHAUST FLUID TANK LEVEL- ABNORMAL UPDATE RATE.

4572- AFTERTREATMENT 1 DIESEL EXHAUST FLUID TANK TEMPERATURE- ABNORMAL UPDATE RATE.





29 Commercial Court Napanee, Ontario K7R 4A2







Invoice: 01R65920

Date / Hour: 7/15/2025 1:53:58PM

Repair Order: 65920 Customer: 02344


Branch: 1

Total Invoice: \$4,740.46

Charge

Page 6 of 6

Completion Date: 07/03/2025

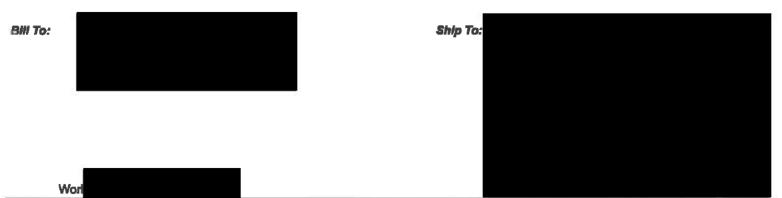

⊆ustomer P/O:

Add User: M!KEC

Correction: TOPPED UP DEF TANK

ALL FAULT CODES RETRIEVED POINT TOWARDS LOSS OF POWER.

CHECKED AFTERTREATMENT PDM. FOUND AFT RELAY MISSING FROM UNIT.

REPLACED RELAY. VERIFIED REPAIR.

PARKED UNIT OUT FRONT.

COMPLETE.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	DEF	DEF FLUID	JG	2.0	\$14.72	\$29.44
	YNPRAA1241	RELAY	EA	1.0	\$28.25	\$28.25
			Tack 10 Subtotals	Parts:		\$57.69
				Labor:		\$96.90
				Task 10 Subtotals		\$154.59

Customer Tax ID: 126028372RT0001

GST/HST Number: 870325958

Detail Tax Info:

HST

\$545.38 \$545.36 Total:

Total Labor: Total FREIGHT:

Open Date: 06/23/2025

Salesperson: TRACEY

\$2,078.61 \$12.40 \$1,903.80 \$86.07

Total Shop Supply:

\$114.22

Invoice Subtotal: **Total Tax:**

\$4,195,10

Total Invoice:

Total Parts:

Total EHC:

\$545.36 \$4,740.46

Payment Method

<u>Terme</u> **NET 30 DAYS**

Due Date





in plat Court Napunisa, Onterla K7F 4A2

PH: (813) 354-71MS (BARZ) FAX: (813) 354-1700 18T#870325958





Involce: 01R83570

Date / Hour: 9/26/2024 12:51:45PM

Repair Order: 63570 Customer: 02344

Branch: 1

Total involce: \$3,749.35


Charge

Page 1 of 2

BIH To:



Ship To:

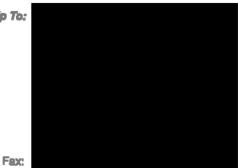

Department: Service

Completion Date: 09/24/2024

Work:

Customer P/O:

Add User: MIKEC

Unit Number: 441913

Type: HWY

Open Date: 09/19/2024

Salesperson: TRACEY

Make/Model: INTERNATIONAL LT625 6x4

Meter: 1028454 Kilometers

Tank: Cooling 02 **Cooling System - Repair/Renew**

Compleint: COOLANT LEAK (UPPER RAD HOSE)

Correction: INSPECTED UNIT. PRESSURE TESTED COOLING SYSTEM TO 15PSI AND COULD NOT FIND LEAK, PRESSURE TESTED SYSTEM TO 17PSI AND FOUND LEAK WAS COMING FROM CRIMP AT THE TOP OF THE RAD UNDER THE UPPER RAD HOSE REMOVED HOOD SHOCK, DRAINED COOLANT AND REMOVED ALL HOSES FROM RAD.

VIN: 3HSDZAPR6KN130187

Model Year: 2019

REMOVED CONDENSOR AND INNER COOLER SET, REMOVED TRANSMISSION COOLER LINES WHICH WERE SEIZED. REMOVED ALL INTAKE PIPING, LOWER RAD MOUNTS, AND RESERVOIR. REMOVED FAN SHROUD, RAD, AND RAD CRADDLE. INSTALLED NEW RAD INTO CRADDLE, REMOVED BRASS FITTINGS FROM OLD TO NEW RAD. FASTENED RAD IN PLACE AND TRANSFERRED FAN SHROUD, SECURED WITH NEW BOLTS AS NEEDED, INSTALLED LOWER MOUNTS AND TIGHTENED, INSTALLED SUPPORT RODS AND INTAKE PIPING, HOOD CLOSURE SEALAND HOOD SHOCK FILLED COOLING SYSTEM AND VERIFIED REPAIRS.

Ѕирр.	Part	Description / Ref Number		Quantity	Price	Extended
	1674058C1	CONSTANT TORQUE CLAMP	U/M EA	1.0	\$45.85	945.85
	1889435C91	CLAMP AIR CLEANER TUBE OR PIPE	EA	1.0	\$50.95	\$50.85
	992410	4.18" T-BOLT CLAMP	EA	2.0	\$18.79	
	AKM8994A	RADIATOR	EA	1.0	\$1,430.00	\$37.88
	TB3508S	CLAMP	EA	1.0	\$16.50	\$1,430.00 \$16.50
		Task 1 Sub	totale	Parte:		1,580.88
		Lebor:		\$1,028.00		
				Tesk 1 Subtotels	\$	2,808.88

Task: Trans 02 Transmission - Repair/Renew

Complaint: RENEW TRANSMISSON COOLER LINE

COTTOCHON: INSTALLED NEW TRANSMISSION COOLER LINES, TOPPED UP TRANSMISSION FLUID WITH 4 LITRES OF 50W, RAN UNIT AND

VERIFIED OPERATION AND REPAIRS.

Эирр.	Part M10UVL3100	Description / Ref Number	U/M	Quantity	Price	Extended
		HOSE , ASSY,XMSN OIL COLLER	EA	1.0	\$133.67	\$133.67
	M10VVL4108	HOSE, ASSEMBLY, TRANSMISSION O		1.0	\$143.84	\$143.84
		Tank 2 Subto	tnis	Parta:	\$277.51	
				Labor:		\$351.00
				Teak 2 Subtotals		\$628,51

Customer Tax ID:

126028372RT0001

GST/HST Number: 870325958

Department: Service

2729261 OnLine

100-2437 Princess Street P.O. Box 29 818-532-3344 Kingston ON K7M 3G1 kingston@unigleseplus.com G8T/H8T Registration No.: 758832935

INVOICE

BILL TO					INVOICE DATE TERMS DUE DATE	28372 08/03/2025 Net 30 05/04/2025	
DATE	ACTIVITY	DESCRIPTION	mig 5 La	TAX	QTY	RATE	AMOUNT'
	Front Glass	Supply and Install glass, includes gla sealants, adhesive moldings, 2019 int LT6ZF, Right CRE 3HSDZAPR6KN13 441913.	ss, labour, s, primers, amational 3982. VIN#	HSTON	1	768.90	768.90
			SUBTOTAL				768.90
			HST (ON) @ 13	%			99.96
			TOTAL				868.86
TAX SUMMARY			BALANCE DUE				\$868.86
		RATE		T/	AX		NET
		HST (ON) @ 13%		99.	96		768.90



INVOICE NO. PAGE DATE 02/22/25 9850830787 1 /1 SEPTER TO INVOICE MOMES OF ALL COMMENTS OF DESCRIPTIONS

KOH1G-001323914 BILL TO

CHRONIN	TOTAL	SOUNCE SEC	LOG	SHIPD DATE
0001323914	N/A-DT	136481	0097	02/21/25

SHIP TO

PO/8C/3D # VER/FLEET/TRLS/UNITS LIC # # STATE

681079 441913 CHB982 VENDOR NUMBER R 118 941 806

PURCHASE CODER # SIGNED BY THE STREET

681079 613-354-0292

REMECH TIRE HS1-0001213875-9675 HELLEVILLE, ON NOW 485 613-966-7798

RER#36893

QUARTITY	PROPERTY CONT	G.S.T.	Parts Price	PRICE	DISCOURT RHY - AMT	net face amount	MEST SPICORE
12	046329000 EMERG ROAD SVC CALL-REG	5.04 ERS/PER 1/4 ER		38.75	01	38.75	465.00
1	047529000 SHOP SUPPLIES	1.11	8.50		01	8.50	0.50
30	046249000 MILEAGE CHARGE PER EM	0.31		2.35	01	2.35	70.50
1	040200000 D/CALL TO CAT YARD						0.00
1	040200000 INSTALLED CUST SPARES C	M STEERS					0.00
1	040200000 REPLACED LF/LRO/LRI RFI	O/BRIO DRIV					0,00
1	040200000 CUST STOCK						0.00

CUSTOMER PST EXEMPT, LICENSE 43261655 13.000 % G.S.T / H.S.T 01 -

70.73

INVOICE TERMS:

DUE DATE 29 MAR 10, 2025 MET MAR 31, 2025 AMOUNT DUE 614.73 614.73

9850830787

TAX 70.73

70.73

544.00

10.88

DISCOUNTABLE CASE DISC ANT HET AMOUNT DUE

603.85

REMIT TO:

GOODYEAR CAMADA INC MET. NO. 01323914 DO BOK 1981 POSTAL STATION A TORCHTO, CHTÁRIO M5W 1W9 G.S.T./T.P.S. 4 R 118 941 806 MERCHANDISE TOTAL G.S.T. / H.S.T.

544.00

TOTAL AMOUNT

70.73 614.73

7001508191

LD874P1



Payment Method

Charge

Terma

NET 30 DAYS



Truck & Equipment Service Inc. 29 Commercial Court Napanee, Ontario K7R 4A2

PH: (613) 354-TIMS (8467) FAX: (613) 354-1700 HST#870325958





Invoice: 01R85861

Date / Hour: 6/16/2025 12:07:04PM

Repair Order: 65861 Customer: 02344 Branch: 1

Total Invoice: \$1,161.49

Charge

Page 1 of 1

BIII To: Ship To: Work Fax: Customer P/O: Open Date: 08/13/2025 Completion Date: 06/13/2025 Add User: MIKEC Salesperson: TRACEY Unit Number: 441913 Model Year: 2019 Make/Model: INTERNATIONAL LT625 6x4 Type: HWY VIN: 3HSDZAPR6KN130187 Meter: 1150087 Kilometers Starting 02 Starting System - Repeir/Renew Department: Service **Complaint: RENEW STARTER** Correction: RE/RE STARTER TESTED WORKING AS IT SHOULD Extended Quantity Price Supp. Part Description / Ref Number UM Price 39MT STARTER DEC8200308 1.0 FA \$725.77 \$725.77 Customer Tex ID: 126028372RT0001 **GST/HST Number: 870325958** Detail Tax Info: **Total Parts:** \$725.77 H\$T \$133.62 **Total Labor:** \$285.00 \$133.62 Total: **Total Shop Supply:** \$17.10 Invoice Subtotal: \$1.027.87 **Total Tax:** \$133,62 **Total Invoice:** \$1.161.49

<u>Due Date</u> 7/17/2026





213 Concession Street Kingston ON K7K 296 Tel.:(813)548-7444 Fax:(813)548-4679

Sold to

INVOICE

Ship to

NC. Ship via Cust, order no. Reference no. Apr 11 2024 3845537 1556284 6133540282 Serial no. Year Km Plate no /Unit Make Model CJJ249/441913 3HSDZAPR6KN130187 0957427 LT 2019 NTERNATIONAL P.S.T. # G.S.T. # MAISON/HOUSE/SCOTT SHANNO Net 30 days 500.00 2 250,00 2 MEDIUM TRUCK ALIGNMENT VWASTMT 15.95 15.95 1 SHOP SUPPLY(LUBRICANTS, CLEANING DISCS 1 \$8 ETC.) 15 95 Labour . Perts : mer agrees to pay an annual compounded interest of 25.8% or 2% per month on the balance of all past due involces. Your wheel ruts have been torqued to the proper specifications: It is the customer responsibility to have the torque level re-checked and the rute re-lightened after the first 50 to 160 elemeters (50 to 100 miles).
This procedure must also be applied when the outside temperature is vary low (finzen conditions). Charge on account=583.02 515.95 67.07 H.S.T.: 104794110RT0001 Please print in block letters
THE WARRANTY ON A CAR REPAIR IS FOR 3 MONTHS Customer signature
ALL PARTS WRITTEN HEREBY ARE NEW .00 OR 5,000 KILOMETERS WHICH EVER OCCURS FIRE UNLESS INDICATED BY "U" ROF USED, "R" FOR REBUILT OR "RN" FOR RECONDITIONED. 583.02 Total (CAD)

MCS Mechanical

Reg. Repair Shop# 870865136R

INVOICE

85262

CUSTOMER

REMOVE FROM TURBO

PERFORM ALL INSTALL PROCEDURES AND CALIBRATIONS

BILL TO

5

VEHICLE


2018 INTERNATIONAL 441913

Plate#: CJJ249 885718 Miles 3HSDZAPR6KN130187

Involce D	ate Customer ID	Sales Category	Invoice #	Service Writer	P	rimary Tec	hnician	Terms
11/22/20	23 AWC7987571589	Main	65262					
Qty	Product ID		Parts Descrip	tton		Taxes	Unit Price	Ext. Price
1	5501185-HO	ACTUATOR			Ø	13.00%	\$2,312.50	\$2,312.5
1		FREIGHT				13.00%	\$70.00	\$70.0
1	QP1224W	PATCH QUICK	CBOND		Ø	13.00%	\$50.12	\$50.1
28	93831612	RIVETS				13.00%	\$0.35	\$9.8
1	124	EXTENDED LI	FE COOLANT R	ED		13.00%	\$19.77	\$19.7

Labor Descri	lption	Hours	Taxes	Price
PULLED UNIT INTO SHOP FOR ENGINE LIGHT				
INTERMITTENT AND TRIANGLE WITH WRENCH		_		
HOOKED UP LAPTOP TO CHECK FOR CODES			13.00%	\$78.00
GOT ACTIVE CODE FRO TURBOCHARGER ACTI	JATOR			
ABNORMAL UPDATE RATE				
PERFORMED ALL TROUBLE SHOOTING FOR CO				
THEN ACCESS VGT AND UNPLUG TO INSPECT				
AND TEST POWER AND GROUND AND CONNEC	TIONS OK			
REINSTALL PLUG				
ACCESS FOURTEEN PIN CROSS OVER CONNEC				
AFT AND CLEAN DIRT FROM PLUG AND INSPEC				
RESECURE BACK INTO PLACE, THEN TRACE H	ARNESS			
TO ENGINE COMPARTMENT ALL OKAY	N=D	25 🖸	120004	\$197.50
FOUND NEEDS NEW ACTUATOR PART ON ORD		2.5 19	13.00%	\$187.QL
THEN CLEANED RIGHT HAND LOWER FUEL TAI	VIK			
FAIRING	OLI INITO			
THEN CUT PATCH TO SIZE AND SECURED PATC	SHINIU	2 🖸	13.00%	\$158.0
PLACE WITH RIVETS		* E	10.00%	\$ 100.00
NOVEMBER 23RD PULLED UNIT BACK INTO SHOP THEN DRAINED	COOL ANT			
AND REMOVED ALL NECESSARY PARTS TO AC				
THEN CUT BOLTS FROM VGT AND USED HEAT				
INEM COL BOLIS LYON AGI WWD 0950 HEVI	10			

Total Parts	Total Labor	Shop Materials	Sub Total	Tax	Total
\$2,462.19	\$650.75	\$70.04	\$3,182.98	\$413.80	\$3,596.78

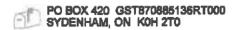

MCS Mechanical

Phone 613-389-9484 Fax 613-389-8918

Reg. Repair Shop# 870865136R

INVOICE

65262

CUSTOMER

BILL TO

VEHICLE


2018 INTERNATIONAL 441913 Plate#: CJJ249 885718 Miles 3HSDZAPR6KN130187

Invoice Date	Customer ID	Sales Category	Invoice #	Service Writer	Primary Technician	Terms
11/22/2023	AWC7987571589	Main	65262			


THEN INSTALL VGT AND REFILL WITH COOLANT AND TOP UP THEN REINSTALL ALL OTHER REMOVED PARTS AND RAN UNIT TO VERIFY REPAIR AND TO BURP **COOLANT SYSTEM**

2.75 🗷 13.00% \$217.25

Total Parts	Total Labor	Shop Materials	Sub Total	Tax	Total
\$2,462.19	\$650.75	\$70.04	\$3,182.98	\$413.80	\$3,596.78

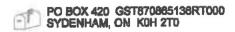

MCS Mechanical

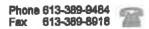

Reg. Repair Shop# 870865136R INVOICE

64896

CUSTOMER

BILL TO

VEHICLE

2018 INTERNATIONAL 441913

Plate#: CJJ249 858438 Miles 3HSDZAPR6KN130187

Invoice t	Date	Customer ID	Sales Category	invoice #	Service Writer	Primary Tec	chnician	Terms
10/2/20	023	AWC7987571589	Main	64896				
Qty		Product ID		Partis Descrip	tion	Taxes	Unit Price	Ext. Price
1	43	26870RX	INLET NOX S	ENSOR		13.00%	\$1,049.84	\$1,049.8

Labor Description	Houre	Taxes	Price
PULLED UNIT INTO SHOP TO CHECK FOR ENGINE			
LIGHT ON			
HOOKED UP LAPTOP TO CHECK FOR CODES		13.00%	\$78.00
GOT ACTIVE CODE FOR AFTERTREATMENT SCR CONVERSION			
EFFICIENCY EXISTS			
PERFORM ALL TROUBLESHOOTING STEPS FOR CODE			
THEN RAN A SCR EFFICIENCY TEST AND RAN A INTAKE			
AND OUTLET NOX SENSOR TESTS			

FOUND INTKE NOX SENSOR FAILED ON BAD READING

OUTLET WAS OKAY

DISCONNECT AN REMOVE ALL NECESSARY PARTS TO ACCESS

WORK SENSOR OUT OF PIPE

FOUND THREADS IN ROUGH SHAPE , USE TAP TO CLEAN UP

THREADS THEN INSTALL NEW NOX SENSOR AND RESECURE

INTO PLACE

REHOOK UP AND REINSTALL ALL REMOVED PARTS

THEN USED LAPTOP TO CLEAR CODES

RAN UNIT TO VERIFY REPAIR ALL OKAY

3.5 2 13.00% \$276.50

Total Parts	Total Labor	Shop Materials	Sub Total	Tax	Total	
\$1,049.84	\$354.50	\$31.60	\$1,435.94	\$186.88	\$1,622.62	