PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	1 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

JBLOW JD ALL Internal
COMPLAINT:
03 BLOW OFF COMBINE AND CLEAN HOPPER >

CORRECTION:
Sunday, June 14, 2026 3:51 PM - Time correction:
• 4.0 hours were spent blowing off and cleaning the combine.

Labor: $460.00 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $460.00

EXPERT-1000000321701 Internal
COMPLAINT:
05 X9-Series Combine ValueMax Inspection
COMPLAINT
X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION
VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

*
HEADER SERIAL # _____

ENGINE HOURS _____876_____

SEPARATOR HOURS _____570_____

DOES THIS UNIT GET A VALUEMAX STICKER _x_ YES __ NO

HAS THE STICKER BEEN INSTALLED _x_ YES __ NO

THIS UNIT HAS HAD THE CAB CLEANED _____mm_____(INITIAL)

THIS UNIT HAS HAD A FINAL CHECKOVER _____mm_____(INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB ___mm_____(INITIAL)
*
THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]4
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	2 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000321701 Internal

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	3 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000321701 Internal
ValueMax Job Task
Serial Number, Check
Safety Shields, Remove
Initial Running, Check
Engine Hours, Check
Separator Hours, Check
Machine Frame, Check
Engine RPM, Check
Multi-Function Control Lever, Check
Back-Up Alarm, Check
Transmission Speed Ranges, Check
AutoTrac System, Check
Park Brake, Check
Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
Feeder House Safety Lock Functionality, Check
Feeder House Dust Fan Functionality, Check
Header Hydraulic Function, Check
Grain Tank Cover Folding Functionality, Check
Unloading Auger and Boot Swing Functionality, Check
Unloading Auger Engage, Check
Separator Engage Switch, Check
Header Engage Switch, Check
Header Reverser Engage Switch, Check
Multi-Function Control Lever Quick Stop, Check
Threshing Clearance Adjustment, Check
Rotor Speed Adjustment, Check
Cleaning Fan Speed Adjustment, Check
Chaffer and Sieve Setting Adjustment, Check
Residue Functionality, Check
Chopper Speed Adjustment Function, Check
Chopper High and Low Operation, Check
Knife Bank Actuation Functionality, Check
Stored Diagnostic Trouble Codes, Check [Need diagnostic stored codes]
Active Diagnostic Trouble Codes, Check
Software Update, Check [Need update software]
MTG/Remote Connection to Service Advisor, Check
PIP's Available
Fluid Scan Test, Perform
Feeder House Frame, Check
Feeder House Position Sensor and Wiring Harness, Check
Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace slip clutch(have play), upper

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	4 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace slip clutch(have play), upper guide and lower guide]
Feeder House Conveyor Chain and Eyebolts, Check [The conveyor chain needs to be replaced. The chain links and rollers are worn.]
Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Four lower plastic guides need to be replaced.]
Lateral Tilt Frame Seal, Check
Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
Lateral Tilt Cylinders, Check
Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
Feederhouse Top Door and Seal
Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace top shaft sprocket
The shaft is also worn at the bearing seating surfaces.]
Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
Feeder House Backshaft and Bearing, Check
Feeder House Front Drum and Bearings, Check
Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
Feeder House Feed Plate, Check
Stone Trap, Check [The stone trap door needs to be aligned.]
Feeder House Floor Sheet and Seal, Check
Fore-Aft Tilt Cylinders, Check
Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
Rotor Plastic Dust Shroud, Check
Separator Feed Floor and Ramp, Check
Rotor Bearings, Check
Rotor Front Feed Flights, Check
Feeder House Lift Cylinder Support, Pins, and Pivots, Check [All four pins need to be replaced as they are worn.]
Feeder House Smart Lock, Check
Feeder House Valve Block, Check
Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check [Need recondition reverse motor]
Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check [Need fixed harness connector
Need replace two quick coupler socket]
Header Locking Pins and Latching Mechanisms, Check [Need install three shears bolts]
Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check
Feeder House Drive Belt and Tensioners, Check
Main Hydraulic Outer Pump Stack, Check
Feeder House Pivots, Retainer and Bushing, Check
Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
Feed Accelerator Speed Sensor and Wiring Harness, Check
Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
Feed Accelerator Shaft and Bearings, Check
Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace belt]
Transmission Speed Ranges, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	5 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Transmission Speed Ranges, Check
Tracks or Tires, Check
Front Drive Shaft Splines and Collars, Check
Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
Front Hydrostatic Motors, Check
Front Final Drive, Check
Front-End Hydraulic Manifold, Check
ACI Valve Block, Check
Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace belt and idler pulley (have noise) And need install three shear bolts]
Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
Grain Tank Cross Auger Bearings, Check
Cross Auger Engage Cylinder, Check
Cross Auger Speed Sensor and Harness, Check
Vertical Unloading Auger Gearcase, Check
Vertical Unloading Auger and Housing, Check
Unloading Auger Sump Clean Out, Check
Cleaning Fan Housings and Fan Blades, Check
Left Side Cleaning Fan Shaft, and Bearings, Check
Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check [Need replace driven belt]
Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
Cleaning Fan Variable Drive Hydraulic Hose, Check
Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
Threshing and Separating Plastic Covers Left Side, Check
Left Side Concave Position Sensor and Wiring Harness, Check
Left Side Concave, Check [Need adjustment]
Left Side Concave Hangers and Hardware, Check
Left Side Concave Fillers, Check
Left Side Concave Z-Bar, Check
Left Side Concave Isolation Hoses and Fittings, Check
Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
Front End Variable Driven Assembly and Belt, Check
Front End Drive Assembly, Pulleys, and Belt, Check
Left Side Separator Grates, Check
Left Side Separator Loss Sensors, Check
Left Side Threshing Elements, Check [Need replace first set]
Left Side Separator Tines, Check
Left Side Rotor Rear Discharge Flights, Check
Left Side Pitman Arms, Swing Arms, and Bearings, Check [Check the sieve timing adjustment. When rotated, the sieve assembly contacts the combine frame. The lever bushings appear to be in good condition.]
Left Side Shake Pan Frame, Swing Arms and Bushings, Check
Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
Tailings Elevator Housing, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	6 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Tailings Elevator Housing, Check
Tailings Monitor Sensor and Wiring Harness, Check
Lower Tailings Auger, Auger Trough, and Lower Bearings, Check
Tailings Elevator Conveyor Chain and Sprockets, Check [Need adjust elevator chain]
Tailings Elevator Slip Clutch, Check [Need replace slip clutch (have play)]
Upper Tailings Return Auger Bearings, Check
Upper Tailings Return Auger Flighting, Check
Upper Tailings Delivery Auger Housing, Check
Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
Active Tailings Camera, Check [Clean the camera lens and verify proper operation.]
Active Tailings Wear Strips and Threshing Bars, Check
Active Tailings Concave Adjustment, Check
Active Tailings Drive Belt, Tensioner, and Pulley, Check
Service Lights, Check
Rotor Variable Sheaves and Belt, Check
Rotor Driven Assembly and Hoses, Check
Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
Chaffer and Sieve Element Electrical Adjust, Check
Chopper Raise and Lower Actuator, Check [Need fixed harness]
Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check [Need replace belt]
Left Side Discharge Beater Bearing, Check
Rotor Grain Loss Sensor and Wiring Harness, Check [The loss sensors #4 and #5 need to be replaced. They do not respond to the tap test. The test was repeated several times with the same result.]
Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check [Need replace seal]
HADE, POD Controllers and Harnesses, Check
Chopper Belt, Tensioner, and Idlers, Check [Need replace belt]
Chopper Drive Pulleys, Check
Chopper Gearcase, Oil Level, and Lube Line, Check [When switching between operating modes, the chopper gearbox fails to lock into position and disengages unexpectedly.]
Chaffer and Sieve, Check
Tailboard, Check
Return Pan, Check
Rear Deflector, Check
Discharge Beater Grate and Vanes

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	7 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000321701 Internal
, Check
Discharge Beater Wear Strips, Check
Chopper Inlet Seals, Check
Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
Straw Chopper Drive Belt, Check
Chopper Housing and Bearings, Check
Chopper Stationary Knife, Actuator, and Wiring Harness, Check
Chopper Blades, Check [Need replace all blades]
Tailboard Center Shroud, Check
Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
Spreader Speed Sensor and Harness, Check
Shroud Actuator and Harness, Check [Need diagnostic codes HAD 517804.06
517847.07
]
Tailboard Shaft Bearings, Check
Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
Spreader Drive Belt, Idlers, and Pulleys, Check [Need replace belt]
Right Hand Residue Harness, Check
Windrow Pivot Actuator and Harness, Check
Left Hand Rear Wheel and Tire, Check
Left Hand Steering Cylinder and Hoses, Check
Left Hand Steering Tie Rod, Check
Left Hand Axle Spindle and Bushing Assembly, Check
Tow Hook, Check
Rear Axle Hardware, Check
Rear Axle Pivot Bushing, Check
Four Wheel Drive Motors and Seals, Check
Right Hand Rear Wheel and Tire, Check
Right Hand Steering Cylinder and Hoses, Check
Right Hand Steering Tie Rod, Check
Right Hand Spindle and Bushing Assembly, Check
AutoTrac System, Check
Wheel Angle Sensor and Wiring Harness, Check
Ether Start Aid, Check
Vacuum Fan Housing, Check
AutoTrac Valve, Fittings, and Hoses, Check
Right Side Discharge Beater Bearing, Check
Machine Fuse Center, Check
Batteries, Cables, and Connections, Check
Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
Shoe Drive Belt, Idler, Tensioner, and Bearings, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	8 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
Right Side Separator Loss Sensors, Check
Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
Right Side Pitman Arms, Swing Arms, and Bearings, Check
Clean Grain Elevator Housing and Boot, Check
Clean Grain Auger, Auger Trough, and Lower Bearings, Check
Clean Grain Elevator Chain and Sprockets, Check [Need adjust elevator]
Moisture Sensor, and Active Clean Grain Camera, Check
Threshing and Separating Covers, Check
Right Side Separator Grates, Check
Right Side Concave Z-Bar, Check
Right Side Concave Hangers and Hardware, Check
Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
Right Side Concave Isolation Hoses and Fittings, Check
Right Side Concave, Check
Right Side Concave Fillers, Check
Right Side Separator Tines, Check
Right Side Threshing Elements, Check
Right Side Rotor Rear Discharge Flights, Check
Right Side Concave Position Sensor and Wiring Harness, Check
Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
Right Side Shake Pan Frame, Swing Arms and Bushings, Check
Heater Hoses, Check
Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
Right Side Grain Tank Cross Auger Bearings, Check
Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check
IPM Controller and Harness, Check
Cab Wall Electrical Connectors, Check
Air Compressor Tank Drain, Check
Feed Accelerator Gear Case and Drives, Check
Right Hand Grain Tank Drain Covers, Check
Engine RPM, Check
Back-Up Alarm, Check
Engine Deck Access Ladder and Light, Check [The ladder lock is not working.]
Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check
Rotary Screen Driveshaft Belt and Bearings, Check
Rotary Screen, Check
Fuel, Oil Cooler, A/C Condenser & Fins, Check
Cooling Package Door Seal, Check
Radiator Hoses, Lines, and Surge Tank, Check
Engine Coolant Level, Check [Need add coolant]
Water Pump, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	9 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Water Pump, Check
Thermostats, Check
Diesel Exhaust Fluid Tank, Check
Fuel Tank, Cap, Sensor and Lines, Check
Hydraulic Reservoir, Check
ECU Connections and Seals, Check
Main Engine Gear Case and Valve, Check
Main Engine Gear Case Hydraulic Hoses, Check
Main Hydraulic Inner Pump Stack, Check
Hydraulic Valve Stack and Accumulator, Check
Exhaust and DPF Exhaust System, Check
Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
Engine Front Seals and Crankshaft Damper, Check
Air Conditioning Compressor and Alternator Drive Belt, Check
Air Compressor Pump and Drive Belt, Check
Accessory Drive Mounting Hardware, Check
Engine Rear Seals, Check
Rotor Speed Sensor and Wiring Harness, Check
Rocker Arm Cover, Check
Exhaust Manifold, Check
Turbocharger, Check
Aftertreatment Harness Module and Sensor, Check
EGR Valve and Actuator, Check
Open Crankcase Vent (OCV) System, Check
Rotor Gear Case, Check
Rotor Driveshaft and U-Joints, Check
Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
Grain Tank Level Switches and Wiring Harness, Check
Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace auger and bearing]
Grain Tank Loading Auger Actuator and Harness, Check
Clean Grain Elevator Mass Flow Sensor Impact Plate, Check [Need replace wear plate HXE17251-1pc]
Grain Sample Trough, Check
Grain Tank Cross Augers, Troughs, and Covers, Check
Active Yield Sensors and Wiring Harnesses, Check
Grain Tank Camera and Light, Check
Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
Unloading Auger Latching Mechanism and Pin, Check
Primary Valve Block, Check
Folding Auger Drive Cog, Check
Unloading Auger Swing Bushing, and Pivot Point, Check
Unloading Auger Cradle, Pins and Hardware, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	10 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Unloading Auger Cradle, Pins and Hardware, Check
Unloading Horizontal Auger and Tube, Check
Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
Unloading Auger Lights, Camera, and Harness, Check
Unloading Auger Grain Saver Door and Boot, Check
Unloading Auger Boot Actuator and Harness, Check
Horizontal Auger 90* Gearcase, Check
Cab Ladder, Check
Mirrors, Check
Cab Door Cinch, Check
Windshield and Cab Glass, Check
Cab Roof, Check
GPS Receiver, Check
Gen 4 Command Center Display and Software, Check
AMS Software and Hardware, Check
Seat Operation and Seat Belt, Check
Park Brake Operation, Check
Steering Column, Check
Armrest Functions, Check
Multi-Function Control Lever Neutral Safety Switch, Check
Wiper and Washer Operation, Check
Horn, Check
Air Conditioning System Operation, Check
Heater Operation, Check
Refrigerator, Check
Cab Radio, Check
Cab Warning Alarm, Check
Corner Post and Armrest Display, Check
Active Header Control Displayed on Corner Post, Check
Auxiliary Power Strip, Check
Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
Safety Decals and Signs, Check
Ladder Safety Chains, Check
Road Disconnect Switch, Check
Rotary Beacon, Field, Transport, and Warning Lights, Check
copy of Operator Seat Presence Switch, Check
Fire Extinguisher, Check
Operators Manual
Camera System, Check
Toolbox, Check
Static Drag Chain/Cable, Check
Remote Front Grease Lines, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	11 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Remote Front Grease Lines, Check
Air Conditioning Drain Hoses, Check
Feed Accelerator Gear Case Oil, Check
Fuel Precleaner Filter, Check
Engine Air Filters, Check
Engine Oil and Filter, Check
Diesel Exhaust Fluid (DEF) System
Fuel Filters, Check
Fuel Tank Breathers, Check
Suction Screen, Check
Hydrostatic and Hydraulic Filters, Check
Final Drives Oil Level, Check
Transmission Filters (ProDrive XL), Check
Main Engine Gear Case Oil, Check
Cab Fresh Air Filter, Check
Cab Recirculation Filter, Check
Grain Tank Loading Auger Gear Case Oil, Check [The gearbox is overfilled with oil. Drain off the excess oil and adjust the level to the proper specification.]
Wiper Fluid Level, Check & Top Up
Final Running, Check
Safety Shields, Install
Water from Air Compressor Reservoir, Drain
Additional Jobs Required
ValueMax Job Task
Serial Number, Check
Safety Shields, Remove
Initial Running, Check
Engine Hours, Check
Separator Hours, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	12 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000321701 Internal
Machine Frame, Check
Engine RPM, Check
Multi-Function Control Lever, Check
Back-Up Alarm, Check
Transmission Speed Ranges, Check
AutoTrac System, Check
Park Brake, Check
Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
Feeder House Safety Lock Functionality, Check
Feeder House Dust Fan Functionality, Check
Header Hydraulic Function, Check
Grain Tank Cover Folding Functionality, Check
Unloading Auger and Boot Swing Functionality, Check
Unloading Auger Engage, Check
Separator Engage Switch, Check
Header Engage Switch, Check
Header Reverser Engage Switch, Check
Multi-Function Control Lever Quick Stop, Check
Threshing Clearance Adjustment, Check
Rotor Speed Adjustment, Check
Cleaning Fan Speed Adjustment, Check
Chaffer and Sieve Setting Adjustment, Check
Residue Functionality, Check
Chopper Speed Adjustment Function, Check
Chopper High and Low Operation, Check
Knife Bank Actuation Functionality, Check
Stored Diagnostic Trouble Codes, Check [Need diagnostic stored codes]
Active Diagnostic Trouble Codes, Check
Software Update, Check [Need update software]
MTG/Remote Connection to Service Advisor, Check
PIP's Available
Fluid Scan Test, Perform
Feeder House Frame, Check
Feeder House Position Sensor and Wiring Harness, Check
Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace slip clutch(have play), upper guide and lower guide]
Feeder House Conveyor Chain and Eyebolts, Check [The conveyor chain needs to be replaced. The chain links and rollers are worn.]
Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Four lower plastic guides need to be replaced.]
Lateral Tilt Frame Seal, Check
Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	13 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Feeder House Dust Pan, Motor, Hoses, and Harnesses, Check
Lateral Tilt Cylinders, Check
Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
Feederhouse Top Door and Seal
Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace top shaft sprocket
The shaft is also worn at the bearing seating surfaces.]
Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
Feeder House Backshaft and Bearing, Check
Feeder House Front Drum and Bearings, Check
Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
Feeder House Feed Plate, Check
Stone Trap, Check [The stone trap door needs to be aligned.]
Feeder House Floor Sheet and Seal, Check
Fore-Aft Tilt Cylinders, Check
Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
Rotor Plastic Dust Shroud, Check
Separator Feed Floor and Ramp, Check
Rotor Bearings, Check
Rotor Front Feed Flights, Check
Feeder House Lift Cylinder Support, Pins, and Pivots, Check [All four pins need to be replaced as they are worn.]
Feeder House Smart Lock, Check
Feeder House Valve Block, Check
Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check [Need recondition reverse motor]
Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check [Need fixed harness connector
Need replace two quick coupler socket]
Header Locking Pins and Latching Mechanisms, Check [Need install three shears bolts]
Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check
Feeder House Drive Belt and Tensioners, Check
Main Hydraulic Outer Pump Stack, Check
Feeder House Pivots, Retainer and Bushing, Check
Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
Feed Accelerator Speed Sensor and Wiring Harness, Check
Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
Feed Accelerator Shaft and Bearings, Check
Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace belt]
Transmission Speed Ranges, Check
Tracks or Tires, Check
Front Drive Shaft Splines and Collars, Check
Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
Front Hydrostatic Motors, Check
Front Final Drive, Check
Front-End Hydraulic Manifold, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	14 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Front-End Hydraulic Manifold, Check
ACI Valve Block, Check
Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace belt and idler pulley (have noise) And need install three shear bolts]
Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
Grain Tank Cross Auger Bearings, Check
Cross Auger Engage Cylinder, Check
Cross Auger Speed Sensor and Harness, Check
Vertical Unloading Auger Gearcase, Check
Vertical Unloading Auger and Housing, Check
Unloading Auger Sump Clean Out, Check
Cleaning Fan Housings and Fan Blades, Check
Left Side Cleaning Fan Shaft, and Bearings, Check
Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check [Need replace driven belt]
Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
Cleaning Fan Variable Drive Hydraulic Hose, Check
Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
Threshing and Separating Plastic Covers Left Side, Check
Left Side Concave Position Sensor and Wiring Harness, Check
Left Side Concave, Check [Need adjustment]
Left Side Concave Hangers and Hardware, Check
Left Side Concave Fillers, Check
Left Side Concave Z-Bar, Check
Left Side Concave Isolation Hoses and Fittings, Check
Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
Front End Variable Driven Assembly and Belt, Check
Front End Drive Assembly, Pulleys, and Belt, Check
Left Side Separator Grates, Check
Left Side Separator Loss Sensors, Check
Left Side Threshing Elements, Check [Need replace first set]
Left Side Separator Tines, Check
Left Side Rotor Rear Discharge Flights, Check
Left Side Pitman Arms, Swing Arms, and Bearings, Check [Check the sieve timing adjustment. When rotated, the sieve assembly contacts the combine frame. The lever bushings appear to be in good condition.]
Left Side Shake Pan Frame, Swing Arms and Bushings, Check
Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
Tailings Elevator Housing, Check
Tailings Monitor Sensor and Wiring Harness, Check
Lower Tailings Auger, Auger Trough, and Lower Bearings, Check
Tailings Elevator Conveyor Chain and Sprockets, Check [Need adjust elevator chain]
Tailings Elevator Slip Clutch, Check [Need replace slip clutch (have play)]
Upper Tailings Return Auger Bearings, Check
Upper Tailings Return Auger Flighting, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	15 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Upper Tailings Return Auger Flighting, Check
Upper Tailings Delivery Auger Housing, Check
Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
Active Tailings Camera, Check [Clean the camera lens and verify proper operation.]
Active Tailings Wear Strips and Threshing Bars, Check
Active Tailings Concave Adjustment, Check
Active Tailings Drive Belt, Tensioner, and Pulley, Check
Service Lights, Check
Rotor Variable Sheaves and Belt, Check
Rotor Driven Assembly and Hoses, Check
Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
Chaffer and Sieve Element Electrical Adjust, Check
Chopper Raise and Lower Actuator, Check [Need fixed harness]
Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check [Need replace belt]
Left Side Discharge Beater Bearing, Check
Rotor Grain Loss Sensor and Wiring Harness, Check [The loss sensors #4 and #5 need to be replaced. They do not respond to the tap test. The test was repeated several times with the same result.]
Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check [Need replace seal]
HADE, POD Controllers and Harnesses, Check
Chopper Belt, Tensioner, and Idlers, Check [Need replace belt]
Chopper Drive Pulleys, Check
Chopper Gearcase, Oil Level, and Lube Line, Check [When switching between operating modes, the chopper gearbox fails to lock into position and disengages unexpectedly.]
Chaffer and Sieve, Check
Tailboard, Check
Return Pan, Check
Rear Deflector, Check
Discharge Beater Grate and Vanes, Check
Discharge Beater Wear Strips, Check
Chopper Inlet Seals, Check
Straw Chopper Drive Belt Tensioner and Idler Pulley, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	16 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000321701 Internal
Straw Chopper Drive Belt, Check
Chopper Housing and Bearings, Check
Chopper Stationary Knife, Actuator, and Wiring Harness, Check
Chopper Blades, Check [Need replace all blades]
Tailboard Center Shroud, Check
Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
Spreader Speed Sensor and Harness, Check
Shroud Actuator and Harness, Check [Need diagnostic codes HAD 517804.06
517847.07
]
Tailboard Shaft Bearings, Check
Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
Spreader Drive Belt, Idlers, and Pulleys, Check [Need replace belt]
Right Hand Residue Harness, Check
Windrow Pivot Actuator and Harness, Check
Left Hand Rear Wheel and Tire, Check
Left Hand Steering Cylinder and Hoses, Check
Left Hand Steering Tie Rod, Check
Left Hand Axle Spindle and Bushing Assembly, Check
Tow Hook, Check
Rear Axle Hardware, Check
Rear Axle Pivot Bushing, Check
Four Wheel Drive Motors and Seals, Check
Right Hand Rear Wheel and Tire, Check
Right Hand Steering Cylinder and Hoses, Check
Right Hand Steering Tie Rod, Check
Right Hand Spindle and Bushing Assembly, Check
AutoTrac System, Check
Wheel Angle Sensor and Wiring Harness, Check
Ether Start Aid, Check
Vacuum Fan Housing, Check
AutoTrac Valve, Fittings, and Hoses, Check
Right Side Discharge Beater Bearing, Check
Machine Fuse Center, Check
Batteries, Cables, and Connections, Check
Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
Right Side Separator Loss Sensors, Check
Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
Right Side Pitman Arms, Swing Arms, and Bearings, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	17 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Right Side Pitman Arms, Swing Arms, and Bearings, Check
Clean Grain Elevator Housing and Boot, Check
Clean Grain Auger, Auger Trough, and Lower Bearings, Check
Clean Grain Elevator Chain and Sprockets, Check [Need adjust elevator]
Moisture Sensor, and Active Clean Grain Camera, Check
Threshing and Separating Covers, Check
Right Side Separator Grates, Check
Right Side Concave Z-Bar, Check
Right Side Concave Hangers and Hardware, Check
Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
Right Side Concave Isolation Hoses and Fittings, Check
Right Side Concave, Check
Right Side Concave Fillers, Check
Right Side Separator Tines, Check
Right Side Threshing Elements, Check
Right Side Rotor Rear Discharge Flights, Check
Right Side Concave Position Sensor and Wiring Harness, Check
Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
Right Side Shake Pan Frame, Swing Arms and Bushings, Check
Heater Hoses, Check
Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
Right Side Grain Tank Cross Auger Bearings, Check
Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check
IPM Controller and Harness, Check
Cab Wall Electrical Connectors, Check
Air Compressor Tank Drain, Check
Feed Accelerator Gear Case and Drives, Check
Right Hand Grain Tank Drain Covers, Check
Engine RPM, Check
Back-Up Alarm, Check
Engine Deck Access Ladder and Light, Check [The ladder lock is not working.]
Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check
Rotary Screen Driveshaft Belt and Bearings, Check
Rotary Screen, Check
Fuel, Oil Cooler, A/C Condenser & Fins, Check
Cooling Package Door Seal, Check
Radiator Hoses, Lines, and Surge Tank, Check
Engine Coolant Level, Check [Need add coolant]
Water Pump, Check
Thermostats, Check
Diesel Exhaust Fluid Tank, Check
Fuel Tank, Cap, Sensor and Lines, Check
Hydraulic Reservoir, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	18 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Hydraulic Reservoir, Check
ECU Connections and Seals, Check
Main Engine Gear Case and Valve, Check
Main Engine Gear Case Hydraulic Hoses, Check
Main Hydraulic Inner Pump Stack, Check
Hydraulic Valve Stack and Accumulator, Check
Exhaust and DPF Exhaust System, Check
Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
Engine Front Seals and Crankshaft Damper, Check
Air Conditioning Compressor and Alternator Drive Belt, Check
Air Compressor Pump and Drive Belt, Check
Accessory Drive Mounting Hardware, Check
Engine Rear Seals, Check
Rotor Speed Sensor and Wiring Harness, Check
Rocker Arm Cover, Check
Exhaust Manifold, Check
Turbocharger, Check
Aftertreatment Harness Module and Sensor, Check
EGR Valve and Actuator, Check
Open Crankcase Vent (OCV) System, Check
Rotor Gear Case, Check
Rotor Driveshaft and U-Joints, Check
Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
Grain Tank Level Switches and Wiring Harness, Check
Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace auger and bearing]
Grain Tank Loading Auger Actuator and Harness, Check
Clean Grain Elevator Mass Flow Sensor Impact Plate, Check [Need replace wear plate HXE17251-1pc]
Grain Sample Trough, Check
Grain Tank Cross Augers, Troughs, and Covers, Check
Active Yield Sensors and Wiring Harnesses, Check
Grain Tank Camera and Light, Check
Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
Unloading Auger Latching Mechanism and Pin, Check
Primary Valve Block, Check
Folding Auger Drive Cog, Check
Unloading Auger Swing Bushing, and Pivot Point, Check
Unloading Auger Cradle, Pins and Hardware, Check
Unloading Horizontal Auger and Tube, Check
Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
Unloading Auger Lights, Camera, and Harness, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	19 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Unloading Auger Lights, Camera, and Harness, Check
Unloading Auger Grain Saver Door and Boot, Check
Unloading Auger Boot Actuator and Harness, Check
Horizontal Auger 90* Gearcase, Check
Cab Ladder, Check
Mirrors, Check
Cab Door Cinch, Check
Windshield and Cab Glass, Check
Cab Roof, Check
GPS Receiver, Check
Gen 4 Command Center Display and Software, Check
AMS Software and Hardware, Check
Seat Operation and Seat Belt, Check
Park Brake Operation, Check
Steering Column, Check
Armrest Functions, Check
Multi-Function Control Lever Neutral Safety Switch, Check
Wiper and Washer Operation, Check
Horn, Check
Air Conditioning System Operation, Check
Heater Operation, Check
Refrigerator, Check
Cab Radio, Check
Cab Warning Alarm, Check
Corner Post and Armrest Display, Check
Active Header Control Displayed on Corner Post, Check
Auxiliary Power Strip, Check
Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
Safety Decals and Signs, Check
Ladder Safety Chains, Check
Road Disconnect Switch, Check
Rotary Beacon, Field, Transport, and Warning Lights, Check
copy of Operator Seat Presence Switch, Check
Fire Extinguisher, Check
Operators Manual
Camera System, Check
Toolbox, Check
Static Drag Chain/Cable, Check
Remote Front Grease Lines, Check
Air Conditioning Drain Hoses, Check
Feed Accelerator Gear Case Oil, Check
Fuel Precleaner Filter, Check
Engine Air Filters, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 20 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

Engine Air Filters, Check
Engine Oil and Filter, Check
Diesel Exhaust Fluid (DEF) System
Fuel Filters, Check
Fuel Tank Breathers, Check
Suction Screen, Check
Hydrostatic and Hydraulic Filters, Check
Final Drives Oil Level, Check
Transmission Filters (ProDrive XL), Check
Main Engine Gear Case Oil, Check
Cab Fresh Air Filter, Check
Cab Recirculation Filter, Check
Grain Tank Loading Auger Gear Case Oil, Check [The gearbox is overfilled with oil. Drain off the excess oil and adjust the level to the proper specification.]
Wiper Fluid Level, Check & Top Up
Final Running, Check
Safety Shields, Install
Water from Air Compressor Reservoir, Drain

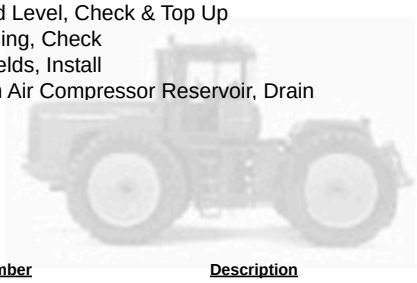

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY22062	HY-GARD J20C 9.46L	1.00	93.01	89.21	$89.21	N
TY26575	COOL-GARDII 3.78L 50/50 PREMIX	1.00	26.38	26.38	$26.38	N
TY26860	INSPECTION+ 4 FLUID TEST KIT	1.00	128.81	128.81	$128.81	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	$1.50	N
EF25	ENVIRO FEE	1.00	0.25	0.25	$0.25	N

Labor: $5,407.50 **Parts: $244.40** **OL&M: $0.00** **Misc: $1.75** **Sub-Total: $5,653.65**

JGEN06- Internal
COMPLAINT:
06 diagnose chopper >

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	21 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

JGEN06- Internal
CORRECTION:
- Approximately 2.0 hours were spent diagnosing the chopper and windrow actuators.
- The separator would not engage because the chopper was stuck in a partially raised position and would not move either up or down.
- Diagnosis was started using Service Advisor.
- All connectors specified by the diagnostic procedure were inspected and found to be in good condition.
- Pin 18 at connector XA41 was not properly locked in place.
- The pin was secured and reinstalled correctly.
- After the repair, all diagnostic codes cleared, system operation returned to normal, and the separator was successfully engaged and tested.

Labor: $420.00 **Parts: $0.00** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $420.00**

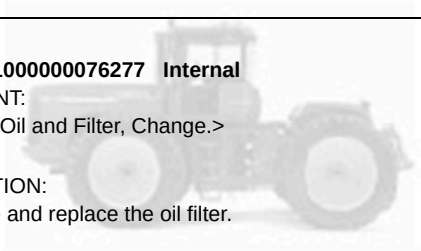

EXPERT-1000000076277 Internal
COMPLAINT:
07 Engine Oil and Filter, Change.>

CORRECTION:
1. Remove and replace the oil filter.

2. To remove the oil, open the drain valve.

3. To fill the oil, remove the cap.

4. Check the oil level after filling with dipstick.

5. The oil level should be at the "FULL" mark on the dipstick.

Thursday, July 16, 2026 6:39 AM
- Changed engine oil and Filter. Checked for leaks.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	133.36	133.36	$133.36	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	12.47	12.47	$12.47	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	22 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000076277 Internal

TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	202.01	202.01	$606.03	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	$1.25	N
EF15	ENVIRO FEE	1.00	0.15	0.15	$0.15	N
EF300	ENVIRO FEE	3.00	3.00	3.00	$9.00	N

Labor: $125.00 **Parts: $751.86** **OL&M: $0.00** **Misc: $10.40** **Sub-Total: $887.26**

EXPERT-1000000313707 Internal

COMPLAINT:
08 Large Multicoupler Hydraulic Quick Coupler Socket, Remove and Replace. This Job Code is for either the Reel Raise/Lower Cartridge, Reel Drive Forward Cartridge, or Reel Drive Reverse Cartridge. >

CORRECTION:
1. Relieve the hydraulic system pressure by fully lowering the header and reel to the ground, then continue to depress the switch for 5 seconds.
2. Use a vacuum pump on the reservoir to avoid draining it. If unavailable, drain the reservoir.
3. Clean all dirt and debris from multicoupler.
4. Remove valve.
5. Clean valve bore of all dirt and oil.
6. Lightly coat valve O-rings and back-up ring with clean oil. Install valve and tighten to specification.
7. Operate hydraulic functions to verify operation and no leakage.

Thursday, July 16, 2026 10:44 AM - replaced the leaking cartridge a new one

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE73035	X9 MC Coupler 1/2" FM	1.00	483.68	483.68	$483.68	N

Labor: $105.00 **Parts: $483.68** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $588.68**

DIAG-1000000211777 Internal

COMPLAINT:
09 Engine Deck Access Ladder Light, Diagnose >

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	23 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

DIAG-1000000211777 Internal
CORRECTION:
Thursday, July 16, 2026 10:47 AM
- during inspection of the engine compartment ladder light, it was found that the light switch was not functioning.
- The faulty light switch was replaced with a new one.
- Light works fine now

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE83486	Switch	1.00	83.20	83.20	$83.20	N

Labor: $315.00 **Parts: $83.20** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $398.20**

EXPERT-1000000074132 Internal
COMPLAINT:
10 Fuel Tank Breather, Remove and Replace. >

CORRECTION:
1. Remove the cap, breather, and O-ring from the fuel tank.
2. Check for leaks.
3. Inspect and replace as necessary.
4. Install in reverse order following these special instructions.
5. - Install the O-ring and breather. Tighten the breather to specification.
6. - Install the cap and tighten to specification.

Thursday, July 16, 2026 1:46 PM
- Removed and replaced the fuel tank breather. Tested OK.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER, FUEL TANK	1.00	33.71	33.71	$33.71	N

Labor: $17.00 **Parts: $33.71** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $50.71**

EXPERT-1000000088467 Internal
COMPLAINT:
11 Update All Controller Software. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	24 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000088467 Internal
1. Update all available controller software to the latest version of Software available.

Thursday, July 16, 2026 12:52 PM
- Updated all controller software to the latest available version.
- Verified successful installation and confirmed proper operation.

Labor: $420.00 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $420.00

DIAG-1000000173458 Internal
COMPLAINT:
12 Multi-Coupler Harness Connections, Diagnose >

CORRECTION:
Friday, July 17, 2026 12:58 PM
- Performed diagnostics and found a faulty Multi-Coupler cable for the header fold function.
- Replaced the cable with a new one and verified proper operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH212083	PUSH PULL CABLE, FH LATCHING	1.00	447.61	447.61	$447.61	N

Labor: $315.00 Parts: $447.61 OL&M: $0.00 Misc: $0.00 Sub-Total: $762.61

EXPERT-1000000076400 Internal
COMPLAINT:
13 Feed Accelerator Drive Belt, Remove and Replace. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	25 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000076400 Internal

1. Loosen nuts to remove tension from the feed accelerator drive belt.

2. Remove the loading auger drive belt. (See Supporting Document - Loading Auger Drive Belt—Replacing).

3. Remove feed accelerator drive belt and install replacement belt.

4. Install the loading auger drive belt. (See Supporting Document - Loading Auger Drive Belt—Replacing).

5. - Tighten nut until the washer is positioned between the end of the gauge and the bottom of the step.

6. - Tighten lock nut to specification.

7. Adjust feed accelerator drive belt. (See Supporting Document - Feed Accelerator Drive Belt—Adjusting).

8. - Tighten nut until the washer is positioned between the end of the gauge and the bottom of the step. Tighten lock nut to specification.

Monday, July 20, 2026 6:32 AM
- the feeder accelerator drive belt was removed and replaced with a new one

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE171261	X9 FEED ACCELERATOR BELT HIGH SPEED	1.00	285.13	285.13	$285.13	N

Labor: $336.00 **Parts: $285.13** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $621.13**

EXPERT-1000000020125 Internal

COMPLAINT:
15 Multi-Coupler Header Latch Pin Cable Shear Bolt, Replace. >

CORRECTION:
1. Replace main shear bolt.

2. Replace missing spare bolts.

Friday, July 17, 2026 1:30 PM
- Removed the broken header latch pin cable shear bolt
- Installed new shear bolts and verified proper operation.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 26 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000020125 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7264	M4-0.75 NYLOCK NUT	3.00	0.52	0.52	$1.56	N
19M9326	M4x30 HEXSOC 12.9 BOLT	3.00	1.99	1.99	$5.97	N

Labor: $52.50 **Parts: $7.53** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $60.03**

EXPERT-1000000076478 Internal
COMPLAINT:
16 Loading Auger Pivoting Gear Case Oil, Add.>

CORRECTION:
1. Top up loading auger pivoting gear case oil.

Friday, July 17, 2026 1:33 PM
- Checked the loading auger pivot gear case oil level.
- Added gear oil to the proper level.

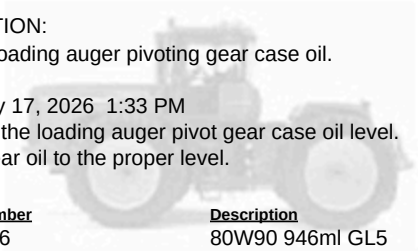

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	1.00	17.63	17.63	$17.63	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	$0.15	N

Labor: $25.00 **Parts: $17.63** **OL&M: $0.00** **Misc: $0.15** **Sub-Total: $42.78**

EXPERT-1000000076128 Internal
COMPLAINT:
17 Chopper Belt, Remove and Replace.>

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	27 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000076128 Internal
1. Remove chopper drive shields.

2. Loosen nuts to remove tension from the chopper drive belt and install replacement belt.

3. Adjust chopper drive belt. (See Supporting Document - Chopper Drive Belt—Adjusting).

4. Install previously removed chopper drive shields.

Thursday, July 16, 2026 10:57 AM
- to replace the chopper belt, it was necessary to remove three belts.
- After a detailed inspection, it was determined that the belt was not damaged as indicated by the combine inspection report.
- After discussing the findings with the service manager it was decided to reinstall the original belt on the combine and return the new belt to the parts department

Labor: $220.50 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $220.50

EXPERT-1000000227913 Internal
COMPLAINT:
18 Rotor Grain Loss Sensor, Remove and Replace.>

CORRECTION:
Tuesday, July 21, 2026 10:12 AM
- performed a follow up diagnostic of the grain loss sensors.
- All sensors are functioning properly.
-The sensors that had been identified for replacement were returned to parts

Labor: $37.80 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $37.80

EXPERT-1000000139767 Internal
COMPLAINT:
19 Concave Level and Adjust. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]4
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	28 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000139767 Internal
1. Start engine and press the threshing clearance adjust switch
.
2. Set threshing clearance to 0.

3. Remove the front separator grate deflector.

4. Remove cap screws, cap screws and nuts, and the front separator grate.

5. Move handle to shift the rotor gear case in the neutral position.
6. Loosen the lower lock nut, lower adjustment nut, and the upper lock nut on the front and rear concave cylinders.

7. While turning the left-hand rotor clockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements “tick” against the rotor. Back off the nut one full turn. Tighten nut finger tight.

8. While turning the right-hand rotor counterclockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements “tick” against the rotor. Back off the nut one full turn. Tighten nut finger tight.

9. Tighten the lower adjustment nut on the front and rear concave cylinders to specification.

10. Tighten the upper and lower lock nuts.

11. Perform the calibration. (See Supporting Documents - User Calibrations - Procedures).

Tuesday, July 21, 2026 10:21 AM
- performed the factory calibration of the concave.
- Tested the system during operation and verified proper functionality.

Labor: $525.00	**Parts: $0.00**	**OL&M: $0.00**	**Misc: $0.00**	**Sub-Total: $525.00**

DIAG-1000000170759 Internal
COMPLAINT:
20 Clean Grain Elevator Mass Flow Sensor Impact Plate, Diagnose >

CORRECTION:
ACTIVATE SERVICE MODE ON LOADING AUGER TO ACCESS THE WEAR PLATE
REMOVE DIRT BUILD UP INSIDE
REMOVE WEAR PLATE FROM IMPACT SIDE
INSTALL NEW WEAR PLATE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 29 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

DIAG-1000000170759 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE172513	SHEET	1.00	150.86	150.86	$150.86	N

Labor: $315.00 **Parts: $150.86** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $465.86**

DIAG-1000000173142 Internal
COMPLAINT:
21 Shroud Actuator, Diagnose >

CORRECTION:
TEST SHROUD MOVEMENT LH AND RH
OPEN TAILBOARD AND CLEAN INSIDE
ADJUST SHROUD
TEST AND ALL WORKING

Labor: $315.00 **Parts: $0.00** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $315.00**

EXPERT-1000000074594 Internal
COMPLAINT:
22 Unloading Auger Drive Shear Bolt, Remove and Replace. >

CORRECTION:
ALL 3 SPARE SHEAR BOLTS WAS MISSING,
WENT TO PARTS AND GOT NEW SPARES

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE209435	UPDATED X9 UNLOAD AUGER M12 SHEARBOLT	3.00	5.15	5.15	$15.45	N

Labor: $105.00 **Parts: $15.45** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $120.45**

DIAG-1000000232484 Internal
COMPLAINT:
23 Stone Trap, Diagnose >

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0 [redacted]

Bus Phone:
Prv Phone:

Deliver To: [redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	30 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

DIAG-1000000232484 Internal

CORRECTION:
Thursday, July 16, 2026 12:58 PM
- Removed the stone trap door for inspection.
- Straitened the bent door,
- reinstalled it,
- adjusted it as required,
- verified proper operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH89461	PIN FASTEN	1.00	12.78	12.78	$12.78	N

Labor: $315.00 Parts: $12.78 OL&M: $0.00 Misc: $0.00 Sub-Total: $327.78

EXPERT-1000000213916 Internal
COMPLAINT:
24 Feeder House Upper Drive Chain Guide, Remove and Replace.>

Friday, July 17, 2026 7:42 AM - Replaced upper feeder house drive chain guide. Tested OK.

CORRECTION:
1. Loosen and remove drive chain, if necessary.

2. Remove cap screws, nuts, and chain guide bracket.

3. Remove and replace feeder house drive chain plastic guide.

4. Assemble in reverse order.

5. Adjust chain tension by using a pry bar in the holes on the inside plate to move the sprocket forward and tighten nut to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE159287	Guide	1.00	65.55	65.55	$65.55	N

Labor: $105.00 Parts: $65.55 OL&M: $0.00 Misc: $0.00 Sub-Total: $170.55

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 31 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000074129 Internal
COMPLAINT:
27 Diesel Exhaust Fluid Tank Breather, Remove and Replace.>

CORRECTION:
1. Access exhaust fluid tank.

2. Remove and replace diesel exhaust fluid tank breather

3. Assemble in reverse order.

Thursday, July 16, 2026 1:49 PM
- Removed and replaced the DEF tank breather.
- tested OK.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER, FUEL TANK	1.00	33.71	33.71	$33.71	N

Labor: $15.00 **Parts: $33.71** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $48.71**

EXPERT-1000000146159 Internal
COMPLAINT:
28 Tailings Elevator Paddle Chain Remove Half Link & Adjust.>

CORRECTION:
1. Rotate tailings elevator conveyor chain until connecting link is visible.

2. Disconnect connecting link. Remove half link.

3. Reconnect tailings elevator conveyor chain with connecting link.

4. Adjust tailings elevator conveyor chain tension to specification.

5. Run the machine and readjust tension if required.

Friday, July 17, 2026 7:46 AM
- Removed half link,
- adjusted tailings elevator paddle chain,
- tested OK.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	32 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000146159 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7099	M2x12 COTTER PIN	2.00	0.30	0.30	$0.60	N

Labor: $105.00 Parts: $0.60 OL&M: $0.00 Misc: $0.00 Sub-Total: $105.60

DIAG-1000000169541 Internal
COMPLAINT:
29 Chopper Raise and Lower Actuator, Diagnose >

CORRECTION:
Wednesday, July 15, 2026 1:30 PM
- Diagnosed the chopper raise and lower actuator.
- Found two damaged wires in the harness.
- Repaired the wiring and verified proper actuator operation.

Labor: $315.00 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $315.00

EXPERT-1000000074148 Internal
COMPLAINT:
30 Fuel Filters, Remove and Replace.>

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	33 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000074148 Internal

1. Close the valve on the fuel precleaner.

2. Remove and replace the secondary fuel filter.

3. Remove and replace the primary fuel filter.
4. Disconnect the water sensor (if equipped).

5. Remove the fuel from the filters and discard.

6. Lubricate the replacement primary and secondary fuel filter seals with a thin film of oil or fuel.

7. Align the filter slots on the primary and secondary fuel filters with housing tabs.

8. Install and tighten the primary and secondary fuel filters until it is hand-tight.

9. Tighten primary fuel filter by an additional 1/2 turn.

10. Tighten secondary fuel filter by one additional full turn.

11. Open the valve on the fuel precleaner.

12. To prime the fuel system, turn the key switch to the ON position for 60 seconds.

13. Start the engine and run 3—5 minutes at low idle.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	150.96	150.96	$150.96	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	145.01	145.01	$145.01	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	$2.50	N

Labor: $80.00 **Parts: $295.97** **OL&M: $0.00** **Misc: $2.50** **Sub-Total: $378.47**

EXPERT-1000000213917 Internal

COMPLAINT:
31 Feeder House Lower Drive Chain Guide, Remove and Replace.>

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0
[redacted]

Bus Phone:
Prv Phone:

Deliver To:
[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 34 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000213917 Internal
CORRECTION:
1. Loosen and remove drive chain, if necessary.

2. Remove cap screws, nuts, and chain guide bracket.

3. Remove and replace feeder house drive chain plastic guide.

4. Assemble in reverse order.

5. Adjust chain tension by using a pry bar in the holes on the inside plate to move the sprocket forward and tighten nut to specification.

Friday, July 17, 2026 7:44 AM
- Replaced lower feeder house drive chain guide.
- Tested OK.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE160082	BOTTOM CHAIN GUIDE	1.00	99.78	99.78	$99.78	N

Labor: $105.00 **Parts: $99.78** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $204.78**

DIAG-1000000169882 Internal
COMPLAINT:
32 Active Tailings Camera, Diagnose 1.>

CORRECTION:
TAILINGS CAMERA LENS WAS FULL OF DIRT BUILD UP
USE SOFT RAG AND WINDOW CLEANER AND CLEAN LENS OF TAILINGS AND CLEAN GRAIN
TEST OPERATION OF TAILINGS AND CLEAN GRAIN CAMERAS

Labor: $37.80 **Parts: $0.00** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $37.80**

EXPERT-1000000073983 Internal
COMPLAINT:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 35 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000073983 Internal
33 Feeder House Lift Cylinder Pin, Remove and Replace.>

Friday, July 17, 2026 7:04 AM - Raised and safely supported the feeder house on stands. Drained the hydraulic oil from the lift cylinder. Removed the feeder house lift cylinder pin and inspected all pins. Replaced one pin, as all remaining pins were in like - new condition. Showed the removed pin to the service manager. Reassembled and verified proper operation.

CORRECTION:
1. Place a suitable stand under the front of the feeder house.

2. Remove cotter pin, and header lift cylinder pin.

3. Replace header lift cylinder pin
.
4. Install in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7085	M6.3x25 COTTER PIN	2.00	1.57	1.57	$3.14	N
14M7396	M8-1.25 FLG NYLOCK NUT	2.00	1.73	1.73	$3.46	N
19M7801	M8x60 FLG 10.9 BOLT	2.00	4.36	4.36	$8.72	N
HXE109020	Pin	1.00	157.90	157.90	$157.90	N

Labor: $73.50 **Parts: $173.22** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $246.72**

J06174021 JD X9 1000 Internal
COMPLAINT:
34 REMOVE AND INSTALL CHAFFER FRAME. originally code Left Side Pitman Arms, Swing Arms, and Bearings, Diagnose 2.
Scott talked to shelby and change in codes and times was approved >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 36 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

J06174021 JD X9 1000 Internal
CHRIS- REMOVE THE TAIL PIECE
REMOVE BOTH CHAFFER AND SIEVE ELEMENTS
REMOVE BOLTS ON SIEVE AND CHAFFER SWING ARMS
REMOVE TOP SHAKER PAN SWING ARM BOLT
REMOVE BOLTS ON PRE CHAFFER
PULL THE CHAFFER FRAME OUT THE BACK OF COMBINE TO REACH THE BOLT ON THE SIEVE SWING ARM BEHIND THE FRAME
INSTALL NEW SWING ARMS ON RH AND LH SIDE
BOLTS WERE RUSTED, WENT TO PARTS TO GET NEW BOLTS
INSTALL CHAFFER FRAME WITH PRE-CHAFFER
INSTALL BOLT TO KEEP SHOE IN MID-STROKE
TORQUE NEW M16 BOLTS TO 236 LB-FT
TORQUE NEW M12 BOLTS TO 96 LB-FT
RE-TORQUE ALL BOLTS AND NUTS ON SWING ARMS
INSTALL PARTS IN REVERSE ORDER
YURRI AND OLEKSANDER
INSTALL SIEVE AND CHAFFER AND TAIL PIECE
TORQUE RETAINING BOLTS ON ELEMENTS TO 26 LB-FT
TURN FRAME AND CHECK ALL ARMS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7358	M16x140 CB 10.9 SN	2.00	23.38	23.38	$46.76	N
03M7699	BOLT	2.00	6.67	6.67	$13.34	N
14M7291	M16-2 FLG NUT	6.00	5.05	5.05	$30.30	N
14M7299	M12-1.75 FLG NUT	2.00	2.86	2.86	$5.72	N
19M7803	M8x70 FLG 10.9 BOLT	2.00	4.69	4.69	$9.38	N
19M7819	M12x90 FLG 10.9 BOLT	2.00	9.36	9.36	$18.72	N
AXE85935	ARM	1.00	494.19	494.19	$494.19	N
AXE85936	ARM	1.00	484.44	484.44	$484.44	N
H227582	M16x135 FLG 10.9 BOLT	2.00	14.76	14.76	$29.52	N

Labor: $4,620.00 **Parts: $1,132.37** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $5,752.37**

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	37 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

DIAG-1000000090221 Internal
COMPLAINT:
35 Diagnose Stored Trouble Codes 1.

CORRECTION:
1. Diagnose stored trouble code.

Tuesday, July 21, 2026 9:42 AM
- CAB 518344,19 steering angle error value received.
- The turn signal multifunction switch has failed, causing an auto trac fault code.
- The multifunction switch was diagnosed as faulty and requires replacement

Labor: $210.00 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $210.00

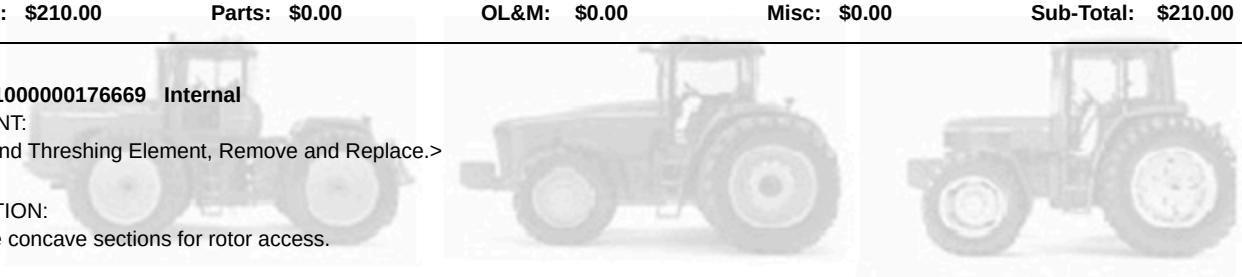

EXPERT-1000000176669 Internal
COMPLAINT:
36 Left-Hand Threshing Element, Remove and Replace.>

CORRECTION:
1. Remove concave sections for rotor access.

2. Inspect wear on threshing elements.

3. Remove cap screws and threshing element.

4. If one element needs replaced, replace all in the group. Example: If replacing element 2, replace elements 1 and 3 also.

5. Use Threshing Elements and Separator Tine Location diagram for identifying elements and tines.

6. Tighten the threshing element cap screws to specification.

Friday, July 17, 2026 11:44 AM
- Removed three left - hand threshing elements and installed three new threshed elements.
- Torqued all hardware to specification and verified proper installation and operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	38 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000176669 Internal

KXE10755	Threshing Element Kit LH KIT-X9 RTR	1.00	1,207.67	1,207.67	$1,207.67	N

Labor: $850.50 **Parts: $1,207.67** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $2,058.17**

EXPERT-1000000128779 Internal

COMPLAINT:
37 Feederhouse Reverser Motor Seal, Remove, Replace and Recondition.>

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	39 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000128779 Internal

1. Fully lower header and reel to ground and continue depressing the switch for 5 to 10 seconds to relieve hydraulic system pressure. Stop engine.

2. To allow removing the pump without draining the reservoir, connect D15032NU Vacuum Pump to reservoir. If vacuum pump is not available, drain reservoir.

3. Remove the left-hand side shields.

4. Disconnect the hydraulic lines.

5. To prevent contamination cap all openings and fittings.

6. Remove socket head cap screws and hydraulic motor from the support arm and coupler.

7. To prevent contamination cap all openings and fittings.

8. Remove cap screws from the hydraulic motor.

9. Repair or replace seals, seal ring, and O-rings as necessary.

10. Install parts in reverse order.

11. Install the reverser hydraulic motor.

12. Repair or replace as necessary.

13. Install parts in reverse order using the following special instruction

14. - Install the hydraulic motor using the socket head cap screws. Tighten socket head cap screws to specific

Friday, July 17, 2026 7:14 AM
- Removed the feeder house reverser motor,
- replaced the seal,
- reconditioned the motor,
- reinstalled it,
- verified proper operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	40 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000128779 Internal

AA46577	REEL DRIVE MOTOR SEAL KIT,OMS100 MOTOR	1.00	356.36	356.36	$356.36	N

Labor: $682.50 Parts: $356.36 OL&M: $0.00 Misc: $0.00 Sub-Total: $1,038.86

EXPERT-1000000076481 Internal

COMPLAINT:
38 Air Filter Elements, Change.>

CORRECTION:
1. Remove the air filter elements.

2. Replace with new air filter elements .

3. Check for leaks and for collapse of the aspirator tube.

Friday, July 17, 2026 8:07 AM
- Replaced air filters elements.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	457.64	457.64	$457.64	N
HXE11091	Secondary EngAir Filter	1.00	322.93	322.93	$322.93	N

Labor: $50.00 Parts: $780.57 OL&M: $0.00 Misc: $0.00 Sub-Total: $830.57

EXPERT-1000000147071 Internal

COMPLAINT:
39 Clean Grain Elevator Paddle Chain, Adjust. REMOVE HALF LINK AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	41 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000147071 Internal
1. REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.

2. TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.

3. DISCONNECT CONNECTING LINK. REMOVE HALF LINK.

4. RECONNECT CONNECTING LINK.

5. ADJUST TENSION TO SPEC.

6. RUN UNIT AND READJUST TENSION AS REQUIRED.

Friday, July 17, 2026 8:09 AM
- Removed half link,
- adjusted clean grain elevator paddle chain,
- tested OK.

Labor: $52.50 **Parts: $0.00** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $52.50**

EXPERT-1000000074762 Internal
COMPLAINT:
40 Cleaning Fan Fixed Drive Belt, Remove and Replace. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number:	[redacted]
Invoice Date:	7/21/2026
Location:	10
Work Order Number:	[redacted]
Payment Type:	Account
Page:	42 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000074762 Internal

1. Remove the cleaning fan fixed drive belt. (See Supporting Document - Cleaning Fan Variable Drive Belt—Replacing).

2. Loosen nuts to remove tension from cleaning fan belt.

3. Remove cleaning fan belt and install replacement belt.

4. Loosen lock nut and tighten nut until the washer is positioned between the end of the gauge and the bottom of the step.

5. Tighten lock nut to specification.
6. Adjust cleaning fan fixed belt. (See Supporting Document - Cleaning Fan Variable Drive Belt—Replacing).

7. Install previously removed cleaning fan fixed drive belt.

Thursday, July 16, 2026 11:13 AM
- the damaged cleaning fan belt was removed and replaced a new one

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE176244	V-Belt	1.00	243.08	243.08	$243.08	N

Labor: $210.00 **Parts: $243.08** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $453.08**

EXPERT-1000000185179 Internal

COMPLAINT:
41 Unloading Auger Drive Belt Idler, Remove and Replace. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 43 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000185179 Internal

1. Loosen nuts to remove tension from the unloading auger drive belt.

2. Remove the unloading auger drive belt.

3. Remove the unloading auger drive belt idler.

4. Install the new unloading auger drive belt idler.

5. Install the unloading auger drive belt.

6. Tighten nut until the washer is positioned between the end of the gauge and the bottom of the step.

7. Tighten lock nut to specification.

Wednesday, July 15, 2026 12:02 PM
- Removed the unloading auger drive belt idler,
- installed a new idler,
- adjusted the belt,
- verified operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7826	M16x70 FLG 10.9 BOLT	1.00	10.99	10.99	$10.99	N
AXE84077	X9 Unload Drive Idler	1.00	548.89	548.89	$548.89	N

Labor: $231.00 **Parts: $559.88** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $790.88**

EXPERT-1000000145842 Internal

COMPLAINT:
42 Chopper Rotor Blades, Replace. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 44 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000145842 Internal
1. Remove lock nut, cap screw, and bushings.

2. Remove and inspect blades and bushings.

3. Replace blade and install cap screw, bushings, and lock nut.
-Tighten lock nuts to specification.

Friday, July 17, 2026 12:27 PM
- Removed 42 chopper rotor blades.
- Installed 42 new rotor blades.
- Tightened all hardware and verified proper installation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE118760	Hexagonal Lock Nut, M10	34.00	1.92	1.92	$65.28	N
HXE119246	Cap Screw M10x55 10.9 *see NOTE	36.00	5.92	5.92	$213.12	N
HXE15909	CHOPPER BLADE BUSHING-INNER	68.00	17.23	17.23	$1,171.64	N
HXE59496	CHOPPER KNIFE BUSHING-OUTER	73.00	14.80	14.80	$1,080.40	N
KXE11415	HI-WEAR X9 CHOPPER KNIFE KIT (8/KIT)	8.00	363.20	363.20	$2,905.60	N

Labor: $651.00 **Parts: $5,436.04** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $6,087.04**

EXPERT-1000000076484 Internal
COMPLAINT:
43 Fuel Precleaner Filter, Clean. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 45 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000076484 Internal
1. Close the valve on the fuel precleaner.

2. Remove the fuel precleaner filter and clean the screen.

3. Install the screen and fuel precleaner filter.

4. To fill the bowl, open the valve on the fuel precleaner.

Friday, July 17, 2026 8:21 AM
- Cleaned fuel precleaner filter.

Labor: $25.00 Parts: $0.00 OL&M: $0.00 Misc: $0.00 Sub-Total: $25.00

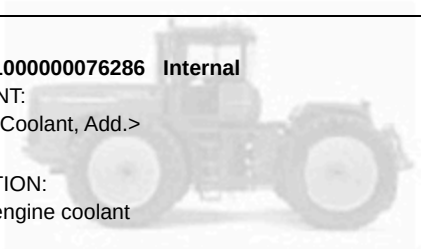

EXPERT-1000000076286 Internal
COMPLAINT:
44 Engine Coolant, Add.>

CORRECTION:
1. Top up engine coolant

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26576	COOL-GARD II 50/50 PRE-MIX JUG 9.46L	1.00	63.12	63.12	$63.12	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	$1.50	N

Labor: $52.50 Parts: $63.12 OL&M: $0.00 Misc: $1.50 Sub-Total: $117.12

EXPERT-1000000075528 Internal
COMPLAINT:
45 Unloading Auger Drive Countershaft Seal, Remove and Replace. >

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 46 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

EXPERT-1000000075528 Internal

1. Loosen unloading auger drive belt tensioner nuts and remove drive belt.

2. Remove lock nut and driveshaft pulley.

3. Remove inner shaft bearing retaining nut and spacer.

4. Remove outer snap ring and driveshaft assembly.

5. Remove output shaft snap rings, sleeve, retaining pin, and coupler.

6. Remove and replace output shaft seal.

7. Assemble in reverse order.

Monday, July 20, 2026 6:28 AM
- the seal on the unloading auger drive intermediate shaft was removed and replaced with a new one

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DE30918	Seal	1.00	39.57	39.57	$39.57	N

Labor: $840.00 **Parts: $39.57** **OL&M: $0.00** **Misc: $0.00** **Sub-Total: $879.57**

DIAG-1000000173508 Internal

COMPLAINT:
46 Chopper Gearcase, Diagnose and repair >

CORRECTION:
Monday, July 20, 2026 10:21 AM
- Performed diagnostics and confirmed that the gearbox oil seal was leaking.
- Disassembled the gearbox as required to access the failed components.
- Replaced the oil seal, two O-rings, and the center retaining nut with new parts.
- Refiled the gearbox with the correct type and amount of oil.
-Re- torqued all related fasteners to manufacture specifications using the proper torque values.
- Cleaned the repair area, checked for leaks,
- verified proper operation No leaks found after repair.
- Machine is operating as designed.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

PATTISON AGRICULTURE

JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

[redacted]

Bus Phone:
Prv Phone:

Deliver To:

[redacted]

Bus Phone:
Prv Phone:

Invoice Number: [redacted]
Invoice Date: 7/21/2026
Location: 10
Work Order Number: [redacted]
Payment Type: Account
Page: 47 of 47

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	874	1H0X910XHP0825267	175888	

DIAG-1000000173508 Internal

DE32457	Seal	1.00	91.52	91.52	$91.52	N
H165447	M30x2.0 NyLck Nut	1.00	21.31	21.31	$21.31	N
R110708	O-RING	1.00	6.84	6.84	$6.84	N
R530785	O-RING	1.00	8.90	8.90	$8.90	N
TY25744	EXTREME DUTY SYNTHETIC GREASE	1.00	27.61	27.61	$27.61	N
TY6354	HY-GARD J20C JUG 3.78L	1.00	40.88	40.88	$40.88	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	$0.60	N

Labor: $315.00 **Parts: $197.06** **OL&M: $0.00** **Misc: $0.60** **Sub-Total: $512.66**

INVOICE CONTAINS $3.80 DISCOUNT

Miscellaneous Charges:
SERVICE ACCESSORIES $150.00

Customer PO No:
Tax Exempt No:
Advisor: Joanne Thronberg

Labor:	$19,457.60
Parts:	$13,218.39
OL&M:	$0.00
Misc:	$166.90
Grand Total:	$32,842.89

*** * * DOCUMENT COPY * * ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN $35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS
I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: ..... Date: .....