Work Order History Report

Asset	W/O No	Description	Finished	Done Reading	
P0301		**Cat 773F Dump Truck**			
	58254	Rigid Dump Truck - 500hr Service 15458hrs #PARTS ONLY. Complete service during Off Hire Repairs.	12/02/2026		Hours
	59357	HME Inspection - Rigid Dump Truck Quote #:	19/12/2025		Hours
	58081	October R & M Monthly WO USO: - A/C repairs 15421hrs - E stop fault, replace perished wire 15526hrs	17/10/2025	15526	Hours
	57982	September Monthly R & M WO - No aircon 29/09 - noise behind cab, rock guard broken 30/09 15437hrs	30/09/2025		Hours
	54781	MAY USO R&M Fit extinguisher. Breakdown on haul circuit, patched up to get off haul circuit Chase up fire supression immobilising truck. Top up trans oil, put cab back together Grease, set speed limit and gear Check tyre pressures. Broke down, ECM control fault codes, won't go into gear and stall when it does, further diagnosing needed. Inspect tyres after operation complaint	18/09/2025		Hours
	56711	August R&M Monthly: Repair hyd leak on hoist circuit Repair / replace rock injector Replace Pos4 - R&M. Damage from rock ejector.	18/09/2025		Hours
	57519	Pos 4 change out costs - Marathon tyres. R&M - damage caused by rock ejector.	4/09/2025		Hours
	56855	Rigid Dump Truck - 250hr Service 15294 hrs	13/08/2025	15294	Hours
	56046	July USO R&M - body alarm not working and flashing light not working, replace relay and repair wire for broken light. 10.07 15114hrs	26/07/2025		Hours

Asset	W/O No	Description	Finished	Done Reading	
		- fit rubber to walkway and fire ext in cab, replace broken rear suspension washer 26/07 - Replace relay, repair wire for broken light			
	55331	Rigid Dump Truck - 1000hr Service 14990hrs 1502 hrs	2/07/2025		Hours
	55325	June USO R&M - Daily grease - Collect oil samples - Transmission faulting 15056hrs - Remove trans harness plugs, clean water out and seal best as possible	29/06/2025		Hours
	54051	Charge front and rear struts. Flip access steps.	7/04/2025		Hours
	52157	Pre-Hire Repair - CAPITAL WORK! s and USO FFP / Spec HME - Dubbo. Report any required repairs. #Refer to Wards handover notes - in cab of truck or see Pete. *Finish 14,720hrs Ward: Replace batteries, remove isolator switch, clean out mud, hydraulic tank down, reseal POS 4 brake cooling hoses, reseal, return junction to hydraulic tank, reseal temp sensor to junction block, reseal fitting to (tee) into, put tyre in tub 20/02: Replace L/H rod end steer cylinder ball joint 21/02: Reseal suction pipe to hydraulic pump, reseal hose to base of A/C 24/02: Replace hose to brake pump, reseal and fit to brake fitter Dawson: Wash, wash radiator, remove and fit far lower guard, put tyre in tub. USO OIL CHARGE OUT - 12 Month fire suppression and extinguisher service	4/03/2025		Hours
	11169	Inspection Findings: Pos 6 lower than the other 3 at the back Wheel chock missing Movement in the R/H steer cyl rod end Step missing bolt R/H bumper bent up & torn Radiator needs a clean out Missing clamp for dipstick tube on R/H side of engine Hyd pump has minor leak Plate in between the 2 brake filters is leaking Leak around rear housing on T/C Rear R/H side brake cooling pipes need seals replacing	25/04/2024		Hours
	9889	De-Mobilisation	21/02/2024		Hours
	8787	Adjust mirror Call out due to brake fault. Checked machine over, connected ET No fault found. Test drove, machine with no fault reappearing.	16/01/2024	14684	Hours

Asset	W/O No	Description	Finished	Done Reading	
	8642	Tub Inspection & Materials for Repair.	11/01/2024	14657	Hours
	8079	Rigid Dump Truck - 500hr Service	10/01/2024	14657	Hours
	8038	Fitted arm rest to driver seat and changed cab filters	12/12/2023	14445	Hours
	7914	Electrical fault. Connect ET diagnose fault and clear. Investigate UHF intermittent fault. Went with operator for a run around the circuit, could not fault. Sent truck back to work.	8/12/2023	14421	Hours
	7531	Carried out check over as required.	28/11/2023	14338	Hours
	7355	Carry out mechanical checks Cleaned out all filters. New armrest required- parts ordered.	23/11/2023	14338	Hours
	7056	Assisted with repairs to tub operation. Check for tub slamming down. Adjusted body position sensor. Check accumulator. Found front accumulator pressure low. Continued diagnostics of tub issue. Topped up accumulators to spec and checked for leaks- all ok. Swapped out body position sensor from another machine and adjusted- all OK. Daily machine checks	19/11/2023		Hours
	6809	Inspect tyre condition. Found to have some cracks but safe to continue working	2/11/2023	14323	Hours
	6134	Rigid Dump Truck - 250hr Service	15/10/2023	14256	Hours
	6072	Replace AC dryer, accumulator, regas and test system	11/10/2023	14221	Hours
	5724	Cleaned out air filters pre-shift Check for fault with A/C. Further diagnosis required. Bolt for strut retainer broken. Replace bolt Assist auto electrician diagnosing electrical fault	1/10/2023	14217	Hours
	5527	Minor R&M Repair coolant leak, check engine oil leak	20/09/2023	14139	Hours
	5214	Minor R&M: Set road speed limit to 40kph. Inspect strut leaking oil.	10/09/2023	14057	Hours
	4783	Pre hire repairs	25/08/2023		Hours
	4188	Clean ladder and walkways. Do pre-hire paperwork and checks. Fill fuel tank.	14/06/2023	14046	Hours
	4185	Fit new fire suppression bottle mounts. Refit top engine/platform covers. Degrease and wash machine.	13/06/2023	14046	Hours
	4181	Drain front struts. Pick up parts and get hose made up to flush front struts, hose for fuel over flow, valve coils for valve ports, hyd breathers, fire suppression bottle mounts. Flush front struts and fill with oil. Jack up the extra inch with portapower.	12/06/2023	14046	KM

Asset	W/O No	Description	Finished	Done Reading	
		Ft fuel overflow hose. Fit hydraulic tank breather.			
	2995	Remove pos 3 & 6 tyres. Stamp rim number on all rims. Wash mud from between duals, check pos 4 & 5 wheel nuts are tight with impact gun. Refit pos 3 & 6 tyres, reposition machine and put body up. Wash down machine around tranny and t/c. Move machine and wash down area. Set up and lower all struts to bottom. Flush re struts and re-oil to correct height. Fit engine belly guards.	11/06/2023		Hours
	2994	Fault find starting problem, found that fire suppression has shut down machine, check and test system. Pressure switches faulty, bypass switches. Start warm up, road up engine and get everything hot to test engine and burn all sealants, anti seize etc off engine components. Check for leaks and levels - ok. Drain water and allow to cool, fill with coolant. Replace window latch and wiper blade clean rubbish from cabin. Set up ready for stamping rims.	10/06/2023		Hours
	2044	Get fire exits stamped, organize fire suppression works, clean up work areas and pack away tooling	19/05/2023		Hours
	2035	Remove broken hungry board RHS of tub	15/05/2023		Hours
	2022	Organize vehicles and drive out to Quarrie and pick up hungry board for RHS of tray. Cut clamp off old elbow, was welded to patch, remove nuts inside exhaust box. Fit new elbow and bolts	13/05/2023		Hours
	2021	Remove exhaust elbow, pick up parts from hastings	12/05/2023		Hours
	1268	Continue refitting fire suppression hoses. Weld on for access steps and paint and fit steps. Clean up work area, pack all tools away	5/05/2023	14045	Hours
	1267	Remove all old camera cables from cab and engine bay. Tie up main harness around cabin. Diagnose and repair air leak from seat base. Remove broken bolt from bonnet mount. Refit bonnet assembly and fire suppression bottle. Start refitting fire suppression hoses to bonnet assembly	4/05/2023	14045	Hours
	1266	Clean up around weld and paint grill & head light boxes. Make & run new wiring harnesses for head light & horns and test to see if working. Mount horns and light onto grill and fit into place. Tidy up harnesses and test. Ok.	3/05/2023	14045	Hours
	1261	Remove front grill and measure up to get boxes made for headlights. Order and pick up parts needed to run and make new wiring harnesses. Modify grill and weld in head light boxes.	2/05/2023	14045	Hours
	1263	Remove handrails, stairs, mud guards, electrical harness etc. from front bumper assembly. Remove both front bumper corners fit and adjust new corners. Refit handrails etc. had to straighten handrails to get them to bolt up properly.	1/05/2023	14045	Hours
	588	Reverse truck out of shed and clean up work area. Park up rest of core returns and load onto truck and take back to Hastings. Bring truck back into shed start removing hand rail etc. to change out bumper corners.	20/04/2023	14004	Hours
	582	Prime fuel, start engine, check oil pressure, ok. Check over for leaks and loose clamp etc. Fit all remaining exhaust legging	19/04/2023	14004	Hours
	581	Continue with engine assembly. Fit remaining pipe & clamps. Fill engine oil & fill with water. Fit new filter & prime engine oil galleries. Batteries flat, try cranking & charging with truck but batteries too dead. Change batteries over night.	18/04/2023	14004	Hours
	567	Fit new radiator hoses, fill radiator, fill engine, clean work area	18/04/2023	14003	Hours
	580	Continue with engine assembly. Fit exhaust to RH manifolds. Fit brackets and refit oil filter housing and fuel filter. Fit new oil filter hoses, Refit all wiring to filters. Fit new fuel lines to head. Refit brackets at front of engine and make hoses	17/04/2023	14003	Hours
	566	Fit LHS, RHS turbo boost pipes, fit clamps to pipes, clean mounting bolts on hydraulic pump, replace orings fit hoses	17/04/2023	14003	Hours

Asset	W/O No	Description	Finished	Done Reading	
	579	Continue with engine assembly. Run wiring harness and tie up properly. Fit fuel piping brackets. Refit exhaust pipes and muffler and adjust	16/04/2023	14003	Hours
	578	Continue with engine assembly. Wire up starter motor & fit brackets. Fit both turbos and adjust. Refit after cooler mounts & refit turbo pipe. Fit fuel lines, fuel pump, engine brackets etc.	15/04/2023	14003	Hours
	562	Refit front cross member and tighten	24/03/2023	14003	Hours
	550	Support front of engine and remove front cross member. Remove sump. Remove drive gear from old oil pump and fit to new oil pump. Fit new oil pump to engine and fit. Pick up pipes. Clean sump and block. Fit sump to engine and tighten.	20/03/2023	14003	Hours
	595	Went to fit new oil pump, but not supplied, order new oil pump. Fit sump up to deep engine clean. Cover top of engine. Tidy up work area and pack all old cores into boxes. Check on progress of heads.	10/03/2023	14002	Hours
	594	Torque up all main bearing caps. Pick up big end bearings. Fit all new piston and guard assemblies. Fit new big end bearings and torque up caps. Clean sump gasket off block and sump. Wash sump ready for install	9/03/2023	14002	Hours
	593	Fit spacer plates & measure linear protrusion, ok . Remove all linears and fit o-rings and refit to bleed. Remove starter motor. Remove main bearing caps and fit new main bearings.	8/03/2023	14002	Hours
	592	Continue cleaning block and spacers plates. Remove all piston and linear nuts? from boxes. Sort out and make piston adapters on conrods. Wash off and clean up all liners and fit to block for protustion checks	7/03/2023	14002	Hours
	591	Remove all oil coolers from side of engine. Needed to get to main bearing cap bolts. Buy 3 drums of kero and get some tubs to wash parts in. Start cleaning block and spacer plates.	6/03/2023	14002	Hours
	590	Remove spacer plates and clean top of all liners. Remove all piston coolers. Remove all piston assemblies. Remove all liners.	5/03/2023	14002	Hours
	589	Remove pre lube motor and cap all lines. Move all machine out of work area and set up for work. Remove sump, had to remove cooler brackets, turbo drain adapter and front engine mount cross member.	4/03/2023	14002	Hours

Work Order History Report

7 December 2023

Asset	W/O No	Description	Finished	Done Reading
P0301		Cat 773F Dump Truck		
	589	Remove pre lube motor and cap all lines. Move all machine out of work area and set up for work. Remove sump, had to remove cooler brackets, turbo drain adapter and front engine mount cross member.	4/03/2023	14002 Hours
	590	Remove spacer plates and clean top of all liners. Remove all piston coolers. Remove all piston assemblies. Remove all liners.	5/03/2023	14002 Hours
	591	Remove all oil coolers from side of engine. Needed to get to main bearing cap bolts. Buy 3 drums of kero and get some tubs to wash parts in. Start cleaning block and spacer plates.	6/03/2023	14002 Hours
	592	Continue cleaning block and spacers plates. Remove all piston and linear nuts? from boxes. Sort out and make piston adapters on conrods. Wash off and clean up all liners and fit to block for protustion checks	7/03/2023	14002 Hours
	593	Fit spacer plates & measure linear protrusion, ok . Remove all linears and fit o-rings and refit to bleed. Remove starter motor. Remove main bearing caps and fit new main bearings.	8/03/2023	14002 Hours
	594	Torque up all main bearing caps. Pick up big end bearings. Fit all new piston and guard assemblies. Fit new big end bearings and torque up caps. Clean sump gasket off block and sump. Wash sump ready for install	9/03/2023	14002 Hours
	595	Went to fit new oil pump, but not supplied, order new oil pump. Fit sump up to deep engine clean. Cover top of engine. Tidy up work area and pack all old cores into boxes. Check on progress of heads.	10/03/2023	14002 Hours
	550	Support front of engine and remove front cross member. Remove sump. Remove drive gear from old oil pump and fit to new oil pump. Fit new oil pump to engine and fit. Pick up pipes. Clean sump and block. Fit sump to engine and tighten.	20/03/2023	14003 Hours
	562	Refit front cross member and tighten	24/03/2023	14003 Hours
	578	Continue with engine assembly. Wire up starter motor & fit brackets. Fit both turbos and adjust. Refit after cooler mounts & refit turbo pipe. Fit fuel lines, fuel pump, engine brackets etc.	15/04/2023	14003 Hours
	579	Continue with engine assembly. Run wiring harness and tie up properly. Fit fuel piping brackets. Refit exhaust pipes and muffler and adjust	16/04/2023	14003 Hours
	566	Fit LHS, RHS turbo boost pipes, fit clamps to pipes, clean mounting bolts on hydraulic pump, replace orings fit hoses	17/04/2023	14003 Hours
	580	Continue with engine assembly. Fit exhaust to RH manifolds. Fit brackets and refit oil filter housing and fuel filter. Fit new oil filter hoses. Refit all wiring to filters. Fit new fuel lines to head. Refit	17/04/2023	14003 Hours

Asset	W/O No	Description	Finished	Done Reading	
		brackets at front of engine and make hoses			
	567	Fit new radiator hoses, fill radiator, fill engine, clean work area	18/04/2023	14003	Hours
	581	Continue with engine assembly. Fit remaining pipe & clamps. Fill engine oil & fill with water. Fit new filter & prime engine oil galleries. Batteries flat, try cranking & charging with truck but batteries too dead. Change batteries over night.	18/04/2023	14004	Hours
	582	Prime fuel, start engine, check oil pressure, ok. Check over for leaks and loose clamp etc. Fit all remaining exhaust legging	19/04/2023	14004	Hours
	588	Reverse truck out of shed and clean up work area. Park up rest of core returns and load onto truck and take back to Hastings. Bring truck back into shed start removing hand rail etc. to change out bumper corners.	20/04/2023	14004	Hours
	1263	Remove handrails, stairs, mud guards, electrical harness etc. from front bumper assembly. Remove both front bumper corners fit and adjust new corners. Refit handrails etc. had to straighten handrails to get them to bolt up properly.	1/05/2023	14045	Hours
	1261	Remove front grill and measure up to get boxes made for headlights. Order and pick up parts needed to run and make new wiring harnesses. Modify grill and weld in head light boxes.	2/05/2023	14045	Hours
	1266	Clean up around weld and paint grill & head light boxes. Make & run new wiring harnesses for head light & horns and test to see if working. Mount horns and light onto grill and fit into place. Tidy up harnesses and test. Ok.	3/05/2023	14045	Hours
	1267	Remove all old camera cables from cab and engine bay. Tie up main harness around cabin. Diagnose and repair air leak from seat base. Remove broken bolt from bonnet mount. Refit bonnet assembly and fire suppression bottle. Start refitting fire suppression hoses to bonnet assembly	4/05/2023	14045	Hours
	1268	Continue refitting fire suppression hoses. Weld on for access steps and paint and fit steps. Clean up work area, pack all tools away	5/05/2023	14045	Hours
	2021	Remove exhaust elbow, pick up parts from hastings	12/05/2023		Hours
	2022	Organize vehicles and drive out to Quarrie and pick up hungry board for RHS of tray. Cut clamp off old elbow, was welded to patch, remove nuts inside exhaust box. Fit new elbow and bolts	13/05/2023		Hours
	2035	Remove broken hungry board RHS of tub	15/05/2023		Hours
	2044	Get fire exits stamped, organize fire suppression works, clean up work areas and pack away tooling	19/05/2023		Hours
	2994	Fault find starting problem, found that fire suppression has shut down machine, check and test system. Pressure switches faulty, bypass switches. Start warm up, road up engine and get everything hot to test engine and burn all sealants, anti seize etc off engine components. Check for leaks and levels - ok. Drain water and allow to cool, fill with coolant. Replace window latch and wiper blade clean rubbish from cabin. Set up ready for stamping rims.	10/06/2023		Hours
	2995	Remove pos 3 & 6 tyres. Stamp rim number on all rims. Wash mud from between duals, check pos 4 & 5 wheel nuts are tight with impact gun. Refit pos 3 & 6 tyres, reposition machine and put body	11/06/2023		Hours

Asset	W/O No	Description	Finished	Done Reading	
		up. Wash down machine around tranny and t/c. Move machine and wash down area. Set up and lower all struts to bottom. Flush re struts and re-oil to correct height. Fit engine belly guards.			
	4181	Drain front struts.Pick up parts and get hose made up to flush front struts, hose for fuel over flow, valve coils for valve ports, hyd breathers, fire suppression bottle mounts.Flush front struts and fill with oil.Jack up the extra inch with portapower.Ft fuel overflow hose.Fit hydraulic tank breather.	12/06/2023	14046	KM
	4185	Fit new fire suppression bottle mounts.Refit top engine/platform covers.Degrease and wash machine.	13/06/2023	14046	Hours
	4188	Clean ladder and walkways. Do pre-hire paperwork and checks. Fill fuel tank.	14/06/2023	14046	Hours
	4783	Pre hire repairs	25/08/2023		Hours
	7056	Minor R&M Monday 13.11.23 to Sunday 19.11.23Assisted with repairs to tub operation.Check for tub slamming down. Adjusted body position sensor. Check accumulator. Found front accumulator pressure low.Continued diagnostics of tub issue. Topped up accumulators to spec and checked for leaks- all ok. Swapped out body position sensor from another machine and adjusted- all OK.Daily machine checks	19/11/2023		Hours

Maas Group Holdings Work Order 6983

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Continue with engine disassembly	Minor defects		18/04/23	14002	14020	18/02/23	19/02/23		

Work Required Continue with engine disassembly	**Status** Closed
Work Done Continue with engine disassembly , finish removing turbos and remove exhaust pipes and muffler assembly	**Completed** 19/02/2023

Work Order Signature



Maas Group Holdings Work Order 6982

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Continue with engine rebuild	Minor defects		18/04/23	14002	14020	19/02/23	19/02/23		

Work Required Continue with engine rebuild	**Status** Closed
Work Done Continue with engine rebuild, remove all roder housing, rocker gear, injectors. Remove camgears & camshafts. Remove fuel lines and fuel pump. Remove all head bolts, ready to lift off	**Completed** 19/02/2023

Work Order Signature



Maas Group Holdings Work Order 6980

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Remove heads	Minor defects		18/04/23	14002	14020	20/02/23	20/02/23		

Work Required Remove heads	**Status** Closed
Work Done Remove heads, wash up and strap to pallet drop heads off at engine reconditioners. Chase up and order parts need to do repairs	**Completed** 20/02/2023

Work Order Signature



Maas Group Holdings Work Order 6713

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Celean up around machine	Minor defects		05/04/23	14002	14020	24/02/23	24/02/23		

Work Required Celean up around machine and make sure everything is covered up.Pick up head parts from Hasting or take to machine shop	**Status** Closed
Work Done Done	**Completed** 24/02/2023

Work Order Signature



Maas Group Holdings Work Order 6414

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Continue with engine disassembly	Minor defects		24/03/23	14002	14020	09/02/23	09/02/23		

Work Required Continue with engine disassembly	**Status** Closed
Work Done Continue with engine disassembly. Remove both turbos & check. U/S. Clean out dirt etc. from valley as best as possible. Continue removing & tagging pipe work & bracket etc. from around engine.	**Completed** 09/02/2023

Work Order Signature



Maas Group Holdings Work Order 6413

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Continue with engine disassembly	Minor defects		24/03/23	14002	14020	08/02/23	08/02/23		

Work Required	Status
Continue with engine disassembly	Closed
Work Done Continue with engine disassembly. Remove all exhaust , loosen all exhaust pipe clamps & spray with WD40. Remove fan shroud, fan & fan drive.	**Completed** 08/02/2023

Work Order Signature



Maas Group Holdings Work Order 6411

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Start removing exhaust & intake pipes	Minor defects		24/03/23	14002	14020	06/02/23	07/02/23		

Work Required Start removing exhaust & intake pipes	**Status** Closed
Work Done Done	**Completed** 07/02/2023

Work Order Signature



Maas Group Holdings Work Order 6410

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Remove walkway/fire suppression	Minor defects		24/03/23	14002	14020	06/02/23	06/02/23		

Work Required Remove walkway/fire suppression	**Status** Closed
Work Done Check over machine. Jump start & move into yard. Remove walkway & ladder from tub. Do up defect list. Remove fire suppression & bonnet assembly	**Completed** 06/02/2023

Work Order Signature



Maas Group Holdings Work Order 2989

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:
Craig Curtis
Daniel Carroll

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Manually generated 1000 hours service	Routine Service		13/10/22	13951	60894	13/10/22	10/10/22		3h

Work Required Obtain engine oil sample	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Change engine oil and filters	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Replace service sticker	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Change fuel/water separator	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Change fuel filter	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Change engine air filter primary elements	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Clean/replace cab filters	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check steering system oil level	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check hoist and brake tank oil level	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check torque convertor/transmission oil level	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check differential oil level	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check final drive oil levels and check magnetic plug	**Status** Closed
Work Done	**Completed** 10/10/2022

Work Required Check front wheel oil level	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Inspect service brakes	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Inspect steering linkage	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Inspect frame and body support pads	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Change engine air filter secondary elements	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Change transmission/torque convertor oil and filter, check and clean magnetic screen	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Change steer system oil and replace filters	Status Closed
Work Done	**Completed** 10/10/2022

Work Required Replace brake filters	Status Closed
Work Done Checked brakes as required	**Completed** 10/10/2022

Work Required Replace front wheel oil	Status Closed
Work Done	**Completed** 10/10/2022

Work Order Signature



Maas Group Holdings Work Order 2364

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Works to be completed at service interval	To do when in workshop		08/09/22			19/09/22	10/08/23		

Work Required Horn does not work	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Latches on the door and rear windows do not lock correctly leaving gaps and allowing dust to get in	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Hungry board damage	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Slight leak behind hydraulic accumulator	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Left armrest broken, window handle broken, seal is also damaged	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Left front mudflap has big tear in it	**Status** Closed
Work Done Noted and inspected on service - OK to return to work	**Completed** 10/10/2022

Work Required Exhaust Leak - near box (Reported by Les Cox - 13760hrs)	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Front right headlight is completely gone, the frame from the headlight area is beat up	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Required Step rubbers broken	**Status** Closed
Work Done Removed and replaced step rubber as required.	**Completed** 10/10/2022

Work Required Tyres are worn 18.10.22	**Status** Closed
Work Done Added to MEX To-do list	**Completed** 10/08/2023

Work Order Signature



Maas Group Holdings Work Order 2082

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Left hungry board joins are snapped, back half abit loose	Equipment breakdown		20/08/22				19/09/22		



Work Required Left hungry board joins snapped. Board is abit loose at the back	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Order Signature



Maas Group Holdings Work Order 2058

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Multiple Prestart Defects	Minor defects		17/08/22				19/09/22		









Work Required Right bumper/frame damaged, lights taken out. Far left headlight taken out	**Status** Closed
Work Done Noted sent back to Work	**Completed** 19/09/2022

Work Required Horn noise is faint	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required Slight leak behind hydraulic accumulator	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required Left armrest broken, window handle broken, seal is also damaged	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required	Status
Left front mud guard has big tear in it, right hungry board has damage in middle	Closed
Work Done	**Completed**
Refer to W/O 2364	19/09/2022

Work Order Signature



Maas Group Holdings Work Order 2021

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:


Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Multiple Prestart Defects	Minor defects		15/08/22				19/09/22		









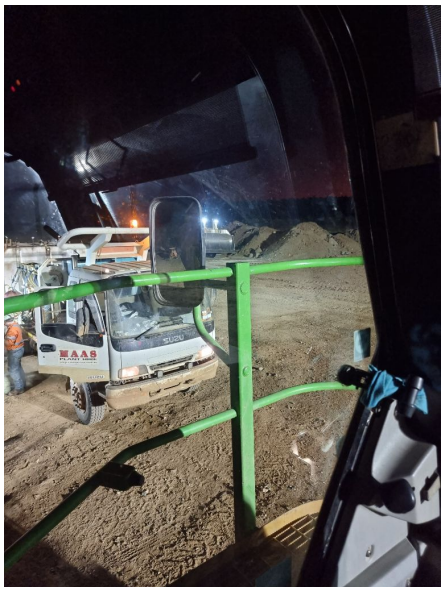

Work Required Right bumper damaged,headlights taken out. Left far headlight taken out	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022


Work Required Onside mirror installed is too small	**Status** Closed
Work Done New mirror fitted	**Completed** 30/08/2022

Work Required Leak coming from hose behind hydraulic accumulators R/H side	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required Right hungry board has hole in it/damage	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required	Status
Left front mudflap has big tear in it	Closed
Work Done	**Completed**
Refer to W/O 2364	19/09/2022

Work Order Signature



Maas Group Holdings Work Order 1821

Asset: P0301 - Cat 773F Dump Truck

Fitter/s:

Description	Priority	Root Cause	Entered	Hours	Km	Start	Complete	Estimated Duration	Actual Duration
Multiple Prestart Defects	Minor defects		29/07/22				19/09/22		











Work Required Right headlight taken out, bumper and surrounding frame damaged/smashed. Left far headlight taken out	**Status** Closed
Work Done Noited sent back to work	**Completed** 29/07/2022

Work Required Right hungry board on inside of tray damaged	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required Slight oil leak behind hydraulic accumulators	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Required Left hand front tyre mudguard has tear in it	**Status** Closed
Work Done Refer to W/O 2364	**Completed** 19/09/2022

Work Order Signature



Service History Report for - P301 Caterpillar 773F Rigid DT

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
15-Sep-22	Shane		$300.00	Change out pos 5 & 6 tyres	
15-Sep-22	Shane		$400.00	R+R pos 4 & 6 tyres	
14-Sep-22	Dayle		$600.00	Refit rear strut	
12-Sep-22	Michael		$400.00	Remove rear strut RHS	
11-Sep-22	Michael		$200.00	Finish 250hr service	
11-Sep-22	Rhys	13690	$250.00	250hr service	
04-Sep-22	Sean	13658	$150.00	Replace rear struts beeper bolts	
31-Aug-22	Shane	13609	$200.00	Fit new dogbone retainer bolt & washers & tighten	
26-Aug-22	Jack	13556	$200.00	500hr service	
22-Aug-22	Sean	13942	$150.00	Window locks broken, repair & ziptie up	
22-Aug-22	Shane		$100.00	Fit new mirror	
18-Aug-22	Sean	13393	$150.00	Broken light	
04-Aug-22	Shane		$100.00	Fit D/S mirror	
03-Aug-22	Shane		$1,000.00	Fix hungry boards	
29-Jul-22	Shane		$110.00	Repair panel damage	
29-Jul-22	Jack		$110.00	Oil leak Reverse camera	
29-Jul-22	Rhys	13163	$220.00	Defect repair & panel damage	
29-Jul-22	Sean Grieve	13163	$55.00	Rock injector	
28-Jul-22	Jack	13163	$110.00	Rock injector	
28-Jul-22	Alex	13180	$288.75	Remove, straighten and install rock ejector Ran up machine Check turbo fault	
26-Jul-22	Sean Grieve	13109	$110.00	UHF fault	
24-Jul-22	Sean	13109	$400.00	1000hr service	
24-Jul-22	Shane	13091	$110.00	LHR loswer start bolt broken Romove bolt from P1204 & fit to P301 Tighten. Ok.	
24-Jul-22	Xander	13109	$165.00	1000hr service	
23-Jul-22	Sean	13081	$150.00	UHF fault	
22-Jul-22	Xander	13081	$55.00	Fuel & grease Check over machine	
20-Jul-22	Xander	13054	$55.00	Grease and fuel Inspect machine	
07-Jul-22	Sean	12889	$100.00	C/O UHF and rewire power supply	
07-Jul-22	Jack	12889	$200.00	C/O UHF and rewired power supply	
06-Jul-22	Sean	12889	$100.00	UHF issues with power supply	
01-Jul-22	Sean	12845	$200.00	Upgrade lights and run piggy wire for high beam	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
25-Jun-22	Sean	12871	$150.00	C/O steering column	
24-Jun-22	Lain	12871	$165.00	Removed steering column guards Tested strut on steering column Ordered new part	
14-Jun-22	Lain	25821	$82.50	Topped up engine and hydraulic oil Pumped up PoS 2 tyre	
22-May-22	Lain		$247.50	Bolted up hole that was made in body and welded up tabs hold wing on	
21-May-22	Lain	12754	$288.75	Oxyed out hole in body wall wings Ground down old welds	
19-May-22	Shane		$150.00	Adjust rear struts LHR low	
13-May-22	Alex	16675	$247.50	Top up engine Grease machine Re-seal trans hose	
13-May-22	Lain	12673	$123.75	Went back to workshop to retreive engine and hyd oil then topped up machine and blew out filters	
16-Mar-22	Lain		$330.00	Lifted body of machine then secured it at the rear points Tested solinoids with pressure gauge Removed top of transmission, removed solinoid 4 and replaced o-rings in the valve then did the same to solinoid 6 & 7 Put gearbox back together and tested	
15-Mar-22	Laine	12396	$88.50	Gathered nitrogen kit component from around site workshop to conduct regas on front struts	
14-Mar-22	Lain	12396	$412.50	Adjusted mirrors into correct place Check over of lights and emergency equipment Removed steps, walk ways and steps from the back of the vehicle Lifted walk ways up with the crane then bolted to the vehicle, also lifted and bolted roof guards to the body of the truck	
05-Mar-22	Shane		$343.75	Diagnose electrical fault, found plug on side of cabin with no seals and full of dirt, clean up and test - OK.	
05-Mar-22	Greg M		$275.00	Diagnose no start, check wiring, test power to and from ECM, foud dirty connector into cab, change plug and test - OK. Fit covers.	
04-Mar-22	Shane		$110.00	Machine wont start after washing, found plug at tranny missing seals and full of mud. Clean and reassemble check - no good.	
04-Mar-22	Lleyton		$165.00	Wash bay.	
04-Mar-22	Harry D		$165.00	weld up cracks on fix bottle	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
04-Mar-22	Shane		$110.00	Machine wont start, found plug at trany missing seals and full of mud, clean and reassemble, no good	
02-Mar-22	Harry D		$151.25	Weld fish plate on and paint it.	
01-Mar-22	Lleyton		$27.50	Install seat cover.	
01-Mar-22	Harry D		$563.75	Weld hole in exhaust, weld wear plates in back of dump truck and weld cracks up.	
28-Feb-22	Harrison	12393	$308.00	Install tracker	
28-Feb-22	Zumbo		$165.00	Remove broken bolts from front grill, remove and replace brake charge valve.	
28-Feb-22	Craig	12392	$41.25	Fit RH front mud flap, make up new plate for mud flap mount.	
28-Feb-22	Harry D		$178.75	Make new exhaust and folded up plate to go over hole in exhaust.	
24-Feb-22	Craig	12392	$398.75	Clean hydaulic tank, replace sight glasses, o rings, grommets, refit return screen and assemble hyd tank. Fill oil. Removed front rock deflectors. Investigate brake pressure fault. Order seal kit for charge valve.	
24-Feb-22	Zumbo		$836.00	Remove walk way and eyebrows from truck Resend hyd tank and check oils Brake change pressure issue, inspect and order parts	
23-Feb-22	Zumbo		$836.00	Replace upper hoist bearings Inspect hyd leak for cracked pipe Clean for repair Remove decals from tub	
23-Feb-22	Clay		$522.50	Rebuild steer cylinder, fit ball stud in cylinder, remove old plant ID stickers, fit new ones Grease machine, put steering column together	
22-Feb-22	Clay	12392	$522.50	Assist putting a frame together, assist with strut pins, fit tranny hoses, replace new hoses, drop tranny/torque converter oil, fill up, pop RHS steer cylinder to reseal	
22-Feb-22	Zumbo		$836.00	Install A Frame and hosing Install drive shaft and tension Replace rear strut lower bearings and install Replace dog bone bearings and insall	
21-Feb-22	Zumbo		$748.00	Replace steering link bushes and pin. Pull A Frame back and replace bearing Make tool to tension retaining nut.	
21-Feb-22	Clay		$261.25	Detail cab, pull steering column apart to see movement, fit steer cylinder hoses, fit new grease line, assist with a frame bearing removed, clean a frame surfaces	
19-Feb-22	Clay	12392	$275.00	Clean grease around ball studs Remove old ball studs Replace with new ones Remove hose from steer cyl	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
18-Feb-22	Zumbo		$836.00	Jack up and support truck to remove A Frame Remove rear struts and dog bone Remove trans/hyd lines and drive shaft Remove nuts from ball studs and pop out of frame	
18-Feb-22	Clay	12392	$467.50	Assist popping ball studs 500HR service tag fire supression/existinguishers Ensure wiper/washer operation works Assist pusahing strut pinas out Remove hoses to access a frame Clean work area	
17-Feb-22	Zumbo		$88.00	Check over for repairs	
23-Jan-22	John C	12391	$82.50	Demobe	
14-Nov-21	JohnCiappara	12264	$55.00	Fit P Clamps to brake lines Pos 3/4	
08-Nov-21	Jackson	12260	$82.50	Top up hyd oil Check tyre pressures	
05-Nov-21	Jackson	12254	$55.00	Replace front step rubbers	
23-Oct-21	JohnCiappara	12192	$220.00	Weld hungry board	
21-Oct-21	JohnCiappara	12172	$55.00	Repair fuel sender wires	
04-Oct-21	Shane O	12087	$110.00	Diagnose electrical fault Repair E-Stop	
30-Sep-21	Jonn C	12082	$137.50	Mobilise	
13-Jul-21	Duncan	11812	$137.50	Complete FFP Inspection Adjust RH mirrors & tighten bolts Tighten bolts on access wires	
30-Jun-21	A Mills	11775	$165.00	Pull sensor out of P1137. Block off hole pull one out of P301 and replace with new one	
29-Jun-21	A Mills	11770	$55.00	Hyd leak on valve. Pull one off other truck with flat tyre	
29-Jun-21	John C	11770	$55.00	Diagnose accumulator pressure sensor leak	
26-Jun-21	John C	11759	$165.00	250hr service Check tyre pressures	
10-Jun-21	B Swan	11649	$55.00	FFP checks & repairs	
08-Jun-21	B Swan		$137.50	Replace hoist pump hyd line	
08-Jun-21	John	11615	$137.50	Hoist pump hose	
07-Jun-21	B Swan		$137.50	Remove hois pump hyd line (blown on top of fill)	
03-Jun-21	John		$55.00	Fit LH mirror	
28-May-21	Duncan	11545	$302.50	Complete 500hr Service Check turbo's Replace RH front headlight line	
28-May-21	John	11545	$55.00	500hr service	
12-May-21	B Swan	11460	$135.00	Top engine oil, repair seat and free up. Repair RH mirrors and mount.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
10-May-21	B Swan	11428	$55.00	Carry out diagnostic checks and change all machines to 40km p/h	
09-May-21	Duncan Steve	11428	$220.00	Repaired front step. Welded cracks around fire supression.	
03-May-21	Duncan	11402	$110.00	Replaced leaking hose from brake changing valve to hoist valve.	
28-Apr-21	John	11352	$55.00	Top up engine oil	
27-Apr-21	Duncan	11398	$55.00	Fitted bottom seat belt latch. Checked operation of latch	
18-Apr-21	John	11305	$385.00	250hr service Reseal trany cooler hose fitting Check brake accumulator pressures Try to find slow brake pressure build up.	
17-Apr-21	Duncan	11292	$82.50	Not building brake pressure. Connected pressure gague to confirm Pull retarter lever stomped on brake. Began to build pressure. Further diagnosis required	
17-Apr-21	John	11300	$27.50	Grease, Engine oil	
13-Apr-21	John	11259	$55.00	Quarterly	
02-Apr-21	A Mills	11203	$55.00	Replace step and fill engine oil	
01-Apr-21	John	11181	$27.50	Grease	
30-Mar-21	A Mills	11165	$27.50	Grease & check over machine & tyres	
29-Mar-21	A Mills	11155	$55.00	Top up engine oil Inspect for leak	
03-Mar-21	John	11050	$55.00	Check brake solenoids	
03-Mar-21	A Mills		$55.00	Check accumulator pressure	
25-Feb-21	A Mills		$41.25	Grease plant	
22-Feb-21	John	11017	$41.25	Check over Grease	
19-Feb-21	John	11015	$55.00	Clean P-Brake solenoid	
17-Feb-21	John	11012	$55.00	Check P-brake problem	
10-Feb-21	John	10995	$55.00	Grease	
07-Feb-21	A Mills		$110.00	Gas struts, strut covers, fix mirrors, move together	
07-Feb-21	John		$107.25	Gas struts, fit strut covers, fit mirrors, mobilise Grease Check over	
02-Feb-21	Ted Van		$82.50	Clear NPM FFP Actions	
29-Jan-21	Jackson	10986	$275.00	North Parkes FFP Sleeve hosing Fix washers & replace wiper Check lights, Fit reflective tape Denso tape starter solenoid terminals	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
28-Jan-21	Connor		$110.00	Prep for painting Put prime coat on	
28-Jan-21	Jackson	10986	$55.00	North Parkes FFP Sleeve hosing with croc sleeve	
27-Jan-21	Connor		$123.75	Prep hand rails	
15-Jan-21	Jackson		$110.00	Fit hand rails	
14-Jan-21	Jackson		$192.50	North Parkes FFP Sleeve hosing	
14-Jan-21	Lindsay		$151.25	Re arrange tyres	
14-Jan-21	Zumbo	10986	$82.50	Fit handrails to machine	
13-Jan-21	Zumbo	10986	$481.25	Remove handrails for paint Burst protection Battery lead covers	
12-Jan-21	KyleMusgrave		$330.00	Extor repair Mud flap repair Crack repair Paint Install light	
07-Jan-21	KyleMusgrave		$302.50	Front bumper repair / replacement	
17-Dec-20	Zumbo		$247.50	Cover fuel lines in burst protection	
16-Dec-20	Zumbo		$82.50	Cover fuel lines in burst protection & repair front grill bolts	
03-Dec-20	Ted Van	10985	$371.25	Check & tag extinguishers Replace batteries - clean out battery box Check against site requirements Fit safety stickers Clean up bay	
02-Dec-20	Ted Van	10985	$412.50	Reseal Starter motor Diagnose multiple leaks in fire supression system Reseal fitting in cab Repair charge point & ground level Replace schroder valve Replace cab & ground level gauges Remove bu…. & clean out Check & tag extinguishers	
02-Dec-20	Will Paull	10984	$330.00	Fit tie rods & new pins Assist with starter motor Replace tranny filter Replace hyd filters	
01-Dec-20	Will Paull	10984	$495.00	Replace cylinder steer pins Remove tie rods to replace pins Replace oil in diff & reseal drain bung	
30-Nov-20	Ted Van	10985	$110.00	Continue 1000hr service	
30-Nov-20	Will Paull	10984	$440.00	Reseal brake filter housing Reseal lock up solinoid Fit brake cooler hose Get parts ordered	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
28-Nov-20	Will Paull	10984	$220.00	1000hr service Lock up valve removed and cleaned	
28-Nov-20	Ted Van	10985	$55.00	Start on 1000hr service	
24-Nov-20	Shane	10984	$82.50	Jump start machine Check over and do up defect list	
24-Nov-20	Greg Mills		$55.00	Jump start Check over	
19-Aug-20	Lindsay		$55.00	Jumpstart and drive to wash bay.	
16-Jan-18	Matt		$272.25	Check engine. Check pressures. Do injector test, all ok.	
20-Dec-17	Mathew	10632	$130.00	Remove front step remove broken studs fit new steps.	
19-Dec-17	Mathew	10623	$195.00	Remove and replace hyd hose on gear box.	
05-Sep-17	Ted Van	10617	$325.00	Fit new exhaust tip. Replace bearing and race in HMU, reseal/reassemble and refit.	
04-Sep-17	Ted Van	10617	$260.00	Remove HMU clean and strip, found bearing race borken - organise parts.	
04-Sep-17	James Mills		$65.00	C/O blown bulbs and start to remove HMU	
04-Sep-17	J Ciappara	10617	$260.00	Replace P1 & P2 brake pads. Replace rear brake cooling hose.	
24-Nov-16	John. C	10614	$260.00	Wash	
23-Nov-16	Ted Van	10614	$162.50	Finish fitting drive shaft covers. Refit torque convertor / transmission scavenge hoses. Replace transmsission filter, refill oil and top up while running.	
22-Nov-16	Ted Van	10613	$227.50	Fit torque convertor scavenge pump. Refit driveshaft and top covers.	
16-Nov-16	Dane		$130.00	Assist fit transmission and fit all hoses for transmission.	
16-Nov-16	Greg Mills		$617.50	Assemble trans, clean torane connection housing, fit trans	
15-Nov-16	Greg Mills		$617.50	Assemble transmission, clean out control valve	
14-Nov-16	Greg Mills		$617.50	Assemble transmission	
11-Nov-16	Greg Mills		$65.00	Start to assemble transfer case	
07-Nov-16	Greg Mills		$617.50	Disassemble trans	
04-Nov-16	Dane.L	10614	$130.00	Assist remove transmission	
04-Nov-16	Greg Mills		$195.00	Remove and split transmission	
28-Oct-16	RAM Diesel	10612	$412.00	Organise franna Load ladder & travel to machine Lift plan/JHA Strip machine & load all equipment into tub Pack up/clean up & return ladder to w/shop Organise with safety & leading hand to load machine from go line in the morning	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
21-Oct-16	RAM Diesel	10612	$371.00	Reassemble trans pump Drain trans oil Remove screens & filter Diagnose major transmission failure Inform Scott & organise solution Order new trans screen & refit trans pump/tailshaft guards	
20-Oct-16	RAM Diesel	10612	$288.00	Begin diagnosis on trans issue Pumping oil out of breather/not selecting gears correctly Remove & inspect trans pump Found fine metal in system Pump has damage Clean up oil spill	
08-Oct-16	RAM Diesel	10529	$206.00	Pick up new trans hose from w/shop Travel to machine & remove old/fit new hose Dispose of waste oil & hoses Top up trans oil	
07-Oct-16	RAM Diesel	10517	$123.00	Diagnose leaking trans cooler hose Search past number on sis & order new one Organise transport to site from Hastings hose in Brisbane	
15-Sep-16	RAM Diesel	10494	$453.00	Organise franna, JHA lift plan Fit walkways, stairs, tub wings, mirrors & wiring Charge struts Organise & roder exhaust tip through Scott Go through site inspection list & make sure machine is ready	
13-Sep-16	D.Lundholm	10491	$308.75	Finish cleaning cab and disassembling for transport. Assist truckie load.	
13-Sep-16	Ted van	10492	$195.00	Complete all pre-hire paperwork, drop front struts for transport, remove tub guards for transport.	
12-Sep-16	DMR	10491	$260.00	Removed steps, repaired wiring on engine due to rubbing, checked over paperwork all OK, repaired wiring for front lights as it was damaged due to steps being bent.	
12-Sep-16	Hedgy		$97.50	Repair Cracks	
12-Sep-16	Ted Van	10492	$195.00	Repair handrail mounts on RHS and resecure handrail, start on customer pre hire paperwork.	
12-Sep-16	D.Lundholm	10491	$195.00	Clean cab. Start removing stairs and eye brows. Bring to site spec.	
12-Sep-16	G Wykes		$93.00	Repair cracks	
12-Sep-16	A Warren	10491	$286.00	Removed steps Repaired wiring on engine due to rubbing Checked over paperwork, all ok Repaired wiring for front lights as it was damaged due to steps being bent	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
09-Sep-16	Jacob Seymor	10491	$471.25	Dug dirt out and washed. Fitted LH light.	
08-Sep-16	Jacob Seymor	10491	$81.25	Pulled HMU out went to reseal. Didn't need to. Put back together.	
08-Sep-16	Kevin.M	10491	$276.25	Check E-stop wiring. Straighten front guards.	
08-Sep-16	Dane.L	10491	$633.75	Assist with front guards. All Bent. Replace LH lower driving light globe. Missing extinguisher, fit bracket and bent hand rails back. Fit extinguisher. Replaced reverse alarm. Calibrated tub down sensor to -4. Replaced o-rings at test ports on fuel filter. Replaced fuel tank E-stop. Replace front E-stop. Replace flashing light. Seat base ok. Retag extinguishers and fire supression. Replaced steer/brake pump hose o-rings. Fitted wheel chocks and fixed wheel chock bracket. Fixed side wall damage on pos 1. strut heights. Dash fault repaired.q	
08-Sep-16	C Ford		$187.00	Tray repairs	
07-Sep-16	Dane.L	10491	$373.75	500Hr service. Reverse alarm u/s. drained and replaced rear diff oil. Resealed diff bung. Reseal hyd/steer filter. UHF fitted.	
07-Sep-16	A. Warren	10491	$232.00	Completed more site paperwork Adjusted tub down rate with computer Repaired wiring under guard for lights	
07-Sep-16	C Ford		$625.00	Tray repairs	
05-Sep-16	A. Warren	10491	$178.00	Checkover & report faults Started to complete site & prehire paperwork	
31-May-16	Ted Van		$32.50	Replace LH mirror.	
16-May-16	Ted Van	10367	$32.50	Clear brake fault	
17-Mar-16	G Wykes		$312.00	Repair tub	
17-Mar-16	G Wykes		$310.00	Repair tub	
24-Feb-16	Ted Van	10292	$97.50	Replace faulty brake oil temp sender, replace suspect reverse alarm relay.	
23-Feb-16	Ted Van	10286	$65.00	Repair oil leak at steer hydraulic tank. Top up oil.	
19-Feb-16	Greg Mills		$97.50	Diagnose electrical fault found u/s relay. u/s brake temp sensor.	
18-Feb-16	Greg Mills	10259	$130.00	Disassemble electriacl fault with rear lights staying on	
16-Feb-16	Greg Mills	10259	$227.50	Brake fault, check pressures and sensors checked.	
10-Feb-16	Ted Van	10221	$32.50	Check over and start	
20-Jan-16	Greg Mills		$32.50	Replace mirror. Repair step.	
21-Dec-15	Greg Mills		$260.00	Fit new fan update, replace fittings on brake filters, fit filter housing assembly	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
18-Dec-15	Ted Van	10080	$130.00	Remove covers and belts, Drive machine back to go line. Remove fan hub assy, stub axle assembley	
14-Dec-15	Ted Van	10040	$227.50	Change enging oil and filters, change fuel filters, inner and outer air filters, change steer filters.	
11-Dec-15	Greg Mills	10039	$390.00	Carry out trans service, replace fan. Load up.	
10-Dec-15	Greg Mills	10039	$520.00	Start 1000hr service, remove fan, replace right hand lift cylinder bearing and pin.	
09-Dec-15	Greg Mills	10039	$195.00	Start to disassemble fan hub.,	
30-Nov-15	Tec Van	9902	$422.50	Remove broken bolt from fan hub repair bearings and reasemble fan hub with updated bolt and refit fan hub and fan hub assembley	
14-Nov-15	G Wykes		$125.04	Repair hungry boards	
10-Nov-15	Greg Mills	9696	$32.50	Replace glass in mirror.	
29-Oct-15	Greg Mills	9584	$130.00	Carry out 500Hr service as manfacturer recommends. Check over machine.	
28-Oct-15	Greg Mills	9520	$162.50	Adjust and oil rear struts, repair grease lines.	
07-Oct-15	G Wykes		$63.00	Repair tank brackets	
17-Sep-15	A Warren	9056	$160.88	Removed fan & hub. Broken fan retainer bolts	
17-Sep-15	Greg Mills	9053	$260.00	Replace bearings and bolt in fan hub and assemble	
16-Sep-15	A Warren	9032	$71.50	Checked & inflated tyres	
16-Sep-15	Greg Mills	9044	$390.00	Carry out 1000hr service as per manufactuer specs. Change eng oil, filters, fuel filters, inner and outer air cleaners, cab filters, trans oil and filters. Trans and converter screens, pilot filters. Remove RH exhaust manifold, remove broken stud, fit new manifold with new studs and gaskets.	No.8 Cylinder wet with oil.
14-Sep-15	Greg Mills	9009	$195.00	Reomve pos 3 wheel, fix up oring, pump up. Check for leaks fit to truck.	
11-Sep-15	Ted Van	9007	$65.00	Remove pos3 + pos6 tyres. Load pos3 on trailer.	
04-Sep-15	A Warren	8364	$143.00	Inspected & tensioned POS 5 & 6 rims	
02-Sep-15	A Warren	8344	$214.50	Changed out POS 6 tyre	
02-Sep-15	Greg Mills	8884	$130.00	Assemble fan hub and fit fan and shrodes	
01-Sep-15	Greg Mills	8884	$195.00	Disassamble fan drive. Fit fan pulley mount.	
01-Sep-15	Greg Mills		$0.00	fit new pulley mount	
21-Aug-15	A Warren		$178.75	Installed & checked steer ram	
20-Aug-15	A Warren	8713	$357.50	Attempted to remove steer ram gland nut. Couldn't remove. Removed complete cylinder. Full checkover & grease. Ordered parts. Repaired mudflaps.	
19-Aug-15	Greg Mills		$195.00	Try to dissasemble steer arm.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
06-Aug-15	Greg Mills	8563	$130.00	Change out POS 6 wheel and tension.	
06-Aug-15	Greg Mills	8563	$260.00	Carry out service, change engine oil/filters/fuel filters/air cleaners, top up steer oil/trans oil, adjust sensor for tub, pump up POS 6 tyre.	
29-Jul-15	A Warren	8423	$71.50	Top up engine oil & checkover	
16-Jul-15	Andrew	8294	$450.00	Changed out pos 5 tyre.	
13-Jul-15	Andrew		$150.00	adjusted tub down level. Greased. Completed 250 hr service.	
09-Jul-15	Andrew		$450.00	Change injector Orings. Change engine oil.	
07-Jul-15	Andrew		$487.50	Replaced injector Orings.	
06-Jul-15	Andrew		$75.00	Diagnosed leaking injector seals & ordered parts.	
03-Jul-15	Andrew	8218	$35.00	checkover & grease.	
01-Jul-15	Andrew	8189	$115.00	checked oil level. Topped up oil. Checkover & grease.	
29-Jun-15	Andrew		$150.00	inflated pos 1 tyre. Greased truck. Inspected & repaired check over wiring harness for remote shutdown.	
25-Jun-15	Andrew	8128	$150.00	calibrated transmission. Adjusted tub downshift.	
24-Jun-15	Andrew	8082	$337.50	removed & installed new RH upper lift cylinder bearing. Made up grease hoses for easier greasing.	
04-Jun-15	Andrew		$187.50	fitted hungry board.	
01-Jun-15	G Wykes		$195.00	Fit hungry boards.	
29-May-15	G Wykes		$130.00	repair hungry boards.	
29-May-15	Ted Van	8060	$243.75	Purge rear struts with oil, gas front and rear struts to spec height. Fit hungry boards.	
28-May-15	Andrew	8060	$356.25	gas up rear strut & oil. Finish off remainder of pre hire check.	
27-May-15	Kevin	8063	$438.75	Fit new inner tie rod ends assist wazza.	
27-May-15	Andrew	8060	$656.25	completed valve set. Repaired guards. Completed checkover. Assisted in tie rod end replacement. Checked tyre pressures.	
03-Mar-15	Greg Mills	8060	$130.00	Fit rear strut	
02-Mar-15	Greg Mills		$178.75	Assemble struts with new seal kit, fit new bearings.	
04-Dec-14	Greg Mills	8060	$65.00	Replace trans hose.	
06-Nov-14	Greg Mills	8060	$32.50	Drop struts on machine.	
14-Oct-14	Greg Mills	8060	$32.50	Check over machine and make up jobs list	
20-Sep-14	Millsy		$35.00	fit washers into rock ejector.	
09-Sep-14	Ted Van	8000	$227.50	Change inner and outer cab filters, replace steer oil and filters, replace transmission and torque converter oil and filter, check screens.	
06-Sep-14	Greg Mills	7972	$32.50	Replace inner and outer air cleaners	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
04-Sep-14	Greg Mills	7964	$130.00	Carry out engine service, change eng oil/filters/fuel filters, check over machine	
14-Aug-14	Ted Van	7932	$65.00	Top up engine oil	
07-Aug-14	Greg Mills		$32.50	Turn RH step upside down and fit chain across handrail.	
28-Jul-14	Ted Van	7826	$32.50	Top up hyd oil	
26-Jul-14	Greg Mills	7814	$130.00	Wait until truck di two loads, tighten wheel nuts	
25-Jul-14	Greg Mills	7814	$260.00	Repalce front step rubbers/brackets and step, stay with tyre fitter.	
21-Jul-14	Greg Mills	7795	$32.50	Fit fuse to flashing light wiring	
07-Jul-14	Greg Mills	7722	$32.50	Repalce trans filter	
07-Jul-14	Greg Mills	7722	$32.50	Fit flashing light to machine.	
04-Jul-14	G Wykes		$20.00	fab flashing light brackets.	
30-Jun-14	Ted Van	7698	$390.00	Escort Westrac and assist with chassis ECM fault diagnosing and testing, replace and calibrate chassis ECM.	
30-Jun-14	Westrac		$901.75	transmission ECM replacement - internal ECM fault. Travel to site, liaise with customer. Installed file into new ECM.	
28-Jun-14	Greg Mills	7698	$325.00	Calibrate transmission, check hoist fault, bypass wiring to solenoid, fitted old ECM, fault code gone - faulty ECM.	
27-Jun-14	Greg Mills	7698	$487.50	Fit new ECM, find last piece of gear in torque converter case, wait with Westrac while ECM is flashed, fit new trans pump/covers and hoses, fill with oil - start and test, code for hoist came up.	
26-Jun-14	Greg Mills	7697	$260.00	Check trans screen, remove trans pump, disassemble found broken gear.	
25-Jun-14	Greg Mills	7697	$130.00	Fit speed sensors - no good, swap ECM, fixed fault - still no drive, check trans pressures no pressure.	
24-Jun-14	Greg Mills	7697	$227.50	Check trans speed sensor fault, test all wiring	
18-Jun-14	Ted Van	7690	$260.00	Check stalling fault - had 3 faults electrical and fuel - organise GB auto for electrical fault, replace fuel filter, replace fuel/water separator, remove fuel line and blow out, reconnect fuel line and bleed and test run.	
17-Jun-14	Ted Van	7689	$97.50	Clean dirty contacts in e-stop, bypass e-stop, check remote shutdown switch.	
30-May-14	Greg Mills		$97.50	Fit steps and mirrors, gas up struts	
19-May-14	Josh Hewett	7618	$130.00	Remove hungry boards/check over, stamp rims, help millsy	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
19-May-14	Greg Mills	7618	$390.00	Check over, check tub dropping to front, adjusted rear tub switch, top up engine/steer oil, help remove hungry boards, fill out paperwork.	
19-May-14	RLW	7618	$130.00	Remove hungry boards.	
16-May-14	Ted Van	7618	$276.25	Replace tie rod/bearing on inside of RH steer cylinder.	
15-May-14	Shane	7618	$225.00	Replace damaged steps & ready machine for transport.	
13-May-14	Greg Mills	7618	$130.00	Replace grease line, check over machine	
03-May-14	Shane		$225.00	Carry out 500 hr service.	
29-Apr-14	Shane		$75.00	Straighten front steps & repair broken lights.	
25-Apr-14	Greg Mills	7395	$130.00	fit fan hub assembly. Fit new belts. Fit fan. Fit fan shrouds.	
24-Apr-14	Greg Mills	7395	$162.50	remove fan shrouds, remove fan & fan hub assembly, change batteries.	
20-Apr-14	Shane	7323	$262.50	reported that batteries caught fire on night shift. Check over machine. Found that battery bracket bolt had broken & the clamp had arc between pos term & mount bolts. Remove U/S parts & batteries. Remvoe required parts from P292 & fit to P301. Check, OK.	
09-Apr-14	Greg Mills	7147	$32.50	Check alarm disconnect tub up alarm	
08-Apr-14	Shane	7136	$412.50	fit 2 new tyres to steer. Jack up & check toe out, OK. Fit 2 old steer tyres to pos 3 & 4 toe. Replace odd tyre & puncture. Fit body up alarm.	
08-Apr-14	Greg Mills	7130	$487.50	Jack up machine fit new tyres to front, fit front tyres to POS 3 & 4 and tension, jack up front and check toe in and toe out.	
06-Apr-14	Shane	7102	$112.50	replace broken step rubbers.	
31-Mar-14	Greg Mills	7073	$65.00	Check brake due to operator complaining about a squealing noise.	
31-Mar-14	Shane	7048	$75.00	check seat belt, OK. Check front brakes squealing, OK..	
29-Mar-14	Greg Mills	7025	$97.50	Check wiper fault, found connecting rod came apart - tried to repair but needs to be replaced.	
28-Mar-14	Greg Mills	7023	$682.50	Carry out 1000hr service, change engine oil and filter/fuel filters/inner and outer air cleaners/cab filters/steer filters/brake filters/trans oil and filter, check trans screen, change steer and brake oil, change front hub oil, check final drive level and bung, check diff bung and level, change out front brake pads both sides, change fuel sender and fuel breather.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
23-Mar-14	Shane	6998	$262.50	Alt belt U/S. found idler on adjustor needs new bearings. Remove adjust from P292 & fit & fit new belt. Straighten LHF mudguard & fit mudflap. Clean out tub & check soft stop on lower, OK. Drill & tap out broken fire supression mount bolt.	
21-Mar-14	Shane	6992	$75.00	bleed up fuel system after it ran out of fuel.	
20-Mar-14	Shane	6988	$150.00	pos 2 tyre has large cut. Remove pos 6 tyre from P292 & fit to pos 2 on P301.	
18-Mar-14	Shane	6924	$150.00	replace both front steps.	
10-Mar-14	Shane		$75.00	Replace leaking Oring on RH steer cylinder.	
25-Feb-14	Shane	6827	$112.50	clear all defects. Replace torn steps & repair windscreen washers.	
22-Feb-14	Shane		$75.00	adjust LHS mirror & tighten.	
13-Feb-14	Andy William	6734	$227.50	Fit hungry boards and check over for service, change POS 3 tyre	
13-Feb-14	Shane		$300.00	Fit new Estop LHS. Re mount LHS head light. Assist with hungry boards. R & R leaking pos 2 tyre.	
13-Feb-14	G Wykes		$373.75	Fit hungry boards.	
11-Feb-14	G Wykes		$89.40	Fab hungry boards.	
10-Feb-14	G Wykes		$81.25	Fab hungry boards.	
07-Feb-14	G Wykes		$30.00	Fab hungry boards.	
06-Feb-14	G Wykes		$75.00	Fab hungry boards.	
05-Feb-14	G Wykes		$90.00	Fab hungry boards.	
04-Feb-14	G Wykes		$95.00	Fab hungry boards.	
30-Jan-14	Jono Pittin	6598	$260.00	Change engine oil/filters/fuel filters, blow cab filters out, replace engine air cleaners, check all plugs	
29-Jan-14	Shane	6581	$112.50	Check tyre pressures & pump up pos 3 tyre.	
24-Jan-14	Greg Mills	6528	$65.00	Fit all new steps to front of machine	
23-Jan-14	G Wykes		$10.00	fab hungry boards.	
22-Jan-14	G Wykes		$30.00	fab hungry boards.	
17-Jan-14	G Wykes		$81.50	fab hungry boards.	
16-Jan-14	G Wykes		$81.50	fab hungry boards.	
15-Jan-14	G Wykes		$81.50	fab hungry boards.	
14-Jan-14	G Wykes		$81.50	fab hungry boards.	
13-Jan-14	G Wykes		$32.50	Fab hungry boards.	
10-Jan-14	G Wykes		$97.50	repair cracks in access steps.	
30-Dec-13	Jono Pittin	6283	$65.00	Repair front access ladder and battery terminals	
29-Dec-13	Greg Mills	6271	$65.00	Pump up tyres	
23-Dec-13	Andy William	6248	$65.00	Remove drive step remove LH step fit step from spare machine.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
11-Dec-13	Andy William	6165	$65.00	POS 3 low air pressure.	
08-Nov-13	Andy William		$422.50	Fit exhaust turbo wrap, separate grease lines at RH lift cylinder, sepo out isolate push behind grill, tap out and fit bolt to handrail, replace globe in headlight, fit reverse alarm, replace plastic fuel bowl, gas struts.	
06-Nov-13	Shane	5980	$300.00	set up tooling & re oil & gas up struts.	
13-Oct-13	WMS - T		$600.00	strip down for transport	
06-Oct-13	WMS - T	5973	$600.00	2000 hr service. No coolant changed of diff.	
01-Sep-13	WMS	5841	$300.00	Carry out 250 hour service	
17-Aug-13	WMS - Tom	5797	$300.00	250 hr service.	
03-Aug-13	WMS	5716	$100.00	checked twoway operation. Repaired handpiece.	
06-Jul-13	WMS	5580	$100.00	checked tyre pressures & adjusted.	
24-Jun-13	WMS	5485	$700.00	change out 2way mic & diagnose noise, turbo blown. Carry out 500 hr service.	
23-May-13	WMS		$45.00	Top up engine oil.	
17-May-13	WMS	5259	$360.00	Carry out 250 hour APS.	
31-Mar-13	WMS	5016	$400.00	carry out 250 hr service.	
22-Mar-13	WMS	5262	$100.00	repair door window latch a scone cover loose.	
14-Mar-13	WMS	4881	$200.00	adjusted tub up speed. Full machine check.	
14-Feb-13	WMS		$100.00	fitted wheel chock. Checked machines.	
08-Jan-13	Mark Unwin	4636	$237.50	retardant low on gas. Aquired dry nitrogen & fittings & recharged. Re-certified fire ext's.	
15-Dec-12	WMS	4628	$495.00	rebuild fan hub & fit back up with new belts.	
13-Dec-12	WMS	4628	$297.00	remove fan hub.	
11-Dec-12	Mark Unwin	4623	$712.50	make up cut grease hoses, grease manifolds & drilled brackets. Fitted 90o fittings to steering system & assembled grease system to truck. Zip tied hoses to tie rods.	
03-Dec-12	mark unwin	4577	$23.50	extinguishers.	
14-Nov-12	WMS	4460	$297.00	shut down code- internal Estop fault. Change out Estop , Test OK.	
13-Nov-12	Mark Unwin	4458	$85.00	Fit fuel bowl to primary filter, tested E-stops both outside not working.	
12-Nov-12	Mark Unwin	4558	$85.00	Cahnge engine oil and filters, greased truck and checked over, carried out brake performance checks OK, checked emergency steer OK, checked lighting and horn systems OK.	
08-Nov-12	Mark Unwin	4433	$21.25	Pre-start check, POS 5 tyre tread damage.	
28-Oct-12	WMS	4359	$90.00	Machine Check	
24-Oct-12	Mark Unwin	4367	$85.00	Tyre report	
16-Oct-12	WMS	4316	$495.00	Carry out 250hr service - oil,fuel,airs.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
13-Oct-12	Mark Unwin	4293	$71.25	Fit extra bolt to nosecone and manipulate bolts tight, due for 250hr service notified nathan about service.	
09-Oct-12	Mark Unwin	4315	$93.50	cyl head 6-8 weeping coolant & wheel chocks missing.	
02-Oct-12	Mark Unwin	4232	$42.50	Attend go-line and fit strut boot POS 5/6.	
28-Sep-12	WMS		$720.00	Press in new strut bearings, reassemble and fill with oil and charge up to spec.	
27-Sep-12	WMS		$495.00	Remove strut + strip down.	
23-Sep-12	WMS-A		$95.00	repaired broken extinguisher bracket.	
20-Sep-12	Mark Unwin	4177	$285.00	250hr service & strut boots.	
11-Sep-12	Mark Unwin	4123	$142.50	Onspected & reported leaking Pos 5 strut.	
22-Aug-12	WMS	4045	$190.00	finish off strut build. Note had seized top pin.	
21-Aug-12	WMS	4892	$332.50	test for no start. Starter test faulty. Change out starter P288.	
21-Aug-12	WMS	4045	$190.00	cont rebuilding strut.	
20-Aug-12	WMS	4045	$570.00	remove RH rear strut & linish up rod as has marks on it. Reassemble with new seals.	
15-Aug-12	WMS		$190.00	test for slamming of body down, snub pos needs adjusting.	
03-Aug-12	WMS	3988	$360.00	Carry out final touches and hand over to abi for use.	
02-Aug-12	WMS		$270.00	Cont build 773F's ready to hand over.	
01-Aug-12	WMS		$225.00	Fit up walkways and rock deflectors.	
07-Jun-12	WMS		$297.50	Load up foot steps and any other items and place in tub.	
05-Jun-12	WMS		$255.00	Prepare hand rails and paint yellow.	
04-Jun-12	WMS		$170.00	Fit up camera rear and in cab and cables, fit up air cleaners and safety stickers	
25-May-12	WMS		$680.00	Fit up guards and mudflaps etc, fit up rear wheels and rock ejectors.	

Service History Report for - P301 Caterpillar 773F Rigid DT

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
15-Sep-22	Shane		$300.00	Change out pos 5 & 6 tyres	
15-Sep-22	Shane		$400.00	R+R pos 4 & 6 tyres	
14-Sep-22	Dayle		$600.00	Refit rear strut	
12-Sep-22	Michael		$400.00	Remove rear strut RHS	
11-Sep-22	Michael		$200.00	Finish 250hr service	
11-Sep-22	Rhys	13690	$250.00	250hr service	
04-Sep-22	Sean	13658	$150.00	Replace rear struts beeper bolts	
31-Aug-22	Shane	13609	$200.00	Fit new dogbone retainer bolt & washers & tighten	
26-Aug-22	Jack	13556	$200.00	500hr service	
22-Aug-22	Sean	13942	$150.00	Window locks broken, repair & ziptie up	
22-Aug-22	Shane		$100.00	Fit new mirror	
18-Aug-22	Sean	13393	$150.00	Broken light	
04-Aug-22	Shane		$100.00	Fit D/S mirror	
03-Aug-22	Shane		$1,000.00	Fix hungry boards	
29-Jul-22	Shane		$110.00	Repair panel damage	
29-Jul-22	Jack		$110.00	Oil leak Reverse camera	
29-Jul-22	Rhys	13163	$220.00	Defect repair & panel damage	
29-Jul-22	Sean Grieve	13163	$55.00	Rock injector	
28-Jul-22	Jack	13163	$110.00	Rock injector	
28-Jul-22	Alex	13180	$288.75	Remove, straighten and install rock ejector Ran up machine Check turbo fault	
26-Jul-22	Sean Grieve	13109	$110.00	UHF fault	
24-Jul-22	Sean	13109	$400.00	1000hr service	
24-Jul-22	Shane	13091	$110.00	LHR loswer start bolt broken Romove bolt from P1204 & fit to P301 Tighten. Ok.	
24-Jul-22	Xander	13109	$165.00	1000hr service	
23-Jul-22	Sean	13081	$150.00	UHF fault	
22-Jul-22	Xander	13081	$55.00	Fuel & grease Check over machine	
20-Jul-22	Xander	13054	$55.00	Grease and fuel Inspect machine	
07-Jul-22	Sean	12889	$100.00	C/O UHF and rewire power supply	
07-Jul-22	Jack	12889	$200.00	C/O UHF and rewired power supply	
06-Jul-22	Sean	12889	$100.00	UHF issues with power supply	
01-Jul-22	Sean	12845	$200.00	Upgrade lights and run piggy wire for high beam	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
25-Jun-22	Sean	12871	$150.00	C/O steering column	
24-Jun-22	Lain	12871	$165.00	Removed steering column guards Tested strut on steering column Ordered new part	
14-Jun-22	Lain	25821	$82.50	Topped up engine and hydraulic oil Pumped up PoS 2 tyre	
22-May-22	Lain		$247.50	Bolted up hole that was made in body and welded up tabs hold wing on	
21-May-22	Lain	12754	$288.75	Oxyed out hole in body wall wings Ground down old welds	
19-May-22	Shane		$150.00	Adjust rear struts LHR low	
13-May-22	Alex	16675	$247.50	Top up engine Grease machine Re-seal trans hose	
13-May-22	Lain	12673	$123.75	Went back to workshop to retreive engine and hyd oil then topped up machine and blew out filters	
16-Mar-22	Lain		$330.00	Lifted body of machine then secured it at the rear points Tested solinoids with pressure gauge Removed top of transmission, removed solinoid 4 and replaced o-rings in the valve then did the same to solinoid 6 & 7 Put gearbox back together and tested	
15-Mar-22	Laine	12396	$88.50	Gathered nitrogen kit component from around site workshop to conduct regas on front struts	
14-Mar-22	Lain	12396	$412.50	Adjusted mirrors into correct place Check over of lights and emergency equipment Removed steps, walk ways and steps from the back of the vehicle Lifted walk ways up with the crane then bolted to the vehicle, also lifted and bolted roof guards to the body of the truck	
05-Mar-22	Shane		$343.75	Diagnose electrical fault, found plug on side of cabin with no seals and full of dirt, clean up and test - OK.	
05-Mar-22	Greg M		$275.00	Diagnose no start, check wiring, test power to and from ECM, foud dirty connector into cab, change plug and test - OK. Fit covers.	
04-Mar-22	Shane		$110.00	Machine wont start after washing, found plug at tranny missing seals and full of mud. Clean and reassemble check - no good.	
04-Mar-22	Lleyton		$165.00	Wash bay.	
04-Mar-22	Harry D		$165.00	weld up cracks on fix bottle	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
04-Mar-22	Shane		$110.00	Machine wont start, found plug at trany missing seals and full of mud, clean and reassemble, no good	
02-Mar-22	Harry D		$151.25	Weld fish plate on and paint it.	
01-Mar-22	Lleyton		$27.50	Install seat cover.	
01-Mar-22	Harry D		$563.75	Weld hole in exhaust, weld wear plates in back of dump truck and weld cracks up.	
28-Feb-22	Harrison	12393	$308.00	Install tracker	
28-Feb-22	Zumbo		$165.00	Remove broken bolts from front grill, remove and replace brake charge valve.	
28-Feb-22	Craig	12392	$41.25	Fit RH front mud flap, make up new plate for mud flap mount.	
28-Feb-22	Harry D		$178.75	Make new exhaust and folded up plate to go over hole in exhaust.	
24-Feb-22	Craig	12392	$398.75	Clean hydaulic tank, replace sight glasses, o rings, grommets, refit return screen and assemble hyd tank. Fill oil. Removed front rock deflectors. Investigate brake pressure fault. Order seal kit for charge valve.	
24-Feb-22	Zumbo		$836.00	Remove walk way and eyebrows from truck Resend hyd tank and check oils Brake change pressure issue, inspect and order parts	
23-Feb-22	Zumbo		$836.00	Replace upper hoist bearings Inspect hyd leak for cracked pipe Clean for repair Remove decals from tub	
23-Feb-22	Clay		$522.50	Rebuild steer cylinder, fit ball stud in cylinder, remove old plant ID stickers, fit new ones Grease machine, put steering column together	
22-Feb-22	Clay	12392	$522.50	Assist putting a frame together, assist with strut pins, fit tranny hoses, replace new hoses, drop tranny/torque converter oil, fill up, pop RHS steer cylinder to reseal	
22-Feb-22	Zumbo		$836.00	Install A Frame and hosing Install drive shaft and tension Replace rear strut lower bearings and install Replace dog bone bearings and insall	
21-Feb-22	Zumbo		$748.00	Replace steering link bushes and pin. Pull A Frame back and replace bearing Make tool to tension retaining nut.	
21-Feb-22	Clay		$261.25	Detail cab, pull steering column apart to see movement, fit steer cylinder hoses, fit new grease line, assist with a frame bearing removed, clean a frame surfaces	
19-Feb-22	Clay	12392	$275.00	Clean grease around ball studs Remove old ball studs Replace with new ones Remove hose from steer cyl	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
18-Feb-22	Zumbo		$836.00	Jack up and support truck to remove A Frame Remove rear struts and dog bone Remove trans/hyd lines and drive shaft Remove nuts from ball studs and pop out of frame	
18-Feb-22	Clay	12392	$467.50	Assist popping ball studs 500HR service tag fire supression/existinguishers Ensure wiper/washer operation works Assist pusahing strut pinas out Remove hoses to access a frame Clean work area	
17-Feb-22	Zumbo		$88.00	Check over for repairs	
23-Jan-22	John C	12391	$82.50	Demobe	
14-Nov-21	JohnCiappara	12264	$55.00	Fit P Clamps to brake lines Pos 3/4	
08-Nov-21	Jackson	12260	$82.50	Top up hyd oil Check tyre pressures	
05-Nov-21	Jackson	12254	$55.00	Replace front step rubbers	
23-Oct-21	JohnCiappara	12192	$220.00	Weld hungry board	
21-Oct-21	JohnCiappara	12172	$55.00	Repair fuel sender wires	
04-Oct-21	Shane O	12087	$110.00	Diagnose electrical fault Repair E-Stop	
30-Sep-21	Jonn C	12082	$137.50	Mobilise	
13-Jul-21	Duncan	11812	$137.50	Complete FFP Inspection Adjust RH mirrors & tighten bolts Tighten bolts on access wires	
30-Jun-21	A Mills	11775	$165.00	Pull sensor out of P1137. Block off hole pull one out of P301 and replace with new one	
29-Jun-21	A Mills	11770	$55.00	Hyd leak on valve. Pull one off other truck with flat tyre	
29-Jun-21	John C	11770	$55.00	Diagnose accumulator pressure sensor leak	
26-Jun-21	John C	11759	$165.00	250hr service Check tyre pressures	
10-Jun-21	B Swan	11649	$55.00	FFP checks & repairs	
08-Jun-21	B Swan		$137.50	Replace hoist pump hyd line	
08-Jun-21	John	11615	$137.50	Hoist pump hose	
07-Jun-21	B Swan		$137.50	Remove hois pump hyd line (blown on top of fill)	
03-Jun-21	John		$55.00	Fit LH mirror	
28-May-21	Duncan	11545	$302.50	Complete 500hr Service Check turbo's Replace RH front headlight line	
28-May-21	John	11545	$55.00	500hr service	
12-May-21	B Swan	11460	$135.00	Top engine oil, repair seat and free up. Repair RH mirrors and mount.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
10-May-21	B Swan	11428	$55.00	Carry out diagnostic checks and change all machines to 40km p/h	
09-May-21	Duncan Steve	11428	$220.00	Repaired front step. Welded cracks around fire supression.	
03-May-21	Duncan	11402	$110.00	Replaced leaking hose from brake changing valve to hoist valve.	
28-Apr-21	John	11352	$55.00	Top up engine oil	
27-Apr-21	Duncan	11398	$55.00	Fitted bottom seat belt latch. Checked operation of latch	
18-Apr-21	John	11305	$385.00	250hr service Reseal trany cooler hose fitting Check brake accumulator pressures Try to find slow brake pressure build up.	
17-Apr-21	Duncan	11292	$82.50	Not building brake pressure. Connected pressure gague to confirm Pull retarter lever stomped on brake. Began to build pressure. Further diagnosis required	
17-Apr-21	John	11300	$27.50	Grease, Engine oil	
13-Apr-21	John	11259	$55.00	Quarterly	
02-Apr-21	A Mills	11203	$55.00	Replace step and fill engine oil	
01-Apr-21	John	11181	$27.50	Grease	
30-Mar-21	A Mills	11165	$27.50	Grease & check over machine & tyres	
29-Mar-21	A Mills	11155	$55.00	Top up engine oil Inspect for leak	
03-Mar-21	John	11050	$55.00	Check brake solenoids	
03-Mar-21	A Mills		$55.00	Check accumulator pressure	
25-Feb-21	A Mills		$41.25	Grease plant	
22-Feb-21	John	11017	$41.25	Check over Grease	
19-Feb-21	John	11015	$55.00	Clean P-Brake solenoid	
17-Feb-21	John	11012	$55.00	Check P-brake problem	
10-Feb-21	John	10995	$55.00	Grease	
07-Feb-21	A Mills		$110.00	Gas struts, strut covers, fix mirrors, move together	
07-Feb-21	John		$107.25	Gas struts, fit strut covers, fit mirrors, mobilise Grease Check over	
02-Feb-21	Ted Van		$82.50	Clear NPM FFP Actions	
29-Jan-21	Jackson	10986	$275.00	North Parkes FFP Sleeve hosing Fix washers & replace wiper Check lights, Fit reflective tape Denso tape starter solenoid terminals	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
28-Jan-21	Connor		$110.00	Prep for painting Put prime coat on	
28-Jan-21	Jackson	10986	$55.00	North Parkes FFP Sleeve hosing with croc sleeve	
27-Jan-21	Connor		$123.75	Prep hand rails	
15-Jan-21	Jackson		$110.00	Fit hand rails	
14-Jan-21	Jackson		$192.50	North Parkes FFP Sleeve hosing	
14-Jan-21	Lindsay		$151.25	Re arrange tyres	
14-Jan-21	Zumbo	10986	$82.50	Fit handrails to machine	
13-Jan-21	Zumbo	10986	$481.25	Remove handrails for paint Burst protection Battery lead covers	
12-Jan-21	KyleMusgrave		$330.00	Extor repair Mud flap repair Crack repair Paint Install light	
07-Jan-21	KyleMusgrave		$302.50	Front bumper repair / replacement	
17-Dec-20	Zumbo		$247.50	Cover fuel lines in burst protection	
16-Dec-20	Zumbo		$82.50	Cover fuel lines in burst protection & repair front grill bolts	
03-Dec-20	Ted Van	10985	$371.25	Check & tag extinguishers Replace batteries - clean out battery box Check against site requirements Fit safety stickers Clean up bay	
02-Dec-20	Ted Van	10985	$412.50	Reseal Starter motor Diagnose multiple leaks in fire supression system Reseal fitting in cab Repair charge point & ground level Replace schroder valve Replace cab & ground level gauges Remove bu…. & clean out Check & tag extinguishers	
02-Dec-20	Will Paull	10984	$330.00	Fit tie rods & new pins Assist with starter motor Replace tranny filter Replace hyd filters	
01-Dec-20	Will Paull	10984	$495.00	Replace cylinder steer pins Remove tie rods to replace pins Replace oil in diff & reseal drain bung	
30-Nov-20	Ted Van	10985	$110.00	Continue 1000hr service	
30-Nov-20	Will Paull	10984	$440.00	Reseal brake filter housing Reseal lock up solinoid Fit brake cooler hose Get parts ordered	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
28-Nov-20	Will Paull	10984	$220.00	1000hr service Lock up valve removed and cleaned	
28-Nov-20	Ted Van	10985	$55.00	Start on 1000hr service	
24-Nov-20	Shane	10984	$82.50	Jump start machine Check over and do up defect list	
24-Nov-20	Greg Mills		$55.00	Jump start Check over	
19-Aug-20	Lindsay		$55.00	Jumpstart and drive to wash bay.	
16-Jan-18	Matt		$272.25	Check engine. Check pressures. Do injector test, all ok.	
20-Dec-17	Mathew	10632	$130.00	Remove front step remove broken studs fit new steps.	
19-Dec-17	Mathew	10623	$195.00	Remove and replace hyd hose on gear box.	
05-Sep-17	Ted Van	10617	$325.00	Fit new exhaust tip. Replace bearing and race in HMU, reseal/reassemble and refit.	
04-Sep-17	Ted Van	10617	$260.00	Remove HMU clean and strip, found bearing race borken - organise parts.	
04-Sep-17	James Mills		$65.00	C/O blown bulbs and start to remove HMU	
04-Sep-17	J Ciappara	10617	$260.00	Replace P1 & P2 brake pads. Replace rear brake cooling hose.	
24-Nov-16	John. C	10614	$260.00	Wash	
23-Nov-16	Ted Van	10614	$162.50	Finish fitting drive shaft covers. Refit torque convertor / transmission scavenge hoses. Replace transmsission filter, refill oil and top up while running.	
22-Nov-16	Ted Van	10613	$227.50	Fit torque convertor scavenge pump. Refit driveshaft and top covers.	
16-Nov-16	Dane		$130.00	Assist fit transmission and fit all hoses for transmission.	
16-Nov-16	Greg Mills		$617.50	Assemble trans, clean torane connection housing, fit trans	
15-Nov-16	Greg Mills		$617.50	Assemble transmission, clean out control valve	
14-Nov-16	Greg Mills		$617.50	Assemble transmission	
11-Nov-16	Greg Mills		$65.00	Start to assemble transfer case	
07-Nov-16	Greg Mills		$617.50	Disassemble trans	
04-Nov-16	Dane.L	10614	$130.00	Assist remove transmission	
04-Nov-16	Greg Mills		$195.00	Remove and split transmission	
28-Oct-16	RAM Diesel	10612	$412.00	Organise franna Load ladder & travel to machine Lift plan/JHA Strip machine & load all equipment into tub Pack up/clean up & return ladder to w/shop Organise with safety & leading hand to load machine from go line in the morning	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
21-Oct-16	RAM Diesel	10612	$371.00	Reassemble trans pump Drain trans oil Remove screens & filter Diagnose major transmission failure Inform Scott & organise solution Order new trans screen & refit trans pump/tailshaft guards	
20-Oct-16	RAM Diesel	10612	$288.00	Begin diagnosis on trans issue Pumping oil out of breather/not selecting gears correctly Remove & inspect trans pump Found fine metal in system Pump has damage Clean up oil spill	
08-Oct-16	RAM Diesel	10529	$206.00	Pick up new trans hose from w/shop Travel to machine & remove old/fit new hose Dispose of waste oil & hoses Top up trans oil	
07-Oct-16	RAM Diesel	10517	$123.00	Diagnose leaking trans cooler hose Search past number on sis & order new one Organise transport to site from Hastings hose in Brisbane	
15-Sep-16	RAM Diesel	10494	$453.00	Organise franna, JHA lift plan Fit walkways, stairs, tub wings, mirrors & wiring Charge struts Organise & roder exhaust tip through Scott Go through site inspection list & make sure machine is ready	
13-Sep-16	D.Lundholm	10491	$308.75	Finish cleaning cab and disassembling for transport. Assist truckie load.	
13-Sep-16	Ted van	10492	$195.00	Complete all pre-hire paperwork, drop front struts for transport, remove tub guards for transport.	
12-Sep-16	DMR	10491	$260.00	Removed steps, repaired wiring on engine due to rubbing, checked over paperwork all OK, repaired wiring for front lights as it was damaged due to steps being bent.	
12-Sep-16	Hedgy		$97.50	Repair Cracks	
12-Sep-16	Ted Van	10492	$195.00	Repair handrail mounts on RHS and resecure handrail, start on customer pre hire paperwork.	
12-Sep-16	D.Lundholm	10491	$195.00	Clean cab. Start removing stairs and eye brows. Bring to site spec.	
12-Sep-16	G Wykes		$93.00	Repair cracks	
12-Sep-16	A Warren	10491	$286.00	Removed steps Repaired wiring on engine due to rubbing Checked over paperwork, all ok Repaired wiring for front lights as it was damaged due to steps being bent	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
09-Sep-16	Jacob Seymor	10491	$471.25	Dug dirt out and washed. Fitted LH light.	
08-Sep-16	Jacob Seymor	10491	$81.25	Pulled HMU out went to reseal. Didn't need to. Put back together.	
08-Sep-16	Kevin.M	10491	$276.25	Check E-stop wiring. Straighten front guards.	
08-Sep-16	Dane.L	10491	$633.75	Assist with front guards. All Bent. Replace LH lower driving light globe. Missing extinguisher, fit bracket and bent hand rails back. Fit extinguisher. Replaced reverse alarm. Calibrated tub down sensor to -4. Replaced o-rings at test ports on fuel filter. Replaced fuel tank E-stop. Replace front E-stop. Replace flashing light. Seat base ok. Retag extinguishers and fire supression. Replaced steer/brake pump hose o-rings. Fitted wheel chocks and fixed wheel chock bracket. Fixed side wall damage on pos 1. strut heights. Dash fault repaired.q	
08-Sep-16	C Ford		$187.00	Tray repairs	
07-Sep-16	Dane.L	10491	$373.75	500Hr service. Reverse alarm u/s. drained and replaced rear diff oil. Resealed diff bung. Reseal hyd/steer filter. UHF fitted.	
07-Sep-16	A. Warren	10491	$232.00	Completed more site paperwork Adjusted tub down rate with computer Repaired wiring under guard for lights	
07-Sep-16	C Ford		$625.00	Tray repairs	
05-Sep-16	A. Warren	10491	$178.00	Checkover & report faults Started to complete site & prehire paperwork	
31-May-16	Ted Van		$32.50	Replace LH mirror.	
16-May-16	Ted Van	10367	$32.50	Clear brake fault	
17-Mar-16	G Wykes		$312.00	Repair tub	
17-Mar-16	G Wykes		$310.00	Repair tub	
24-Feb-16	Ted Van	10292	$97.50	Replace faulty brake oil temp sender, replace suspect reverse alarm relay.	
23-Feb-16	Ted Van	10286	$65.00	Repair oil leak at steer hydraulic tank. Top up oil.	
19-Feb-16	Greg Mills		$97.50	Diagnose electrical fault found u/s relay. u/s brake temp sensor.	
18-Feb-16	Greg Mills	10259	$130.00	Disassemble electriacl fault with rear lights staying on	
16-Feb-16	Greg Mills	10259	$227.50	Brake fault, check pressures and sensors checked.	
10-Feb-16	Ted Van	10221	$32.50	Check over and start	
20-Jan-16	Greg Mills		$32.50	Replace mirror. Repair step.	
21-Dec-15	Greg Mills		$260.00	Fit new fan update, replace fittings on brake filters, fit filter housing assembly	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
18-Dec-15	Ted Van	10080	$130.00	Remove covers and belts, Drive machine back to go line. Remove fan hub assy, stub axle assembley	
14-Dec-15	Ted Van	10040	$227.50	Change enging oil and filters, change fuel filters, inner and outer air filters, change steer filters.	
11-Dec-15	Greg Mills	10039	$390.00	Carry out trans service, replace fan. Load up.	
10-Dec-15	Greg Mills	10039	$520.00	Start 1000hr service, remove fan, replace right hand lift cylinder bearing and pin.	
09-Dec-15	Greg Mills	10039	$195.00	Start to disassemble fan hub.,	
30-Nov-15	Tec Van	9902	$422.50	Remove broken bolt from fan hub repair bearings and reasemble fan hub with updated bolt and refit fan hub and fan hub assembley	
14-Nov-15	G Wykes		$125.04	Repair hungry boards	
10-Nov-15	Greg Mills	9696	$32.50	Replace glass in mirror.	
29-Oct-15	Greg Mills	9584	$130.00	Carry out 500Hr service as manfacturer recommends. Check over machine.	
28-Oct-15	Greg Mills	9520	$162.50	Adjust and oil rear struts, repair grease lines.	
07-Oct-15	G Wykes		$63.00	Repair tank brackets	
17-Sep-15	A Warren	9056	$160.88	Removed fan & hub. Broken fan retainer bolts	
17-Sep-15	Greg Mills	9053	$260.00	Replace bearings and bolt in fan hub and assemble	
16-Sep-15	A Warren	9032	$71.50	Checked & inflated tyres	
16-Sep-15	Greg Mills	9044	$390.00	Carry out 1000hr service as per manufactuer specs. Change eng oil, filters, fuel filters, inner and outer air cleaners, cab filters, trans oil and filters. Trans and converter screens, pilot filters. Remove RH exhaust manifold, remove broken stud, fit new manifold with new studs and gaskets.	No.8 Cylinder wet with oil.
14-Sep-15	Greg Mills	9009	$195.00	Reomve pos 3 wheel, fix up oring, pump up. Check for leaks fit to truck.	
11-Sep-15	Ted Van	9007	$65.00	Remove pos3 + pos6 tyres. Load pos3 on trailer.	
04-Sep-15	A Warren	8364	$143.00	Inspected & tensioned POS 5 & 6 rims	
02-Sep-15	A Warren	8344	$214.50	Changed out POS 6 tyre	
02-Sep-15	Greg Mills	8884	$130.00	Assemble fan hub and fit fan and shrodes	
01-Sep-15	Greg Mills	8884	$195.00	Disassamble fan drive. Fit fan pulley mount.	
01-Sep-15	Greg Mills		$0.00	fit new pulley mount	
21-Aug-15	A Warren		$178.75	Installed & checked steer ram	
20-Aug-15	A Warren	8713	$357.50	Attempted to remove steer ram gland nut. Couldn't remove. Removed complete cylinder. Full checkover & grease. Ordered parts. Repaired mudflaps.	
19-Aug-15	Greg Mills		$195.00	Try to dissasemble steer arm.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
06-Aug-15	Greg Mills	8563	$130.00	Change out POS 6 wheel and tension.	
06-Aug-15	Greg Mills	8563	$260.00	Carry out service, change engine oil/filters/fuel filters/air cleaners, top up steer oil/trans oil, adjust sensor for tub, pump up POS 6 tyre.	
29-Jul-15	A Warren	8423	$71.50	Top up engine oil & checkover	
16-Jul-15	Andrew	8294	$450.00	Changed out pos 5 tyre.	
13-Jul-15	Andrew		$150.00	adjusted tub down level. Greased. Completed 250 hr service.	
09-Jul-15	Andrew		$450.00	Change injector Orings. Change engine oil.	
07-Jul-15	Andrew		$487.50	Replaced injector Orings.	
06-Jul-15	Andrew		$75.00	Diagnosed leaking injector seals & ordered parts.	
03-Jul-15	Andrew	8218	$35.00	checkover & grease.	
01-Jul-15	Andrew	8189	$115.00	checked oil level. Topped up oil. Checkover & grease.	
29-Jun-15	Andrew		$150.00	inflated pos 1 tyre. Greased truck. Inspected & repaired check over wiring harness for remote shutdown.	
25-Jun-15	Andrew	8128	$150.00	calibrated transmission. Adjusted tub downshift.	
24-Jun-15	Andrew	8082	$337.50	removed & installed new RH upper lift cylinder bearing. Made up grease hoses for easier greasing.	
04-Jun-15	Andrew		$187.50	fitted hungry board.	
01-Jun-15	G Wykes		$195.00	Fit hungry boards.	
29-May-15	G Wykes		$130.00	repair hungry boards.	
29-May-15	Ted Van	8060	$243.75	Purge rear struts with oil, gas front and rear struts to spec height. Fit hungry boards.	
28-May-15	Andrew	8060	$356.25	gas up rear strut & oil. Finish off remainder of pre hire check.	
27-May-15	Kevin	8063	$438.75	Fit new inner tie rod ends assist wazza.	
27-May-15	Andrew	8060	$656.25	completed valve set. Repaired guards. Completed checkover. Assisted in tie rod end replacement. Checked tyre pressures.	
03-Mar-15	Greg Mills	8060	$130.00	Fit rear strut	
02-Mar-15	Greg Mills		$178.75	Assemble struts with new seal kit, fit new bearings.	
04-Dec-14	Greg Mills	8060	$65.00	Replace trans hose.	
06-Nov-14	Greg Mills	8060	$32.50	Drop struts on machine.	
14-Oct-14	Greg Mills	8060	$32.50	Check over machine and make up jobs list	
20-Sep-14	Millsy		$35.00	fit washers into rock ejector.	
09-Sep-14	Ted Van	8000	$227.50	Change inner and outer cab filters, replace steer oil and filters, replace transmission and torque converter oil and filter, check screens.	
06-Sep-14	Greg Mills	7972	$32.50	Replace inner and outer air cleaners	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
04-Sep-14	Greg Mills	7964	$130.00	Carry out engine service, change eng oil/filters/fuel filters, check over machine	
14-Aug-14	Ted Van	7932	$65.00	Top up engine oil	
07-Aug-14	Greg Mills		$32.50	Turn RH step upside down and fit chain across handrail.	
28-Jul-14	Ted Van	7826	$32.50	Top up hyd oil	
26-Jul-14	Greg Mills	7814	$130.00	Wait until truck di two loads, tighten wheel nuts	
25-Jul-14	Greg Mills	7814	$260.00	Repalce front step rubbers/brackets and step, stay with tyre fitter.	
21-Jul-14	Greg Mills	7795	$32.50	Fit fuse to flashing light wiring	
07-Jul-14	Greg Mills	7722	$32.50	Repalce trans filter	
07-Jul-14	Greg Mills	7722	$32.50	Fit flashing light to machine.	
04-Jul-14	G Wykes		$20.00	fab flashing light brackets.	
30-Jun-14	Ted Van	7698	$390.00	Escort Westrac and assist with chassis ECM fault diagnosing and testing, replace and calibrate chassis ECM.	
30-Jun-14	Westrac		$901.75	transmission ECM replacement - internal ECM fault. Travel to site, liaise with customer. Installed file into new ECM.	
28-Jun-14	Greg Mills	7698	$325.00	Calibrate transmission, check hoist fault, bypass wiring to solenoid, fitted old ECM, fault code gone - faulty ECM.	
27-Jun-14	Greg Mills	7698	$487.50	Fit new ECM, find last piece of gear in torque converter case, wait with Westrac while ECM is flashed, fit new trans pump/covers and hoses, fill with oil - start and test, code for hoist came up.	
26-Jun-14	Greg Mills	7697	$260.00	Check trans screen, remove trans pump, disassemble found broken gear.	
25-Jun-14	Greg Mills	7697	$130.00	Fit speed sensors - no good, swap ECM, fixed fault - still no drive, check trans pressures no pressure.	
24-Jun-14	Greg Mills	7697	$227.50	Check trans speed sensor fault, test all wiring	
18-Jun-14	Ted Van	7690	$260.00	Check stalling fault - had 3 faults electrical and fuel - organise GB auto for electrical fault, replace fuel filter, replace fuel/water separator, remove fuel line and blow out, reconnect fuel line and bleed and test run.	
17-Jun-14	Ted Van	7689	$97.50	Clean dirty contacts in e-stop, bypass e-stop, check remote shutdown switch.	
30-May-14	Greg Mills		$97.50	Fit steps and mirrors, gas up struts	
19-May-14	Josh Hewett	7618	$130.00	Remove hungry boards/check over, stamp rims, help millsy	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
19-May-14	Greg Mills	7618	$390.00	Check over, check tub dropping to front, adjusted rear tub switch, top up engine/steer oil, help remove hungry boards, fill out paperwork.	
19-May-14	RLW	7618	$130.00	Remove hungry boards.	
16-May-14	Ted Van	7618	$276.25	Replace tie rod/bearing on inside of RH steer cylinder.	
15-May-14	Shane	7618	$225.00	Replace damaged steps & ready machine for transport.	
13-May-14	Greg Mills	7618	$130.00	Replace grease line, check over machine	
03-May-14	Shane		$225.00	Carry out 500 hr service.	
29-Apr-14	Shane		$75.00	Straighten front steps & repair broken lights.	
25-Apr-14	Greg Mills	7395	$130.00	fit fan hub assembly. Fit new belts. Fit fan. Fit fan shrouds.	
24-Apr-14	Greg Mills	7395	$162.50	remove fan shrouds, remove fan & fan hub assembly, change batteries.	
20-Apr-14	Shane	7323	$262.50	reported that batteries caught fire on night shift. Check over machine. Found that battery bracket bolt had broken & the clamp had arc between pos term & mount bolts. Remove U/S parts & batteries. Remvoe required parts from P292 & fit to P301. Check, OK.	
09-Apr-14	Greg Mills	7147	$32.50	Check alarm disconnect tub up alarm	
08-Apr-14	Shane	7136	$412.50	fit 2 new tyres to steer. Jack up & check toe out, OK. Fit 2 old steer tyres to pos 3 & 4 toe. Replace odd tyre & puncture. Fit body up alarm.	
08-Apr-14	Greg Mills	7130	$487.50	Jack up machine fit new tyres to front, fit front tyres to POS 3 & 4 and tension, jack up front and check toe in and toe out.	
06-Apr-14	Shane	7102	$112.50	replace broken step rubbers.	
31-Mar-14	Greg Mills	7073	$65.00	Check brake due to operator complaining about a squealing noise.	
31-Mar-14	Shane	7048	$75.00	check seat belt, OK. Check front brakes squealing, OK..	
29-Mar-14	Greg Mills	7025	$97.50	Check wiper fault, found connecting rod came apart - tried to repair but needs to be replaced.	
28-Mar-14	Greg Mills	7023	$682.50	Carry out 1000hr service, change engine oil and filter/fuel filters/inner and outer air cleaners/cab filters/steer filters/brake filters/trans oil and filter, check trans screen, change steer and brake oil, change front hub oil, check final drive level and bung, check diff bung and level, change out front brake pads both sides, change fuel sender and fuel breather.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
23-Mar-14	Shane	6998	$262.50	Alt belt U/S. found idler on adjustor needs new bearings. Remove adjust from P292 & fit & fit new belt. Straighten LHF mudguard & fit mudflap. Clean out tub & check soft stop on lower, OK. Drill & tap out broken fire supression mount bolt.	
21-Mar-14	Shane	6992	$75.00	bleed up fuel system after it ran out of fuel.	
20-Mar-14	Shane	6988	$150.00	pos 2 tyre has large cut. Remove pos 6 tyre from P292 & fit to pos 2 on P301.	
18-Mar-14	Shane	6924	$150.00	replace both front steps.	
10-Mar-14	Shane		$75.00	Replace leaking Oring on RH steer cylinder.	
25-Feb-14	Shane	6827	$112.50	clear all defects. Replace torn steps & repair windscreen washers.	
22-Feb-14	Shane		$75.00	adjust LHS mirror & tighten.	
13-Feb-14	Andy William	6734	$227.50	Fit hungry boards and check over for service, change POS 3 tyre	
13-Feb-14	Shane		$300.00	Fit new Estop LHS. Re mount LHS head light. Assist with hungry boards. R & R leaking pos 2 tyre.	
13-Feb-14	G Wykes		$373.75	Fit hungry boards.	
11-Feb-14	G Wykes		$89.40	Fab hungry boards.	
10-Feb-14	G Wykes		$81.25	Fab hungry boards.	
07-Feb-14	G Wykes		$30.00	Fab hungry boards.	
06-Feb-14	G Wykes		$75.00	Fab hungry boards.	
05-Feb-14	G Wykes		$90.00	Fab hungry boards.	
04-Feb-14	G Wykes		$95.00	Fab hungry boards.	
30-Jan-14	Jono Pittin	6598	$260.00	Change engine oil/filters/fuel filters, blow cab filters out, replace engine air cleaners, check all plugs	
29-Jan-14	Shane	6581	$112.50	Check tyre pressures & pump up pos 3 tyre.	
24-Jan-14	Greg Mills	6528	$65.00	Fit all new steps to front of machine	
23-Jan-14	G Wykes		$10.00	fab hungry boards.	
22-Jan-14	G Wykes		$30.00	fab hungry boards.	
17-Jan-14	G Wykes		$81.50	fab hungry boards.	
16-Jan-14	G Wykes		$81.50	fab hungry boards.	
15-Jan-14	G Wykes		$81.50	fab hungry boards.	
14-Jan-14	G Wykes		$81.50	fab hungry boards.	
13-Jan-14	G Wykes		$32.50	Fab hungry boards.	
10-Jan-14	G Wykes		$97.50	repair cracks in access steps.	
30-Dec-13	Jono Pittin	6283	$65.00	Repair front access ladder and battery terminals	
29-Dec-13	Greg Mills	6271	$65.00	Pump up tyres	
23-Dec-13	Andy William	6248	$65.00	Remove drive step remove LH step fit step from spare machine.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
11-Dec-13	Andy William	6165	$65.00	POS 3 low air pressure.	
08-Nov-13	Andy William		$422.50	Fit exhaust turbo wrap, separate grease lines at RH lift cylinder, sepo out isolate push behind grill, tap out and fit bolt to handrail, replace globe in headlight, fit reverse alarm, replace plastic fuel bowl, gas struts.	
06-Nov-13	Shane	5980	$300.00	set up tooling & re oil & gas up struts.	
13-Oct-13	WMS - T		$600.00	strip down for transport	
06-Oct-13	WMS - T	5973	$600.00	2000 hr service. No coolant changed of diff.	
01-Sep-13	WMS	5841	$300.00	Carry out 250 hour service	
17-Aug-13	WMS - Tom	5797	$300.00	250 hr service.	
03-Aug-13	WMS	5716	$100.00	checked twoway operation. Repaired handpiece.	
06-Jul-13	WMS	5580	$100.00	checked tyre pressures & adjusted.	
24-Jun-13	WMS	5485	$700.00	change out 2way mic & diagnose noise, turbo blown. Carry out 500 hr service.	
23-May-13	WMS		$45.00	Top up engine oil.	
17-May-13	WMS	5259	$360.00	Carry out 250 hour APS.	
31-Mar-13	WMS	5016	$400.00	carry out 250 hr service.	
22-Mar-13	WMS	5262	$100.00	repair door window latch a scone cover loose.	
14-Mar-13	WMS	4881	$200.00	adjusted tub up speed. Full machine check.	
14-Feb-13	WMS		$100.00	fitted wheel chock. Checked machines.	
08-Jan-13	Mark Unwin	4636	$237.50	retardant low on gas. Aquired dry nitrogen & fittings & recharged. Re-certified fire ext's.	
15-Dec-12	WMS	4628	$495.00	rebuild fan hub & fit back up with new belts.	
13-Dec-12	WMS	4628	$297.00	remove fan hub.	
11-Dec-12	Mark Unwin	4623	$712.50	make up cut grease hoses, grease manifolds & drilled brackets. Fitted 90o fittings to steering system & assembled grease system to truck. Zip tied hoses to tie rods.	
03-Dec-12	mark unwin	4577	$23.50	extinguishers.	
14-Nov-12	WMS	4460	$297.00	shut down code- internal Estop fault. Change out Estop , Test OK.	
13-Nov-12	Mark Unwin	4458	$85.00	Fit fuel bowl to primary filter, tested E-stops both outside not working.	
12-Nov-12	Mark Unwin	4558	$85.00	Cahnge engine oil and filters, greased truck and checked over, carried out brake performance checks OK, checked emergency steer OK, checked lighting and horn systems OK.	
08-Nov-12	Mark Unwin	4433	$21.25	Pre-start check, POS 5 tyre tread damage.	
28-Oct-12	WMS	4359	$90.00	Machine Check	
24-Oct-12	Mark Unwin	4367	$85.00	Tyre report	
16-Oct-12	WMS	4316	$495.00	Carry out 250hr service - oil,fuel,airs.	

Service Date	Tech Name	Service Hrs	Labour $	Service Notes	Next Service Notes
13-Oct-12	Mark Unwin	4293	$71.25	Fit extra bolt to nosecone and manipulate bolts tight, due for 250hr service notified nathan about service.	
09-Oct-12	Mark Unwin	4315	$93.50	cyl head 6-8 weeping coolant & wheel chocks missing.	
02-Oct-12	Mark Unwin	4232	$42.50	Attend go-line and fit strut boot POS 5/6.	
28-Sep-12	WMS		$720.00	Press in new strut bearings, reassemble and fill with oil and charge up to spec.	
27-Sep-12	WMS		$495.00	Remove strut + strip down.	
23-Sep-12	WMS-A		$95.00	repaired broken extinguisher bracket.	
20-Sep-12	Mark Unwin	4177	$285.00	250hr service & strut boots.	
11-Sep-12	Mark Unwin	4123	$142.50	Onspected & reported leaking Pos 5 strut.	
22-Aug-12	WMS	4045	$190.00	finish off strut build. Note had seized top pin.	
21-Aug-12	WMS	4892	$332.50	test for no start. Starter test faulty. Change out starter P288.	
21-Aug-12	WMS	4045	$190.00	cont rebuilding strut.	
20-Aug-12	WMS	4045	$570.00	remove RH rear strut & linish up rod as has marks on it. Reassemble with new seals.	
15-Aug-12	WMS		$190.00	test for slamming of body down, snub pos needs adjusting.	
03-Aug-12	WMS	3988	$360.00	Carry out final touches and hand over to abi for use.	
02-Aug-12	WMS		$270.00	Cont build 773F's ready to hand over.	
01-Aug-12	WMS		$225.00	Fit up walkways and rock deflectors.	
07-Jun-12	WMS		$297.50	Load up foot steps and any other items and place in tub.	
05-Jun-12	WMS		$255.00	Prepare hand rails and paint yellow.	
04-Jun-12	WMS		$170.00	Fit up camera rear and in cab and cables, fit up air cleaners and safety stickers	
25-May-12	WMS		$680.00	Fit up guards and mudflaps etc, fit up rear wheels and rock ejectors.	