014-3
NOV

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 25861
Date: 08/05/2026

Completed Date: 08/06/2026

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 08/05/2026
Entered By: Valerie

Labor

Category	Description	Technician Notes	Mechanic	Amount
Shop Inspection Check / A...	08/04 repair 7-way power cord	Resolved by Daniel 08/06		.00
Shop Inspection Check / A...	08/06 no start	Resolved by Daniel 08/06		.00
Labor -Jones Journeyman	TASK #	Diagnose 7-way plug damage on trailer cord. Assign Raimand to replace damaged plug/still shorts remaining/schedule truck into shop	Randy Donaldson	20.26
Labor - Jones Apprentice	TASK #	Truck 7-wire cap plug replaced	Raimand Noronha	45.79
Labor - Jones Apprentice	TASK #	Air up/move in unit. Trouble shoot 7-way issue. Replace main 7-way. Open up junction box, re-pair pulled out/corroded wires. Put all back together. Test/move unit out	Daniel Massner	106.84

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
15-730, Male 7 Wire Plug		1.00	12.19	12.19
15-720, Light Socket 7 Wire Plug [Female]		1.00	14.40	14.40
15-740, Rubber boot 7 pin female		1.00	2.36	2.36

Total Labor	172.89
Total Parts	28.95
Total Returns	.00
Total Sublet	.00
Shop Supplies	17.29
Invoice Total	219.13

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 25829
Date: 07/31/2026

Completed Date: 07/31/2026

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 07/31/2026
Entered By: Valerie

Labor

Category	Description	Technician Notes	Mechanic	Amount
Shop Inspection Check / A...	07/31 - Leaky fuel cap	Resolved by Daniel 07/31		.00
Labor - Jones Apprentice	TASK #	Install leak defender on unit outside	Daniel Massner	15.26

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
LEA-CAP-001, Leak Defender [Replacement Fuel Cap]		1.00	350.17	350.17

Total Labor	15.26
Total Parts	350.17
Total Returns	.00
Total Sublet	.00
Shop Supplies	1.53
Invoice Total	366.96

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 25654
Date: 07/02/2026

Completed Date: 07/20/2026

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 07/02/2026
Entered By: Valerie

Labor

Category	Description	Technician Notes	Mechanic	Amount
CVIP	07/02 - CVIP CV8713572	Resolved by Randy 07/02		.00
ORDER PARTS / SUBLET	Brake drums 15" x2	FGI F3543447		.00
ORDER PARTS / SUBLET	Track bar	SIF 001-259379		.00
RE-TORQUE REQUIRED	100-150 km from 136284 km all tires			.00
Labor - Jones Apprentice	TASK #	Put booster pack on unit	Daniel Massner	15.26
Labor - Jones Apprentice	TASK #	Air up / move into shop / bring booster pack in	Daniel Massner	15.26
Labor - Jones Apprentice	TASK #	Continue cvip inspection from months' back-order parts	Daniel Massner	91.58
Labor - Jones Apprentice	TASK #	Jack up other side / remove wheels for inspection / replace drums for cvip / take meter mats for cvip - order parts	Daniel Massner	91.58
Labor - Jones Apprentice	TASK #	Put boost pack back on - start/air up unit/move over to the pit - look up/measure for track bar/find part - removing shock mount - drill out rusted in bolts - ream out holes - set into place - talk with randy about unit	Daniel Massner	122.10
Labor -Jones Journeyman	TASK #	Cvip & paperwork / consult with mechanic regarding repairs / confirm repairs ad file paperwork with e-facility	Randy Donaldson	162.10
Labor -Jones Journeyman	TASK #	Look up parts for 932 whip liners, order via parts request via daniel	Randy Donaldson	40.53
Labor -Jones Journeyman	TASK #	Locate proper rivet nuts for whipline track bar mount / supply to mechanic	Randy Donaldson	20.26
ORDER PARTS / SUBLET	Batteries Core Credits	SIF 001-259766 CREDIT		.00
Labor - Jones Apprentice	TASK #	Drill holes for air line holder/7 way holder, install holder, move wrap for clamp / re-wrap, install spring hanger, hanger lines, remove broken mudflap hanger, fix marker lights x2 , remove / install license plate / insall all decals, air up / move unit out, lub up / free up brake pad / inspec top lights / lub up bolts / charge out parts	Daniel Massner	167.89
ORDER PARTS / SUBLET	GVW/Tare decals	MPrint 16427		.00
Labor - Jones Apprentice	TASK #	Drill out rust, bolt down shock bracket, bolt on shock, make up mud flap/bracket, start removing battery holder bracket	Daniel Massner	45.79
Labor - Jones Apprentice	TASK #	Removed battery holder, removed battery cables, removed batteries, wash down acid sock mat, spray acid neutralizer in battery box, grind down all battery cables, six up 2 cables/put new ends, tap down cables to match and place battery in battery box	Daniel Massner	106.84
Labor - Jones Apprentice	TASK #	Wire in all batteries/spray down to protect, test/put cover back on, bolt down driver seat, tap out threads for strap holders, install strap holders, seat belt buckles x4	Daniel Massner	122.10

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Apprentice	TASK #	Drill holes/practice run on riv-nut/measure/mark, install/drill/install rivnuts, install handle bar on unit	Daniel Massner	76.31
Labor - Jones Apprentice	TASK #	Put binder/reg/new CVIP sticker on	Daniel Massner	15.26
Shop Inspection Check / A...	07/09 - install samsara	Resolved by Daniel 07/09		.00
Shop Inspection Check / A...	07/10 - inside detail required	Resolved by Raimond 07/11		.00
Shop Inspection Check / A...	07/10 Tina (Verbal) - cab shock squeak	Resolved by Daniel 07/15 - see activity		.00
Shop Inspection Check / A...	07/10 Tina (Verbal) - Brake pedal is extremely difficult to engage.	Resolved by Daniel 07/15		.00
Labor - Jones Apprentice	TASK #	Install Samsara/camera	Daniel Massner	45.79
Labor - Jones Apprentice	TASK #	Truck inside cleaned & outside night, left side old decals removed & truck inventory work in progress	Raimand Noronha	335.78
Labor - Jones Apprentice	TASK #	Air up unit/wait for trailer/SIF - Dude to move/move into shop	Daniel Massner	30.53
Labor - Jones Apprentice	TASK #	Clean out broke pedal/LUB up/greased all 5-cam tubes and slacks	Daniel Massner	30.53
Labor - Jones Apprentice	TASK #	Adjust brakes/do brake app to move s-cams	Daniel Massner	30.53
RE-TORQUE COMPLETED		Resolved by Raimond 07/20		.00
Shop Inspection Check / A...	07/10 Tina (Verbal) - while accelerating over 80km/hr the truck started to roll coal - lots of black smokeTASK #	Not Resolved - see notes		.00
Labor - Jones Apprentice	TASK #	Truck all tyres, retorque	Raimand Noronha	45.79

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
PHL 15-041, Plug & Gladhand Bracket [Stow Away]		1.00	30.60	30.60
177.3005 / 9820-2, TENDER KIT 16" DOUBLE WITH TEC CLAMP		1.00	34.12	34.12
45583, AMBER LED W/ 180 BULLETS & BEZEL		1.00	37.96	37.96
QS-31T12, Battery 1000CCA Group 31T		4.00	109.49	437.96

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: F3543447 Supplier: Fort Garry Industries Ltd. (Edmonton)	BRAKE DRUM-15.00X4.00 10HL 11.25 BC 8.78	1.00	355.10	355.10
	Invoice: 16427 Supplier: Mprint Sign and Print Solutions Inc.	GVW/TARE decals	1.00	45.86	45.86
	Invoice: 001-259379 Supplier: SIF Superiors Industrial Frictions Ltd.	Tracker Slider Bar 38in	1.00	34.56	34.56
	Invoice: 001-259766 Supplier: SIF Superiors Industrial Frictions Ltd.	core return	1.00	-144.00	-144.00

CVIP

Total Labor	1,611.81
Total Parts	540.64
Total Returns	.00
Total Sublet	291.52
Shop Supplies	190.33
Invoice Total	2,634.30

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 25198
Date: 03/26/2026

Completed Date: 04/20/2026

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 03/26/2026
Entered By: Valerie

Labor

Category	Description	Technician Notes	Mechanic	Amount
Shop Inspection Check / A...	Get running, check over everything. Retorque notice on previous WO but truck likely hasn't moved since.	Not resolved. added to excel sheet. see CVIP line regarding previous retorque info		100.00
Labor -Jones Journeyman	TASK #	assist brining unit into shop and list of repairs	Randy Donaldson	20.26
Labor - Jones Apprentice	TASK #	hook up booster / try and start unit	Daniel Massner	45.79
Labor - Jones Apprentice	TASK #	put booster on 932	Daniel Massner	15.26
Labor - Jones Apprentice	TASK #	got unit runnign / air up / put away booster / move into shop	Daniel Massner	30.53
Labor - Jones Apprentice	TASK #	inspect / write up all defects on unit	Daniel Massner	61.05
Labor - Jones Apprentice	TASK #	put on booster pack / air up and move unit over pit	Daniel Massner	15.26
Labor -Jones Journeyman	TASK #	Removed Pedestal Assembly Center Supports, Grab Bars And Removed Side By Side And Removed Install New Beacon Lights	Randy Donaldson	60.79
Labor - Jones Apprentice	TASK #	Removed booster air up / move to bay 1 / sweep up / clean up	Daniel Massner	45.79
Labor - Jones Apprentice	TASK #	Truck left & right side old decal removed	Raimand Noronha	61.05
CVIP	CVIP Expired	Not resolved. CVIP requires all wheels off (not always but in this case) - new retorque notice will be required.		.00
ORDER PARTS / SUBLET	brakeshoe kits w/ hardware + $54 core each ($108 on cores)	SIF 001-250644		.00
Labor - Jones Apprentice	TASK #	Look over work sheet. Jack up axle #3 / removed seized wheels / drums / brake shoose. Inspect brakes performance	Daniel Massner	106.84
Labor - Jones Apprentice	TASK #	Get prepare CVIP doc. LVB up axle #2 wheel nuts / order parts / lift axle #2 up / removed wheels / drums / start taking. Measurements for CVIP doc	Daniel Massner	106.84
Labor - Jones Apprentice	TASK #	Clean up all metal / take out all new drums / measure for CVIP. Grind down posts for brake shoes. Build up new shoes. Install new shoes on axle #3. Wire wheel down all wheel studs on axle 3, 2 R.H.S. Put new drums on R.H.S Axle #3,2. Clean up work space	Daniel Massner	122.10
Labor -Jones Journeyman	TASK #	Oversee Daniel on 932	Randy Donaldson	20.26
Labor -Jones Journeyman	TASK #	CVIP inspection renew with mechanic in charge of repairs	Randy Donaldson	81.05
Labor -Jones Journeyman	TASK #	Complete CVIP inspection - assist with rear drives	Randy Donaldson	81.05
Labor -Jones Journeyman	TASK #	Clean wheel studs and install - temp moved outside, has to come back in, wheels off, not going anywhere	Zorro Golubic	60.79
Labor -Jones Journeyman	TASK #	Install and clean rust on aluminum rims & wheels on rear axles	Zorro Golubic	81.05
Labor -Jones Journeyman	TASK #	Install wheels on drive / remove stands	Zorro Golubic	121.58
Labor -Jones Journeyman	TASK #	Torque rear 2 axles / adjust brakes	Zorro Golubic	60.79

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor -Jones Journeyman	TASK #	Charge and boost truck - load test batteries - to be replaced	Randy Donaldson	81.05
Labor -Jones Journeyman	TASK #	review with mechanic on further repairs required when truck comes back into shop	Randy Donaldson	40.53
ORDER PARTS / SUBLET	unit decals and door decals	Mr. Signs 2253		.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
3600AX, 16.50X7.00 BRAKE DR		4.00	74.00	296.00

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 001-250644 Supplier: SIF Superiors Industrial Frictions Ltd.	brake shoe kit	1.00	138.28	138.28
	Invoice: 001-250644 Supplier: SIF Superiors Industrial Frictions Ltd.	core	1.00	108.00	108.00
	Invoice: 2253 Supplier: Mr. Signs & Print	decals	1.00	99.00	99.00
	Invoice: 001-251412 Supplier: SIF Superiors Industrial Frictions Ltd.	core return	1.00	-108.00	-108.00

Total Labor	1,419.71
Total Parts	296.00
Total Returns	.00
Total Sublet	237.28
Shop Supplies	165.70
Invoice Total	2,118.69

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 22367
Date: 10/27/2023

Completed Date: 09/23/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 10/27/2023
Entered By: Aleda

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [10.26.23 William] Fuel cap is still leaking			100.00
Labor - Jones Trucks	DVIR [10.26.23 William] Right side round convex mirror will not stay in place shifts upwards as it looks at the sky	This is nonsense! It is tight enough!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.26.23 Willaim] Low beams are not bright enough as its hard to see the road, need brighter headlights	Mount all used beams back in ! Start to work on PS. high beam repair!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.26.23 William] Air line has a small crack in line going to the air shutoff valve as I am not able to find anyway to fix this issue as ,y Air pressure is reaching 150 psi	Gear Head - Invoice# 24708		100.00
Labor - Jones Trucks	DVIR [10.27.23 William] Loosing Air faster when brakes are applied to slow down a hill	There is no significant air loss/decay more then the application pressure! Small leak found under the claster!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.28.23 William] Had to stop and add a gallon of antifreeze as the check engine light came on	That was because the many coolant leaks!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.28.23 William] Blower will not switch over to windshield	Yes it does! It isn`t blowing so strong over there anymore but all work just fine!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.30.23 William] The exhaust pipe is leaking by the drivers door	Removed the heat shield and fixed up the cracked/broken lower pipe of the stack with a clamp! Readjust the brackets of the heat shield and mounted that back (fight with the rusted bolts)!	Laszlo Sarkozi	125.00
Labor - Jones Trucks	DVIR [10.30.23 William] Belts are squealing even at high idle or driving down the highway, need to be tightened.	Remove the/a used tensioner and belt, mach up the belt with a new tensioner and mount them on!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [10.30.23 William] Truck looses air once truck is shut off			100.00
Labor - Jones Trucks	DVIR [10.30.23. William] Need a set of single chains and the triples fixed as a couple links broke off	Not important anymore!	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Inland - altenator and tensioner	Inland 50606YTP	Service Writer	.00
ORDER PARTS / SUBLET	James Bailey to do the work and put in Altenator and Tensioner	Invoice# 2022062	Service Writer	.00
Labor - Jones Trucks	DVIR [10.31.23 William] Idler pulley is starting to go as its starting to sieze up	Checked out, nothing wrong with it!	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Gearhead - airline at governor broke off at nut, cut airline the rest of the way and re/re nut and furrel	Gearhead 24708	Service Writer	.00
ORDER PARTS / SUBLET	DGN - Driveline, bumper, engine - loosing collant. radiator repair. Cab - checked and fixed vent controller had to remove the panels in the cab.	DGN 2672	Service Writer	.00
Labor - Jones Trucks	Coolant leaks at lower rad. hose/conn. and at/from coolant filter housing...	Check out all the coolant leaks and make plan to fix them up!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Engine front support bushings worn out bad, engine is moving side to side	Inspect the front end of the engine, open up some coolant leak/support bushings issue! Order parts in for next repairs!	Laszlo Sarkozi	100.00

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	Coolant leaks at lower rad. hose/conn. and at/from coolant filter housing...	Drain the coolant and inspect the gasket of the rad. down pipe flange1	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Inland - credit. returned parts	Inland CM50606YTP	Service Writer	.00
Labor - Jones Trucks	DS. rear axles missing dust shields	Clean up all the coolant down pipes for reinstallation! Move the truck around! Removed the wheels from rear drive axle DS., removed the broken dust shield bolts and mount a new pair of dust shield on! put the brake shoes and everything else back on axle!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DS. front drive missing dust shield	Completed with other jobs	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Rear/tail lights bracket falling off	Removed the wheels from DS. front drive to remove the broken dust shield! Removed and fixed up the tail lights bracket and mounted back on!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Engine front support bushings worn out bad, engine is moving side to side	Replaced those bushings!	Laszlo Sarkozi	50.00
Labor - Jones Trucks	Engine front support bushings worn out bad, engine is moving side to side	removal of parts / down pipe / remove coolant	Daniel Massner	125.00
Labor - Jones Trucks	Coolant leaks at lower rad. hose/conn. and at/from coolant filter housing...	Mount the pipes back on with new rad. gasket and silicon hoses, reposition the heaters feed line on oil pan...	Laszlo Sarkozi	150.00
ORDER PARTS / SUBLET	Ed Ken - Tensioner, motor mount kit	EW 02NP750755	Service Writer	.00
ORDER PARTS / SUBLET	Ed Ken - Rad cap	EW 02NP751068	Service Writer	.00
ORDER PARTS / SUBLET	Ed Ken - Spring for light	EW 02NP753892	Service Writer	.00
Labor - Jones Trucks	DS. front drive missing dust shield	installed new dust shield/ wheels on	Daniel Massner	50.00
Labor - Jones Trucks	Engine front support bushings worn out bad, engine is moving side to side	installed new bushing for front engine support	Daniel Massner	75.00
Labor - Jones Trucks	coolant leaks	spotting unit and filling with coolant testing and movedback	Daniel Massner	125.00
Labor - Jones Trucks	RHS. high beam out of order	Inspect beams and whole wire harness up into the frame junction! Open up the wire issue and fix it up, replaced the high beam of the PS. and mount, insulate everything back on! Mount up the front spot light properly too!	Laszlo Sarkozi	175.00
Labor - Jones Trucks	Smaller repair jobs, complaint checks !	Inspected all the drivert complaint and...	Laszlo Sarkozi	100.00
Labor - Jones Trucks	One of the aux. lights out on PS.	Start to work on wires	Laszlo Sarkozi	25.00
Unit In/Out Shop - Truck / ...	Move unit in or out of the shop/washbay	Finalize repairs and park the truck outside!	Laszlo Sarkozi	25.00
Labor - Jones Trucks	PS running light out 3 one down	put on new light	Daniel Massner	25.00
ORDER PARTS / SUBLET	Ed Kenworth - rad cap, gasket	EW 02NP752662		.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
6122215, Paccar Belt 12 Ribs 2215mm		1.00	100.99	100.99
89440DYC, TENSIONER BELT		1.00	288.36	288.36
805143N, Kit		1.00	83.51	83.51
562.U3105SS, Exhaust Band Clamp Performed 5"		1.00	9.53	9.53

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 2672 Supplier: DGN Truck & Trailer Repair Ltd.	DGN - Driveline, bumper, engine - loosing coilant. radiator repair. Cab - checked and fixed vent controller had to remove the panels in the cab.	1.00	2,212.00	2,212.00
	Invoice: 24708 Supplier: Gearheads Truck Repair	Gearhead - airline at governor broke off at nut, cut airline the rest of the way and re/re nut and furrel	1.00	79.82	79.82

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 50606YTP Supplier: Inland Kenworth	alternator and tensioner belt	1.00	1,254.14	1,254.14
	Invoice: CM50606YTP Supplier: Inland Kenworth	credit for alternator and tensioner belt	1.00	-1,254.14	-1,254.14
	Invoice: 2022062 Supplier: James Bailey Auto	used fan belt tensioner and installation	1.00	235.00	235.00
	Invoice: 02NP750755 Supplier: Edmonton Kenworth Ltd.	tensioner, motor mount kit,	1.00	489.75	489.75
	Invoice: 02NP751068 Supplier: Edmonton Kenworth Ltd.	cap-radiator 15 PSI	1.00	15.68	15.68
	Invoice: 34712995 Supplier: Manitoulin Transport Inc.	part delivery wrong	1.00	-133.38	-133.38
	Invoice: 34712995 (2) Supplier: Manitoulin Transport Inc.	wrong delivery	1.00	133.38	133.38
	Invoice: 02NP753892 Supplier: Edmonton Kenworth Ltd.	housing with springs	1.00	27.12	27.12
	Invoice: 02NP752662 Supplier: Edmonton Kenworth Ltd.	cap-radiator, gasket radiator lower,	1.00	73.30	73.30

Total Labor	2,750.00
Total Parts	482.39
Total Returns	.00
Total Sublet	3,132.67
Shop Supplies	588.27
Invoice Total	6,953.33

PAT'S DRIVELINE
14715-116 AVENUE
EDMONTON, AB T5M 3E8
780-453-5105 Fax:780-452-3555
www.patsdriveline.com

INVOICE

Order #	2990935-00
Invoice Date	10/24/2023
Customer #	99901
P.O. #	(none)
Taken By	Lester Eleseo
Sales Rep	HOUSE ACCOUNT - 1000
Ship Point	PAT'S DRIVELINE - EDMONTON N/S
Ship Via	CUST P/U
Shipped Date	10/24/23
SRO #	250849-00
Terms	CASH

Instructions

Bill To	JONES TRANSPORTATION 12455 - 153 ST SUITE 201 EDMONTON, AB T5V 1E4
Ship To	JONES TRANSPORTATION 12455 - 153 ST SUITE 201 EDMONTON, AB T5V 1E4

Remit to: 15729-118 AVENUE
EDMONTON, AB T5V 1B7
ATTN: ACCOUNTS RECEIVABLE

Line	Product/ Description	Quantity Order	Quantity Backordered	Quantity Ship	Qty UM	Net Price/ Unit	Unit	Amount (Net)
1	**Repair Item** **REAR DRIVESHAFT** INBOARD SLIP D/S REPAIR SW REPAIR LINE USE ONLY! **Problem :** 1810 H/R SLIP SHAFT INSPECT AND ESTIMATE *MATCH SAMPLE END YOKE AND SUPPLY ONE* **Work Performed :** U-JOINT IS BRINELLED, TUBING IS DENTED / GROOVED. WELD YOKE EARS ARE WORN OUT AND SPRUNG. EXCESSIVE PLAY BETWEEN SLIP AND SPLINE. COMPLETE REPLACEMENT RECOMMENDED. DRIVESHAFT TO MEASURE: 43-1/4" CENTER OF U-JOINT TO CENTER OF U-JOINT COLLAPSED/ 45.00" CENTER OF U-JOINT TO CENTER OF U-JOINT IN RUNNING POSITION BALANCE DRIVESHAFT Payment type : \							

Date: 10.24.23 UNIT # 932.
Received By:
WO# or PO# 22296
Approved By:

Lines Total

PAT'S DRIVE LINE SPECIAL
14715 - 116 AVENUE
EDMONTON, AB, T5M 3E8
7804535105
- SALE
Manager: 66831
MID: 5845284
TID: 001 REF#: 00000002
Batch #: 297001 RRN: 00000002
10/24/23 11:40:27
APPR CODE: 008372G
AMOUNT $1,710.90
APPROVED
I AGREE TO PAY ABOVE TOTAL AMOUNT IN ACCORDANCE WITH CARD ISSUER'S AGREEMENT
(MERCHANT AGREEMENT IF CREDIT VOUCHER)
RETAIN THIS COPY FOR STATEMENT VERIFICATION
THANK YOU! / MERCI!
CUSTOMER COPY

Total	1629.43
GST/HST	81.47
Payment	1710.90
Invoice Total	0.00

****
PARTS LISTED ARE
ORIGINAL EQUIPM
TRADEMARKS OR
INFORMATIONAL
****

RECEIVED _____

** I acknowledge receipt of the above goods/services and that I have read and understand the warranty policy and end use acknowledgement stated on the back of this invoice.

PST Lic#: GST Reg#: 119476596RT0001

DGN TRUCK & TRAILER REPAIR LTD.
7710, YELLOWHEAD TRAIL
EDMONTON AB T5B 1G3
7808634113
dgntrucktrailerrepair@gmail.com
GST/HST Registration No.:
710012295RT0001

INVOICE

BILL TO
JONES TRANSPORTATION
INC
KW
KMS 1309628
VIN 970338
UNIT 932

INVOICE # 2672
DATE 10/20/2023
DUE DATE 10/20/2023
TERMS Due on receipt

ACTIVITY	QTY	RATE	AMOUNT
Engine BRING N UNIT FOR LOOSING COOLANT.UNABLE TO HOLD THE PRESSURE.REMOVED THE OIL PAN.RAD NECK IS WORN OUT ABND ALSO COOLANT LEAK AT BOTTOM.TALKED TO CUSTOMER RAD NEED TO BE REPAIRED.REMOVED THE RAD AFTER DRAINING THE COOLANT.HAD TO REMOVE THE PLUMBING AND HOOD.SEND OUT RAD.GOT BACK AFTER REPAIR.INSTALLED THE RAD.PUT COOLANT BACK IN.FIXED COOLANT LEAK AT TURBO ACTUATOR.PRESSURE TEST FOR 4 HOURS.DO NOT SEE ANY LEAK.INSTALLED PAN BACK WITH NEW GASKET.PUT NEW OIL IN AND REPLACED THE OIL FILTER AND FUEL FILTER.	10	110.00	1,100.00
cab COMPLAINT FOR VENT AIR STAEDY AT ONE POINT.CHECKED AND FIXED VENT CONTROLLER HAD TO REMOVE THE PANELS IN THE CAB.	1	110.00	110.00

ACTIVITY	QTY	RATE	AMOUNT
~~DRIVELINE~~ CHECKED AND FOUND REAR U JOINT IS WORN OUT ,ALSO DRIVE LINE TWISTED.STEADY BEARING WORN OUT.REMOVED THE DRIVE LINE AND SEND OUT FOR REPAIR BY THE CUSTOMER.REPLACED THE STEADY BEARING.INSTALLED THE YOKE WITH NEW NUT.GOT DRIVE LINE BACK AND INSTALLED WITH NEW STRAP KIT.	4	110.00	440.00
~~BUMPER~~ REMOVED THE OLD FRONT BUMPER.INSTALLED THE BUMPER SUPPLIED BY THE CUSTOMER.HAD TO DRILL OSME HOLES TO MATCH THE OLD ONE.INSTALLED NUMBER PLATE AND LIGHT WAS INSTALLED AT OLD BUMPER.	2	110.00	220.00
~~Services~~ OIL 15W40 DELO CHEV	1	282.00	282.00
~~Services~~ PARTS AND SHOP SUPPLY INCLUDING OIL PAN BOLT AND NUT.	1	60.00	60.00

SUBTOTAL	2,212.00
GST @ 5%	110.60
TOTAL	2,322.60
BALANCE DUE	**$2,322.60**

TAX SUMMARY

RATE	TAX	NET
GST @ 5%	110.60	2,212.00

Date: 10.20.23. UNIT #932.
Received By: _____
WO# or PO# 22567
Approved By: _____

DGN TRUCK & TRAILER REPAIR LTD.
7710, YELLOWHEAD TRAIL
EDMONTON AB T5B 1G3
7808634113
dgntrucktrailerrepair@gmail.com
GST/HST Registration No.:
710012295RT0001

INVOICE

Date: 10.10.23 UNIT # 932.
Received By:
WO# or PO# 22296
Approved By:

BILL TO
JONES TRANSPORTATION
INC
KW
KMS 128065
VIN 970338
UNIT 932

INVOICE # 2660
DATE 10/09/2023
DUE DATE 10/09/2023
TERMS Due on receipt

ACTIVITY	QTY	RATE	AMOUNT
cab and sleeper BRING IN UNIT CAB HEAT NOT SWITCHING.TROUBLESHOOT FOUND VALVE AND SWICH NEED TO REPLACE.ALSO FOUND CABLE BROKEN FOR HEATER CONTROL.GOT PARTS .REMOVED THE CAB PANELS . INSTALLED CABLE AND VALVE.REPLAED THE SWITCH.TESTED ALL OK NOW.	3	100.00	300.00
PARTS AND SHOP SUPPLY. VALVE ASSEMBLY WATER ,HEATR CONTROLLER CABLE AND NUT PUSH	1	189.74	189.74
Services SHOP SUPPLY	1	20.00	20.00

SUBTOTAL	509.74
GST @ 5%	25.49
TOTAL	535.23
BALANCE DUE	**$535.23**

TAX SUMMARY

RATE	TAX	NET
GST @ 5%	25.49	509.74

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 22296
Date: 10/04/2023

Completed Date: 02/14/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 10/04/2023
Entered By: Aleda

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [09.29.23 William] Temperature gauge and blower control doesn't work properly as it doesn't turn the blower motor to the window as it should and blows only hot air on the lowest setting		Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] Vhf radio has no range as no one can hear me unless I am sitting next to them	Went to Tridon in Hinton and rented a radio till his got fixed.	Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] Rear jockey box lid doesn't stay closed as the latch needs to be replaced		Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] Front bumper needs to be replaced as there's a a crack where it was welded before		Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] Blower doesn't switch to the windshield as it only works on the vent and floor	DGN	Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] The grill needs be fixed or replaced as the truck needs a winter front		Service Writer	.00
Labor - Jones Trucks	DVIR [10.03.23 William] The radiator cap is letting the antifreeze out as it is barely holding on		Service Writer	.00
Labor - Jones Trucks	DVIR [10.10.23 William] Right side fuel cap is leaking fuel		Service Writer	.00
Labor - Jones Trucks	DVIR [10.11.23 William] The defroster doesn't work as nothing comes out of the windshield vents	DGN	Service Writer	.00
Labor - Jones Trucks	DVIR [10.13.23 William]Left side exhaust leak from the pipe behind the chrome faring	WO 22367	Service Writer	.00
Labor - Jones Trucks	DVIR [10.13.23 William] Added 2 more gallons of antifreeze to 932 as it used total of 4 gallons in the last 2 days	WO 22367	Service Writer	.00
Labor - Jones Trucks	DVIR [10.14.23 William] Right side convex mirror won't stay in sight of view position of side trailer as the wind and vibration move the mirror outwards		Service Writer	.00
Labor - Jones Trucks	DVIR [10.14.23 William] The center clearance light on this top of the sleeper is burnt-out		Service Writer	.00
ORDER PARTS / SUBLET	SIF - Batteries X4	001-156750	Service Writer	.00
ORDER PARTS / SUBLET	U joint kit - Ed Kenworth	Invoice 02NP746143	Service Writer	.00
ORDER PARTS / SUBLET	ED Kenworth - Center bearing, yoke, seal, gasket, filter, strap kit and bolts	Invoice# 02nP746136	Service Writer	.00
ORDER PARTS / SUBLET	Pats DriveLine - Drive Shaft	Invoice# 2990935-00	Service Writer	.00
ORDER PARTS / SUBLET	Hunter Radiator - clean, tested and repaired. Steam cleaned in and out and flushed. retorque tank botls and replaced damaged/worn filler neck	Invoice# 80705	Service Writer	.00
ORDER PARTS / SUBLET	Ed Kenworth - Harness kit	Invoice# 02NP746002	Service Writer	.00
ORDER PARTS / SUBLET	Earth Communication - repair radio and antenna	Invoice#52303	Service Writer	.00
ORDER PARTS / SUBLET	Tridon hinton - radio rental	Invoice# INB243433	Service Writer	.00

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
ORDER PARTS / SUBLET	DGN - heat not switching. valve and switch need to be rplaced. cable was broken for heater control. Installed cable and vavlve replace the switch	Invoice# 2660	Service Writer	.00

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 80705 Supplier: Hunter Radiators Inc.	radiator, steam , test, repair, clean	1.00	.00	.00
	Invoice: 001-156750 Supplier: SIF Superiors Industrial Frictions Ltd.	batteryx4	1.00	426.20	426.20
	Invoice: 001-156750 Supplier: SIF Superiors Industrial Frictions Ltd.	battery core x4	1.00	144.00	144.00
	Invoice: 02NP746143 Supplier: Edmonton Kenworth Ltd.	kit u-joint	1.00	162.78	162.78
	Invoice: 02NP746136 Supplier: Edmonton Kenworth Ltd.	seal-oil, nut, yoke retaining, centerbearing assembly, seal oring, gasket oil pan, filter fuel filter, kit strap	1.00	700.16	700.16
	Invoice: 2990935-00 Supplier: Pats Driveline	rear driveshaft	1.00	1,629.43	1,629.43
	Invoice: 52303 Supplier: Earth Communications	repair audio and antenna	1.00	193.95	193.95
	Invoice: IN243433 Supplier: Tridon	daily rental	1.00	84.95	84.95
	Invoice: 2660 Supplier: DGN Truck & Trailer Repair Ltd.	cab and sleper trubleshoot	1.00	509.74	509.74
	Invoice: 001-167791 Supplier: SIF Superiors Industrial Frictions Ltd.	core credit	1.00	-144.00	-144.00

Total Labor	.00
Total Parts	.00
Total Returns	.00
Total Sublet	3,707.21
Shop Supplies	.00
Invoice Total	3,707.21

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 22248
Date: 09/19/2023

Completed Date: 09/20/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 09/19/2023
Entered By: Aleda

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [09.16.23 William] Air conditioning stopped working as it only blows hot air out of vents		Service Writer	100.00
Labor - Jones Trucks	DVIR [09.16.23 William] Low beams aren't bright enough as its hard to tell if they are on as they are too dim		Service Writer	100.00
Labor - Jones Trucks	DVIR [09.16.23 William] Left signal works intermittently	Keep working on front diff. oil temp. sensor & its wires! Start to work on signal sw. replacement! Make phone call to order a proper/right part for this job... Replaced the signal multy sw.	Service Writer	100.00
Labor - Jones Trucks	DVIR [08.25.23 William] Fwd and rear axle gauges still don't work	Check out the signal problem and open up the issue, order the necessary part in for repair! Inspect the temp. sensor and its wires of both diff. Repaired the wires of the rear one and started to work on the front one (wires corroded on multiple places)	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Raymond Perrson - Call out and repair	Invoice# 552092	Service Writer	.00
Labor - Jones Trucks	DVIR[09.25.23 William] The left front tire is wearing on the inside more than normally	Unit headed to Fountain Tire for 1000 to have 2 steer tires and an alignment	Service Writer	100.00
Labor - Jones Trucks	DVIR [09.25.23. William]Engine oil temperature gauge not working the forward and rear diff temperature gauges don't work the exhaust temperature gauge not working the outside temperature gauge not working		Service Writer	100.00
ORDER PARTS / SUBLET	switch turn signal	edfm kw 02NP740125	Service Writer	.00
Labor - Jones Trucks	DVIR [09.29.23 William] Oil temperature gauge not working , exhaust temperature gauge not working,		Service Writer	100.00
ORDER PARTS / SUBLET	Fountain Tire - Tire replacement and balaced, R&R King pin replacement and air ride bushings, front wheel seals, srping pins, rear bushings	015|321444		.00
ORDER PARTS / SUBLET	swith turn signal without harness	EDM KW 02NP740312		.00

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 552092 Supplier: Yukon Storage and Sales	repair call out	1.00	1,235.00	1,235.00
	Invoice: 02NP740125 Supplier: Edmonton Kenworth Ltd.	switch turn signal	1.00	140.66	140.66
	Invoice: 02NP740312 Supplier: Edmonton Kenworth Ltd.	return switch turn signal	1.00	-140.66	-140.66
	Invoice: 02NP740312 Supplier: Edmonton Kenworth Ltd.	swith turn signal without harness	1.00	94.42	94.42
	Invoice: 015|321444 Supplier: Fountain Tire	alignment, tires, changeover, balance	1.00	7,823.02	7,823.02

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount

Total Labor	700.00
Total Parts	.00
Total Returns	.00
Total Sublet	9,152.44
Shop Supplies	985.24
Invoice Total	10,837.68

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 22158
Date: 08/15/2023

Completed Date: 09/30/2023

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 08/15/2023
Entered By: Aleda

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [08.15.23 William] Truck pulls to the right as it needs a wheel alignment			.00
Labor - Jones Trucks	DVIR [08.15.23 William] Engine oil temperature gauge inoperative the fwd and rear drive gauges inoperative	Look up the wire schematic, find the sensor on block! Check out the diff. temp. sensors too!	Laszlo Sarkozi	50.00
Labor - Jones Trucks	DVIR [08.15.23 William] The heat and air conditioning doesn't work in the sleeper as its inoperable	Take apart the lower bed and interior, inspect wire harnesses & sw., open up the issue, rewired the power supply for heater fun sw.	Laszlo Sarkozi	275.00
Labor - Jones Trucks	DVIR [08.19.23 William] Left tail light on truck not working	Looking for the problem of this, found the power wire broken/corroded off 2 different spots, fixed up that brown wire in the harness...	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [08.19.23 William] Left side accessory lights on sleeper not working	Found a broken ground wire, fixed it up	Laszlo Sarkozi	25.00
Labor - Jones Trucks	DVIR [08.19.23 William] Right front shock is leaking as both shock should be replaced already	Replaced both shock absorbers	Laszlo Sarkozi	50.00
Labor - Jones Trucks	DVIR [08.19.23 William] Exhaust pipe is starting to leak just after turbo	Replaced the 4" flex pipe and both clamps	Laszlo Sarkozi	75.00
Labor - Jones Trucks	DVIR [08.19.23 William] Blower motor stopped working all together	Look up all the DVIR complaints ! looking for the issues of the blower fan, open up the problems, order the necessary part in! Cleaned up all the wire conn. of the back of the control sw., replaced the termistor, replaced the wire conn. of the blower fan! Mount all the engine and interior parts back and run a test !	Laszlo Sarkozi	375.00
Labor - Jones Trucks	DVIR [08.19.23 William] Right side mirror won't stay in place as its moving while traveling down highway also the round convex mirror is moving as it won't stay in place	Tied up that mirror, but adjustment necessary by driver	Laszlo Sarkozi	25.00
Labor - Jones Trucks	Exhaust stack shield has loose bolts on both sides	Fixed them up with new bolts	Laszlo Sarkozi	50.00
Labor - Jones Trucks	DVIR [08.23.23 William]Heater is not working in the cab as its still not working properly	Move it outside to run the engine to warm up to inspect the heater lines & blower! Open the ball valve of the return hose to the engine!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [08.29.23 William] Fwd and rear axle gauges still don't work			.00
Labor - Jones Trucks	DVIR [08.29.23 William] Sleeper has no Air conditioning as it only hot air out of vents	Check out the sleeper HVAC & the Eberspecher stand by heater, start to look for the issues!	Laszlo Sarkozi	75.00
Labor - Jones Trucks	DVIR[08.29.23 William] Can't lock the truck from the outside door lock as key doesn't work To the door also no keys working for the jockey box	Replaced only the driver door lock/thumbler and set up the keys!	Laszlo Sarkozi	75.00
Labor - Jones Trucks	DVIR [08.29.23 William] High beams need to be brighter than they are	Rewired and replaced both of them!	Laszlo Sarkozi	100.00
Tractor SERVICE	250 Hours or 25000 kms	Perform Oil service & PM, grease it up ! Open up other issues & order parts in !	Laszlo Sarkozi	675.00

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	Clutch is grainding when goe into the start gear	Move the truck into the shop! Inspect the clutch brake, open up the issue!	Laszlo Sarkozi	50.00
ORDER PARTS / SUBLET	SIF - Clutch brake			.00
Labor - Jones Trucks	Clutch is grainding when goe into the start gear	Mount on a new disc and the access hole cover! Mount & seal back the engine rotating hole!	Laszlo Sarkozi	125.00
Labor - Jones Trucks	Power Divider input pinion has too big lash, should be adjusted and seal leaks oil	Replaced the Inter axle lock/front axle differencial! Mount back up all dismounted parts...	Laszlo Sarkozi	650.00
Labor - Jones Trucks	DVIR [08.15.23 William] Engine oil temperature gauge inoperative	Replaced the sensor and mount the fuel filter back1	Laszlo Sarkozi	75.00
Labor - Jones Trucks	DVIR [08.15.23 William] Engine oil temperature gauge inoperative			.00
Labor - Jones Trucks	DVIR [08.29.23 William] Sleeper has no Air conditioning as it only hot air out of vents			.00
Labor - Jones Trucks	Exhaust manifold and EGR valve conn. to EGR cooler leaks	Removed the exh. manifold, turbo, coolant lines, EGR valve... for gaskets replacement!	Laszlo Sarkozi	275.00
ORDER PARTS / SUBLET	resistor fan speed-hvac	Edm KW 02NP730713		.00
Labor - Jones Trucks	Stand by/overnight bunk heater is out of order	Inspect the heater over heat protection and wires, open up the problem and repaired the controller wire conn. Rewired the harness of the controller...	Laszlo Sarkozi	200.00
ORDER PARTS / SUBLET	Temp sensor	Invoice# 02NP732800	Service Writer	.00
Labor - Jones Trucks	Stand by/overnight bunk heater is out of order	removal of bed in bunk	Daniel Massner	50.00
Labor - Jones Trucks	Stand by/overnight bunk heater is out of order	install of bed	Daniel Massner	50.00
Labor - Jones Trucks	Exhaust manifold and EGR valve conn. to EGR cooler leaks	Clean up all the conn. surfaces and put the manifold back with new gaskets!	Laszlo Sarkozi	200.00
Labor - Jones Trucks	Exhaust manifold and EGR valve conn. to EGR cooler leaks	Mount the Turbo, EGR valve, EGR cooler conn. and all the dismounted engine parts back on, refill it with coolant and perform a test run!	Laszlo Sarkozi	300.00
Labor - Jones Trucks	Exhaust manifold and EGR valve conn. to EGR cooler leaks	put coolant back into system/runing/ testing	Daniel Massner	75.00
Unit In/Out Shop - Truck / ...	Move unit in or out of the shop/washbay	moved unit in yard	Daniel Massner	25.00
ORDER PARTS / SUBLET	SIF - shock absorber	SIF 001-150220	Service Writer	.00
ORDER PARTS / SUBLET	SIF - V band clamps	Invoice# 001-151312	Service Writer	.00
Labor - Jones Trucks	Power Divider input pinion has too big lash, should be adjusted and seal leaks oil	Put the wheels, drive line, input half drive shafts, step deck, front chain hanger... back on! Replaced the quick release/damp valve and hook back on all the brake pot lines! Take it for test drive twice ! Clean up after these jobs!	Laszlo Sarkozi	325.00
Labor - Jones Trucks	Power Divider input pinion has too big lash, should be adjusted and seal leaks oil	removal of diff and installed new diff/ filled with oil	Daniel Massner	450.00
Labor - Jones Trucks	pack up diff	packing up diff from unit	Daniel Massner	50.00
Labor - Jones Trucks	Broke down in Watson Lake due to input pinion nut failure	Make phone calls & messages with driver and parts store	Laszlo Sarkozi	25.00
ORDER PARTS / SUBLET	SIF - Valve	Invoice# 001-152516	Service Writer	.00
ORDER PARTS / SUBLET	ED KW - gasket turbocharger, v-clamp	Invoice# 02NP733948	Service Writer	.00
ORDER PARTS / SUBLET	ED KW - Rod ends	Invoice# 02NP734565	Service Writer	.00
ORDER PARTS / SUBLET	Differential reman	Invoice# 02NP734533	Service Writer	.00
ORDER PARTS / SUBLET	Ed Ken - Exhaust gasket, exhaust manifold gasket, gas recon valve,	Invoice# 02NP733355	Service Writer	.00
ORDER PARTS / SUBLET	return v-clamp	SIF 001-151829	Service Writer	.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
94707-3, Fit'N Forget Pigtail 3 Wires		1.00	5.26	5.26
44202R, LED, Red, Fit'n Forget [Round]		1.00	70.66	70.66
EF4012S, Pipe-Exhaust Flex 4"x12" SS		1.00	22.16	22.16

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Parts


Description	Description Detail	Quantity/Hours	Price/Rate	Amount
562.U3104SS, Exhaust Band Clamp Performed 4"		2.00	9.24	18.48
BF7766, Filter Fuel Spin-on		1.00	18.77	18.77
BF7760, Filter Fuel Spin-on [Wire Mesh]		1.00	16.31	16.31
SPC500010047, 10W-30 Bulk Oil		42.00	4.16	174.72
SB200, Brake-Clutch		1.00	142.79	142.79
180-10613, Drive Flange Gasket		2.00	2.17	4.34
157.1001, Wheel Separator Plate		2.00	7.34	14.68
3102314CUM, Gasket Turbo Changer		1.00	15.11	15.11

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 02NP730713 Supplier: Edmonton Kenworth Ltd.	resistor fan speed-hvac	1.00	29.83	29.83
	Invoice: 02NP733223 Supplier: Edmonton Kenworth Ltd.	credit	1.00	-129.46	-129.46
	Invoice: 02NP732800 Supplier: Edmonton Kenworth Ltd.	sensor temp, sensor, oil, cover clutch	1.00	178.14	178.14
	Invoice: 001-150220 Supplier: SIF Superiors Industrial Frictions Ltd.	shock absorber	1.00	118.82	118.82
	Invoice: 001-151312 Supplier: SIF Superiors Industrial Frictions Ltd.	v-band clamp	1.00	62.00	62.00
	Invoice: 02NP733948 Supplier: Edmonton Kenworth Ltd.	gasket, clamp v-band	1.00	182.14	182.14
	Invoice: 02NP734533 Supplier: Edmonton Kenworth Ltd.	differential	1.00	3,212.71	3,212.71
	Invoice: 02NP734533 Supplier: Edmonton Kenworth Ltd.	differential-core	1.00	2,500.00	2,500.00
	Invoice: 02NP734565 Supplier: Edmonton Kenworth Ltd.	rod-end	1.00	203.10	203.10
	Invoice: 001-152516 Supplier: SIF Superiors Industrial Frictions Ltd.	valve	1.00	19.88	19.88
	Invoice: 02NP736595 Supplier: Edmonton Kenworth Ltd.	rod end credit	1.00	-180.86	-180.86
	Invoice: 02NP733355 Supplier: Edmonton Kenworth Ltd.	Exhaust gasket, exhaust manifold gasket, gas recon valve,	1.00	423.71	423.71
	Invoice: 02NP737377 Supplier: Edmonton Kenworth Ltd.	differential core	1.00	-2,500.00	-2,500.00
	Invoice: 001-151829 Supplier: SIF Superiors Industrial Frictions Ltd.	v-band clamp	1.00	-19.57	-19.57

Total Labor	4,975.00
Total Parts	503.28
Total Returns	.00
Total Sublet	4,100.44
Shop Supplies	907.54
Invoice Total	10,486.26

Chardikala Truck & Trailer Repair Inc
7072 72 AVE
Edmonton AB T6B 0A2
7808053531
chardikalatruck@gmail.com

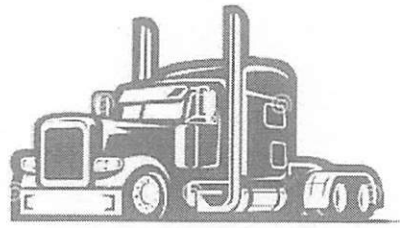

BILL TO
JONES
TRANSPORTATION INC
115 Hayes Cresent
Acheson Alberta T7X6C3

INVOICE 1013

DATE 08/05/2023 **TERMS** Due on

DUE DATE 08/05/2023

MILEAGE	MAKE & YEAR	PLATE OR UNIT NUMBER
962624	W900	A-45124 (932)

DESCRIPTION OF WORK	QTY	RATE	AMOUNT
Services REAR SUSPENSION BUSHINGS REPLACED	8	110.00	880.00
Services PARTS	1	893.00	893.00

Chardikala Truck & Trailer Repair Inc is not responsible for loss or damage to truck or articles left in truck in case of fire, theft or any cause beyond our control. I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and your employees permission to operate the truck for the purpose of testing or inspecting.an express mechanic lien is hereby acknowledged on the above truck to secure the amount of repairs there to. Responsible only work done at shop. any delays for payments 28% interest per Anum.

Signature: _____

SUBTOTAL	1,773.00
GST @ 5%	88.65
TOTAL	1,861.65

Date:_____ UNIT # 932
Received By:_____
WO# or PO# 21942
Approved By: _____

TOTAL DUE **$1,861.65**

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21940
Date: 05/24/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 05/24/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [Unit 932 05092023] - Service call out tire changeover			100.00
ORDER PARTS / SUBLET	Service called out after hours	Kal-tire [whitehorse 699340415]		.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need adjustment,not going into gear when ready to move off -	pushed unit in shop/ removal of trany/ washed trany	Daniel Massner	100.00
ORDER PARTS / SUBLET	flywheel, clutches, ball bearing			.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need	clean up tany removal of Y fork and bushings / fis up wires on trany	Daniel Massner	100.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need	removal of gasket on trany/ removal of out put shaft plate	Daniel Massner	100.00
ORDER PARTS / SUBLET	shaft-clutch release , shaft-cross, clutch	KW 708484		.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need	helping install out put shaft kit on unit	Daniel Massner	100.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need	installing trany	Daniel Massner	100.00
ORDER PARTS / SUBLET	Gregg Order# 273940 - Ready rod			.00
Tractor SERVICE	250 Hours or 25000 kms	oil service and pm on unit	Daniel Massner	300.00
Labor - Jones Trucks	service repairs	lights and pump motor for wipers	Daniel Massner	100.00
Labor - Jones Trucks	DVIR [05.19.23 Andrew] - This gear stick booth need changing . Also clutch need	finalized trany put on mud flap and air tank	Daniel Massner	100.00
Labor - Jones Trucks	air tank off / now window wiper pump motor/ lights out	air tank/finalized / moved out / installed pump / lights	Daniel Massner	100.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
SPC500010047, 10W-30 Bulk Oil		41.00	4.16	170.56
BD50000, High Efficiency Dual-Flow		1.00	88.33	88.33
562-312, Mud Flap Hanger Kit		1.00	59.26	59.26
45583, AMBER LED W/ 180 BULLETS & BEZEL		1.00	35.78	35.78

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 001-140870 Supplier: SIF Superiors Industrial Frictions Ltd.	flywheel, clutches, ball bearing	1.00	124.54	124.54
	Invoice: 02NP708484 Supplier: Edmonton Kenworth Ltd.	shaft clutch, shaft cross, clutch	1.00	89.25	89.25
	Invoice: 057-267892 Supplier: Gregg Distributors	alloy bar 2x	1.00	25.30	25.30

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Total Labor	1,200.00
Total Parts	353.93
Total Returns	.00
Total Sublet	239.09
Shop Supplies	143.91
Invoice Total	1,936.93

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21927
Date: 05/11/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 05/11/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
MOVE TO NEW WORK O...	DVIR [05.11.23] - Fridge works on and off, will need it to fix	It is running and cold since truck is on the yard!	Laszlo Sarkozi	.00
Labor - Jones Trucks	A/C repair			100.00
ORDER PARTS / SUBLET	sourced out	DGN		.00
ORDER PARTS / SUBLET	part source out D9032-3120 [Prince George, BC]	Peterbilt Pacific Inc. [P8377077 - CC-0719]		.00
ORDER PARTS / SUBLET	part souced out D931-9177 [Calgary, AB] purolator	Great West Kenworth [CC-0719]		.00
Labor - Jones Trucks	Shift lever floor booth should be replaced	Completed with the trany jobs!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Weird noise from flywheel at pull offs	Completed with the transmission jobs!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Inspect clutch operation, try to adjust the release bearing free run out, something fell apart and the truck doesn't go into gear anymore! Try to remove the clutch brake disc!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Remove the transmission & clutch, flywheel! Move the trany to washbay to clean it up!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Start to work on trany, inspect all the parts! Replaced the crankshaft rear seal!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Transmission input shaft section should be rebuilt	Removed the bellhouse and drained the oil, started to clean up the sealed surfaces!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Transmission input shaft section should be rebuilt	Rebuild the input shaft section and mount the clutch housing back with new gaskets!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch should be replaced	Install the new release fork/shaft bushings and mount up the new clutch assy.	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Shift lever housing should be resealed	Keep working on trany	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Mount the Flywheel back on engine	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Keep working on trany	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Mount the trany back and start to put all the parts of that back!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Put the drive line back up, mount the new rubber bootv of the shift lever in... Fabricate new U-bolts/clamps for PS. air tank !	Laszlo Sarkozi	100.00
Labor - Jones Trucks	All the complaints	Finalize paperjobs and go over all the WO# Perform same things for #9103	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Clutch is grainding/hard to put into the start gear	Mount the PS. air tank back, remove the frame stands and take the truck for a test drive!	Laszlo Sarkozi	100.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
MAFB201, Hinged Brake		1.00	35.00	35.00
562.440, Conspicuity Plate Set Straight		1.00	23.33	23.33
562-312, Mud Flap Hanger Kit		1.00	59.26	59.26
550044797, SPIRAX S6 GME 40-TRANS		1.00	337.52	337.52

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: P837077 Supplier: Peterbilt Manitoba Ltd.	Hardline Assy	1.00	507.76	507.76
	Invoice: PC1160281 Supplier: Greatwest Kenworth Ltd. Calgary	Hardline Assy-HVAC	1.00	350.70	350.70

Total Labor	1,600.00
Total Parts	455.11
Total Returns	.00
Total Sublet	858.46
Shop Supplies	245.85
Invoice Total	3,159.42

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21874
Date: 05/01/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 05/01/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR [04.24.23 - Andrew] - Driver seat needs to change, its finish.	Inspected, all works to me in the shop but sinks when the truck is driven! Inspect that set again and order it in! Cut off fan shraud on PS. a little bit!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [04.26.23-Andrew] - Mud Gaurd too close to center Axl tire, can't install chain on it, will cause damage, need to be fix.			100.00
Labor - Jones Trucks	DVIR [04.28.23-Andrew] - Air bag at right ware axle leaking. Oil pressure gauge at full rave going up hill is at 32 psi, should be over 40 psi Unresolved	Inspect the suspension, replaced the air ride of the rear axle PS. and its fittings! Finalize the PM!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [04.28.23] - I'm hearing two weird sounds coming from beneath the truck. One is when turning with the load on			100.00
Labor - Jones Trucks	DVIR [04.28.23- Andrew] - The other is the exhaust leaking especially when going up hill, it's very loud	put new flex pipe on exhaust. removal of parts for fan shroud	Daniel Massner	100.00
Tractor SERVICE	250 Hours or 25000 kms	Perform Oil Service & PM!	Laszlo Sarkozi	300.00
Labor - Jones Trucks	Check air conditioner - summer months coming up - DGN if needed	Check out A/C	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR [04.24.23 - Andrew] - Driver seat needs to change, its finish.	removed and installed new chair	Daniel Massner	100.00
Labor - Jones Trucks	DVIR [04.24.23 - Andrew] - Driver seat needs to change, its finish.	Replaced that seat!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	pre-trip on unit	pre trip and starting unit for gullum	Daniel Massner	100.00
ORDER PARTS / SUBLET	spring assy air bracket			.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
BD50000, High Efficiency Dual-Flow		1.00	39.86	39.86
BF7766, Filter Fuel Spin-on		1.00	18.77	18.77
BF7760, Filter Fuel Spin-on [Wire Mesh]		1.00	16.31	16.31
SPC500010047, 10W-30 Bulk Oil		42.00	4.16	174.72
562.U3105SS, Exhaust Band Clamp Performed 5"		2.00	9.53	19.06

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 02NP702909 Supplier: Edmonton Kenworth Ltd.	seat legacy silver HB 2W air lum	1.00	1,422.47	1,422.47
	Invoice: 02NP701670 Supplier: Edmonton Kenworth Ltd.	spring assy air bracket	1.00	191.44	191.44

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount

Total Labor	1,200.00
Total Parts	268.72
Total Returns	.00
Total Sublet	1,613.91
Shop Supplies	281.39
Invoice Total	3,364.02

JONES TRANSPORTATION INC.

Date: May - 1st - 2023

Unit # 9132

Odometer Reading: 962946 (1559835)

Hour Reading: 20335

Work Order # 21874

✓ CHECKED & OK

/ ADJUSTED

R REPAIR or REPLACEMENT REQUIRED

X REPAIRED, REPLACED or COMPLETED

Service interval as per Manufacturer's Specification

TRUCK / TRACTOR

BODY & FRAME	▲	★
Body		1
Frame & Cargo Body	11	3
Bumpers		1
Cab	2	
Coupling Devices	4	
Door Releases/Latches		1
Doors		1
Drive Shaft		6
Driver Controls	6	
Driver Seat	7	
Emergency Equipment & SafetyDevices	9	
Fenders		1
Fifth Wheel & Coupling Devices	4	31
General	13	23
Heater & Defroster	15	25
Horn	16	
Mirrors	14	7
Mudflaps		1
Sun Visors		1
Underbody		5

Windshield & Windows	14	7
Windshield Wipers & Washer	23	24
BRAKES		
Air Brake System	1	14
Brake Pedal		13
Electric Hydraulic Brake System		16
Mechanical Components		12
Parking/Emergency Brake		15
ELECTRICAL COMPONENTS		
Lamps & Reflectors	18	27
Neutral Safety Starting Switch		26
STEERING		
Steering Column & Box		18
Steering Linkage		21
Power Assist	19	
Wheel Alignment (Visual)		19
FUEL & EXHAUST		
Exhaust System	10	9
Filler Cap & Fuel Lines		8
Fuel System	12	8
Fuel Tank		8

SERVICE		
Complete Lubrication		30
Oil Change		
Check/Replace Air Filters		
Check Diff Oil		
Check Trans Oil		
Check Power Steering Fluid		
Check Front Hub Oil		
SUSPENSION		
Suspension System	20	22
Shock Absorber Condition	20	22
OK Spring Condition	20	22
WHEELS & TIRES		
Tires	21	28
Torqued Fasteners	22	29
Wheels, Hubs, Fasteners	22	29
OTHER		
Cargo Securement	3	
Dangerous Goods	5	

★ **Inspected Per AR 121/2009 Schedule 2 Section # (as shown above ★)**

▲ **Inspected Per NSC Standard 13, Part 2, Schedule 1, # (as shown above ▲)**

Notes: 1.) Rear drive a. P.S. air ride leaks bad

BF 7766

BF 7760

BD 50000

Lumsden

Rev 12.18

Signature: Lolo S.

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21766
Date: 03/14/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 03/14/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR - some lights not working on Cab [03.11.23] Andrew [GP]	fixed 2 marker lights and helped with exught leak	Daniel Massner	100.00
Labor - Jones Trucks	DVIR - Both outside mirrors not defrosting, when engage switch [03.13.23] Andrew [GP]	All 4 in a good working condition every time when we checked them!	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	booked appt for Mar 14.23 at 1PM [GP]	TruckZone [called to adjust clutch too] 03.14.23]		.00
Labor - Jones Trucks	DVIR - Clutch pedal out of adjustment. There's a sound coming from the fan pully wheel 03.20.23 Andrew	had driver stop by Truck Zone		100.00
ORDER PARTS / SUBLET	quote for clutch [1.1hr ($185.90) + clutch brake ($71) = $256.90] 03.21.23	Truck Zone 03.21.23 [02W5488]		.00
ORDER PARTS / SUBLET	assessed issue - 2 REAR ENGINE MOUNTS WORN & CAUSING ENGINE FAN TO RUB ON FAN SHROUD =SQUEAK #1 - TENSION PULLIES AND IDLER PULLIES SQUEAKING = SQUEAK # 2	Truck Zone 03.21.23		.00
Labor - Jones Trucks	PS. rear engine support wore out	Replaced that support! Mount up the new alternator ! Fabricate a side rail bracket for that shraud to secure it!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Front engine support bushings must be inspected			100.00
Labor - Jones Trucks	Fan shroud deformed	It is repaired with other jobs!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Fan belts & tensioners laud	Replaced the alternator!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Fuel leak somewhere around the Tee of the fuel lines	washed under unit/ inspected for leak/ replaced return F/splitter vale	Daniel Massner	100.00
Labor - Jones Trucks	DS. fuel tank leaks	Install a LEAK DEFENDER on that tank! Inspect the fuel line leaks! Removed the belts and tensioners for replacement1	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Exhaust muffler has leak	working on exust leak	Daniel Massner	100.00
Labor - Jones Trucks	Mechanical Inspection	Perform Inspection & doc. for those!	Laszlo Sarkozi	100.00
Unit In/Out Shop - Truck / ...	Move unit in or out of the shop/washbay	moved unit into shop	Daniel Massner	100.00
Labor - Jones Trucks	Windshield repair - split - passenger [cracked] /driver [rock chips]			100.00
ORDER PARTS / SUBLET	book appt for both windshields to be replaced	Jeff's Auto Glass [03.27.23] 71780	Service Writer	.00
Tractor SERVICE	250 Hours or 25000 kms			300.00
Labor - Jones Trucks	PS. rear engine support wore out	helping out laszlo to remove and install new engine supports	Daniel Massner	100.00
Labor - Jones Trucks	Exhaust muffler has leak	Keep working on that muffler and weld up its front bracket to secure it and mounted it back up!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Fan belts & tensioners laud	Mount all the new tensioners and belts up! Move it to other bay and removed the alternator for replacement!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Exhaust muffler has leak	Try to repair that muffler aleaks on spot with welding! Finally removed it and started to patch it on workbench1	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	ordered Muffler - return don't need repair by Laszlo	Western Star [order/return]	Service Writer	.00

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Labor

Category	Description	Technician Notes	Mechanic	Amount
ORDER PARTS / SUBLET	parts required - alternator / idler tension pulley /motor mounts / tensioner assessbly	SIF [134139 /134326 - returns]		.00
Labor - Jones Trucks	Fan belts & tensioners laud	removal of rad/fan clutch/ water pump	Daniel Massner	100.00
Labor - Jones Trucks	Fan belts & tensioners laud	Remove the rad. & fan clutch & waterpump for inspection! Mount the new waterpump on!	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	as per Laszlo required a water pump	SIF [03.28.23]		.00
Labor - Jones Trucks	Correct fan clutch should be mounted on	Mount on the new part and put all the belts... on! Remove the new fan clutch because it is incorrect!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Correct fan clutch should be mounted on	helping mount proper fan clutch and installed rad back on	Daniel Massner	100.00
Labor - Jones Trucks	Correct fan clutch should be mounted on	Continue to work on front-end...	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Fan shraud is misaligned	Fabricate bolts to secure it properly!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Correct fan clutch should be mounted on / missing mud flaps x3	finished mount all parts/ filled with coolent / making up mud flaps and mounting/testing / battires coverd .	Daniel Massner	100.00
Labor - Jones Trucks	Fan shraud misaligned and the fan blade rubbing on it!	Keep working on rad. reinstallation and finalize front end repairs. Continue to work on front end noise/issue!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	unit still skretching/ making noice from front	went to pull unit out hurd noice coming from front/ inspeting/ start to remove parts	Daniel Massner	100.00
Labor - Jones Trucks	viberation dummper changed out	removal and install of dumper	Daniel Massner	100.00
Labor - Jones Trucks	Coolant leaks here and there upon rad. reinstallation	Keep working on few coolant leaks! Inspect the screaming noise again1	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Still screaming somewhere from front end	Install the new vibration dumper on!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Still screaming somewhere from front end	put power steering pump and rad mount back on	Daniel Massner	100.00
Labor - Jones Trucks	Still screaming somewhere from front end	Put the front end back together after vibration dumper replacement! Put the booster pack on batt.	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Still screaming somewhere from front end	helped install another new belt on unit	Daniel Massner	100.00
ORDER PARTS / SUBLET	part source [damper viscous vibration]	EDM KW [697613]	Harisch De Costa	.00
Labor - Jones Trucks	Still screaming somewhere from front end	Replaced the main /fan belt and mount everything back together!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	unit will not start	put on booster pack	Daniel Massner	100.00
Labor - Jones Trucks	It doesn't start on yard	Put the batt. charger on	Laszlo Sarkozi	100.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
LEA-CAP-001, Leak Defender [Replacement Fuel Cap]		1.00	350.17	350.17
562.U3105SS, Exhaust Band Clamp Performed 5"		1.00	9.53	9.53
562-312, Mud Flap Hanger Kit		1.00	59.26	59.26
TU-1031, Anti Sail Bracket - Chrome		1.00	11.87	11.87
562-102436, Mud Flap - Standard 3/16" Thick		3.00	15.90	47.70
DYN 66461, Quick Pin [Round]-5PK		2.00	3.39	6.78

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 001-134326 Supplier: SIF Superiors Industrial Frictions Ltd.	alternator pad mount	1.00	303.67	303.67
	Invoice: 001-134139 Supplier: SIF Superiors Industrial Frictions Ltd.	motor mount	1.00	992.40	992.40
	Invoice: 71780 Supplier: Jeffs Auto Glass	install windshield	1.00	400.00	400.00
	Invoice: 02NP693160 Supplier: Edmonton Kenworth Ltd.	Muffler	1.00	884.54	884.54
	Invoice: 001-134490 Supplier: SIF Superiors Industrial Frictions Ltd.	water pump	1.00	425.01	425.01

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 02W5488 Supplier: Truck Zone	headlights not working properly, mirror heaters not working	1.00	1,134.35	1,134.35
	Invoice: 02NP694049 Supplier: Edmonton Kenworth Ltd.	Clutch fan	1.00	1,275.04	1,275.04
	Invoice: 02NP694049 Supplier: Edmonton Kenworth Ltd.	core	1.00	528.00	528.00
	Invoice: 02NP694049 Supplier: Edmonton Kenworth Ltd.	freight fees	1.00	140.00	140.00
	Invoice: 02NP695216 Supplier: Edmonton Kenworth Ltd.	clutch fan	1.00	1,302.89	1,302.89
	Invoice: 02NP695216 Supplier: Edmonton Kenworth Ltd.	Core	1.00	528.00	528.00
	Invoice: 02NP695712 Supplier: Edmonton Kenworth Ltd.	return clutch fan	1.00	-1,275.04	-1,275.04
	Invoice: 02NP695712 Supplier: Edmonton Kenworth Ltd.	wrong core	1.00	-528.00	-528.00
	Invoice: 02NP695723 Supplier: Edmonton Kenworth Ltd.	Prepaid freight credit	1.00	-140.00	-140.00
	Invoice: 02NP697613 Supplier: Edmonton Kenworth Ltd.	damper viscous vobration	1.00	1,185.24	1,185.24
	Invoice: 02W5507 Supplier: Truck Zone	clutch pedal has grinding noise	1.00	929.69	929.69
	Invoice: 111610622 Supplier: Callingwood Registry	Vehicle renewal	1.00	2,172.45	2,172.45
	Invoice: 02NP694279 Supplier: Edmonton Kenworth Ltd.	muffler returned	1.00	-884.54	-884.54
	Invoice: 001-134904 Supplier: SIF Superiors Industrial Frictions Ltd.	HD Tensioner Assembly	1.00	-183.73	-183.73
	Invoice: 001-134904 Supplier: SIF Superiors Industrial Frictions Ltd.	HD Idler Tensioner Pulley	1.00	-113.26	-113.26
	Invoice: 001-134904 Supplier: SIF Superiors Industrial Frictions Ltd.	Idler/Tensioner Pulley	1.00	-62.05	-62.05
	Invoice: 02NP695724 Supplier: Edmonton Kenworth Ltd.	Core	1.00	-554.40	-554.40

Total Labor	3,800.00
Total Parts	485.31
Total Returns	.00
Total Sublet	8,460.26
Shop Supplies	1,226.03
Invoice Total	13,971.60

HUNTER RADIATORS INC.
5632 - 92 St NW
Edmonton, AB T6E 4Y6
Phone # 780-430-0020
Fax # 780-430-0212

Ship To: Jones Transportation Inc.
115 Hayes Crescent
Acheson, AB T7X 5A4

Invoice

Sold To: Jones Transportation Inc.
11585 - 257th Street
Acheson, AB T7X 6C3

Date	Invoice #
01/03/2023	79456

P.O. No.	Terms	Via	Make/Model	Unit #	Contact / Phone #
21691	Cash Account	Pick Up	KW	932	

Quantity	Item	Description	Price Each	Amount
1	Bolt-On Recore	Radiator - Bolt-on recore with industrial style core. Supply and install new filler neck, tank and bottom connection gaskets, nuts, bolts, lock and flat washers. Replace (4) broken studs in bottom tank. Test, dry and paint.	2,150.00	2,150.00
		GST on sales	5.00%	107.50

Date: 03.01.23 UNIT # 932
Received By: Ghulam Harsh P/u
WO# or PO#
Approved By:

PAID MAR 01 2023

Recieved By _____

Thank You for your Business

Subtotal	$2,150.00
Sales Tax Total	$107.50
GST No. 810438283	

CASH	CHEQUE	VISA	MASTERCARD	INTERAC	CHARGE	**Total:**	**$2,257.50**
		✓					

www.hunterrad.com

R&R Diagnostics and Repair

2801 92 Ave
Dawson Creek BC V1G-0G2
(250) 467-2304
accounts.payable@rrdiagnostics.com
www.rrdiagnostics.com
GST/HST Registration No.: 76896 7317RT0001
Business Number 768967317 RT 0001

R&R DIAGNOSTICS & REPAIR

Date: 03.02.23 UNIT # 932
Received By: Ghulam
WO# or PO# 21691
Approved By:

INVOICE

BILL TO

JONES TRANSPORTATION
EDMONTON ALBERTA

INVOICE	4852
DATE	24/02/2023
TERMS	Due on receipt
DUE DATE	24/02/2023

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
21/02/2023	VEHICLE DESCRIPTION	YEAR: 2003 MAKE: KW MODEL: W900 UNIT: 932 SER. 970338 ODO. 880155 HRS: N/A PLATE # N/A	1	0.00	0.00
21/02/2023	CUSTOMER COMPLAINT	DRIVER CAME TO SHOP WITH COOLANT LEAK.	1	0.00	0.00
21/02/2023	DIAGNOSE	WENT OUTSIDE TO PRESSURE TEST RADIATOR, OPENED THE HOOD AND FOUND FAN BLADE HAD LOST MOST OF ITS BLADES AND WENT THRU THE RADIATOR, INFORMED CUSTOMER OF COST AND AVALIABILITY AND PARK TRUCK.	1	165.00	165.00
23/02/2023	HOURS	CUSTOMER REQUEST TO HAVE RADIATOR REMOVED FROM TRUCK AND LOADED ONTO ONE OF THEIR COMPANY TRUCKS AND THEY WOULD SUPPLY PARTS, TRUCK WOULDN'T START, PLUG IN CHARGER AND BOOST, TRUCK STILL WOULDN'T START, AFTER SEVERAL TRIES OVER 2 DAYS IT WAS DECIDED TO HAVE TRUCK TOWED INTO SHOP.	2	165.00	330.00
23/02/2023	HOURS	WITH TRUCK INSIDE SHOP WE REMOVED HOOD, AIR TO AIR	4	165.00	660.00

All warranty claims must be done through R&R Diagnostics and Repair F.O.B Dawson Creek, BC.

All wheels removed from equipment need to be returned to OEM spec within 150 km

		COOLER, A/C CONDENSOR AND RADIATOR, LOADED RADIATOR ONTO COMPANY TRUCK CUSTOMER SUPPLIED.			
28/02/2023	HOURS	RECIEVE RADIATOR FROM CUSTOMER, INSTALL RADIATOR AND REASSEMBLE AIR TO AIR COOLER AS WELL AS THE A/C/ CONDENSOR, MISC BRACKETS AND FAN BLADE, FILL WITH COOLANT AND TEST FOR LEAKS, NO LEAKS FOUND, TAKE TRUCK OUTSIDE AND RUN UP TO TEMPERATURE, TOP UP COOLANT AND RELEASE TRUCK TO CUSTOMER.	6	165.00	990.00
28/02/2023	SALES	RADIATOR BUSHING MOUNTING KIT.	4	108.42	433.68
28/02/2023	SALES	CHARGE AIR COOLER BUSHING MOUNTING KIT.	1	258.86	258.86
28/02/2023	SALES	FAN BLADE. 32" 12 BLADE.	1	310.69	310.69
28/02/2023	SALES	COOLANT	50	9.60	480.00
28/02/2023	SALES	COOLANT LEVEL SENSOR	1	350.31	350.31
28/02/2023	SHOP SUPPLIES	MISC SUPPLIES	1	235.95	235.95

We know you have choices.
We appreciate your business!

TERMS: A late payment charge of 5% per month compounded monthly (79% annually) from the invoice date may be applied to accounts that have not been paid in full by the payment due date.

Thank you,
R&R Diagnostics and Repair

SUBTOTAL	4,214.49
GST @ 5%	210.72
PST (BC) @ 7%	295.02
TOTAL	4,720.23
BALANCE DUE	**$4,720.23**

Approved

13 hr of labour

All warranty claims must be done through R&R Diagnostics and Repair FOB Dawson Creek, BC.

All materials removed from equipment should be maintained in OEM condition (i.e. no cuts

JONES TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21691
Date: 02/21/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 02/21/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
Labor - Jones Trucks	DVIR - Dawson Creek at the old DOT scale station, Radiator fan broken and damaged the Radiator cour, so I'm losing coolant at the moment [Andrew 02.21.23]			100.00
ORDER PARTS / SUBLET	in shop for repairs on radiator	R&R Diagnostic and Repair [02.21.23]		.00
ORDER PARTS / SUBLET	rebuild of radiator	Hunter Radiator [02.27.23]		.00
ORDER PARTS / SUBLET	room for the wait	Expedia - 02.21.23 - Andrew - c/c		.00
ORDER PARTS / SUBLET	room for the wait for repairs	Expedia - 03.02.23 - Andrew - c/c		.00

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 4852 Supplier: R&R Diagnostics & Repair	DRIVER CAME TO SHOP WITH COOLANT LEAK.	1.00	4,214.49	4,214.49
	Invoice: 02W5329 Supplier: Truck Zone	SERVICE CALL NO COOLANT ON UNIT BLEW HOSE (over payment on CC will issue a Credit)	1.00	2,439.94	2,439.94
	Invoice: 72503060712097 Supplier: Expedia.com	hotel for andrew pinnock	1.00	126.72	126.72
	Invoice: 79456 Supplier: Hunter Radiators Inc.	radiator-bolt-on recore	1.00	2,150.00	2,150.00
	Invoice: 02W5114 Supplier: Truck Zone	COOLANT SERVICE ON UNIT	1.00	1,315.19	1,315.19

Total Labor	100.00
Total Parts	.00
Total Returns	.00
Total Sublet	10,246.34
Shop Supplies	1,034.63
Invoice Total	11,380.97

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21655
Date: 02/08/2023

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 02/08/2023
Entered By: Shuzelle

Labor

Category	Description	Technician Notes	Mechanic	Amount
Tractor CVIP	CVIP REQUIRED	CVIP unit and repairs	Daniel Massner	400.00
Labor - Jones Trucks	DVIR - Engine bunk heater and webasco not working [02.05.23]	Eberspecher aux. heater wiring installation, replace its fuel pump! Mount all the Interior back, fix head lights!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR - Oil Clock light on dashboard not working. Right side run light on right side burn out. [02.06.23] Picture attached			100.00
Labor - Jones Trucks	DVIR -Clutch pedal feel a bit high [02.07.23]			100.00
Labor - Jones Trucks	DVIR - Side light on passenger side burn out. [02.07.23]	Repaired with CVIP	Daniel Massner	100.00
Labor - Jones Trucks	new light bar should be installed	install new light bar	Ryan Dhaese	100.00
Tractor SERVICE	250 Hours or 25000 kms	service and repairs	Ryan Dhaese	300.00
Labor - Jones Trucks	DVIR - Engine bunk heater and webasco not working [02.05.23]	Inspect all the bunk heaters and open up the problems!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	SAMSARA is out of order	Replaced the device and its wire harness, perform a test drive!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	A spot light must be installed, should be a little bit higher!	Build out the wire harness from dashboard to that spot light! Put all the clusters back together. Check out the wire harness of the new Eberspecher aux. heater, install the heater body!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	DVIR - Engine bunk heater and webasco not working [02.05.23]	Work on bunk heaters, open up the issues! Order the necc. parts for all the repairs! Inspect the wires of diag. link & replace the device! Perform CVI & doc. Removed both rear fenders and try to mount on smaller ones - not possible !	Laszlo Sarkozi	100.00
Tractor SERVICE	250 Hours or 25000 kms	oil service/ service repairs/ light bar install	Daniel Massner	300.00
Labor - Jones Trucks	DVIR - Engine bunk heater and webasco not working [02.05.23]	helping to put bed back on	Daniel Massner	100.00

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: 100-754359 Supplier: Northern Metalic	tools for Andrew Pinnock	1.00	878.54	878.54
	Invoice: 1013 Supplier: Diamond Shine Detailing	detailed cleaning	1.00	257.50	257.50
	Invoice: 001-129384 Supplier: SIF Superiors Industrial Frictions Ltd.	HEAVY DUTY AIR DOOR KIT	1.00	1,610.87	1,610.87
	Invoice: 001-129308 Supplier: SIF Superiors Industrial Frictions Ltd.	DOUBLE ROW AUX	1.00	279.93	279.93

Total Labor	2,000.00
Total Parts	.00

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Total Returns	.00
Total Sublet	3,026.84
Shop Supplies	502.68
Invoice Total	5,529.52

TRUCK ZONE – GRANDE PRAIRIE

15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

Invoice: **02W5336**
Date / Hour: 2/2/2023 11:22:15AM
Repair Order: 5336
Customer:
Branch: GRP
Total Invoice: $ 3,422.33
Charge

Bill To: JONES TRANSPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Work: 780-453-1156

Date: 02022 UNIT # 932
Received By: Shuttle
WO# or PO# 21643
Approved By:

Ship To: JONES TRANSPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156
Email: arap@jonestransportation.ca
Fax: 780-453-1146

Customer P/O: 21643
Add User: AWilliams

Open Date: 02/01/2023 Completion Date: 02/02/2023
Salesperson:

Unit Number: 932 **Model Year: 2003** **Make/Model: KENWORTH W 900**
Type: TRUCK HEAVY DUTY **VIN: 1XKWD49X53R970338** **Meter: 81056 Kilometers**

Task: 1 160-1000 Service Truck Call out **Department: ServiceTRK**

Complaint: CALL OUT TO 11925 101AVE GRANDE PRAIRIE PETRO PASS 02/01/23 @ 8:30AM: ALTERNATOR NOT WORKING + BATTERIES DEAD

Correction: DROVE TO UNIT, INSPECTED. EVERYTHING WAS DEAD. REMOVED 4 BATTERIES AND INSTALLED 4 NEW. TRUCK STARTED GOOD, AND ALTERNATOR PUT THE CHRAGE UP OVER 14VOLTS. TESTED POWER AT ALTERNATOR, GOOD. TESTED ALL BATTERIES AND WAS BRING THEM TO 14 VOLTS. THAT WAS WITH ALL LIGHTS ON TRUCK AND TRAILER. TIGTENED ALL PARTS AND REATTACHED BATTERY COVER. TRUCK HELD PROPER VOLTS.

**KM BILLED FOR TRAVEL AT RATE OF $2.00/ PER KM. 25KM BILLED.
SERVICE CALL DAY RATE APPLIES AT $199.00/HR**

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Z12	GA31S	BATTERY, GRP31, 925 CCA, 1050 CA	EA	4.0	$225.55	$902.20
	HAZ	Hazardous Fee		1.0	$16.00	$16.00
	Shop Sup	Shop Supplies		1.0	$109.45	$109.45

Task 1 Subtotals	
Parts:	$902.20
Labor:	$1,094.50
Miscellaneous:	$125.45
Task 1 Subtotals	$2,122.15

Task: 2 020-2000 General Truck Repairs **Department: ServiceTRK**

Complaint: UNIT CAME TO TZ AT END OF DAY WITH LOW BATTERY VOLTAGE MESSAGE ON DASH

Correction: UNIT CAME TO SHOP. LOW BATTER VOLTAGE MESSAGE ON DASH AGAIN. FOUND ALTERNATOR WAS DROPPING VOLTS THIS TIME. HAD TO CALL A NUMBER OF PLACES TO FIND CORRECT ALTERNATOR PART. WENT AND PICKED UP CORRECT PART AFTER ABOUT AN HOURS OR SO TRYING TO FIND CORRECT ONE. INSTALLED ON TO UNIT. TESTED CHARGE SYSTE AGAIN, VOLTS HELD GOOD UNDER ALL LOADS AND WITH INVERTYOR HEATER TURNED ON. MONITORED FOR AN HOUR AND CHARGE HELD GOOD. RELEASE UNIT.

WORKING WITH CUSTOMER ON LABOR, AFTER HOURS RATE NOT APPLIED. BILLED 3.0HRS @ REG SHOP RATE $169.00/HR

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
DEC	8600889	ALTERNATOR 24SI 12V 160A	EA	1.0	$579.51	$579.51
	Shop Sup	Shop Supplies		1.0	$50.70	$50.70

Task 2 Subtotals	
Parts:	$579.51
Labor:	$507.00
Miscellaneous:	$50.70
Task 2 Subtotals	$1,137.21

GST/HST Number: 845685726RT0001

** See Last Page for Invoice Total **

TRUCKZONE
Keeping you on the road

TRUCK ZONE – GRANDE PRAIRIE
15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

Invoice: **02W5336**
Date / Hour: 2/2/2023 11:22:15AM
Repair Order: 5336
Customer: 9094
Branch: GRP
Total Invoice: $ 3,422.33
Charge

Bill To: JONES TRANSPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Ship To: JONES TRANSPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156
Email: arap@jonestransportation.ca

Work: 780-453-1156
Fax: 780-453-1146

Customer P/O: 21643
Add User: AWilliams
Open Date: 02/01/2023
Completion Date: 02/02/2023
Salesperson:

Detail Tax Info:

GST		$162.97
Sales Tax		$0.00
	Total:	$162.97

Total Parts:	**$1,481.71**
Total Labor:	**$1,601.50**
Total Miscellaneous:	**$176.15**
Invoice Subtotal:	**$3,259.36**
Total Tax:	**$162.97**
Total Invoice:	**$3,422.33**

Payment Method	Terms	Due Date
Charge	N30	3/4/2023

Remit To:
Truck Zone
15816 - 111 Ave NW

Edmonton, AB T5M 2R8

Payment Terms: Payment is due upon receipt of parts/service performed unless charged to customer's account. Unpaid balances will be charged interest of 2% per month compounded monthly (26.82% per annum)

Garage Keepers' Lien: By signing below you acknowledge and agree that the vehicle described below is subject to a garage keepers' lien in favor of Truck Zone Inc for the amount of parts, accessories, materials, and services provided by Truck Zone Inc., as permitted under the Garage Keepers' Lien Act (Alberta), as amended from time to time

Liability: IT IS UNDERSTOOD THAT TRUCK ZONE INC DOES NOT ASSUME ANY LIABILITY WHATSOEVER FOR DAMAGE TO VEHICLE OR CONTENTS WHILE IN THEIR POSSESSION

Storage Fees: Vehicles not picked up within 48 hours of notification of completion are subject to a $10 per day storage fee

Parts Returns: All parts returned must be unused, accompanied with original packaging and the original purchase invoice, and returned within 30 days of the purchase invoice date. There is absolutely no return or exchange on electrical or special order parts. A 15% re-stocking charge will apply on all returned parts.

Signature: _____

TRUCKZONE
Keeping you on the road

TRUCK ZONE – GRANDE PRAIRIE
15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

Invoice: **02W5332**
Date / Hour: 2/2/2023 10:56:27AM
Repair Order: 5332
Customer:
Branch: GRP
Total Invoice: $ 1,150.24
Charge

Bill To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Work: 780-453-1156

Ship To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156

Fax: 780-453-1146

Customer P/O: 21633
Add User: AWilliams

Open Date: 01/31/2023 Completion Date: 01/31/2023
Salesperson:

Unit Number: 9104 **Model Year: 2013** **Make/Model: KENWORTH T800**
Type: TRUCK HEAVY DUTY **VIN: 1XKDD49X9DJ964968** **Meter: 1055641 Kilometers**

Task: 1 160-1000 Service Truck Call out **Department: ServiceTRK**

Complaint: UNIT WILL NOT START AT CUSTOMER YARD

Correction: AFTER HOURS CALL OUT 01/31/23
DROVE TO TZ TO BOOST UNIT, REMOVED BATTERY COVER AND RAN EXTENSION CORD AND BATTERY CHARGER. LET TRUCK BOOST FOR 15-20 MINS. STARTED UNIT, FIRED UP GOOD. REINSTALLED BATTER COVER.

AFTER HOURS CALL OUT RATE APPLIES $249.00/HR 3.00HR MIN CHARGE

NOTE: PART MISSED ON RO 5328, BILLED OUT ON THIS RO

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
PAC	N4751001	AIR TO AIR MOUNT KIT	EA	1.0	$257.76	$257.76
was missed on RO 5328						
	HAZ	Hazardous Fee		1.0	$16.00	$16.00
	Shop Sup	Shop Supplies		1.0	$74.70	$74.70

GST/HST Number: 845685726RT0001

Detail Tax Info:

GST		$54.78
Sales Tax		$0.00
	Total:	$54.78

Total Parts:	**$257.76**
Total Labor:	**$747.00**
Total Miscellaneous:	**$90.70**
Invoice Subtotal:	**$1,095.46**
Total Tax:	**$54.78**
Total Invoice:	**$1,150.24**

Payment Method	Terms	Due Date
Charge	N30	3/4/2023

Remit To:
Truck Zone
15816 - 111 Ave NW

Edmonton, AB T5M 2R8

Date: 01.02.23 UNIT # 9104
Received By: Shirelle
WO# or PO# 21633
Approved By:



TRUCK ZONE – GRANDE PRAIRIE

15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

Invoice: **02W5332**
Date / Hour: 2/2/2023 10:56:27AM
Repair Order: 5332
Customer: 9094
Branch: GRP
Total Invoice: $ 1,150.24
Charge

Bill To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Ship To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156

Work: 780-453-1156 Fax: 780-453-1146

Customer P/O: 21633
Add User: AWilliams
Open Date: 01/31/2023 Completion Date: 01/31/2023
Salesperson:

Payment Terms: Payment is due upon receipt of parts/service performed unless charged to customer's account. Unpaid balances will be charged interest of 2% per month compounded monthly (26.82% per annum)

Garage Keepers' Lien: By signing below you acknowledge and agree that the vehicle described below is subject to a garage keepers' lien in favor of Truck Zone Inc for the amount of parts, accessories, materials, and services provided by Truck Zone Inc., as permitted under the Garage Keepers' Lien Act (Alberta), as amended from time to time

Liability: IT IS UNDERSTOOD THAT TRUCK ZONE INC DOES NOT ASSUME ANY LIABILITY WHATSOEVER FOR DAMAGE TO VEHICLE OR CONTENTS WHILE IN THEIR POSSESSION

Storage Fees: Vehicles not picked up within 48 hours of notification of completion are subject to a $10 per day storage fee

Parts Returns: All parts returned must be unused, accompanied with original packaging and the original purchase invoice, and returned within 30 days of the purchase invoice date. There is absolutely no return or exchange on electrical or special order parts. A 15% re-stocking charge will apply on all returned parts.

Signature: _____

TRUCKZONE
Keeping you on the road

TRUCK ZONE – GRANDE PRAIRIE
15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

** Reprint **
Invoice: **02W5329**
Date / Hour: 2/2/2023 10:44:49AM
Repair Order: 5329
Customer:
Branch: GRP
Total Invoice: $ 2,389.64
Charge

Bill To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Work: 780-453-1156

Ship To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156

Fax: 780-453-1146

Customer P/O: ~~21634~~ 2643
Add User: AWilliams

Open Date: 01/30/2023 Completion Date: 01/30/2023
Salesperson:

Unit Number: 939
Type: TRUCK HEAVY DUTY
Model Year: 2003
VIN: 1XKWD49X53R970338
Make/Model: KENWORTH W 900
Meter: 80652 Kilometers

Task: 1 160-1000 Service Truck Call out
Department: ServiceTRK

Complaint: CALL OUT TO HUSKY ROAD/ UNIT LOACTION @12:00PM 01/30/23: NO COOLANT IN UNIT- BLEW HOSE/ FLASHING RED STOP LIGHTS

OPERATOR: ANDREW 780-920-6589

Correction: GATHERED SUPPLIES THAT MAY BE NEEDED BEFORE LEAVING SHOP. WENT AND PICKED UP DRIVER, LEFT TOWN. DROVE TO LOCATION OF UNIT, DIAGNOSED. FOUND BROKEN WATER HOSE, HAD A NEW LINE THAT WILL WORK FOR THIS. REMOVED OLD HOSE AND INSTALLED NEW. ADDED 11 JUGS OF COOLANT TO RAD RES. TRUCK WAS DEAD, GOT TO BATTERIES AND BOOSTED UNIT. TOOK A VERY LONG TIME. ONCE STARTED, KEPT RUNNING FOR 30 MINS TO INSPECT FOR ANY MORE LEAKS WHEN COOLANT IS WARM. ALL GOOD. PUT BATTERY COVER BACK ON AND CLOSED EVERYTHING UP. GAVE DRIVER 3 MORE JUGS OF COOLANT AS SPARE. CALLED AND CHECKED ON DRIVER 45 MINS AFTER HE LEFT LOCATION, GOOD NO LEAKS. DROVE BACK TO TZ SHOP.

** SERVICE CALL DAY RATE APPLIES $199.00. 7.00 HOURS BILLED.
KM BILLED FOR TRAVEL @ $2.00 PER KM. 225KM TRAVELED.***

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
AUM	561.09250	COOLANT SILICONE STICK HOSE 4 PLY	EA	2.0	$30.06	$60.12
Z12	74055	ANTIFREEZE, PRESTONE, ELC 50/50, 3.78L, REEA		14.0	$15.53	$217.42
	HAZ	Hazardous Fee		1.0	$16.00	$16.00
	Shop Sup	Shop Supplies		1.0	$139.30	$139.30
	TZMileage	Mileage		225.0	$2.00	$450.00

GST/HST Number: 845685726RT0001

Detail Tax Info:

GST		$113.80
Sales Tax		$0.00
	Total:	$113.80

Total Parts:	**$277.54**
Total Labor:	**$1,393.00**
Total Miscellaneous:	**$605.30**
Invoice Subtotal:	**$2,275.84**
Total Tax:	**$113.80**
Total Invoice:	**$2,389.64**

Payment Method	Terms	Due Date
Charge	N30	3/4/2023

Remit To:
Truck Zone
15816 - 111 Ave NW

Edmonton, AB T5M 2R8

Date: 02/02/23 UNIT# 939
Received By: Shuttle.
(WO# or PO# 2643
Approved By:



TRUCK ZONE – GRANDE PRAIRIE

15202 – 94 STREET
GRANDE PRAIRIE, AB T8X 0L2
PHONE: 780-532-0395
www.truckzone.ca

SERVICE.GRP@TRUCKZONE.CA
PARTS.GRP@TRUCKZONE.CA
CREDIT@TRUCKZONE.CA

** *Reprint* **
Invoice: **02W5329**
Date / Hour: 2/2/2023 10:44:49AM
Repair Order: 5329
Customer: 9094
Branch: GRP
Total Invoice: $ 2,389.64
Charge

Bill To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3

Ship To: JONES TRASPORTATION INC
11585 257 STREET
ACHESON, AB T7X 6C3
Office Phone: 780-453-1156

Work: 780-453-1156 Fax: 780-453-1146

Customer P/O: 21634 Open Date: 01/30/2023 Completion Date: 01/30/2023

Add User: AWilliams Salesperson:

Payment Terms: Payment is due upon receipt of parts/service performed unless charged to customer's account. Unpaid balances will be charged interest of 2% per month compounded monthly (26.82% per annum)

Garage Keepers' Lien: By signing below you acknowledge and agree that the vehicle described below is subject to a garage keepers' lien in favor of Truck Zone Inc for the amount of parts, accessories, materials, and services provided by Truck Zone Inc., as permitted under the Garage Keepers' Lien Act (Alberta), as amended from time to time

Liability: IT IS UNDERSTOOD THAT TRUCK ZONE INC DOES NOT ASSUME ANY LIABILITY WHATSOEVER FOR DAMAGE TO VEHICLE OR CONTENTS WHILE IN THEIR POSSESSION

Storage Fees: Vehicles not picked up within 48 hours of notification of completion are subject to a $10 per day storage fee

Parts Returns: All parts returned must be unused, accompanied with original packaging and the original purchase invoice, and returned within 30 days of the purchase invoice date. There is absolutely no return or exchange on electrical or special order parts. A 15% re-stocking charge will apply on all returned parts.

Signature: _____

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Equipment: 932 J-C-Jones Transportation

Work Order #: 21478
Date: 10/05/2022

Completed Date: 09/19/2024

Year: 2003
Make: Kenworth
Model: W900L-2003 Kenworth

Serial Number: 1XKWD49X53R970338
Date: 10/05/2022
Entered By: rormiston

Labor

Category	Description	Technician Notes	Mechanic	Amount
Wash Bay per hour water c...	Wash bay per hour charge @ 1.10/ Minute	WASHED REAR DIF	Harisch De Costa	33.00
Labor - Jones Trucks	Rear diff. leaks bad from multiple holes	Put patches over those holes / welding jobs!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Radios & fridge are out of order	Inspected them and start to look for the problems	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Radios & fridge are out of order	Open up the problem of the VHF radio, replaced it, removed all the others! Bent the tail lights bracket back and secured with new bolts!	Laszlo Sarkozi	100.00
Wash Bay per hour water c...	Wash bay per hour charge @ 1.10/ Minute	washed the truck	Harisch De Costa	66.00
Labor - Jones Trucks	dead battires	removing covers and charging up battires	Daniel Massner	100.00
Labor - Jones Trucks	Missing Inverter and damaged previously installed wires!			100.00
Labor - Jones Trucks	EBERSPECHER standby bank dry air heater is out of order	Move it between bays, Try to repaire the EBERSPE CHER dry air heater!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	low oil and needs conveter	added 10l of oil in unit out side and re wired/installed converter	Daniel Massner	100.00
Labor - Jones Trucks	need new drive wheels	jacked up / got tires from storsage	Daniel Massner	100.00
Labor - Jones Trucks	EBERSPECHER standby bank dry air heater is out of order	Work on the heater, replaced & relocate the fuel pump, build out the fuel lines, precharge the fuel system and perform multiple test on heater!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Both seat belt lock missing	Mount them back on! Probably driver removed them somewhy!	Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Detailing by Leo			.00
Labor - Jones Trucks	dead battires	booster pack and starting	Daniel Massner	100.00
Labor - Jones Trucks	dead batteries	remove step, put on battery charger	Ryan Dhaese	100.00
Labor - Jones Trucks	Interior & ACC. inspection	Check it out inside, make sure all the ACC. running fine!	Laszlo Sarkozi	100.00
Labor - Jones Trucks	dead batteries	start up unit with charger	Ryan Dhaese	100.00
Labor - Jones Trucks	dead batteries	start up with booster	Daniel Massner	100.00
Wash Bay - Interior cleaning	Interior cleaning of Unit		Laszlo Sarkozi	100.00
ORDER PARTS / SUBLET	Detailing by Leo	It is done!		.00
Labor - Jones Trucks	Starter got burnt	Rescue and tow it into the shop !	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Starter got burnt	removed starter/installed new/draged into shop	Daniel Massner	100.00
Labor - Jones Trucks	Starter got burnt	Help to replace the starter	Laszlo Sarkozi	100.00
Labor - Jones Trucks	Starter got burnt	remove and install new starter	Ryan Dhaese	100.00
ORDER PARTS / SUBLET	part ordered [starter]	SIF [01.24.23]		.00
Labor - Jones Trucks	tire issue	TireCraft - change over w/tire out of Jones stock		100.00

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount
68013, Boomer, Tire Chain		1.00	3.94	3.94

JONES
TRANSPORTATION
ACHESON, ALBERTA, CANADA

DISPATCH# 780-453-1156
DISPATCH FAX# 780-453-1146
DISPATCH@JONESTRANSPORTATION.CA
WWW.JONESTRANSPORTATION.CA

PROUDLY SERVING CANADA AND THE USA WITH FULL LOAD AND LTL SERVICE

BULK · FLATDECKS · STEPDECKS · DOUBLE DROP DECKS · VANS
TRACTOR SERVICE · INTERMODAL CONTAINERS / CHASSIS · TRANSLOADING

Parts

Description	Description Detail	Quantity/Hours	Price/Rate	Amount

Sublet

Category	Description	Invoice Description	Quantity/Hours	Price/Rate	Amount
	Invoice: ETC554751 Supplier: Tirecraft Edmonton Truck Centre	mobile service change tires	1.00	471.40	471.40
	Invoice: 1009 Supplier: Diamond Shine Detailing	Detailed wash	1.00	320.00	320.00
	Invoice: GPALBIN1639 Supplier: Prairie Mobile Communications	radio programming	1.00	25.00	25.00
	Invoice: 001-127559 Supplier: SIF Superiors Industrial Frictions Ltd.	new starter	1.00	289.93	289.93
	Invoice: 1425 Supplier: HeavyTek Truck and Trailer	-service call found leak @ receiver dryer remove line and replace o ring	1.00	1,721.29	1,721.29

Total Labor	2,199.00
Total Parts	3.94
Total Returns	.00
Total Sublet	2,827.62
Shop Supplies	502.66
Invoice Total	5,533.22