

CJ11-22



Custom Track Service Percent Worn

FINNING INTERNATIONAL INC.

M PIDHERNEYS INC (CA-0001785)

Prepared By: Tanner Wiberg

Model	D6TLGPVP	Job Site	Pids yard Rocky		Inspection Date	12Dec24
Manufacturer	Caterpillar		<u>Left</u>	<u>Right</u>	Next Inspection Date	12Dec25
Serial Number	RAD00845	Track Sag (46.0 mm - 66.0 mm)	40.6 mm	40.6 mm	Next Inspection Hours	10771
Reference Number	7846	Frame Ext (max 142.0 mm)	59.7 mm	59.7 mm	<u>Underfoot Conditions</u>	
Hour Meter Reading	10271	Frame Ext %	42%	42%	Impact	Moderate
Hours Per Week	26.2	Dry Joints	0	0	Abrasion	Moderate
Total Odometer Reading	34681 km	Link Roller System	55%	48%	Moisture	Moderate
Forward Odometer	21325 km				Packing	Moderate
Reverse Odometer	13356 km				Bushing Allowable Wear	Greater
Distance Per Week	--				Link Allowable Wear	Greater

Position		Part Number		Status		Date Installed		SMU Installed		Hours on Wear Surface		Measurement (mm)		Percent Worn	
Component		Left	Right	Left	Right	Left	Right	Left	Right	Left	Right	Left	Right	Left	Right
Link Assemblies		Left: 5611061		Right: 5611061		Pitch: 8 in (203.2 mm)				Sections: 45					
Track Link		2349699	2349699	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	35.6 (U)	36.3 (U)	42%	36%
Bushing (Ext)		2908049	2908049	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	11.2 (U)	11.4 (U)	55%	52%
Track Shoe		Left Width: 790.0mm						Right Width: 790.0mm							
		2940574	2940574	Original	Original	22Mar21	22Mar21	4671	4671	5600	5600	52.6 (U)	50.5 (U)	81%	84%
Idlers															
Front		3231170	3231170	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	49.5 (D)	49.5 (D)	34%	34%
Rear		3231170	3231170	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	49.5 (D)	50.3 (D)	34%	28%
Carrier Roller															
Front		2355974	2355974	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	172.7 (C)	182.9 (C)	72%	52%
Track Roller															
Front	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	36.6 (U)	39.9 (U)	64%	46%
2	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	44.4 (U)	40.4 (U)	19%	43%
3	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	--	--	--	--
CONDITION: Guarded								CONDITION: Guarded							
4	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	42.9 (U)	39.9 (U)	29%	46%
5	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	42.7 (U)	38.9 (U)	30%	52%
6	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	--	--	--	--
CONDITION: Guarded								CONDITION: Guarded							
7	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	38.4 (U)	39.4 (U)	55%	49%
												35.8	37.8		

8	S	2354157	2354157	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	(U)	(U)	67%	59%
	Sprocket														
		1730946	1730946	Replaced	Replaced	22Mar21	22Mar21	4671	4671	5600	5600	213.9 (T)	213.1 (T)	58%	61%

(U) Ultrasonic I (C) Caliper I (D) Depth Gauge I (T) Tape I (E) Estimated

Recommendations

-Track pads: chipped/broken, worn, missing entirely, hardware missing -Both side sprockets missing 1 nut/bolt

Photos

Pre-Inspect



Pre-Inspect



Pre-Inspect



Pre-Inspect





Pre-Inspect



Pre-Inspect



Pre-Inspect



Pre-Inspect






Pre-Inspect




Pre-Inspect



Pre-Inspect

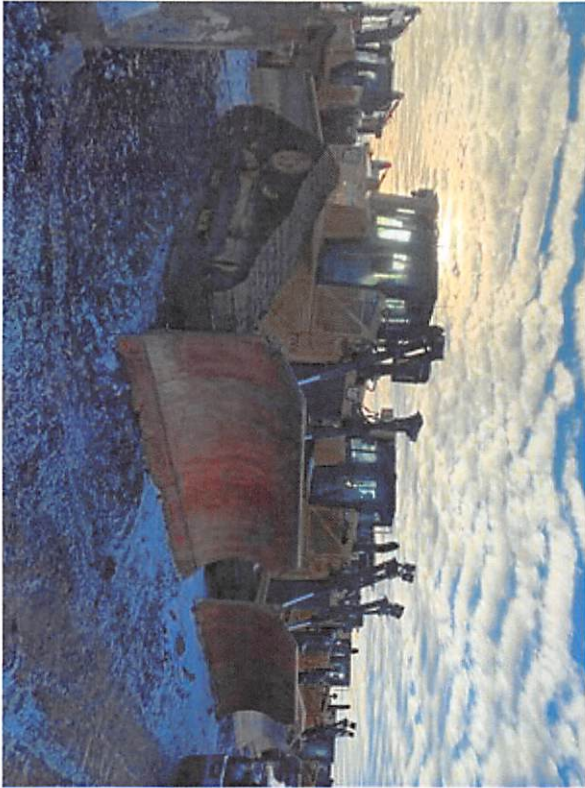


Pre-Inspect

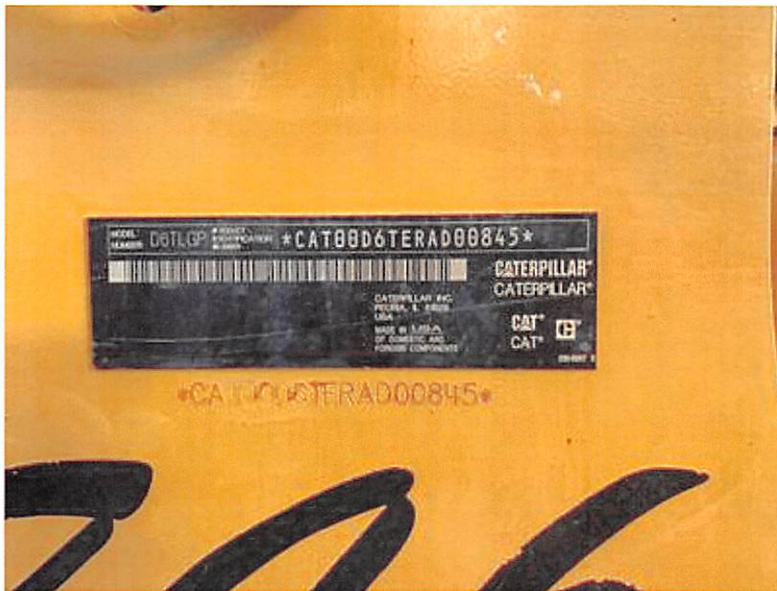

Pre-Inspect




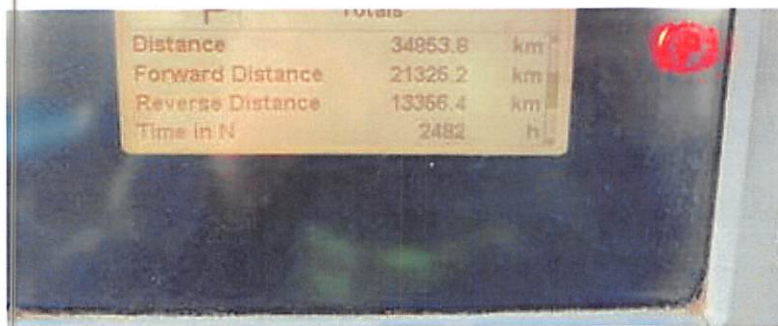

Pre-Inspect



Pre-Inspect

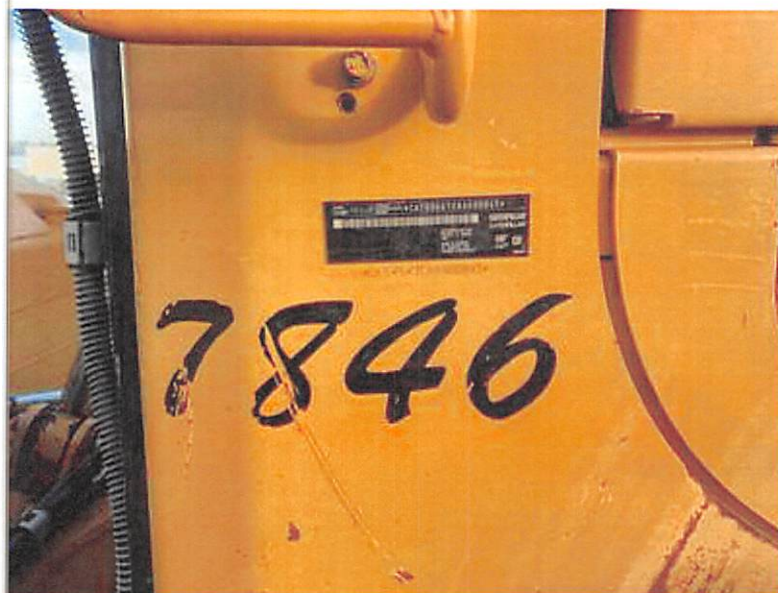

Pre-Inspect






Pre-Inspect



Pre-Inspect

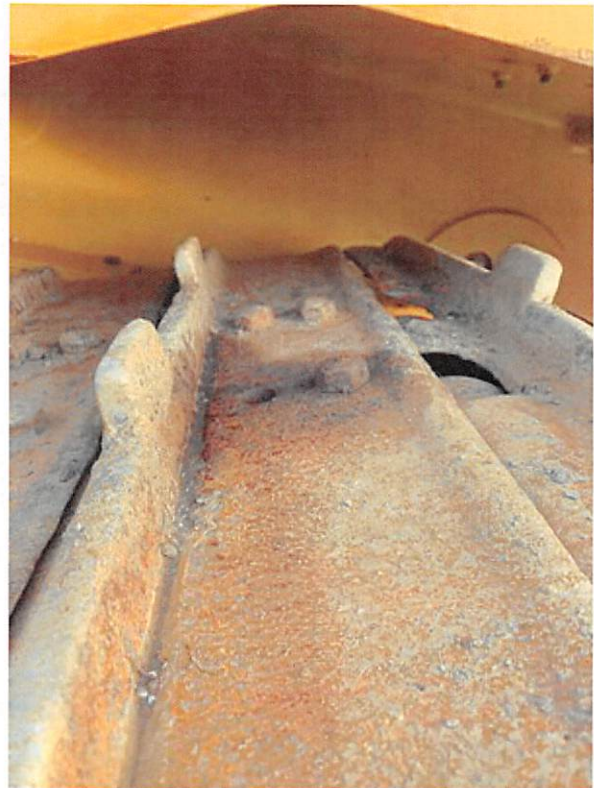

Pre-Inspect





Pre-Inspect



Pre-Inspect



Pre-Inspect



Pre-Inspect





Pre-Inspect



Pre-Inspect



Pre-Inspect

