



Vehicle Standards and Inspection

517-5

Heavy Truck Inspection Certificate

This Certificate is issued under the authority of the Province of Saskatchewan

Decal # A212792

Station #: 70400	Station Name: 101076904 Saskatchewan Ltd.
Technician #: 83537	Technician Name: Wayde Pollock
Signing Officer #: 89229	Signing Officer Name: Carla Harris

Customer Details:

Name: Yorkton Concrete Products Ltd (2012) Address: Box 129, Yorkton, Saskatchewan, S3N 2V6


Inspection Completed Date: 17Nov2025 Inspection Expiry Date: 30Nov2026

Vehicle Details:

VIN: 5KKHAXDV8KPKU6527	Odometer Reading: 296907 km
Year: 2019	Vehicle Make/Model: WESTERN STAR/HEAVY VEHICLE
Plate: 249 LQC	Jurisdiction: Saskatchewan
Unit: DT-01	

Message(s): VIN has been validated.

This certificate does not warranty or guarantee the condition of this vehicle's components and systems for any period of time.

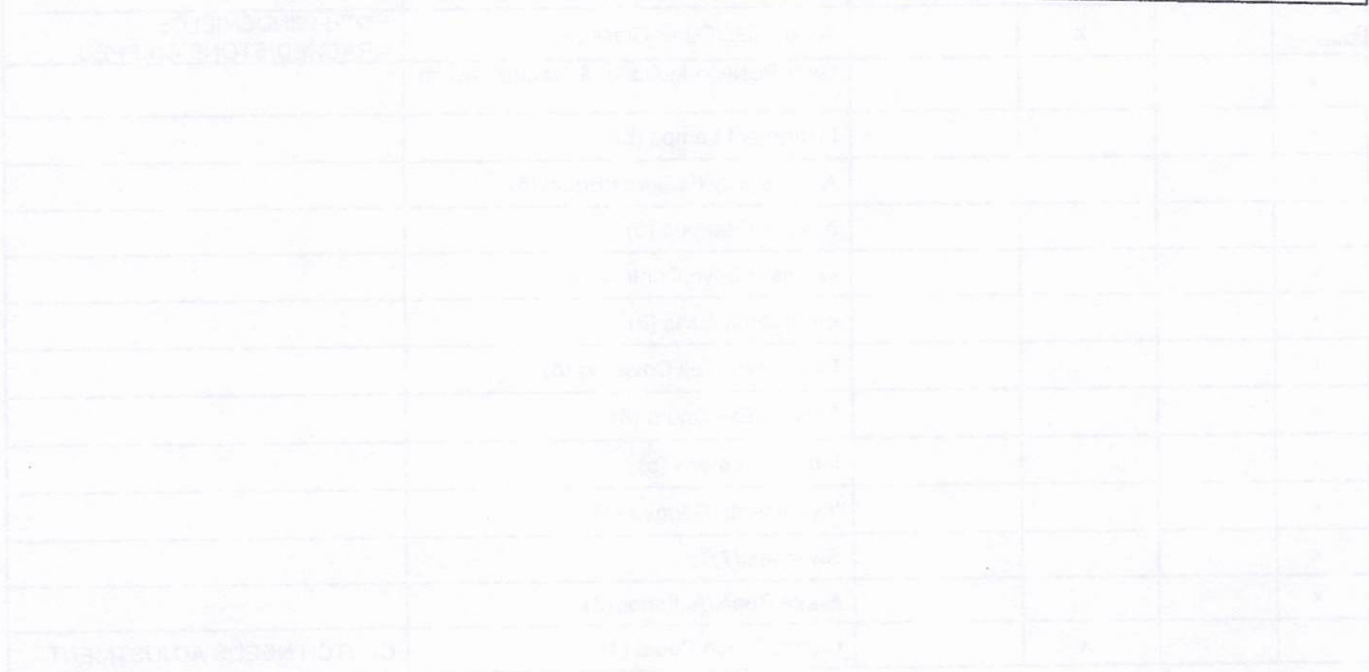



Vehicle Standards and Inspection

Heavy Truck Record of Inspection

The Record of Inspection must be given to the customer regardless of whether the vehicle passes or fails.

Station #: 70400

Station Name: 101076904 Saskatchewan Ltd.

Technician #: 83537

Technician Name: Wayde Pollock

Signing Officer #: 89229

Signing Officer Name: Carla Harris

Customer Details:

Name: Yorkton Concrete Products Ltd (2012)

Address: Box 129, Yorkton, Saskatchewan, S3N 2V6

Vehicle Details:

VIN: 5KKHAXDV8KPKU6527

Odometer Reading: 296907 km

Year: 2019

Vehicle Make/Model: WESTERN STAR HEAVY VEHICLE

Inspection Details:

Pass	Rejected	Corrected	Req Attn	DRIVERS COMPARTMENT	Comments
x				Vehicle Identification (5)	
x				Sun Visor Interior (8)	
x				Horn Operation (5)	
x				Mirrors (8)	
x				Windshield Wipers/Washers (8)	
x				Windshield Defroster/Heater (8)	
		x		Windshield/Other Glass (8)	BOTH WINDSHIELDS CRACKED/STONE CHIPPED
x				Gear Position Indicator & Neutral Switch (1)	
x				Instrument Lamps (6)	
x				Accessibility Features/Equip (5)	
x				Auxiliary Heaters (5)	
x				Auxiliary Drive Controls (5)	
x				Emergency Exits (8)	
x				Floor/Step Well Covering (8)	
x				Service/Exit Doors (8)	
x				Indicator Lamps (5)	
x				Instruments/Gauges (5)	
x				Switches (7)	
x				Brake Pedal/Actuator (3)	
		x		Clutch/Clutch Pedal (1)	CLUTCH NEEDS ADJUSTMENT

		x		Air Brake System/Components (3.2)	AIR LEAK FRONT LHS AIR TANK
x				Wheel Bearings (9)	
x				King Pins/Ball Joints (4)	
x				Steering Linkage (4)	
x				Tires/Wheels (9)	
x				Self-Steering Axle (4)	
x				Engine/Transmission Mounts (1)	
x				Frame/Crossmembers/Mounts (8)	
x				Suspension/Axles (2)	
x				Drive Shaft/Universal Joints (1)	
x				Exhaust/Emission System (1)	

Brake/Tire Measurements

Axle 1-Pass

Wheel1-On : Tire Tread Depth: 19 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 25/32 in • Cam Rotation: 38.0 degrees • Brake Stroke: 2.0 in

Wheel2-On : Tire Tread Depth: 14 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 3/4 in • Cam Rotation: 46.0 degrees • Brake Stroke: 2.0 in

Axle 2-Pass

Wheel1-On : Tire Tread Depth: 12 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 27/32 in • Cam Rotation: 28.0 degrees • Brake Stroke: 2.0 in

Wheel2 : Tire Tread Depth: 10 in

Brake(1): No Brake

N/A

Wheel3 : Tire Tread Depth: 10 in

Brake(1): No Brake

N/A

Wheel4-On : Tire Tread Depth: 11 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 25/32 in • Cam Rotation: 36.0 degrees • Brake Stroke: 2.0 in

Axle 3-Pass

Wheel1-On : Tire Tread Depth: 13 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 27/32 in • Cam Rotation: 27.0 degrees • Brake Stroke: 2.0 in

Wheel2 : Tire Tread Depth: 15 in

Brake(1): No Brake

N/A

Wheel3 : Tire Tread Depth: 13 in

Brake(1): No Brake

N/A

Wheel4-On : Tire Tread Depth: 15 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 9/16 in • Cam Rotation: 88.0 degrees • Brake Stroke: 2.0 in

PASS - vehicle passes inspection

Decal # A212792

Inspection Completed Date: 17Nov2025