



Box 519  
 124 Railway Avenue  
 Eston SK S0L 1A0  
 Phone: (306) 962-3637 Fax: (306) 962-3831  
 www.owensandsweitzer.com

RO: 20696A  
 Invoice: 22679A  
 Date: 06/15/2023

|           |    |                  |        |                  |              |
|-----------|----|------------------|--------|------------------|--------------|
| Part No.  |    | Part Name        |        | Part Description |              |
| Stock No. | PO | Part Information | Qty    | Customer         | Telephone    |
|           |    |                  |        | 08127            | 306-628-8127 |
| Cond      |    |                  | OpCode | Total            |              |

RO Open Date: 05/30/23

001 REPAIR NO START

F TRAVELED OUT TO MACHINE. SWITCHED ON TO TEST. FOUND DASH IS NOT WORKING. ENGINE CRANKING BUT NOT STARTING. OPENED FUSE BOX TO TEST FUSES- ALL FUSES TEST OK. FOUND FUSES BOARD CORRODED AT BOTTOM. UNPLUGGED FUSE BOARD AND REMOVED TO CLEAN AND INSPECT. RE-INSTALLED BOARD AND TRIED TO START MACHINE. MACHINE STARTS AND RUNS BUT DASH STILL NOT WORKING. OPENED AND TESTED DASH PLUGS- ALL SEEM TO BE OK. ASSEMBLED COVERS AND PACKED UP TOOLS TO RETURN TO SHOP. OPENED TECH CASE AFTER RETURNING TO SHOP. UPLOADED INFO

|   |                        |      |                               |         |
|---|------------------------|------|-------------------------------|---------|
| L | L LABOUR               | 6.00 | 179.00                        | 1074.00 |
| P | AG524540 INLINE ST     | 1.00 | 17.72                         | 17.72   |
| P | ENVIRO FILTER SMALL 02 | 1.00 | 0.50                          | 0.50    |
|   |                        |      | Subtotal charges this section | 1092.22 |

02 REPAIR DASH LOOSES POWER

F LOADED TOOLS AND TRAVELED OUT TO MACHINE. REMOVED EIC FROM MACHINE TO INSPECT. OPENED EIC TO INSPECT CONNECTIONS. FOUND LOOSE CONNECTION ON CIRCUIT BOARD. TIGHTENED RIBBON CONNECTOR. RE-INSTALLED EIC IN TO DASH. STARTED TO TEST MACHINE. MACHINE NOT STARTING. INSPECTED ENGINE HARNESS AND FOUND FUEL PUMP CAM SENSOR WIRING IS LOOSE. REPAIRED WIRE AND SOLDERED CONNECTOR. TRIED TO START. ENGINE STARTS AND RUNS. INSPECTED ENGINE HARNESS WHILE MACHINE IS RUNNING. FOUND MACHINE RPM FLUX WHEN TEACHING FUEL PRESSURE SENSOR. INSPECTED WIRING ON SENSOR- LOOKS OK. REMOVED PINS TO INSPECT- FOUND PINS WERE LOOSE IN CONNECTOR. TIGHTENED CONNECTOR PINS AND RE-INSTALLED. STARTED TO TEST- ALL TEST OK. MACHINE RUNS GOOD WHEN PULLING ON HARNESS. PACKED UP TOOLS AND RETURNED TO SHOP.

|   |          |      |                               |        |
|---|----------|------|-------------------------------|--------|
| L | L LABOUR | 4.67 | 179.00                        | 835.93 |
|   |          |      | Subtotal charges this section | 835.93 |

M SHOP SUPPLIES

114.60


THANK YOU FOR YOUR BUSINESS



Box 519  
 124 Railway Avenue  
 Eston SK S0L 1A0  
 Phone: (306) 962-3637 Fax: (306) 962-3831  
 www.owensandsweitzer.com

GST# R104033287

RO: 20696A  
 Invoice: 22679A  
 Date: 06/15/2023

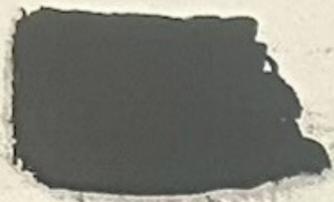

|          |    |            |     |                        |              |
|----------|----|------------|-----|------------------------|--------------|
| Year     |    | Make/Model |     | Vehicle Identification |              |
| Stock No | PO | License    | Tag | Customer               | Telephone    |
|          |    |            |     | 08127                  | 306-628-8127 |

| Cond | OpCode | Description | Quantity | Unit | Rate | Total |
|------|--------|-------------|----------|------|------|-------|
|------|--------|-------------|----------|------|------|-------|

Repair Floater

POSTED

Order ID: 23061513162525033

VISA \*5145 XX/XX Auth:010541

2144.89

ERMS:  
 service charge at a rate of 24% per annum (24% per month) may be applied  
 to overdue accounts.

| DESC     | TOTALS  |
|----------|---------|
| LABOR    | 1909.93 |
| PARTS    | 18.22   |
| SUBLET   |         |
| MISC     | 114.60  |
| OTHER    |         |
| SUBTOTAL | 2042.75 |
| GST      | 102.14  |
| PST      |         |
| TOTAL    | 2144.89 |

Signature: \_\_\_\_\_