

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeseville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 1 of 16
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

EXPERT-1000000122469 Internal

COMPLAINT:

X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

COMPLAINT

X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____
ENGINE HOURS _____ 742 _____
SEPARATOR HOURS _____ 440.1 _____

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
THIS UNIT HAS HAD THE CAB CLEANED _____ (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER _____ KT _____ (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ TT _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

SEE QUOTE

WARRANTY DATES ON REPAIRS COMPLETED:

START DATE: AUGUST 1, 2025

END DATE: AUGUST 1, 2026

Job Total: \$3,860.00

JELECDIAG2 JD ALL Internal

COMPLAINT:

1000000

1000000

1000000

1000000

1000000

1000000

1000000

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Præceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 2 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

JELECDIAG2 JD ALL Internal
DIAGNOSE GRAIN TANK AND TAILINGS CAMERAS

CORRECTION:
UPDATED CAMERAS
REPAIR VERIFIED - CAMERAS NOW WORKING

Labor: \$600.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$600.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JSOFTWARE JD X9 1100 Internal
COMPLAINT:
UPDATE ALL CONTROLLER SOFTWARE (RECOMMENDED)

CORRECTION:
DOWNLOADED SOFTWARE TO COMPUTER
DISPLAY WOULD NOT DOWNLOAD ONTO COMPUTER
HAD TO DELETE EXTRA PAYLOADS ON LAPTOP TO FREE UP SPACE
DISPLAY DOWNLOADED TO LAPTOP
DISPLAY WOULD NO DOWNLOAD TO COMBINE
COMBINE STORAGE WAS FULL
DID A RESET ON THE STORAGE
COMBINE TOOK THE DISPLAY UPDATE
UPDATED SOFTWARE FOR ALL CONTROLLERS

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001040 JD X9 1100 Internal
COMPLAINT:
REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.(RECOMMENDED)

CORRECTION:
LOOSENED CHAIN OFF
TOOK A HALF LINK OUT
PUT THE CHAIN BACK TOGETHER

11-11-11

11-11-11

11-11-11
11-11-11
11-11-11
11-11-11

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 847-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 6/27/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
		Page: 3 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

J06001040 JD X9 1100 Internal

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

JGEN04- Internal

COMPLAINT:

REPLACE MISSING SHEAR BOLTS ON LATCHING MECHANISM (RECOMMENDED)
- CLEAN LOCKING PINS

CORRECTION:

REPLACED SHEER PINS ON MULTI COUPLER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7264	M4-0.75 NYLOCK NUT	4.00	0.56	0.56	\$2.24	N
19M9326	M4x30 HEXSOC 12.9 BOLT	2.00	2.29	2.29	\$4.58	N
Labor: \$60.00		Parts: \$6.82	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$66.82	

EXPERT-1000000176030 Internal

COMPLAINT:

FEED ACCELERATOR WING, REMOVE AND REPLACE (RECOMMENDED)
- REMOVE AND REPLACE BENT WINGS (4).
- FEED ACCELERATOR UNBALANCED CLEAN, ALIGN AND REPOSITION WINGS AN CHEVRONS, ALL TIME STOPS AT THE SAME SPOT.
- BAD VIBRATION WITH SEPARATOR ENGAGED.

CORRECTION:

REMOVED ROUND-HEAD BOLTS AND WEAR STRIPS FROM THE FEED ACCELERATOR WINGS.
REMOVED CAP SCREWS FROM THE FEED ACCELERATOR WING.
REPLACED THE FEED ACCELERATOR WINGS AS REQUIRED.
INSTALLED THE FEED ACCELERATOR WING AND HARDWARE.
TIGHTENED THE FEED ACCELERATOR CAP SCREWS TO SPECIFICATION.
INSTALLED THE FEED ACCELERATOR WING WEAR STRIPS AND HARDWARE.
TIGHTENED THE WEAR STRIP ROUND-HEAD BOLTS TO SPECIFICATION.
TOOK ONE OF THE WING STRIPS OFF AND STRAIGHTEN IN THE PRESS - THE BOLT HOLE WERE NOT LINING UP
VACUUMED OUT FEED ACCELERATOR WHEN WING STRIPS WERE REMOVED

100-100000

100-100000

100-100000

100-100000

100-100000

100-100000

100-100000

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 4 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

EXPERT-1000000176030 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE174444	X9 FEED ACCELERATOR/BEATER STRIP ASN 82K	2.00	434.81	434.81	\$869.62	N
HXE177730	STRIP	2.00	601.68	601.68	\$1,203.36	N
Labor: \$600.00		Parts: \$2,072.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,672.98	

EXPERT-1000000075379 Internal

COMPLAINT:

LEFT-HAND CONCAVE, REMOVE AND REPLACE (CRITICAL)
- #4 AND # 6 LARGE WIRE REPLACE

CORRECTION:

STARTED ENGINE AND PRESS THRESHING CLEARANCE ADJUST SWITCH.
TO ALLOW EASIER ACCESS TO "Z" BAR HARDWARE, TOUCH PLUS (+) OR MINUS (-) SYMBOL, OR ROTATE THE SELECTION DIAL TO SET THRESHING CLEARANCE TO 5.
USING THE HANDLE, SHIFTED THE ROTOR GEAR CASE TO THE NEUTRAL POSITION.
REMOVED CAP SCREW AND COVER SUPPORT.
REMOVED CAP SCREWS AND NUTS AND THE SIDE HILL DIVIDER FROM THE FRONT CHAFFER CROP DIVIDER.
REMOVED THE CAP SCREWS AND NUTS FROM THE "Z" BAR.
REMOVED CAP SCREWS FROM THE CONCAVE AND CONCAVE SUPPORT.
SLID AND REMOVED THE CONCAVES OUT THE SIDE OF THE MACHINE.
REPAIRED OR REPLACED AS NECESSARY.
INSTALLED IN REVERSE ORDER FOLLOWING THESE SPECIAL INSTRUCTIONS.
GUIDED AND INSTALLED CONCAVES ONTO THE CONCAVE SUPPORTS USING CAP SCREWS AND TIGHTEN.
VERIFIED ENDS OF CONCAVES FIT SNUG INTO "Z" BAR; THEN TIGHTEN CAP SCREWS AND NUTS.
LOOSENED OFF JAM NUTS ON CLEARANCE CYLINDERS
TIGHTENED NUTS AND SPUN ROTOR UNTIL IT HIT CONCAVES
BACKED OFF NUT 1/4 TURN UNTIL ROTOR DID NOT RUB
TIGHTENED UP JAM NUTS
REPEATED PROCESS FOR REAR CYLINDER
COMPLETED CONCAVE LEVELING CALIBRATION
COMPLETED THRESHING CLEARANCE CALIBRATION

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

SECRET

SECRET

0-72419E

प्राथमिक

650

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preecavilla, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 6/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 5 of 16
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

EXPERT-1000000075379 Internal
 AXE96610 X9 LARGE WIRE CONCAVE REG WEAR 2.00 907.46 907.46 \$1,814.92 N

Labor: \$1,000.00 Parts: \$1,814.92 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,814.92

EXPERT-1000000176686 Internal

COMPLAINT:

LEFT-HAND SEPARATOR TINES, REMOVE AND REPLACE (RECOMMENDED)
 - TINE'S BROKEN (2), REMOVE AND REPLACE 2 SETS

CORRECTION:

REMOVED SEPARATOR GRATES FOR ROTOR ACCESS
 INSPECTED WEAR ON SEPARATOR TINES
 REMOVED CAP SCREWS AND SEPARATOR TINES
 REMOVED THE MATCHING TINE TO KEEP THE ROTOR IN BALANCE
 TIGHTENED THE SEPARATOR TINE HARDWARE TO SPEC

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10959	X9 Rotor Tine Set	2.00	316.54	316.54	\$633.08	N

Labor: \$260.00 Parts: \$633.08 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$893.08

J06175204 JD X9 1100 Internal

COMPLAINT:

TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST (RECOMMENDED)

CORRECTION:

LOOSENEED HARDWARE
 SLID GEAR DOWN TO TENSION THE CHAIN

Labor: \$100.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$100.00

J06180070 JD X9 1100 Internal

COMPLAINT:

ROTOR VARIABLE BELT, REMOVE AND REPLACE (CRITICAL)

11

12

13
14
15
16

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 6 of 16
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

J06180070 JD X9 1100 Internal

CORRECTION:

BELT WAS ALREADY OFF
INSTALLED THE BELT
TENSIONED THE BELT
PUT LINES BACK ON
RAN THE COMBINE
ROTOR WASN'T REACHING RPM
HAD TO TIGHTEN THE BELT MORE
RAN THE COMBINE AGAIN

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,697.06	1,697.06	\$1,697.06	N

Labor: \$400.00 Parts: \$1,697.06 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,097.06

JADJCHAFSIEV JD X911 Internal

COMPLAINT:

FACTORY CALIBRATION OF SIEVE AND CHAFFER (RECOMMENDED)

CORRECTION:

OPENED AND CLOSED SIEVE LOUVERS ALL THE WAY
OPENED CHAFFER LOUVER'S ALL THE WAY
USED TOOL FROM SHOP TO HAVE CONCAVES SET OPEN AT 5MM
WENT INTO CAB AND PERFORMED FACTORY CALIBRATION ON SIEVE
SAVED SETTINGS
REPEATED SAME PROCESS FOR CHAFFER
REPAIR VERIFIED

Labor: \$200.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$200.00

J06001001 JD S790 Internal

COMPLAINT:

TOP UP ALL FLUIDS (RECOMMENDED)
- LOW OIL IN GEAR CASES, COOLANT LOW, GRAIN LOADING GEARCASE OVER FILLED

10-10-10

10-10-10

10-10-10
10-10-10
10-10-10
10-10-10

PATTISON AGRICULTURE LIMITED

Hwy 8 South

Kamsack, SK S0A 1S0

Phone: (306) 542-2814

Fax: (306) 542-2178

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 7 of 16
Prv Phone:	Prv Phone:	

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

739

1H0X911XAN0820336

100315

J06001001 JD S790 Internal**CORRECTION:**

DRAINED OIL OUT OF BOTH GEAR BOXES IN THE HOPPER
 DRAINED SOME OIL OUT OF MAIN ENGINE GEAR CASE
 CHECKED IT AND STILL HAD TO TAKE MORE OUT
 CHECKED IT AGAIN AND IT WAS GOOD
 TOPPED UP COOLANT


Labor: \$50.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000019910 Internal**COMPLAINT:**

BATTERY BOX DEBRIS, CLEAN (RECOMMENDED)

CORRECTION:

REMOVED BATTERY BOX COVER
 CLEANED DEBRIS OUT OF BATTERY BOX
 REINSTALLED BATTERY BOX COVER

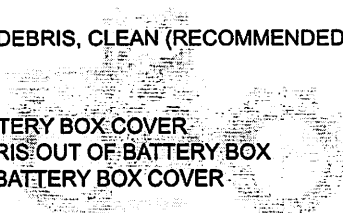

Labor: \$45.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$45.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06001201 JD X9 1100 Internal**COMPLAINT:**

ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK (RECOMMENDED)

CORRECTION:

REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
 TURNED CHAIN UNTIL CONNECTING LINK IS VISIBLE.
 DISCONNECTED CONNECTING LINK.
 REMOVED HALF LINK.
 RECONNECTED CONNECTING LINK.
 ADJUSTED TENSION TO SPEC.
 RAN UNIT AND READJUST TENSION AS REQUIRED.

1000

1000

1000
1000
1000
1000

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preecaville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: ●

Deliver To:

Internal Used Stock No. ●	Internal Used Stock No. ●	Invoice Number: ●
		Invoice Date: 6/27/2025
		Location: ●
Bus Phone:	Bus Phone:	Work Order Number: ●
Prv Phone:	Prv Phone:	Payment Type: ●
		Page: 8 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

J06001201 JD X9 1100 Internal

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
-----------------	---------------	--------------	--------------	---------------------


EXPERT-1000000075643 Internal

COMPLAINT:

RIGHT-HAND CONCAVE, REMOVE AND REPLACE (RECOMMENDED)
- 1 LARGE WIRE AND 1 SMALL WIRE

CORRECTION:

STRAIGHTENED THE 2 CONCAVES THAT WERE BENT
INSTALLED ONE NEW BIG WIRE CONCAVE AND ONE NEW SMALL WIRE CONCAVE
INSTALLED CONCAVES AND HAND TIGHTENED BOLTS AT THE BOTTOM OF TH CONCAVES TO THE CONCAVE CRADLE
USED PRY BAR TO PULL CONCAVES UP AND INSTALLED BOLTS TO Z-BAR
INSTALLED ALL HARDWARE HOLDING CONCAVES IN PLACE
TIGHTENED BOLTS AT BOTTOM OF CONCAVES TO THE CONCAVE CRADLE
REINSTALLED CONCAVE COVERS
LEFT ONE SEPARATOR GRATE OFF TO SPIN ROTOR WHEN LEVELING
STILL NEED TO JUST LEVEL CONCAVES
LOOSENED OFF JAM NUTS ON CLEARANCE CYLINDERS
TIGHTENED NUTS AND SPUN ROTOR UNTIL IT HIT CONCAVES
BACKED OFF NUT 1/4 TURN UNTIL ROTOR DID NOT RUB
TIGHTENED UP JAM NUTS
REPEATED PROCESS FOR REAR CYLINDER
DID CONCAVE LEVELING CALIBRATION
DID THRESHING CLEARANCE CALIBRATION
SPUN ROTOR TO MAKE SURE IT CLEARS CONCAVES
DID NO HIT
REINSTALLED SEPARATOR GRATE
REINSTALLED COVERS FOR SEPARATOR

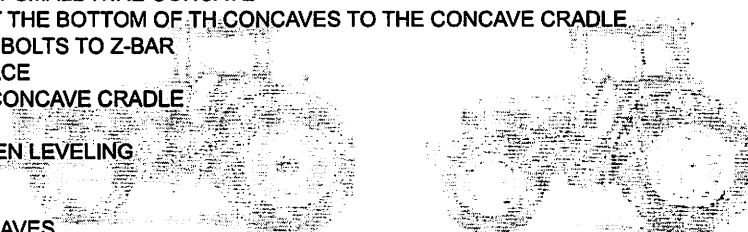

REPAIR VERIFIED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE96610	X9 LARGE WIRE CONCAVE REG WEAR	1.00	907.46	907.46	\$907.46	N

三

三

三

三

三

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 6/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 9 of 16
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

EXPERT-1000000075643 Internal

AXE96613	X9 SMALL WIRE CONCAVE REG WEAR	1.00	928.71	928.71	\$928.71	N
----------	--------------------------------	------	--------	--------	----------	---

Labor: \$1,000.00	Parts: \$1,836.17	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,836.17
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000179734 Internal

COMPLAINT:

RIGHT-HAND SEPARATOR TINES, REMOVE AND REPLACE (RECOMMENDED)
- REPLACE 2 SETS OF TINES

CORRECTION:

REMOVED SEPARATOR GRATES FOR ROTOR ACCESS
INSPECTED WEAR ON SEPARATOR TINES
REMOVED CAP SCREWS AND SEPARATOR TINES
REMOVED THE MATCHING TINE TO KEEP THE ROTOR IN BALANCE
TIGHTEN THE SEPARATOR TINE CAP SCREWS TO SPECIFICATION

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
KXE10959	X9 Rotor Tine Set	2.00	316.54	316.54	\$633.08	N

Labor: \$260.00	Parts: \$633.08	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$893.08
------------------------	------------------------	-------------------------	---------------------	----------------------------

JBLOWCOLERPK1 JD ALL Internal

COMPLAINT:

WASH/BLOW OUT COOLING PACKAGE ALL MACHINES (RECOMMENDED)

CORRECTION:

BLEW OUT COOLING PACKAGE

Labor: \$172.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$172.50
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN17- Internal

COMPLAINT:

TIGHTEN HOSE CLAMPS ON HYDRAULIC TANK AND GEAR CASE AND INNER PUMP STACK (RECOMMENDED)

11-11-11

11-11-11

11-11-11
11-11-11
11-11-11
11-11-11

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 6/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 10 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

JGEN17- Internal

CORRECTION:

TIGHTENED ALL HOSE CLAMPS ON HYDRAULIC TANK, GEAR CASE AND INNER PUMP STACK

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN18- Internal

COMPLAINT:

ADJUST STEP IN HOPPER, RUBBING ON ROCKSHAFT (RECOMMENDED)

CORRECTION:

WENT INTO HOPPER
LOOSENED OFF HARDWARE FOR STEP ADJUSTMENTS
LIFTED STEP OFF THE ROCK SHAFT
TIGHTENED UP HARDWARE TO SPEC
REPAIR VERIFIED

Labor: \$70.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$70.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

JGEN19- Internal

COMPLAINT:

LEFT HAND SIDE BIN LEVEL HARNESS PINCHED , ADJUST HARNESS (RECOMMENDED)

CORRECTION:

UNHOOKED CONNECTOR
REMOVED CHRISTMAS TREE CLIPS
MOVED TO OTHER SIDE TO MOVE HARNESS FROM PINCH POINT
RECONNECTED CONNECTOR
REPAIR VERIFIED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
57M9940	Connector Barb Mount	1.00	2.25	2.25	\$2.25	N
Labor: \$50.00		Parts: \$2.25	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$52.25	

1

1

111

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 11 of 16
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

EXPERT-1000000077752 Internal

COMPLAINT:

FIRE EXTINGUISHER, CHARGE (RECOMMENDED)

CORRECTION:

FILLED FIRE EXTINGUISHER UP WITH WATER

TRIED TESTING IT AND IT WASN'T WORKING PROPERLY

HAD TO OIL UP THE HANDLE SO THE EXTINGUISHER WOULD STOP SPRAYING WHEN THE HANDLE ISN'T BEING HELD DOWN

REFILLED EXTINGUISHER

Labor: \$50.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.00
----------------	---------------	--------------	--------------	--------------------

EXPERT-1000000076484 Internal

COMPLAINT:

FUEL PRE-CLEANER FILTER, CLEAN (RECOMMENDED)

CORRECTION:

Close the valve on the fuel precleaner.

Remove the fuel precleaner filter and clean the screen.

Install the screen and fuel precleaner filter.

To fill the bowl, open the valve on the fuel precleaner.

Labor: \$25.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$25.00
----------------	---------------	--------------	--------------	--------------------

JENGAIRFIL JD X9 11 Internal

COMPLAINT:

REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS (RECOMMENDED)

CORRECTION:

REMOVED AND REPLACED PRIMARY AND SECONDARY ENGINE AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	477.72	477.72	\$477.72	N

1000

1000

1000

1000

1000

1000

1000

PATTISON AGRICULTURE LIMITED

Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355
Shaunavon, SK (306) 297-2639

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 12 of 16

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

739

1H0X911XAN0820336

100315

JENGAIRFLT JD X9 11 Internal

HXE11091

Secondary EngAir Filter

1.00

337.08

337.08

\$337.08

N

Labor: \$50.00**Parts: \$814.80****OL&M: \$0.00****Misc: \$0.00****Sub-Total: \$864.80****JENGOILCHNG JD X9 11 Internal****COMPLAINT:**

REPLACE ENGINE OIL AND FILTER (RECOMMENDED)

CORRECTION:

DRAINED ENGINE OIL AND REMOVED FILTER

CLEANED AREA

ADDED 50L OF OIL

INSTALLED NEW OIL AND FILTER

RAN UNIT AND LEAK CHECK

ADJUSTED OIL LEVEL AS REQUIRED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	156.67	156.67	\$156.67	N
TY6267B	HYGARD - per Litre	57.00	11.76	11.76	\$670.32	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF15	ENVIRO FEE	57.00	0.15	0.15	\$8.55	N

Labor: \$125.00**Parts: \$826.99****OL&M: \$0.00****Misc: \$9.80****Sub-Total: \$961.79****J10030100 JD X9 1100 Internal****COMPLAINT:**

REPLACE ENGINE FUEL FILTERS (RECOMMENDED)

CORRECTION:

REPLACED PRIMARY AND SECONDARY FUEL FILTERS

REMOVED AND CLEANED FUEL STRAINER

BLED FUEL SYSTEM

FUNCTION AND LEAK CHECKED

1000000

1000000

1000000

1000000

1000000

1000000

1000000

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 13 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

J10030100 JD X9 1100 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	168.89	168.89	\$168.89	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	162.25	162.25	\$162.25	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$80.00 Parts: \$331.14 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$413.64

EXPERT-1000000074132 Internal

COMPLAINT:

FUEL TANK BREATHER, REMOVE AND REPLACE (RECOMMENDED)

CORRECTION:

REMOVED THE CAP, BREATHER, AND O-RING FROM THE FUEL TANK
CHECKED FOR LEAKS
INSPECTED AND REPLACED AS NECESSARY
INSTALLED IN REVERSE ORDER FOLLOWING THESE SPECIAL INSTRUCTIONS
INSTALLED THE O-RING AND BREATHER
TIGHTENED THE BREATHER TO SPECIFICATION
INSTALLED THE CAP AND TIGHTEN TO SPECIFICATION

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	DEF Tank Breather	1.00	47.04	47.04	\$47.04	N

Labor: \$17.00 Parts: \$47.04 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$64.04

JCABFILTER JD X9 11 Internal

COMPLAINT:

REPLACE CAB AIR FILTERS (RECOMMENDED)

CORRECTION:

REMOVED CAB AIR FILTERS
CLEANED FILTER HOUSING
INSTALLED NEW AIR FILTERS

1000

1000

1000
1000
1000
1000

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 6/27/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
		Page: 14 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

JCABFILTER JD X9 11 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	Cab Recirc Air Filter	1.00	40.49	40.49	\$40.49	N
TA32591	Cab FreshAir Filter	1.00	125.95	125.95	\$125.95	N

Labor: \$50.00 Parts: \$166.44 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$216.44

JGEN27- Internal

COMPLAINT:

FEEDER HOUSE SAFETY SHIELD LOCK PIN MISSING AND STRAP FOR LOCK PIN'S BROKEN ON RIGHT HAND SIDE

CORRECTION:

INSTALLED MISSING PIN
INSTALLED BROKEN STRAP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H167815	Retaining Cable	1.00	8.30	8.30	\$8.30	N
M72598	Quick Lock Pin	1.00	4.88	4.88	\$4.88	N

Labor: \$30.00 Parts: \$13.18 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$43.18

JGEN28- Internal

COMPLAINT:

ADJUST FAN VARIABLE DRIVE , DOESN'T REACH REQUIRED RPM (RECOMMENDED)

CORRECTION:

ADJUSTED FAN VARIABLE DRIVE
TESTED UNIT - NOW REACHES REQUIRED RPM'S

Labor: \$100.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$100.00

JGEN29- Internal

COMPLAINT:

RESEARCH

SECRET

15

SECRET

SECRET

1997

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: [REDACTED]

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 6/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 15 of 16
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

JGEN29- Internal
FEED ACCELERATOR PULLEY LOOSE , REPAIR (RECOMMENDED)

CORRECTION:
TIGHTENED BOLT ON PULLEY TO SPEC
REPAIR VERIFIED

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN30- Internal
COMPLAINT:
REPLACE MISSING RIVET ON CHAFFER FRAME SEAL (RECOMMENDED)
- PN - M64720 x1

CORRECTION:
INSTALLED MISSING RIVET ON CHAFFER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
M64720	Pop Rivet 188 X .575	1.00	1.40	1.40	\$1.40	N
Labor: \$50.00	Parts: \$1.40	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$51.40		

JGEN31- Internal
COMPLAINT:
REPLACE O-RINGS ON CHOPPER GEARCASE LUBE LINE LEAKING (RECOMMENDED)
- PN# T77814 x 1
- PN# R26375 x 1

CORRECTION:
Replaced the one oring on gearbox lube line that looked to be leaking
Checked for leaks
Done

1

2

3
4
5
6

PATTISON AGRICULTURE LIMITED
Hwy 8 South
Kamsack, SK S0A 1S0
Phone: (306) 542-2814
Fax: (306) 542-2178
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 6/27/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 16 of 16

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	739	1H0X911XAN0820336	100315	

JGEN31- Internal

Labor: \$70.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$70.00
----------------	---------------	--------------	--------------	--------------------

JGEN01- Internal

COMPLAINT:
CHAFFER READING ERRATIC

CORRECTION:
CHECKED THE HOLE HARNESS FOR DAMAGE
CLEANED THE GROUNDS
CHECKED ALL CONNECTORS AND CLEANED THEM
RAN THE COMBINE AND MADE SURE IT WOULD READ CORRECTLY

Labor: \$160.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$160.00
-----------------	---------------	--------------	--------------	---------------------

Miscellaneous Charges: SERVICE ACCESSORIES	\$150.00
---	----------

Customer PO No:
Tax Exempt No:
Advisor: KADE TROFIMENKOFF

Job Total:	\$21,694.15
Grand Total:	\$21,694.15

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by:

Date:

1000000000

1000000000

1000000000

1000000000

1000000000

1000000000