



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: [REDACTED]
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
		Page: 1 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JGLSPR JD ALL Internal

COMPLAINT:

01 SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS 2709 hrs

DOES THIS UNIT GET A VALUEMAX STICKER YES ☒ NO ☐
HAS THE STICKER BEEN INSTALLED YES ☒ NO ☐
CAB HAS BEEN COMPLETELY CLEANED LR (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER LR (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB LR (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:

Shields are in crate #7

Job Total: \$2,828.32

JWASH10 USED SPRAYER Internal

COMPLAINT:

02 WASH USED SPRAYER, READY FOR DISPLAY.

CORRECTION:

CONTINUED ON NEXT PAGE->



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No: [REDACTED]	Internal Used Stock No: [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: [REDACTED]
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 2 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JWASH10 USED SPRAYER Internal

INCLUDES THE FOLLOWING:

- WASH COMPLETE EXTERIOR.
- WASHING OUT RADIATOR AND ALL COOLERS.
- VACUUM CAB AND WASH FLOOR MAT.
- WASH ALL CAB INTERIOR SURFACES
- CLEAN WINDOWS

Labor: \$1,150.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,150.00
-------------------	---------------	--------------	--------------	-----------------------

J21070101 JD R4045 Internal

COMPLAINT:

03 HYDRO DRIVE MOTOR FRONT REVERSE PROPEL HOSE, REPLACE (AKK34317)

CORRECTION:

Left a hydraulic oil trail driving into the shop from the RH rear wheel motor line
 Removed 2 of the clamps where there was oil to find the leak
 Identified which line was actually leaking and ordered new line
 Left overnight and lots of oil leaked out onto the floor
 Taped up line to reduce spillage
 Removed and capped line at the top fitting
 Removed all the other clamps and pulled hose out
 Removed bottom fitting at the wheel motor and capped
 Installed new hose at the wheel motor
 Routed through the clamps and other hoses
 Installed and tightened all the clamps
 Installed hose at top fitting
 Clean and leak checked

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK34317	HYDRAULIC	1.00	349.97	349.97	\$349.97	N
TY27956	TORQ-GARD II 10W30 CK4 18.9L	2.00	144.50	144.50	\$289.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/9/2025 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 3 of 33
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J21070101 JD R4045 Internal								
EF300	ENVIRO FEE		2.00	3.00	3.00	\$6.00	N	
Labor: \$600.00		Parts: \$638.97	OL&M: \$0.00	Misc: \$6.00	Sub-Total: \$1,244.97			

J21070105 JD R4045 Internal

COMPLAINT:

04 RIGHT FRONT HYDRO DRIVE MOTOR HOSES, RE-ALIGN HOSES (CUT ZIPTIES AND RE CLAMP HOSES IN CORRECT SPACING)

CORRECTION:

Right Front wheel motor hydraulic lines in-correctly routed
 Cut all the zip ties
 Removed all the clamps
 Removed the front big hose and re-routed to be on the correct side of the other hoses
 Re-installed clamps
 All hoses have been re-aligned correctly

Labor: \$600.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$600.00
-----------------	---------------	--------------	--------------	---------------------

JENGAIRFILT JD R4045 Internal

COMPLAINT:

05 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

JF changed filters
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN403918	Primary Engine Air Filter	1.00	295.74	295.74	\$295.74	N
AN403919	Secondary Engine Air Filter	1.00	257.15	257.15	\$257.15	N
Labor: \$50.00		Parts: \$552.89	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$602.89	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/9/2025 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 4 of 33
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JENGOILCHNG JD R4045 Internal

COMPLAINT:

06 REPLACE ENGINE OIL AND FILTER

CORRECTION:

Tuesday, November 4, 2025 9:36 AM - SH

- engine oil drained
- old filter removed
- new filter installed
- drain plug reinstalled
- fresh oil added
- unit tested, no leaks
- checked and topped up oil level

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE509672	Engine Oil Filter	1.00	51.27	51.27	\$51.27	N
TY26673	15W40 3.78L Plus-50II CK4/SN	1.00	37.78	37.78	\$37.78	N
TY26675	PLUS-50 II 15W-40 CK4/SN JUG 9.46L	1.00	89.73	89.73	\$89.73	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	1.00	170.86	170.86	\$170.86	N
TY26801	15W40 TORQ-GARD II 18.9L	1.00	137.60	137.60	\$137.60	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF300	ENVIRO FEE	2.00	3.00	3.00	\$6.00	N
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$100.00		Parts: \$487.24	OL&M: \$0.00	Misc: \$8.65	Sub-Total: \$595.89	

J21001090 JD R4045 Internal

COMPLAINT:

07 REPLACE ENGINE FUEL FILTERS

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Box 860
Moosomin, SK S0G 3N0
Phone: (306) 435-3301
Fax: (306) 435-3082
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355
Shaunavon, SK (306) 297-2639



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 5 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J21001090 JD R4045 Internal

Tuesday, November 4, 2025 7:56 AM - SH

- removed old filters
- removed and cleaned water separator
- installed new filters with new seals
- reinstalled water separator
- tested unit, no leaks

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	FINAL FUEL FILTER	1.00	247.52	247.52	\$247.52	N
DZ130550	FILTER ELE	1.00	243.60	243.60	\$243.60	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$70.00		Parts: \$491.12	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$563.62	

J21070001 JD R4045 Internal

COMPLAINT:

08 REPLACE HYDROSTATIC FILTERS
change out hydraulic & hydrostatic filters

CORRECTION:

Wednesday, November 5, 2025 3:47 PM - SH

- cleaned dirt from filter areas
- removed old filters
- installed new filters
- needs leak check

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN203010	Hydraulic Filter	2.00	123.38	123.38	\$246.76	N
AN207572	FILTER	1.00	511.82	511.82	\$511.82	N
AT318160	Hydraulic Oil Filter	1.00	219.73	219.73	\$219.73	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/9/2025 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 6 of 33
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J21070001 JD R4045 Internal					
EF50	ENVIRO FEE		2.00	0.55	0.55
					\$1.10
					N
Labor: \$35.00	Parts: \$978.31	OL&M: \$0.00	Misc: \$2.35	Sub-Total: \$1,015.66	

J21001007 JD R4045 Internal

COMPLAINT:

09 REPLACE OIL IN PLANETARY WHEEL HUBS.

CORRECTION:


DRAINED OIL FROM PLANETARY HOUSINGS.

INSTALLED NEW OIL.

LEAK CHECKED.

Wednesday, November 5, 2025 2:45 PM - SH

- removed front hub covers, drained oil
- removed both front planetary assemblies
- LF planetary reinstalled into RF hub
- RF planetary reinstalled into LF hub
- filled hubs with fresh oil
- process repeated for the rear hubs
- checked all hardware and plugs, no leaks
- cleaned work area

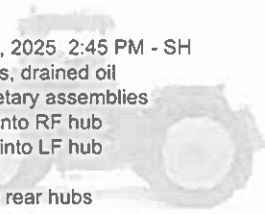

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	11.00	47.83	47.83	\$526.13	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	11.00	0.15	0.15	\$1.65	N
Labor: \$175.00	Parts: \$526.13	OL&M: \$0.00	Misc: \$1.65	Sub-Total: \$702.78		

JCABFILTER JD R4045 Internal

COMPLAINT:

10 REPLACE CAB AIR FILTERS

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 7 of 33
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JCABFILTER JD R4045 Internal

Removed old filter
 Cleaned housing
 Installed and dated new filter
 Re-installed housing

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE333567	CabFreshFilter Carbon	1.00	688.13	688.13	\$688.13	N
RE333569	CabRecircFilter Carbon	1.00	609.91	609.91	\$609.91	N

Labor: \$50.00	Parts: \$1,298.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,348.04
----------------	-------------------	--------------	--------------	-----------------------

J06001001 JD 9760STS Internal

COMPLAINT:
 11 TOP UP low washer fluid

CORRECTION:
 Done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
WWA4L	W/W ANTIFREE	1.00	5.50	5.50	\$5.50	N

Labor: \$50.00	Parts: \$5.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$55.50
----------------	---------------	--------------	--------------	--------------------

J01020211 JD 7610 Internal

COMPLAINT:
 12 REPLACE FAN BELT TENSIONER IDLER PULLEY.

CORRECTION:
 JF replaced
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J01020211 JD 7610 Internal								
AL201362	IDLER		1.00	186.96	186.96	\$186.96		N
Labor: \$100.00	Parts: \$186.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$286.96				

JENGDIAG1 JD ALL Internal

COMPLAINT:

13 diagnose engine leak on RH side

CORRECTION:

seal for injector harness is inside valve cover
 it is sweating oil not wet
 was advised that unless it is leaking bad or we are taking apart the assembly above the engine for something else that we usually
 dont worry about it

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J01001610 JD 4020 Internal

COMPLAINT:

14 FLUSH COOLING SYSTEM

oil residue on coolant tank walls - clean coolant system and replace tank (wait to hear back from fluid samples for any further
 actions)

ECU 000111.18 engine coolant level alarm switch activated at moderate coolant temperature

CORRECTION:

DRAINED COOLANT. REMOVED THERMOSTAT.
 INSTALLED FLUSH. DRAINED SYSTEM.
 REPLACED THERMOSTAT. FILLED SYSTEM WITH ANTIFREEZE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMCC2610X	RESTORE - COOLING SYSTEM FLUSH	1.00	83.88	83.88	\$83.88	N
RE558306	RADIATOR R	1.00	588.49	588.49	\$588.49	N
TY26575	COOL-GARDII 3.78L 50/50 PREMIX	1.00	26.38	26.38	\$26.38	N

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 9 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J01001610 JD 4020 Internal							
TY26576	COOL-GARD II 50/50 PRE-MIX JUG 9.46L	3.00	63.12	63.12	\$189.36	N	
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>	
EF150	ENVIRO FEE	3.00	1.50	1.50	\$4.50	N	
EF25	ENVIRO FEE	1.00	0.25	0.25	\$0.25	N	

Labor: \$600.00 Parts: \$888.11 OL&M: \$0.00 Misc: \$4.75 Sub-Total: \$1,492.86

JBLOWCOOLERPK JD ALL Internal

COMPLAINT:

15 WASH/BLOW OUT COOLING PACKAGE ALL MACHINES.

CORRECTION:

WASH OUT RADIATOR.
 WASH OUT ALL COOLERS.

Labor: \$100.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$100.00

JGEN16- Internal

COMPLAINT:

16 missing ether can

CORRECTION:

Removed Either cap
 Cleaned cap and housing with break clean
 During installation either line started to leak
 FERULES

\$4.88

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kinderley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 10 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JGEN16- Internal	RE556468	PREMIUM ETHER STARTING FLUID	1.00	14.65	14.65	\$14.65	N
-------------------------	----------	------------------------------	------	-------	-------	---------	---

OL&M Charges:

<u>Description</u>	<u>Value</u>
FERULES	\$4.88

Labor: \$50.00	Parts: \$14.65	OL&M: \$4.88	Misc: \$0.00	Sub-Total: \$69.53
----------------	----------------	--------------	--------------	--------------------

JSOFTWARE JD R4045 Internal

COMPLAINT:

17 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON 3 CONTROLLERS.
 HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CORRECTION:

updated CCU, MNA and display

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

JELECDIAG1 JD ALL Internal

COMPLAINT:

18 MNA 002028.09 Vehicle yaw rate data from source address 28 is missing

SR1 000168.04 SPN 168 - FMI 4

VTI 517832.02 un able to communicate with machine

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 11 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JELECDIAG1 JD ALL Internal

MNA 2028.09- vehicle yaw rate missing- This code is in relation to the vehicle yaw data gathered from the receiver and sent to the Master Nozzle Controller. This code will be active as long as there is no receiver plugged into the machine. When a receiver is plugged in it can collect the vehicle yaw data and send it to the MNA.

SR1 168.04 - unswitched power low to SR1 controller.

Constant power to controller is lost or not present. Checked 2 unswitched power circuits to sr1. cc0002 had 12 volts from source to controller connector. viewed address for cc0002 in sr1 and 12.3 volts was displayed. cc0002 all ok Checked power on cc8202 from source to sr1 11.8v was present from source to sr1. Viewed address in sr1 for cc8202 and 0v was displayed. Load tested wire and voltage dropped off. Ran a new wire from source to pin L1 on sr1 connector. Viewed address in SR1 for cc8202, 12.8v was displayed and code was gone.

=VTI 517832.02 This code is related to the display being able to communicate with machine, It is generated when the display is loaded and then the machine is started, causing the display to lose power and also communication with machine. It is a nuisance code and does not have any affect on the operation of the machine

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

JTREADADJ1 JD R4045 Internal

COMPLAINT:

19 ADJUST AXLE TREAD ADJUST SHIMS. FRONT AND REAR

CORRECTION:

treaded wheels all the way
 used die grinder with polishing disc to clean rust and dirt build up from tread wear surfaces
 coated in graphite lubricant
 dropped air bags
 tried to install spindle spacer
 had to disconnect air ride linkage to lower sprayer enough to get spindle spacer in
 jacked up sprayer
 loosened dog point bolts
 loosened rear bolts
 torqued dog point bolts to 100 ft/lbs. repeatedly until they didnt move anymore
 torqued rear bolts to 184 ft/lbs.
 loosened dog point bolts 1/8 of a turn
 tightened lock nuts
 lowered sprayer
 removed spindle spacer
 repeated steps on all wheels
 done

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 12 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JTREADADJ1 JD R4045 Internal

Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
-----------------	---------------	--------------	--------------	---------------------

JWHLTOEADJ JD R4045 Internal

COMPLAINT:
 20 ADJUST FRONT WHEEL TOE
 adjust toe-in (0-0.375")

CORRECTION:

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

DIAG-1000000239465 Internal

COMPLAINT:
 21 Left Front Hydraulic Hoses, Tubing, and Fittings, Diagnose and Repair 1
 2 LH wheel motor hydraulic lines leaking and worn

CORRECTION:

removed all hose holders and brackets that holds every hose for wheel motors
 removed zipties and harnesses attached to hoses
 removed flanges on both ends of hydraulic lines
 fed lines out
 got new orings
 fed new lines and attached wheel motor side first with new orings
 worked way up the lines installing brackets and clamps
 connected hydro pump side of lines with new oring
 adjusted lines for proper slack around corners
 tightened all clamps and holders
 tightened both ends of hydraulic lines
 zip-tied lines and harnesses
 cleaned area of oil and cut off zipties
 done

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No: 0

Deliver To:

SERVICE INVOICE

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 13 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

DIAG-1000000239465 Internal

AKK30404	HYDRAULIC	1.00	1,101.40	1,101.40	\$1,101.40	N
AKK30406	HYDRAULIC	1.00	1,093.24	1,093.24	\$1,093.24	N
T59014	-12_6xFlg O-ring	1.00	8.40	8.40	\$8.40	N
T78313	-16_6xFlg O-ring	2.00	7.99	7.99	\$15.98	N

Labor: \$300.00	Parts: \$2,219.02	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,519.02
------------------------	--------------------------	-------------------------	---------------------	------------------------------

DIAG-1000000205239 Internal

COMPLAINT:

22 Steering Cylinder Ball Joints,
 steering ball joints worn on both sides

CORRECTION:

removed cotter pins
 loosened castle nuts
 used porta-power press for rear ball joint
 used 2 jaw puller for front ball joint
 lock nut on front ball joint was seized
 removed and capped hydraulic lines going to steering cylinder
 removed steering cylinder and put in vise
 had to use cheater bar to remove lock nut
 marked threads and removed ball joints on front and back
 installed new ball joints to mark and tightened lock nut and clamp
 installed steering cylinder
 installed hydraulic lines
 torqued castle nuts
 installed cotter pins
 repeated all steps on other side
 done



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7087	M4x40 COTTER PIN	4.00	0.72	0.72	\$2.88	N
AN209814	TIE ROD EN	2.00	309.25	309.25	\$618.50	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/9/2025 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 14 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120" EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

DIAG-1000000205239 Internal

AN304070	Tie Rod End	2.00	309.25	309.25	\$618.50	N
----------	-------------	------	--------	--------	----------	---

Labor: \$300.00	Parts: \$1,239.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,539.88
-----------------	-------------------	--------------	--------------	-----------------------

JPWTRNDIAG1 JD ALL Internal

COMPLAINT:

23 diagnose constant variation when forward gear 20

CORRECTION:



PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JPWTRNDIAG1 JD ALL Internal

drove sprayer to verify issue
 starts surging around "gear" 16 and is worst around gear 20
 happens most at WOT with hydro handle fully forward
 verified that hydro handle was adjusted correctly and was within spec
 unplugged each wheel motor solenoid one at a time and drove to see which wheel motor might be causing the problem
 went through test once in the lowest gear and never discovered anything
 did test again and found that when the rear right wheel motor is unplugged the surging stops
 ran sprayer with it plugged in and then unplugged again to verify
 brought sprayer into shop
 drained hydraulic oil and swapped the rear solenoids to isolate problem from solenoids
 the oring on the solenoid was pinched and couldnt get it to seal
 had none of the right orings in stock so matched up to the closest one
 filled with hydraulic oil
 drove sprayer outside and found that the sprayer now surges when either of the rear solenoids are unplugged
 that didnt narrow down where the problem might be
 unplugged front left solenoid and discovered that it doesnt surge when that one is unplugged
 plugged back in drove a bit then unplugged to verify problem
 doesnt make a lot of sense other then those wheel motors are on the same circuit but why does the problem area change
 continued diagnostics from beginning
 unplugged all of the wheel motor solenoids to see if one of the wheel motors would try and turn none did
 plugged in solenoids and unplugged speed sensors and drove
 found that it doesnt surge when speed sensors are unplugged
 installed globe and calibrated wheel speed sensors
 it still surged
 next step was to test case drain flow on each wheel motor
 shop doesnt have tools required to perform test
 trying to source the proper tools for the test
 got the hoses and fittings needed made by parts
 started on RR wheel motor
 removed case flush line and capped both ends
 removed reverse drive line on connector bulkhead and wheel motor
 had hoses made by parts to cap off flange fittings
 removed case drain line and installed flow meter
 removed all wheel motor solenoids
 installed exhaust vent
 put cardboard in front of oil cooler to heat oil faster
 started tractor and made sure to set park brake
 increased RPM to 1200
 moved hydro handle forward until display read around 6000 PSI to heat oil
 kept there until hydraulic temp was between 50 60 °C
 increased engine to high idle

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
 Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
 Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
 Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
 Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
 Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
 North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
 Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
 Kelvington, SK (306) 327-4355
 Shaunavon, SK (306) 297-2639



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 16 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

increased engine to high idle
 pushed hydro handle until pressure was around 7250 psi
 checked flow reading
 RR- .9 GPM
 LR - 1.2 GPM
 LF - 1 GPM
 RF - 1.2 GPM
 let oil cool for a couple mins
 removed all caps and reinstalled all lines and removed flow meter
 repeated steps on other wheel motors
 wheel motors should be replaced
 informed managers and was decided that it wasnt worth it to change wheel motors

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
T143169	O-RING	1.00	2.24	2.24	\$2.24	N
TY27956	TORQ-GARD II 10W30 CK4 18.9L	2.00	144.50	144.50	\$289.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF300	ENVIRO FEE	2.00	3.00	3.00	\$6.00	N
Labor: \$300.00		Parts: \$291.24	OL&M: \$0.00	Misc: \$6.00	Sub-Total: \$597.24	

JHYDOILCHG JD R4045 Internal

COMPLAINT:

24 REPLACE HYDRAULIC OIL AND FILTERS.
 2 layers of hydraulic fluid - drain and replace

CORRECTION:

DRAIN HYDRAULIC RESERVOIR.
 INSTALL NEW OIL.
 CHECK AND ADJUST LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
T77932	-10FF O-ring	1.00	3.67	3.67	\$3.67	N
TY26801	15W40 TORQ-GARD II 18.9L	5.00	137.60	137.60	\$688.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 17 of 33
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JHYDOILCHG JD R4045 Internal

EF300	ENVIRO FEE	5.00	3.00	3.00	\$15.00	N
-------	------------	------	------	------	---------	---

Labor: \$420.00	Parts: \$691.67	OL&M: \$0.00	Misc: \$15.00	Sub-Total: \$1,126.67
-----------------	-----------------	--------------	---------------	-----------------------

J21001150 JD R4045 Internal

COMPLAINT:

25 hydraulic tank leaks on rear - clean and tighten hose clamp

CORRECTION:

Monday, November 3, 2025 9:51 AM - SH

-removed panel

-oil leak appears to be coming from reservoir cap, new cap needed

-checked hose clamps, clamps ok

-old cap removed, new cap installed

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK25690	Filler Cap	1.00	89.55	89.55	\$89.55	N
Labor: \$400.00	Parts: \$89.55	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$489.55		

JHYDDIAG1 JD ALL Internal

COMPLAINT:

26 diagnose solution pump hydraulics leaking. If motor needs to be resealed an additional \$500 labor plus seal kit

CORRECTION:

Cleaned up hydraulic motor

replaced all o-rings on fittings

split motor from pump to check seal

was clean in the housing where pump/motor mate.

All ok

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
51M7042	O-RING	1.00	4.78	4.78	\$4.78	N
51M7045	O-RING M22	2.00	4.60	4.60	\$9.20	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 18 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120" EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JHYDDIAG1 JD ALL Internal

51M7047	O-RING M27	1.00	6.08	6.08	\$6.08	N
T77613	-6FF O-ring	1.00	3.04	3.04	\$3.04	N
T77858	-12FF O-ring	2.00	3.55	3.55	\$7.10	N

Labor: \$300.00	Parts: \$30.20	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$330.20
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JHYDDIAG3 JD ALL Internal

COMPLAINT:

27 diagnose leak around air compressor

Of air compressor needs to be replaced an additional \$1400 labor plus parts

CORRECTION:

looks like oil is coming from the top and front of air compressor
 checked with mirror to see it top is wet but it was all dry
 determined its coming from the top fitting on compressor
 checked parts advisor and ordered sealing ring for that fitting
 also noticed line beside compressor is very wet
 ordered line

Friday, November 14, 2025 2:56 PM -
 disconnected compressor side of line
 cut all zipties under cab
 removed brackets
 removed air dryer side of the line
 fed line into middle from both directions and pulled out
 ran new line into position
 loosely installed both ends
 installed clamps and zipties
 tightened both ends
 done



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK46063	AIR HOSE - COMPRESSOR TO DRYER	1.00	536.05	536.05	\$536.05	N

Labor: \$1,000.00	Parts: \$536.05	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,536.05
--------------------------	------------------------	-------------------------	---------------------	------------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 19 of 33
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120" EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JHYDDIAG4 JD ALL Internal


COMPLAINT:

28 Boom hydraulic block leaking when un-folding LH outer wing

CORRECTION:

RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: _____

cleaned area and folded and unfolded outer LH boom
 coming from one of the 4 bottom valves on valve block
 removed hoses on boom strainers assembly
 removed bolts on boom strainer assembly bracket and hung out of the way to gain access
 cleaned area better and folded outer left boom to find which valve is leaking
 bottom left counterbalance valve was leaking
 removed solenoid beside it
 counterbalance valve was loose and oring was blown out
 matched up new oring because parts advisor doesnt give part #
 installed counterbalance valve with new oring
 installed solenoid
 folded boom a couple times to verify that there is no more leak
 all good
 installed boom strainer bracket
 installed hoses
 done

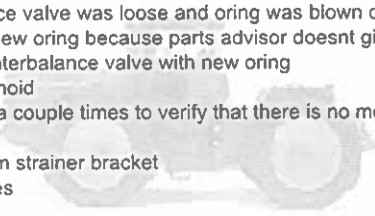

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R26375	O-RING	1.00	2.95	2.95	\$2.95	N
Labor: \$300.00		Parts: \$2.95	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$302.95	

J21070085 JD R4045 Internal

COMPLAINT:

29 LH outer fold cylinder seals leaking

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 20 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J21070085 JD R4045 Internal

unfolded sprayer booms
 inspected for scratches on rod
 strapped outer boom so it would flop back when pins are removed
 disconnected and capped hydraulic lines
 removed snap rings and removed pins
 removed cylinder
 disassembled cylinder
 removed all seals
 cleaned rust in dust seal areas
 installed new seals
 assembled cylinder
 installed cylinder in reverse order and applied anti-seize to pins
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC16983	HydCyl Rod SealKit	1.00	37.34	37.34	\$37.34	N
AHC16988	Hydraulic Cylinder Kit	1.00	56.24	56.24	\$56.24	N
AHC19323	HYDRAULIC	1.00	179.00	179.00	\$179.00	N
Labor: \$300.00		Parts: \$272.58	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$572.58	

EXPERT-1000000039417 Internal

COMPLAINT:

30 Full Boom Breakaway Cylinder, Recondition
 full boom breakaway cylinder seals leaking

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 21 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

EXPERT-1000000039417 Internal

inspected and found no visible scratches were present
 chained and strapped booms so the would fall back when pins are removed
 Relieve the pressure from the cylinder.
 Remove the hoses and capped
 tried hammering pins and they were very seized
 got air hammer and pins started moving
 eventually got pins out
 removed rod from cylinder and noticed small scratch in rod under the seals
 cylinder would eventually leak if it was just resealed
 scott said to replace
 new cylinder ordered

Wednesday, October 29, 2025 11:29 AM - alexis

- got new cylinder
- removed hose fittings from old cylinder
- put fittings into new cylinder
- installed new cylinder
- cleaned up the pins
- secured cylinder with the pins & snap rings
- connected hydraulic lines back to the cylinder

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7707	M8-1.25 STOVER LOCK NUT	1.00	1.37	1.37	\$1.37	N
19M9836	M8x20 FLG 10.9 BOLT	2.00	2.38	2.38	\$4.76	N
AHC21556	Hydraulic Cylinder	1.00	2,027.83	2,027.83	\$2,027.83	N
T77858	-12FF O-ring	1.00	3.55	3.55	\$3.55	N

Labor: \$1,214.00	Parts: \$2,037.51	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,251.51
-------------------	-------------------	--------------	--------------	-----------------------

JHYDDIAG6 JD ALL Internal

COMPLAINT:

31 hydraulic line leaking in front of hydrostatic on RH side

CORRECTION:

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 22 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JHYDDIAG6 JD ALL Internal

RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: _____

removed clamps and zip ties along hose
 loosened both ends and fed hose through and out of sprayer
 got new seals
 ran hose into sprayer
 tightened hose clamps and brackets
 tightened both hose ends
 zip tied
 cleaned area of oil and cut zip ties
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK25064	HYDRAULIC	1.00	501.38	501.38	\$501.38	N
T59014	-12_6xFlg O-ring	2.00	8.40	8.40	\$16.80	N
Labor: \$200.00		Parts: \$518.18	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$718.18	

J21130013 JD R4045 Internal

COMPLAINT:

32 BOOM FRAME INNER TO OUTER HINGE BUSHINGS (RH), REPLACE
 RH hinge bushings

CORRECTION:

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 23 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J21130013 JD R4045 Internal

strapped boom for safety before removing cylinder
 removed sensor linkage
 removed snap ring and pin from cylinder
 removed unfolding linkage and pins
 when removing pins noticed that other bushings were also worn
 decided to replace all RH outer wing fold bushings because they need to be disassembled anyway and they were in stock
 supported boom with forklifts
 removed main hinge pins
 shifted boom over to gain access to bushings
 hit out old bushings cleaned surfaces and installed new ones
 replaced all of the bushings in all of the hinge linkages
 cleaned pins from rust
 installed fold linkage pins
 lined up outer boom with inner boom to install main hinge pins
 installed fold cylinder
 tightened hydraulic lines
 installed sensor linkage
 removed forklifts
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N409842	BUSHING	2.00	27.80	27.80	\$55.60	N
Labor: \$800.00		Parts: \$55.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$855.60	

JGEN33- Internal

COMPLAINT:

33 both sides swing arms

CORRECTION:

unfolded inner booms and lowered cradle
 lifted one side of boom with forklift until tension was off of swing arm link bolts
 removed bolts and swing arm link
 installed new swing arm link
 lowered boom with forklift
 torqued bolts to 561 ft/lbs
 repeated steps on other side

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 24 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120" EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JGEN33- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK47135	Link	2.00	700.46	700.46	\$1,400.92	N
N209867	BALL	1.00	1.64	1.64	\$1.64	N
PMK010-1216	3/4" Clear PVC /ft	9.00	2.51	2.51	\$22.59	N

Labor: \$1,000.00	Parts: \$1,425.15	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,425.15
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

JELECDIAG5 JD ALL Internal

COMPLAINT:

34 wire loom is damaged

CORRECTION:

Monday, November 3, 2025 10:29 AM -

found loom was damaged on breakaway boom hinge points and on main boom harness
 on main boom harness removed zipties and pulled damaged area of loom off of the harness
 cleaned dirt that built up around wires went to parts and they couldnt find a part number for a 2 inch wire loom
 had to order
 on breakaway hinge harness area removed zipties and pulled away damaged area of loom
 cleaned dirt build up around wires
 installed new loom around harness
 ziptied harness up in original position
 repeated on other breakaway hinge area
 large wire loom is still on order.
 JF installed loom

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N209867	BALL	1.00	1.64	1.64	\$1.64	N
785704677894	2" Split Wire Loom Tubing- 10FT	1.00	40.55	40.55	\$40.55	N
5143-B	50FT 3/4IN SPLIT	1.00	32.86	25.41	\$25.41	N

Labor: \$200.00	Parts: \$67.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$267.60
------------------------	-----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 25 of 33
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

EXPERT-1000000113148 Internal

COMPLAINT:

35 breakaway boom solution brackets broken x3

CORRECTION:

tried replacing bracket without removing entire breakaway boom nozzle bracket
 didn't work
 removed breakaway boom nozzle body bracket
 removed 3 broken support brackets
 installed new support brackets
 installed nozzle body bracket
 tightened all hardware
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KK26811	BRACKET	3.00	37.79	37.79	\$113.37	N
Labor: \$150.00		Parts: \$113.37	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$263.37	

DIAG-1000000206673 Internal

COMPLAINT:

36 exact apply wire connector broken

CORRECTION:

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/9/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 26 of 33

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

DIAG-1000000206673 Internal

Connector housing is broken, pins are corroded on harness and nozzle body sides. Recommend replacing harness end with KK67760 splice and replacing nozzle body, corroded pins will cause further issues.

Monday, November 3, 2025 4:47 PM -

exposed wiring harness in where new connector would be spliced in
 new connectors are coming already pinned with epoxy in backing so it has to be spliced into harness
 followed procedure in manual and spliced all 8 wires
 referred to connector pin chart to make sure that all wires were being spliced into correct spot
 used heat shrink connectors and covered each splice in heat shrink tubing
 scattered splices in harness to make it less bulky
 replaced nozzle body that had corroded pins with new one
 installed plug before covering harness with loom to verify repair
 sprayer threw a can bus code
 cleaned plug connection and code was still there
 before going through diagnostic procedure checked plugs on all nozzle bodies and found a loose plug
 cleaned plug and reconnected
 checked for codes and everything was good
 covered harness with loom and taped and zip tied harness as it was from factory
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
57M13278	Elec. Connector Housing	1.00	39.10	39.10	\$39.10	N
AKK44859	EXACT APPLY NOZZLE BODY ASSY 32BIT	1.00	863.26	863.26	\$863.26	N
KK67760	Exact Apply Repair Sealed Pigtail	1.00	202.32	202.32	\$202.32	N

Labor: \$300.00	Parts: \$1,104.68	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,404.68
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000039197 Internal

COMPLAINT:

37 outer fold pin bushing worn

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kinderley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0


Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 27 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

EXPERT-1000000039197 Internal

relieved pressure on outer fold hydraulic cylinder
 removed sensor linkage
 nut was seized and broke nut on sensor linkage
 strapped boom for safety before removing cylinder
 removed snap ring and pin from cylinder
 removed unfolding linkage and pins
 when removing pins noticed that other bushings were also worn
 decided to replace all LH outer wing fold bushings because they need to be disassembled anyway and they were in stock
 supported boom with forklifts
 removed main hinge pins
 shifted boom over to gain access to bushings
 hit out old bushings cleaned surfaces and installed new ones
 replaced all of the bushings in all of the hinge linkages
 cleaned pins from rust
 installed fold linkage pins
 lined up outer boom with inner boom to install main hinge pins
 installed fold cylinder
 tightened hydraulic lines
 installed sensor linkage with new tie rod
 removed forklifts
 done

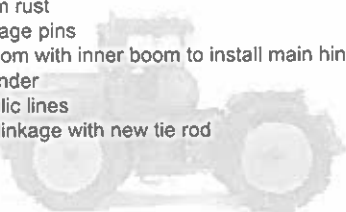

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC16988	Hydraulic Cylinder Kit	-1.00	56.24	56.24	(\$56.24)	N
AKK20497	TIE ROD AS	1.00	124.84	124.84	\$124.84	N
N409840	BUSHING	4.00	18.46	18.46	\$73.84	N
N409841	BUSHING	12.00	17.26	17.26	\$207.12	N
N409842	BUSHING	-2.00	27.80	27.80	(\$55.60)	N
Labor: \$580.00		Parts: \$293.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$873.96	

DIAG-1000000239341 Internal

COMPLAINT:

38 diagnose outer boom that has silicone around structural support (weld?)

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 28 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

DIAG-1000000239341 Internal

Monday, November 3, 2025 8:14 AM - SH

- right boom, grinded off paint, there is a crack that needs to be welded (inner fold pin)
- left boom: removed silicone with wire brush, weld is ok there
- left boom: grinded off paint, weld appears to be starting to crack (inner fold pin)

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

JEMISSDIAG2 JD ALL Internal

COMPLAINT:

40 diagnose lack of cabin pressure
 linked to windshield?

CORRECTION:

Verified low cabin pressure
 checked filters, fan, door and window seals, pressure indicator and inlet/outlet ports, all ok
 found air leak on lh front ducting at bottom of cab, cab conner posts are the ducting for the vents and the bottom plug/cover was
 blown out of LH front. re-sealed duct positive cabin pressure returned.

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

J004006003 SH WAR Internal

COMPLAINT:

41 missing reflector sign on RH rear
 slow moving vehicle sign is broken

CORRECTION:

replaced smv sign and reflector
 done

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
JD5922	Reflector	1.00	13.08	13.08	\$13.08	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4458	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 29 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

J004006003 SH WAR Internal					
JD5929	SMV EMBLEM	1.00	34.51	34.51	\$34.51 N

Labor: \$50.00	Parts: \$47.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$97.59
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000038424 Internal

COMPLAINT:

42 Solution Tank Sight Gauge Hose, Remove and Replace
 solution tank gauge is yellow

CORRECTION:

Loosen clamps.
 Remove and replace the tank level sight gauge hose.
 Assemble in reverse order.
 sight ball was missing so replaced

Labor: \$110.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$110.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000105384 Internal

COMPLAINT:

43 Rinse Tank Sight Gauge, Replace REPLACE RINSE TANK SIGHT GAUGE
 rinse tank gauge dirty

CORRECTION:

REMOVE MOUNTING CLAMPS.
 REPLACE SIGHT GAUGE TUBE.
 INSTALL REMOVED HARDWARE.
 FUNCTION AND LEAK TEST.
 sight ball was missing so replaced

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK010-1216	3/4" Clear PVC /ft	10.00	2.51	2.51	\$25.10	N

Labor: \$140.00	Parts: \$25.10	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$165.10
------------------------	-----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 30 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JGEN44- Internal

COMPLAINT:

44 DIAGNOSE LEAKING ETHER LINE

CORRECTION:

Ordered either line

Removed either solenoid

Monday, November 3, 2025 5:20 PM - SH

-clocked into wrong gen (16) for this

-removed damaged line

-went to twins, napa and davidson to find a compression fitting that would work on new line

-installed new line

-tried installing ether can but the housing was too rusty and corroded and would not seal properly

-removed housing, removed line from housing

-installed new line onto new housing, installed new housing

-installed ether can, did not leak

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KK21382	Bulk Hose	1.00	59.52	59.52	\$59.52	N
RE48310	Starting Aid Unit Assembly	1.00	265.57	265.57	\$265.57	N
Labor: \$200.00		Parts: \$325.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$525.09	

JELECDIAG3 JD ALL Internal

COMPLAINT:

45 diagnose why machine wont move

CORRECTION:

Went to move to start working on

Corner post display and armrest would not light up therefore i could not take it out of park

Hit the battery disconnect switch and let sprayer reset itself

It moved with no problems the next time we tried to move

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 31 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JELECDIAG3 JD ALL Internal

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

JGEN46- Internal

COMPLAINT:

46 Seal Boom Hydraulic Block

CORRECTION:

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
---------------	---------------	--------------	--------------	-------------------

JWELD1 JD ALL Internal

COMPLAINT:

47 MISC WELDING. (1HR) REPAIR: WELD AND PAINT CRACKS IN INNER TO OUTER BOOM HINGE LH/ RH SIDES

CORRECTION:

pulled sprayer out of shop
 folded out booms
 ground crack out
 brought welder outside
 welded crack
 ground and cleaned area
 painted
 repeated steps on the other side
 folded up sprayer boom
 brought sprayer to shop
 brought welder back into shop
 cleaned up cords and hoses
 done

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4458	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No: XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No: XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/9/2025 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 32 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JGEN48- Internal

COMPLAINT:

48 REPLACE 3 HOSES LEAKING 2@ REAR RH WHEEL MOTOR HOSES, 1 HOSE UNDER SPRAYER

CORRECTION:

removed all brackets clamps and zipties from wheel motor hoses and harness
 disconnected lines at both ends
 ran lines out
 fed new lines in
 got new orings and installed
 loosely installed both ends of hoses
 installed all of the brackets clamps and zipties
 tightened both lines
 moved to line underneath cab
 removed clamps and cut zipties
 disconnected line and fed out
 fed new line in
 connected line
 installed clamps and zipties
 done



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK34149	HYDRAULIC	1.00	915.70	915.70	\$915.70	N
AKK34317	HYDRAULIC	1.00	367.19	367.19	\$367.19	N
AN406425	Hydraulic Hose	1.00	137.55	137.55	\$137.55	N
T59014	-12_6xFlg O-ring	1.00	8.40	8.40	\$8.40	N
T77857	-8FF O-ring	-2.00	3.10	3.10	(\$6.20)	N
T78313	-16_6xFlg O-ring	1.00	7.99	7.99	\$7.99	N

Labor: \$1,000.00	Parts: \$1,430.63	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,430.63
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

JNFEFUEL Internal

COMPLAINT:

49 ADD FUEL TO UNIT

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No: 0

Deliver To:

SERVICE INVOICE

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/9/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 33 of 33
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' EA 1600GL 800/55R4	2714	1N04045RKJ0196270	890189	#2

JNFEFUEL Internal

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
BULKFUEL	BULK FUEL CHARGE	100.00	2.00	1.79	\$179.00	N
Labor: \$10.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$179.00	Sub-Total: \$189.00	

INVOICE CONTAINS \$28.45 DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

\$150.00

Customer PO No:
 Tax Exempt No:
 Advisor:

Job Total: \$38,398.62
 Grand Total: \$38,398.62

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: _____ Date: _____