

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 3/12/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: Account
		Page: 1 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:


VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____ n/a
ENGINE HOURS _____ 745
SEPERATOR HOURS _____ 534

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
THIS UNIT HAS HAD THE CAB CLEANED _____ JOE _____ (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER _____ AK _____ (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ AK _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

- DESICCANT BAGS FOR CAMERAS REPLACE.
- FEW TEETH MISSING ON SEPARATOR GRATES.
- FIRE EXTINGUISHER BY THE ENGINE INSTALL.

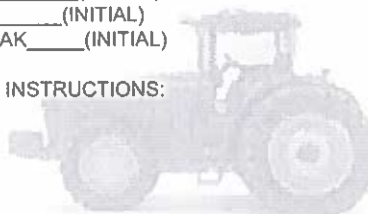

Job Total: \$3,860.00

JFCC JD ALL Internal

COMPLAINT:

02 FREE CLEANUP OF CAB

CORRECTION:

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------

20200258
CO2-811

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 3/12/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: Account Page: 2 of 13
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JFCC JD ALL Internal							
LABDIS	LAB DISC CUST	-1.00	172.50	172.50	(\$172.50)	N	
Labor: \$172.50	Parts: \$0.00	OL&M: \$0.00	Misc: (\$172.50)	Sub-Total: \$0.00			

JSOFTWARE JD X9 1100 Internal
COMPLAINT:
03 UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:
UPDATED SOFTWARE ON 4 CONTROLLERS.
INSTALLED GEN 4 SOFTWARE THROUGH SCREEN.

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00			
------------------------	----------------------	-------------------------	---------------------	----------------------------	--	--	--

J06171003 JD X9 1100 Internal
COMPLAINT:
04 ADJUST FEEDERHOUSE DRIVE CHAIN.

CORRECTION:
REMOVED SIDE SHIELD.
ADJUST CHAIN TENSION TO THE SPEC.
RAN UNIT AND RECHECKED TENSION.
REINSTALLED SHIELDS BACK IN PLACE.
FUNCTION CHECKED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00			
------------------------	----------------------	-------------------------	---------------------	----------------------------	--	--	--

JGEN05- Internal
COMPLAINT:
05 REPAIR REVERSER

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 3/12/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: Account Page: 3 of 13
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGEN05- Internal

CLEANED UP REVERSER AND HOSES AROUND.
CHECKED LINES IF ANY OF O-RING WERE DAMAGED OR MISSING, EVERYTHING LOOKS GOOD.
TOOK IT OUTSIDE FOR RUNNING CHECKS.
FOUND LEAK AROUND BOTTOM SHAFT.
REMOVED FEEDER HOUSE DRIVE CHAIN AND SHAFT SPROCKETS.
DISCONNECTED SPEED SENSOR AND LOOSENED BOLTS FOR DRIVE BEARING ON RH SIDE.
REMOVED SHAFT AND INSPECTED.
REMOVED DAMAGED QUAD-RING AND REPLACED IT WITH A NEW ONE.
REINSTALLED EVERYTHING IN REVERSE ORDER.
FUNCTION CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H223849	Quad Ring	1.00	13.50	13.50	\$13.50	N
Labor: \$600.00		Parts: \$13.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$613.50	

JGEN06- Internal

COMPLAINT:
06 REPLACE FRONT END IDLER

CORRECTION:

LOOSENED BELT TENSION AND REMOVED IT FROM PULLEY.
REMOVED PULLEY OF THE UNIT.
REMOVED AND REPLACED BEARING WITH A NEW ONE.
REINSTALLED EVERYTHING BACK AND TENSIONED BELT.
RAN UNIT AND CHECKED BELT, IT WAS RUNNING TO CLOSE TO THE OUTSIDE EDGE OF THE PULLEY.
LOOSENED IDLER MOUNTING ARM AND CHECKED IT, FOUND THAT BUSHINGS FOR MOUNT WASN'T IN PLACE.
INSTALLED BUSHINGS IN PLACE AND TENSIONED BELT.
RAN UNIT AND CHECKED BELT, IT WAS STILL RUNNING TO CLOSE TO OUTSIDE EDGE OF IDLER.
LOOSENED TENSION AND REMOVED PULLEY ON JACKSHAFT FOR FRONT DRIVE.
ADJUSTED SHIM PLATES ON PULLEY JACKSHAFT.
REASSEMBLED EVERYTHING BACK TOGETHER.
RAN UNIT AND VERIFY REPAIRS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE87376	Ball Bearing	1.00	268.56	268.56	\$268.56	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 647-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 3/12/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: Account Page: 4 of 13
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGEN06- Internal

H140461	Bushing	4.00	20.43	20.43	\$81.72	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$600.00 Parts: \$350.28 OL&M: \$0.00 Misc: \$35.00 Sub-Total: \$985.28

J06171060 JD X9 1100 Internal

COMPLAINT:

07 FEED ACCELERATOR VIBRATION

CORRECTION:

REMOVED TOP COVER.

LOOSENED CHEVRON BOLTS ON FEEDER HOSE AND MOVE THEM ALL THE WAY TO THE BACK.

TORQUED CHEVRON BOLTS TO THE SPEC.

REINSTALLED EVERYTHING BACK IN PLACE.

FUNCTION CHECKED.

Labor: \$200.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$200.00

JGEN08- Internal

COMPLAINT:

08 ADJUST FEED ACCELERATOR PULLEY

CORRECTION:

REMOVED PULLEY CHECKED BOLT AND THREADS.

CLEANED UP BOLT THREADS AND INSIDE SHAFT.

REMOVED PULLEY AND INSPECT FOR ANY DAMAGE.

CHECKED SHAFT SPLINES, LOOKS GOOD.

REMOVED BEARING AND CHECKED FOR ANY WEAR ON THE SHAFT.

REMOVED SPACER AND COMPARE SIZE TO A NEW SPACER.

REASSEMBLED EVERYTHING BACK IN REVERSE ORDER.

DURING ROTATING FEED ACCELERATOR NOTICED NOISE, THAT NORMAL DUE TO HEX SHAFT ON LH SIDE.

INSTALLED SHIM AND TORQUED PULLEY TO THE SPEC.

CHECKED MOVEMENT ON PULLEY AND IT WAS NO MOVEMENTS.

VERIFY REPAIRS.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 3/12/2025 Location: Work Order Number: [REDACTED] Payment Type: Account Page: 5 of 13
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGEN08- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24H1572	Washer 1-13/16x2.375	1.00	3.82	3.82	\$3.82	N
Labor: \$500.00		Parts: \$3.82	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$503.82	

J06180070 JD X9 1100 Internal

COMPLAINT:

09 ROTOR VARIABLE BELT, REMOVE AND REPLACE

CORRECTION:

REMOVED THE UNLOADING AUGER DRIVE BELT.
 REMOVED THE FEEDER HOUSE FIXED OR VARIABLE SPEED DRIVE BELT.
 LOOSENED ROTOR VARIABLE DRIVE BELT.
 REMOVED THE ROTOR DRIVE BELT AND INSTALL REPLACEMENT BELT.
 ADJUSTED THE ROTOR DRIVE BELT.
 INSTALLED THE PREVIOUSLY REMOVED FEEDER HOUSE FIXED OR VARIABLE SPEED DRIVE BELT.
 INSTALLED THE PREVIOUSLY REMOVED UNLOADING AUGER DRIVE BELT.
 RAN UNIT AND CHECKED GAP.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,697.06	1,697.06	\$1,697.06	N
Labor: \$400.00		Parts: \$1,697.06	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,097.06	

J06180512 JD X9 1100 Internal

COMPLAINT:

10 CONCAVE LEVEL AND ADJUST

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 6 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

J06180512 JD X9 1100 Internal

SET THRESHING CLEARANCE TO 0.
REMOVED THE FRONT SEPARATOR GRATE DEFLECTOR.
REMOVED CAP SCREWS, CAP SCREWS AND NUTS, AND THE FRONT SEPARATOR GRATE.
MOVED HANDLE TO SHIFT THE ROTOR GEAR CASE IN THE NEUTRAL POSITION.
LOOSENED THE LOWER LOCK NUT, LOWER ADJUSTMENT NUT, AND THE UPPER LOCK NUT ON THE FRONT AND REAR CONCAVE CYLINDERS.
WHILE TURNING THE LEFT-HAND ROTOR CLOCKWISE BY HAND, TIGHTENED THE UPPER ADJUSTMENT NUT SLOWLY ON THE FRONT CONCAVE CYLINDER UNTIL THE ELEMENTS "TICK" AGAINST THE ROTOR. BACKED OFF THE NUT ONE FULL TURN. TIGHTENED NUT FINGER TIGHT.
WHILE TURNING THE RIGHT-HAND ROTOR COUNTERCLOCKWISE BY HAND, TIGHTENED THE UPPER ADJUSTMENT NUT SLOWLY ON THE FRONT CONCAVE CYLINDER UNTIL THE ELEMENTS "TICK" AGAINST THE ROTOR. BACKED OFF THE NUT ONE FULL TURN. TIGHTENED NUT FINGER TIGHT.
TIGHTENED THE LOWER ADJUSTMENT NUT ON THE FRONT AND REAR CONCAVE CYLINDERS TO SPECIFICATION. 69 N·M (51 LB·FT)
TIGHTENED THE UPPER AND LOWER LOCK NUTS.
PERFORMED THE CALIBRATION.
RAN UNIT AND CHECKED FUNCTIONS.

Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
-----------------	---------------	--------------	--------------	---------------------

JADJCHAFSIEV JD X911 Internal

COMPLAINT:
11 FACTORY CALIBRATION OF SIEVE AND CHAFFER AND CHANGE LOUVERS

CORRECTION:
STRAIGHTENED LOUVERS ON CHAFFER.
REINSTALLED CHAFFER AND SIEVE BACK IN UNIT.
PERFORMED FACTORY CALIBRATION OF SIEVE AND CHAFFER.
CHECKED FUNCTION.

Labor: \$350.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$350.00
-----------------	---------------	--------------	--------------	---------------------

J06001009 JD X9 1100 Internal

COMPLAINT:
12 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 647-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 7 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

J06001009 JD X9 1100 Internal

CORRECTION:

DRAINED OIL
REMOVED SIGHT GLASS AND REPLACED WITH PLUG
REFILLED WITH OIL TO SPEC

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R26375	-8ORB o-ring	1.00	4.25	4.25	\$4.25	N
R39112	-8ORBplugHollow	1.00	14.69	14.69	\$14.69	N
TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$200.00		Parts: \$54.58	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$255.18	

JGEN13- Internal

COMPLAINT:

13 DISCHARGE BEATER BEARING

CORRECTION:

LIFTED RH SIDE DOOR.
REMOVED BOTTOM RAD SHIELD TO GET ACCESS TO THE HARDWARE BEHIND.
LOOSENEED AND REMOVED BELTS THAT DRIVES OF DISCHARGE BEATER SHAFT ON RH SIDE.
REMOVED BACK RADIATOR PLATE AND DOOR HANDLE.
INSTALLED PULLER AND PULLED OUTSIDE DRIVE PULLEY FOR SIEVE AND CHAFFER.
REMOVED PULLEY FOR CLEAN GRAIN AND CROSS AUGERS DRIVE.
REMOVED DISCHARGE BEATER RH SIDE BEARING WITH LOCKING COLLAR AND REPLACED IT WITH A NEW ONE.
REINSTALLED EVERYTHING IN REVERSE ORDER.
TENSIONED ALL THE BELTS.
RAN UNIT AND CHECKED FUNCTION.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 3/12/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: Account Page: 8 of 13
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGEN13- Internal							
AXE85999	Bearing With Housing	1.00	405.72	405.72	\$405.72	N	
Labor: \$800.00		Parts: \$405.72	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,205.72		

J06001201 JD X9 1100 Internal

COMPLAINT:

14 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

REMOVE HALF LINK AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
RECONNECT CONNECTING LINK.
ADJUST TENSION TO SPEC.
RUN UNIT AND READJUST TENSION AS REQUIRED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06180021 JD X9 1100 Internal

COMPLAINT:

15 CONCAVE REPLACE

CORRECTION:

REMOVED DAMAGED CONCAVE AND INSTALLED NEW
STRAIGHTENED BENT BARS ON 2 OTHER CONCAVES

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE96613	X9 SMALL WIRE CONCAVE REG WEAR	1.00	928.71	928.71	\$928.71	N
Labor: \$200.00		Parts: \$928.71	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,128.71	

JGEN16- Internal

COMPLAINT:

16 ACCELERATOR BELT

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kinderley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 9 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JGEN16- Internal

CORRECTION:
REMOVED SHIELDS.
LOOSENED TENSION OF THE BELT.
REMOVE BELT AND REPLACED WITH A NEW ONE AND TENSIONED BELT.
REASSEMBLED EVERYTHING IN REVERSE ORDER.
CHECKED FUNCTION.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE171261	X9 FEED ACCELERATOR BELT HIGH SPEED	1.00	290.93	290.93	\$290.93	N
Labor: \$300.00		Parts: \$290.93	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$590.93	

JGEN17- Internal

COMPLAINT:
17 ACCELERATOR GEAR CASE OIL

CORRECTION:
DRAINED OIL AND REFILLED WITH OIL TO SPEC

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	2.00	15.99	15.99	\$31.98	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N
Labor: \$75.00		Parts: \$31.98	OL&M: \$0.00	Misc: \$0.30	Sub-Total: \$107.28	

J06030020 JD X9 1100 Internal

COMPLAINT:
18 REPLACE ROTARY BEARING

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 10 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

J06030020 JD X9 1100 Internal
LOOSENED DRIVE SCREEN BELT AND REMOVED IT.
REMOVED OUTSIDE PULLEY LOOSENED BEARINGS AND REMOVED SHAFT.
INSTALLED NEW SHAFT WITH BEARINGS.
LINED UP ALL PULLEYS AND TIGHTENED ALL HARDWARE.
INSTALLED NEW BELTS.
RAN UNIT AND CHECKED FUNCTIONS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70716	Bearing With Housing	2.00	144.20	144.20	\$288.40	N
HXE166406	Shaft	1.00	517.08	517.08	\$517.08	N
HXE166680	Rotary Screen V-Belt X9	1.00	95.10	95.10	\$95.10	N
Labor: \$350.00		Parts: \$900.58	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,250.58	

JFUELDIAG1 JD ALL Internal
COMPLAINT:
19 REPAIR FUEL LEAK

CORRECTION:
REMOVED HOUSING OFF UNIT TO LOCATE LEAK
CLEANED UP HOUSING
FOUND VALVE WAS LEAKING
REPLACED VALVE AND ORINGS ON VALVE
DRAINED WATER FROM BOWL
RAN UNIT VERIFIED REPAIR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE21460	O-RING	1.00	2.69	2.69	\$2.69	N
HXE21482	O-RING	1.00	3.38	3.38	\$3.38	N
HXE74480	VALVE	1.00	335.91	335.91	\$335.91	N
Labor: \$280.00		Parts: \$341.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$621.98	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kinderley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Præcerville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 11 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JHYDDIAG1 JD ALL Internal

COMPLAINT:

20 REPAIR HYDRAULIC LEAK

CORRECTION:

CLEANED UP HYDRAULIC LINES AROUND TANK AND PUMPS.

TIGHTENED HOSE CLAMPS.

CLEANED UP CLEANING FAN VALVE BY THE AUGER.

RAN UNIT AND CHECKED FOR LEAKS.

REMOVED LINE AND INSTALLED O-RING, IT WAS NOT IN PLACE.

RAN UNIT, CHECKED FOR LEAKS.

VERIFY REPAIRS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
T77814	-4FF O-ring	1.00	3.09	3.09	\$3.09	N
Labor: \$70.00		Parts: \$3.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$73.09	

JENGAIRFILT JD X9 11 Internal

COMPLAINT:

21 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

REMOVED AND REPLACED WITH A NEW ONES ENGINE AIR FILTERS.

VERIFY REPAIRS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	477.72	477.72	\$477.72	N
HXE11091	Secondary EngAir Filter	1.00	337.08	337.08	\$337.08	N
Labor: \$50.00		Parts: \$814.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$864.80	

JENGOILCHNG JD X9 11 Internal

COMPLAINT:

22 REPLACE ENGINE OIL AND FILTER

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 12 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

JENGOILCHNG JD X9 11 Internal

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER.
CLEAN AREA.
INSTALL NEW OIL AND FILTER.
RUN UNIT AND LEAK CHECK
ADJUST OIL LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	156.67	156.67	\$156.67	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00		Parts: \$669.25	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$804.50	

JCABFILTER JD X9 11 Internal

COMPLAINT:

23 REPLACE CAB AIR FILTERS

CORRECTION:

REMOVE CAB AIR FILTERS
CLEAN FILTER HOUSING
INSTALL NEW AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.49	40.49	\$40.49	N
Labor: \$50.00		Parts: \$40.49	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$90.49	

J06070003 JD X9 1100 Internal

COMPLAINT:

24 TRANSMISSION RETURN FILTER, REPLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 38 South, Box 1057
Kelvington, SK S0A 1W0
Phone: (306) 327-4355
Fax: (306) 327-4314
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 3/12/2025
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 13 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XLN0820418	107026	

J06070003 JD X9 1100 Internal

CORRECTION:

REMOVE CLAMP

REMOVE CAP

REMOVE AND INSTALL NEW FILTER AND ORING

REINSTALL CAP AND CLAMP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	173.37	173.37	\$173.37	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$45.00 Parts: \$173.37 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$219.62

Miscellaneous Charges:
SERVICE ACCESSORIES

\$150.00

Customer PO No: MH
Tax Exempt No:
Advisor: MATTHEW HRYTZAK

Job Total: \$17,072.54
Grand Total: \$17,072.54

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: