

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

 Bus Phone: Prv Phone:	 Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 8/21/2026 Location: 10 Work Order Number: Payment Type: Account Page: 1 of 25
----------------------------------	----------------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____
 ENGINE HOURS 1005
 SEPERATOR HOURS 636

DOES THIS UNIT GET A VALUEMAX STICKER X YES NO
 HAS THE STICKER BEEN INSTALLED X YES NO
 THIS UNIT HAS HAD THE CAB CLEANED MM _____ (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER MM _____ (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB MM _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

2026 VMC SEASON OF USE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26860	INSPECTION+ 4 FLUID TEST KIT	1.00	128.81	128.81	\$128.81	N
TY6341	SD POLYUREA GREASE	1.00	11.08	11.08	\$11.08	N

Labor: \$5,407.50	Parts: \$139.89	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$5,547.39
--------------------------	------------------------	-------------------------	---------------------	------------------------------

JSOFTWARE JD X9 1000 Internal

COMPLAINT:

05 UPDATE ALL CONTROLLER SOFTWARE - 30 >

UPDATED SOFTWARE ON _____, CONTROLLERS.
 HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 2 of 25
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JSOFTWARE JD X9 1000 Internal

UPDATED SOFTWARE ON _____ CONTROLLERS.
 HAD TO PREFORM THE FOLLOWING CALIBRATIONS.

INSTALL UPDATES ON DISPLAY INCLUDING CHECK FOR OTHER DEVICES

INSTALL
 DISPLAY [DISPLAY-Display]
 ENGINE [Engine]
 COREOS [COREOS-Gen4OS Automated SAR]

Labor: \$420.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$420.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06070044 JD S790 Internal

COMPLAINT:

06 REPLACE ONE SINGLE POINT MULTI COUPLER CARTRIDGE - POINT IS STUCK IN >

CORRECTION:

LOOKED FOR CARTRIDGE REMOVAL TOOL IN TOOL ROOM AND DID NOT FIND IT
 ASKED SSM AND HE HAD IT
 REMOVE STUCK CARTRIDGE
 LUBE NEW CARTRIDGE AND INSTALL TO SPEC

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE73035	X9 MC Coupler 1/2" FM	1.00	483.68	483.68	\$483.68	N

Labor: \$94.50	Parts: \$483.68	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$578.18
-----------------------	------------------------	-------------------------	---------------------	----------------------------

J06171124 JD S790 Internal

COMPLAINT:

07 REPLACE FEEDERHOUSE DRIVE BELT IDLER PULLEY BEARING AND CLEAN TENSIONER UP >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 3 of 25
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06171124 JD S790 Internal

TIME NEED TO BE ADDED FOR THIS SEGMENT:

UNDO TENSIONERS
 REMOVE FEEDERHOUSE DRIVE BELT TO REMOVE FEEDERHOUSE DRIVEN BELT
 REPLACE BELT
 CHANGE 3 IDLER PULLEYS AS SPECIFIED
 THE TOP IDLER PULLEY HAS A BEARING THAT CAN BE REPLACED, CHANGE THE PULLEY WITH ONLY A BEARING
 WENT TO THE PRESS AND REMOVE SNAP RING
 PRESS OUT OLD BEARING
 PRESS IN NEW BEARING
 INSTALL IDLER AND TENSION BELTS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE82507	Idler	2.00	754.13	754.13	\$1,508.26	N
AXE87376	Double Row Spherical Ball Bearing	1.00	342.06	342.06	\$342.06	N
AXE89978	Idler	1.00	1,105.42	1,105.42	\$1,105.42	N
HXE175042	Front Secondary FixedSpd Belt LH	1.00	763.26	763.26	\$763.26	N
Labor: \$256.20		Parts: \$3,719.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,975.20	

J06171080 JD S790 Internal

COMPLAINT:
 08 REPLACE FEEDERHOUSE DRIVE CHAIN SPROCKET, BEARING, BOLT AND NUT >

CORRECTION:
 AH216585
 LOOSEN FEEDERHOUSE DRIVE CHAIN TENSION.
 REMOVE DRIVE CHAIN.
 REMOVE IDLER BRACKET.
 REMOVE IDLERS FROM BRACKET, INSTALL NEW IDLER, BUSHINGS, BOLT AND NUT
 ASSEMBLE IN REVERSE ORDER.
 TENSION DRIVE CHAIN TO SPEC.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7672	Bolt	1.00	10.58	10.58	\$10.58	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number:	[Redacted]
		Invoice Date:	8/21/2026
		Location:	10
		Work Order Number:	[Redacted]
		Payment Type:	Account
		Page:	4 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06171080 JD S790 Internal

14M7291	M16-2 FLG NUT	2.00	5.05	5.05	\$10.10	N
24M7525	M17X50 FLAT WASHER	1.00	6.24	6.24	\$6.24	N
AXE83290	Idler Sprocket	1.00	393.11	393.11	\$393.11	N
HXE159750	Bushing	2.00	37.53	37.53	\$75.06	N

Labor: \$315.00	Parts: \$495.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$810.09
------------------------	------------------------	-------------------------	---------------------	----------------------------


J06230090 JD T670 Internal

COMPLAINT:

10 REPLACE CLEAN GRAIN ELEVATOR DRIVE BELT IDLER BEARING. >

CORRECTION:

UNDO TENSIONER, FOUND ONE LOCKING NUT MISSING
 WENT TO PARTS AND GET A NEW NUT
 REMOVE IDLER PULLEY
 INSTALL NEW PULLEY AND TORQUE TO SPEC
 INSTALL BELT AND TIGHTEN TENSIONER

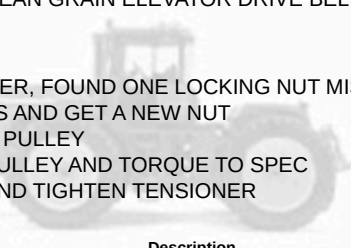

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7275	M12-1.75 NUT	1.00	1.77	1.77	\$1.77	N
AXE93348	Idler	1.00	970.03	970.03	\$970.03	N

Labor: \$385.36	Parts: \$971.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,357.16
------------------------	------------------------	-------------------------	---------------------	------------------------------

JGEN11- Internal

COMPLAINT:

11 RH SIDE CONCAVE HANGER MISSING BOLTS, RH CONCAVE REAR FRONT NEEDS SLAT BENT BACK AND RH
 CONCAVES NEED WIRE SUPPORTS >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 5 of 25
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN11- Internal

REMOVE CONCAVES
 USE HAMMER AND PUNCH TO STRAIGHTEN BENDED BARS
 REMOVE DAMAGED WIRES
 USE WELDING MACHINE TO WELD CRACKED BARS
 USE GRINDER TO SMOOTH WELDING


Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE142914	CONCAVE WIRE	6.00	13.17	13.17	\$79.02	N
Labor: \$630.00		Parts: \$79.02	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$709.02	

JFUELVENT JD S790 Internal

COMPLAINT:
 13 CLEAN OR REPLACE FUEL TANK SCREEN >

CORRECTION:
 Tuesday, August 11, 2026 4:13 PM - INSTALLED fuel tank screen

new seg needed:
 hydraulic breather installed
 PT: AXE82230

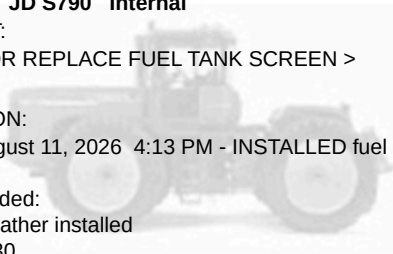

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R183142	SCREEN	1.00	161.01	161.01	\$161.01	N
Labor: \$25.00		Parts: \$161.01	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$186.01	

JENGOILCHNG JD X9 10 Internal

COMPLAINT:
 14 REPLACE ENGINE OIL AND FILTER >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [REDACTED] Payment Type: Account Page: 6 of 25
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JENGOILCHNG JD X9 10 Internal

DRAIN ENGINE OIL AND REMOVE FILTER.
 CLEAN AREA.
 INSTALL NEW FILTER.
 NEW OIL: +- 54 LITERS
 RUN UNIT AND LEAK CHECK

NEED TO CHECK OIL LEVEL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	133.36	133.36	\$133.36	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	203.74	203.74	\$611.22	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00		Parts: \$744.58	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$879.83	

JGEN15- Internal

COMPLAINT:

15 > DIAG UNLOAD AUGER SWING. FOLD FOR AUGER EXTENSION WAS NOT LOCKING MAKING EXTENSION MOVE NOT AS INTENDED BUT ONLY HAPPENS INTERMITTENTLY

CORRECTION:

UNDO STRAP AROUND AUGER AND MOVE LATCH PIN TO THE CENTER OF THE LATCH
 TEST AUGER AND ARE STILL CODING
 MOVE SADDLE TO THE MOST REAR POSITION
 TEST AUGER AND CODE WENT AWAY, BUT AFTER 3RD ATTEMPT IT CODED AGAIN
 INSTALL WASHERS BEHIND LATCH AND TEST AND STILL CODING
 CUT A 8MM PLATE AND DRILL 4 HOLES TO MATCH THE HOLES ON LATCH
 INSTALL PLATE BEHIND LATCH WITH 4 NEW LONGER BOLTS AND CHECK OPERATION
 OPENED AND CLOSED 6 TIMES WITHOUT CODING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7835	M10x35 FLG 10.9 BOLT	4.00	0.72	0.72	\$2.88	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

In [REDACTED] Bus Phone: Prv Phone:	To [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [REDACTED] Payment Type: Account Page: 7 of 25
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN15- Internal

24M7047	Washer M13x24	8.00	1.33	1.33	\$10.64	N
---------	---------------	------	------	------	---------	---

Labor: \$630.00	Parts: \$13.52	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$643.52
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN16- Internal

COMPLAINT:

16 BOTTOM STEP OF LADDER TO CAB IS BENT . NEED NEW >

CORRECTION:



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 8 of 25
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN16- Internal

Tuesday, August 11, 2026 3:14 PM - confirmed with joe what pieces to order

Monday, August 17, 2026 11:40 AM -
 -this SEG goes together with SEG 31

- removed bent step
- removed 4 bolts from bent bracket that connects to step
- installed new left and right bracket to step
- straightened side of step
- went to another x9 to check
- had to flip the brackets
- put off to side.

- removed hand rail 16 bolts n nuts
- removed the 2 & 3 step (4 bolts per step)
- removed bent left and right side bracket for the 2nd & # step
- noticed another bracket on the left side was bent
- removed that bracket and straightened it in the press
- put it back on
- noticed another bracket was bent which attaches to 2 gas shocks
- removed the gas shocks from the bracket
- put the bracket into the press to straighten as best as I could
- then put it in vice and straightened a little more
- installed the bracket with a rod and bolt and then re-attached the 2 shocks



- Installed the new left and right hand brackets for the 2nd & 3rd Step
- installed the bottom step
- put the railing back on
- tested the function
- DONE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE96308	Link	1.00	434.71	434.71	\$434.71	N
AXE96309	Link	1.00	549.99	549.99	\$549.99	N
HXE154049	Plate	1.00	149.64	149.64	\$149.64	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

		Invoice Number: Invoice Date: 8/21/2026 Location: 10 Work Order Number: Payment Type: Account Page: 9 of 25
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN16- Internal

HXE154052	Plate	1.00	151.25	151.25	\$151.25	N
-----------	-------	------	--------	--------	----------	---

Labor: \$0.00	Parts: \$1,285.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,285.59
----------------------	--------------------------	-------------------------	---------------------	------------------------------

JGEN17- Internal

COMPLAINT:

17 TOP UP WIPER FLUID >

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
WWASH	All Season Washer Fluid	1.00	6.99	6.99	\$6.99	N
Labor: \$15.00	Parts: \$6.99	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$21.99		

J06001690 JD S790 Internal

COMPLAINT:

18 WATER EXTINGUISHER, RECHARGE >

CORRECTION:

FILLED WITH WATER

ADDED AIR

TESTED

RE-ADDED MORE AIR TO BE IN THE GREEN

DONE

Labor: \$25.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$25.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

JENGAIRFILTD JD X9 10 Internal

COMPLAINT:

19 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS and clean out housing and cap >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number:	[Redacted]
		Invoice Date:	8/21/2026
		Location:	10
		Work Order Number:	[Redacted]
		Payment Type:	Account
		Page:	10 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JENGAIRFILT JD X9 10 Internal

DONE

REPLACED PRIMARY AND SECONDARY FILTER, DATE AND HOUR ON FILTER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	457.64	457.64	\$457.64	N
HXE11091	Secondary EngAir Filter	1.00	322.93	322.93	\$322.93	N
Labor: \$100.00		Parts: \$780.57	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$880.57	

J10030100 JD X9 1000 Internal

COMPLAINT:

20 REPLACE ENGINE FUEL FILTERS. >

CORRECTION:

REPLACED PRIMARY AND SECONDARY FUEL FILTERS.
 REMOVED AND CLEANED FUEL STRAINER.
 BLED FUEL SYSTEM.
 FUNCTION AND LEAK CHECKED.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	150.96	150.96	\$150.96	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	145.01	145.01	\$145.01	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$80.00		Parts: \$295.97	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$378.47	

J06070005 JD X9 1000 Internal

COMPLAINT:

21 TRANSMISSION FILTER, REPLACE >

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 11 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06070005 JD X9 1000 Internal

R567277	RING	2.00	13.99	13.99	\$27.98	N
RE577250	HYDRAULIC OIL FILTER	2.00	157.22	157.22	\$314.44	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$45.00 Parts: \$342.42 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$389.92

J06070003 JD X9 1000 Internal

COMPLAINT:

22 TRANSMISSION RETURN FILTER, REPLACE >

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE103407	HYDRAULIC	1.00	157.44	157.44	\$157.44	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$45.00 Parts: \$157.44 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$203.69

S790F1194770 Internal

COMPLAINT:

23 1000 HOUR SERVICE INTERVAL PRO DRIVE MACHINES ONLY >

CORRECTION:

Replace Change Main Engine Gear Case Oil and filter and breather.
 Replace Hydraulic Reservoir Filter (S780 and S790) and oil
 replace hydrostatic charge, cooler return and hydraulic aux return filters

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AR69444	HY-GARD J20C 18.9L PAIL	7.00	193.85	193.85	\$1,356.95	N
AXE73797	Hydraulic Filter	1.00	173.99	173.99	\$173.99	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 12 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

S790F1194770 Internal

AXE73798	Hydraulic Filter	1.00	214.20	214.20	\$214.20	N
AXE82230	BREATHER	1.00	133.14	133.14	\$133.14	N
R564922	Oil Filter Seal Ring	1.00	12.34	12.34	\$12.34	N
RE577612	Hydraulic Oil Filter	1.00	207.34	207.34	\$207.34	N
TY22062	HY-GARD J20C 9.46L	2.00	98.20	98.20	\$196.40	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	3.00	1.25	1.25	\$3.75	N
EF150	ENVIRO FEE	2.00	1.50	1.50	\$3.00	N

Labor: \$60.00 Parts: \$2,294.36 OL&M: \$0.00 Misc: \$6.75 Sub-Total: \$2,361.11

JCABFILTER JD X9 10 Internal

COMPLAINT:
 24 REPLACE CAB AIR FILTERS >

CORRECTION:
 REMOVE CAB AIR FILTERS
 CLEAN FILTER HOUSING
 INSTALL NEW AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.52	40.52	\$40.52	N
TA32591	Cab FreshAir Filter	1.00	117.71	117.71	\$117.71	N

Labor: \$50.00 Parts: \$158.23 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$208.23

J06001010 JD S790 Internal

COMPLAINT:
 25 change cleaning fan variable speed driven sheave oil >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 13 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06001010 JD S790 Internal

GREASE SEPARATOR VARIABLE SHEAVES DRIVE AND DRIVEN.

Thursday, August 13, 2026 11:22 AM - changed cleaning fan variable speed driven sheave oil

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	1.00	17.85	17.78	\$17.78	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
Labor: \$75.00		Parts: \$17.78	OL&M: \$0.00	Misc: \$0.15	Sub-Total: \$92.93	

JGEN26- Internal

COMPLAINT:

26 change feed accelerator gear case oil >

CORRECTION:

Monday, August 17, 2026 11:39 AM -

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R26448	-6ORB o-ring	1.00	2.58	2.58	\$2.58	N
TY6296	80W90 946ml GL5	2.00	17.85	17.78	\$35.56	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N
Labor: \$100.00		Parts: \$38.14	OL&M: \$0.00	Misc: \$0.30	Sub-Total: \$138.44	

JDRAGCHAIN JD X9 10 Internal

COMPLAINT:

27 INSTALL STATIC DRAG CABLE. >

CORRECTION:

DONE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 14 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JDRAGCHAIN JD X9 10 Internal

STATIC	STATIC DRAG CABLE 3/8"	1.00	288.00	288.00	\$288.00	N
Labor: \$105.00		Parts: \$288.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$393.00	

JGEN28- Internal

COMPLAINT:

28 back hazard not working >

CORRECTION:

Thursday, August 13, 2026 10:28 AM -

DURING DIAGNOSTICS, IT WAS FOUND THAT A WIRE HAD BROKEN OFF FROM THE PIN AT CONNECTOR NEAR THE LADDER.

A NEW CONNECTION WAS MADE, AND THE SYSTEM WAS TESTED AND CONFIRMED TO BE WORKING PROPERLY

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06175204 JD X9 1000 Internal

COMPLAINT:

29 TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST >

CORRECTION:

ROTATE TAILINGS ELEVATOR CONVEYOR CHAIN UNTIL CONNECTING LINK IS VISIBLE.

DISCONNECT CONNECTING LINK. REMOVE HALF LINK.

RECONNECT TAILINGS ELEVATOR CONVEYOR CHAIN WITH CONNECTING LINK.

ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.

RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN31- Internal

COMPLAINT:

31 left and right brackets on ladder are bent, ladder portion that folds up is bent and latch is stuck >

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 15 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN31- Internal

CORRECTION:

Tuesday, August 11, 2026 4:48 PM - WAITING FOR PARTS TO COME IN FOR BOTTOM STAIR THEN SEEING IF IT HELPS WITH IT BEING STRAIGHTENED.

Monday, August 17, 2026 12:00 PM -

-SEG GOES WITH 16

-removed bent step

-removed 4 bolts from bent bracket that connects to step

-installed new left and right bracket to step

straightened side of step

-went to another x9 to check

-had to flip the brackets

-put off to side.

-removed hand rail 16 bolts n nuts

-removed the 2 & 3 step (4 bolts per step)

-removed bent left and right side bracket for the 2nd & # step

-noticed another bracket on the left side was bent

-removed that bracket and straightened it in the press

-put it back on

-noticed another bracket was bent which attaches to 2 gas shocks

-removed the gas shocks from the bracket

-put the bracket into the press to straighten as best as I could

-then put it in vice and straightened a little more

-installed the bracket with a rod and bolt and then re-attached the 2 shocks

-Installed the new left and right hand brackets for the 2nd & 3rd Step

-installed the bottom step

-put the railing back on

-tested the function

-DONE



Labor: \$210.00

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$210.00

JGEN32- Internal

COMPLAINT:

32 missing bolts on back panel >

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 16 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN32- Internal CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7298	M8-1.25 FLG NUT	5.00	1.51	1.51	\$7.55	N
Labor: \$63.00		Parts: \$7.55	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$70.55	

JGEN33- Internal COMPLAINT:

33 water accumulating at rotary screen door and rubber to fan is damaged >

CORRECTION:

OPEN ACCESS DOOR
 FOUND MUD AND DEBRIS BUILD UP ON SEAL AND ON FRAME
 USE AIR AND BLOW OUT ALL DIRT
 REMOVE SEAL ON VACUUM FAN AND REPLACE WITH A NEW SEAL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE38720	: WEATHERSTRIP, ROTARY SCREEN DUCT SE	1.00	74.62	74.62	\$74.62	N
Labor: \$210.00		Parts: \$74.62	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$284.62	

JGEN34- Internal COMPLAINT:

34 locking latch for engine access to hopper hand rail is seized. latch for above engine platform is worn and clamp for hose in engine compartment is missing >

CORRECTION:

Thursday, August 13, 2026 8:54 AM -
 -REMOVED 4 BOLTS
 -REMOVED THE LATCH FROM BRACKET
 INSTALLED NEW LATCH
 -INSTALLED ON TO COMBINE,
 -LINED IT UP WITH ENGINE BAY DOOR
 TESTED
 FIXED

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	8887029
		Invoice Date:	8/21/2026
		Location:	10
		Work Order Number:	
		Payment Type:	Account
		Page:	17 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN34- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE72025	Buckle	1.00	92.56	92.56	\$92.56	N
Labor: \$105.00		Parts: \$92.56	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$197.56	

JGEN35- Internal

COMPLAINT:

35 pivot fitting for chopper pulley is leaking >

CORRECTION:

REMOVE AND CAP HYDRAULIC LINE
 REMOVE UNION
 INSTALL NEW UNION
 INSTALL HYDRAULIC LINE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH218190	Hyd Rotary Union Fitting	1.00	678.52	678.52	\$678.52	N
Labor: \$105.00		Parts: \$678.52	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$783.52	

J06172010 JD X9 1000 Internal

COMPLAINT:

36 CHOPPER BLADES, REPLACE. >

CORRECTION:

Remove lock nut, cap screw, and bushings.
 Remove and inspect blades and bushings.
 Replace blade and install cap screw, bushings, and lock nut.
 Tighten lock nuts to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	211111
		Invoice Date:	8/21/2026
		Location:	10
		Work Order Number:	
		Payment Type:	Account
		Page:	18 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06172010 JD X9 1000 Internal

KXE10761	S7 SERIES CHOPPER KNIFE KIT 8/CS	9.00	280.53	280.53	\$2,524.77	N
----------	----------------------------------	------	--------	--------	------------	---

Labor: \$651.00	Parts: \$2,524.77	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,175.77
------------------------	--------------------------	-------------------------	---------------------	------------------------------

JKNIFEFLIP JD S790 Internal

COMPLAINT:

37 FLIP OVER CHOPPER STATIONARY KNIFE BANK >

CORRECTION:

REMOVE KNIFE BANK.

CLEAN AREA.

FLIP KNIFES

INSTALL KNIFE BANK.

Labor: \$157.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$157.50
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN38- Internal

COMPLAINT:

38 missing thread insert for left hand shield >

CORRECTION:

Thursday, August 13, 2026 11:22 AM -

up at parts trying to find the right rivet

removed old broken rivet, installed new one

tested and work.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE68767	Hexagonal Rivet Nut, M8	1.00	6.74	6.74	\$6.74	N

Labor: \$52.50	Parts: \$6.74	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$59.24
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06001201 JD X9 1000 Internal

COMPLAINT:

39 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK. >

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 19 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

J06001201 JD X9 1000 Internal

CORRECTION:
 UNDO TENSION ON CHAIN
 TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
 DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
 RECONNECT CONNECTING LINK.
 INSTALL RED LOCTITE ON CAP SCREWS AND TORQUE TO 26 LB-FT
 ADJUST TENSION TO SPEC.
 RUN UNIT AND READJUST TENSION AS REQUIRED.

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06180269 JD X9 1000 Internal

COMPLAINT:
 40 R&R, CONCAVES- > 1h concave middle front one has one slat with a severe bend and cracks, left hand middle back concave has bend and crack- either replace or bend back and weld. Left hand hanger nut inserts spins in bracket and concaves need wire support

CORRECTION:
 REMOVE CONCAVES.
 INSTALLED CONCAVES (ENSURE THAT THE CONCAVES ARE TIGHT TO ONE ANOTHER AND THERE IS ADEQUATE BULKHEAD CLEARANCE)
 LEVELED CONCAVES AS PER SERVICE ADVISOR.
 PERFORMED CONCAVE CALIBRATION.

Labor: \$1,260.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,260.00
--------------------------	----------------------	-------------------------	---------------------	------------------------------

JGEN41- Internal

COMPLAINT:
 41 REPLACE SPREADER DRIVE BELT TENSIONER ROD >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [REDACTED] Payment Type: Account Page: 20 of 25
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN41- Internal

Tuesday, August 11, 2026 9:36 AM -
 removed shield
 removed jam nut
 removed tension off of belt
 removed spring and bracket
 removed bolt from eye rod
 removed eye bolt tensioner bolt
 installed in reverse order

DONE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7276	M16-2.0 NUT	2.00	3.16	3.16	\$6.32	N
H173900	Pivot, IDLER SPRING	1.00	28.87	28.87	\$28.87	N
H204589	EYEBOLT	1.00	78.25	78.25	\$78.25	N
H204591	Bushing	1.00	25.20	25.20	\$25.20	N
Labor: \$105.00		Parts: \$138.64	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$243.64	

JGEN42- Internal

COMPLAINT:

42 over center latch for chopper gearbox does not latch properly >

CORRECTION:

- latch is lose but has all required parts, as i looked at another one.
 -spring washers are damaged and not inter-changeable
 -removed locking washer (have new one to install when part gets here)

Tuesday, August 11, 2026 10:34 AM - ordering new latch,

Thursday, August 13, 2026 8:00 AM- INSTALLED NEW PIECE
 ATTACHED LOCKING WASHER
 TESTED
 FIXED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 8/21/2026 Location: 10 [REDACTED] Work Order Number: [REDACTED] Payment Type: Account Page: 21 of 25
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN42- Internal

HXE171827	Latch	1.00	77.59	77.59	\$77.59	N
Z34136	Washer	1.00	10.69	10.69	\$10.69	N

Labor: \$210.00	Parts: \$88.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$298.28
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN43- Internal

COMPLAINT:

43 hole in moveable concave for re-thresher. either weld or new >

CORRECTION:

UNDO ALL BELT TENSIONERS AROUND THE RE-THRESHER
 REMOVE IDLER PULLEY
 REMOVE RE-THRESHER DOOR HINGE
 REMOVE RE-THRESHER CONCAVE

Labor: \$840.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$840.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN44- Internal

COMPLAINT:

44 CHOPPER DRIVE HAS 3 IDLERS AND TENSIONERS BEARINGS ARE DRY >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number:	[Redacted]
		Invoice Date:	8/21/2026
		Location:	10
		Work Order Number:	[Redacted]
		Payment Type:	Account
		Page:	22 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JGEN44- Internal

Tuesday, August 11, 2026 11:28 AM -

removed tension off chopper belt

NOTE: eye bolt tensioner has wear - probably good one more season.

noticed they had 3 idlers but 4 on combine,

referred to serhii attachments but could not find which ones specifically.

removed chaffer shield, 12 bolts, and bracket

removed bolt and idlerx2

removed cotter pin, and straightened with a hammer

removed pin where cotter was in

removed snap ring and idler,

found a special allan key to remove idler shaft

pulled other idler and changed for new

changed 3 idlers.

put back in reverse order.

done.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE89981	IDLER	3.00	1,155.66	1,155.66	\$3,466.98	N
Labor: \$210.00		Parts: \$3,466.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,676.98	

JBLOW JD ALL Internal

COMPLAINT:

45 BLOW OFF COMBINE AND CLEAN HOPPER

CORRECTION:

Thursday, July 2, 2026 11:56 AM - nts

-Remove shields

-Run threshing and unloading to clear dust

-Blow off around combine

Labor: \$772.21	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$772.21
------------------------	----------------------	-------------------------	---------------------	----------------------------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] [Redacted] [Redacted] Bus Phone: Prv Phone:	[Redacted] [Redacted] [Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 23 of 25
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

EXPERT-1000000146238 Internal

COMPLAINT:

46 Active Tailings System Slip Clutch, Remove and Replace >

CORRECTION:

Loosen nuts and remove tailings auger drive belt.

Loosen nuts and remove clean grain elevator drive belt.

Remove lock nut, slip clutch assembly, and shaft key from shaft.

Install a new shaft key, install slip clutch assembly, and retain with nut and tighten to specification.

Install the tailings auger and clean grain elevator drive belts and adjust to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE92005	SLIP CLUTCH - CLEANING SHOE RETRESHER	1.00	2,622.00	2,622.00	\$2,622.00	N
H149361	M20 FLG LOCK NUT	1.00	6.39	6.39	\$6.39	N
Labor: \$315.00		Parts: \$2,628.39	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,943.39	

JGEN47- Internal

COMPLAINT:

47 reel drive valve hyd hose >

CORRECTION:

Thursday, August 13, 2026 12:01 PM - damaged hydraulic hose replaced

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE86497	HOSE, HYDR	1.00	311.97	311.97	\$311.97	N
Labor: \$153.30		Parts: \$311.97	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$465.27	

JELECDIAG1 JD ALL Internal

COMPLAINT:

48 Diagnose active tailings camera code 516905.12 >

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 8/21/2026 Location: 10 Work Order Number: XXXXXXXXXX Payment Type: Account Page: 24 of 25
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JELECDIAG1 JD ALL Internal
 CODE 516905.12


OPENED TAILINGS CAMERA
 TESTED FOR POWER AND ALL GOOD
 CHECK HARNESS AND ALL GOOD
 FOUND THE VIDEO WIRE WAS DISCONNECTED AT PLUG ON TOP OF THE TAILINGS
 CLEAN PLUG OUT AND INSTALL
 TURN POWER OF ON COMBINE AND RESET THE SYSTEM
 POWER BACK UP AND TEST CAMERAS
 TAILINGS AND ELEVATOR CAMERAS ARE WORKING
 CLEAN WITH WINDOW CLEAN AND CLOSE THEM UP.

Labor: \$222.60	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$222.60
------------------------	----------------------	-------------------------	---------------------	----------------------------

JELECDIAG4 JD ALL Internal
 COMPLAINT:
 49 FULL GRAIN ALARM STAYS ON

CORRECTION:
 RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: _____

WENT INTO THE GRAIN BIN AND MANUALLY MOVED BOTH FULL SENSORS
 ALARM STILL ACTIVATED
 DISCONNECT ON SENSOR AND CHECK ALARM, BUT STILL ACTIVE
 FOLLOW HARNESS AND UNPLUG CONNECTION
 CLEAN OUT AND INSTALL AGAIN
 POWER DOWN THE BATTERY, AND POWER BACK UP
 ALARM WENT AWAY
 GRAIN TANK LIDS CLOSED AS SHOULD

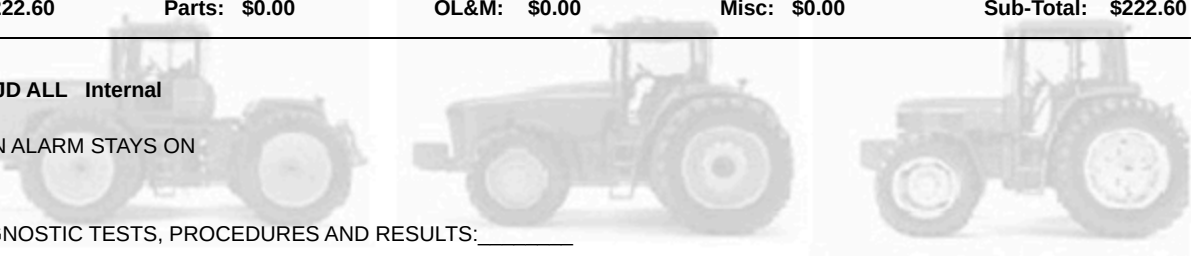

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 8/21/2026 Location: 10 Work Order Number: [REDACTED] Payment Type: Account Page: 25 of 25
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	1005	1H0X910XJP0825262	105262	

JELECDIAG4 JD ALL Internal

Labor: \$148.11	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$148.11
------------------------	----------------------	-------------------------	---------------------	----------------------------

INVOICE CONTAINS \$0.21 DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

\$150.00

Customer PO No: Tax Exempt No: Advisor: Joanne Thronberg

Labor:	\$15,198.78
Parts:	\$22,492.10
OL&M:	\$0.00
Misc:	\$173.70
Grand Total:	\$37,864.58

*** DOCUMENT COPY ***



ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: