

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

42 Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 8/18/2025 Location: 10 Work Order Number: Payment Type: Account Page: 1 of 12
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____
ENGINE HOURS _____ 774 _____
SEPERATOR HOURS _____

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
THIS UNIT HAS HAD THE CAB CLEANED _____ Is _____ (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER _____ Is _____ (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ Is _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

Friday, July 25, 2025 10:32 AM - Attempted to complete the display software and the combine internal storage was too fill to accept the update so i have to complete a factory reset in order to clear enough space to do the updates. TP

Wednesday, August 13, 2025 11:33 AM - reset tailings/clean grain elevator belt back onto tensioner pulley and replaced the leaking quick connect port out of the multiconnect valve. JM

Job Total: \$3,860.00

JSOFTWARE JD X9 1000 Internal

COMPLAINT:

04 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON _____ CONTROLLERS.
HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	
		Invoice Date:	8/18/2025
		Location:	10
		Work Order Number:	
		Payment Type:	Account
		Page:	2 of 12

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JSOFTWARE JD X9 1000 Internal

CORRECTION:
 UPDATED SOFTWARE ON _____ CONTROLLERS.
 HAD TO PREFORM THE FOLLOWING CALIBRATIONS.

Friday, July 25, 2025 1:33 PM - The combine did not have enough storage room for the display update so i had to factory reset the combine storage and then after that was complete i could start doing the updates on the controllers, i had to do 11 updates, im having troubles with one of them so i will get assistance from a manager to complete it when they have time to assist. TP

Monday, August 11, 2025 11:25 AM - Completed all of the required updates to unit. TP

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06171080 JD X9 1000 Internal

COMPLAINT:
 05 REPLACE FEEDERHOUSE CONVEYOR DRIVE CHAIN BEARING IN PULLEY & ADJUST CHAIN

CORRECTION:
 Friday, July 25, 2025 12:11 PM - loosened chain tensioner, removed chain and tensioner sproket. changed tensioner sproket bearing and reinstalled sproket. replaced chain as tensioner was maxed and chain was still sloppy. installed new chain and set chain tension. JM

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7298	M8-1.25 FLG NUT	10.00	1.54	1.54	\$15.40	N
AKK15137	BEARING, WALKING BEAM PIVOT	1.00	44.65	44.65	\$44.65	N
AXE90399	X9 FEEDER CHAIN DRIVE 80H BSN 83000	1.00	1,101.36	1,101.36	\$1,101.36	N
Labor: \$400.00	Parts: \$1,161.41	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,561.41		

J06001040 JD X9 1000 Internal

COMPLAINT:
 06 REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/18/2025 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 3 of 12
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

J06001040 JD X9 1000 Internal

Saturday, July 26, 2025 6:21 PM - R/H tension bolt is packed full of grime and will not tighten anymore, the bolt and spring wil need to be removed and cleaned. TP

Monday, July 28, 2025 9:50 AM - cleaned up tension bolt spring and area, re tensioned the spring to spec, reinstalled drive belt and re tensioned to spec.JM

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN01- Internal

COMPLAINT:

07 RUBBER ON FEED ACCELERATOR ACCESS DOOR REPLACE

CORRECTION:

Friday, August 1, 2025 11:41 AM - removed old rubber, found part number for rubber. HXE174701. JM

Saturday, August 9, 2025 12:08 PM - I looked for the part for a bit then checked at the parts desk and the part was never ordered to the WO. we had one in stock so i installed the new rubber seal and then installed the pannel back onto the combine. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7784	M10x20 FLG 10.9 BOLT	34.00	2.32	2.32	\$78.88	N
19M7866	M8x20 FLG 10.9 BOLT	9.00	1.81	1.81	\$16.29	N
HXE174701	SEAL	1.00	72.80	72.80	\$72.80	N
Labor: \$100.00		Parts: \$167.97	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$267.97	

J06180269 JD X9 1000 Internal

COMPLAINT:

08 R&R, CONCAVES, LEVEL AND CALIBRATE. BOTH SIDES

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

 Bus Phone: Prv Phone:	 Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 8/18/2025 Location: 10 Work Order Number: Payment Type: Account Page: 4 of 12
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

J06180269 JD X9 1000 Internal

REMOVE CONCAVES.

INSTALLED CONCAVES (ENSURE THAT THE CONCAVES ARE TIGHT TO ONE ANOTHER AND THERE IS ADEQUATE BULKHEAD CLEARANCE)

LEVELED CONCAVES AS PER SERVICE ADVISOR.

PERFORMED CONCAVE CALIBRATION.

Sunday, July 27, 2025 9:11 AM - New concaves are here but z-bar is missing on both sides and i cannot find them in the yard, i will ask management when they are in tomorrow. TP

Monday, July 28, 2025 3:22 PM - Found the z bars and the box with all of the shields and hardware in the yard will start installing right away. TP

Monday, July 28, 2025 9:45 PM - Had to dig through the box of parts to fins the hardware for the concaves, then i have to install the small wire concave pip into the new concaves before installing them, i have the right side all back together i just have to finish the left tomorrow and calibrate the concaves. TP

Tuesday, July 29, 2025 10:28 PM - I installed the Left side and leveled the concaves, i need a couple new bolts for tomorrow so i fill finish the calibrations and the bolts tomorrow. TP

Saturday, August 9, 2025 7:00 PM - All parts are installed concaves are both leveled and calibrations are completed. There was a stripped nut in the concave holder so i had to repair the thread inside the nut to be able to get it to torque properly which took quite a bit of time. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7186	M8x30 CB 8.8 SN	4.00	1.41	1.41	\$5.64	N
03M7199	M12x35 CB 8.8 SN	2.00	2.52	2.52	\$5.04	N
14M7298	M8-1.25 FLG NUT	4.00	1.54	1.54	\$6.16	N
14M7299	M12-1.75 FLG NUT	5.00	2.91	2.91	\$14.55	N
19M7789	M12x30 FLG 10.9 BOLT	5.00	2.66	2.66	\$13.30	N
BXE11577	CONCAVE KI	1.00	8,446.08	8,446.08	\$8,446.08	N
Labor: \$1,200.00		Parts: \$8,490.77	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$9,690.77	

J06175204 JD X9 1000 Internal

COMPLAINT:

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

		Invoice Number:
Bus Phone:	Bus Phone:	Invoice Date: 8/18/2025
Prv Phone:	Prv Phone:	Location: 10
		Work Order Number:
		Payment Type: Account
		Page: 5 of 12

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

J06175204 JD X9 1000 Internal

09 TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST

CORRECTION:

ROTATE TAILINGS ELEVATOR CONVEYOR CHAIN UNTIL CONNECTING LINK IS VISIBLE.
DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
RECONNECT TAILINGS ELEVATOR CONVEYOR CHAIN WITH CONNECTING LINK.
ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.
RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Friday, July 25, 2025 1:42 PM - loosen chain and pulley tensioner, position removable link to the bottom and removed the half link, retighten tensioners. JM

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN02- Internal

COMPLAINT:

10 PLATE IN FRONT OF SIEVE IS BENT REPLACE

CORRECTION:

Saturday, July 26, 2025 3:43 PM - found bent plate inside combine removed it bent it back into proper shape and reinstalled, then checked the sieve and chaffer and the sieve needs a few louvers replaced and they can be reinstalled in unit. TP

Wednesday, July 30, 2025 7:15 PM - The louvers came in but i accidentally ordered all left side louvers instead of left and right, i will finish when the correct parts come in. TP

Friday, August 8, 2025 6:39 PM - Replaced the broken louvers on the sieve and just have to install and calibrate, will need a second person to help me install back into combine. TP

Saturday, August 9, 2025 10:49 AM - Installed the sieve and chaffer into the combine and calibrated, had to find the mounting bolts as the box in the crate had broken and bolts scattered inside crate under all of the shields. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE79689	Sieve Louver Weldment - LH	2.00	61.09	61.09	\$122.18	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

 Bus Phone: Prv Phone:	 Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 8/18/2025 Location: 10 Work Order Number: Payment Type: Account Page: 6 of 12
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JGEN02- Internal

AXE79693	Louver	3.00	61.09	61.09	\$183.27	N
----------	--------	------	-------	-------	----------	---

Labor: \$600.00	Parts: \$305.45	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$905.45
------------------------	------------------------	-------------------------	---------------------	----------------------------

JGEN03- Internal

COMPLAINT:

11 LEAK FROM CHOPPER GEARCASE LUBE LINE REPLACE

CORRECTION:

Saturday, August 9, 2025 1:00 PM - Took hose off and inspected flat face oring and it was flattened very badly so i took the fitting the rest of the way out and replaced the o-ring boss o-ring on the inside and the flat face oring on the outside and reinstalled it. TP

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001201 JD X9 1000 Internal

COMPLAINT:

12 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
 TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
 DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
 RECONNECT CONNECTING LINK.
 ADJUST TENSION TO SPEC.
 RUN UNIT AND READJUST TENSION AS REQUIRED.

Friday, July 25, 2025 3:36 PM - tightened the chain tensioner as there was not enough slack to remove the half link

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN04- Internal

COMPLAINT:

13 REPAIR ENGINE ACCESS DOOR LATCH

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

		Invoice Number:
		Invoice Date: 8/18/2025
		Location: 10
Bus Phone:	Bus Phone:	Work Order Number:
Prv Phone:	Prv Phone:	Payment Type: Account
		Page: 7 of 12

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JGEN04- Internal

CORRECTION:

Saturday, July 26, 2025 4:16 PM - Adjusted height of the latch and now door closes and opens properly. TP

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN05- Internal

COMPLAINT:

14 REPAIR COOLANT LEAK & TOP UP

CORRECTION:

Saturday, July 26, 2025 4:08 PM - I believe i found the possible leak, will need to talk to tech that completed inspection to verify as there was no general location of leak given in notes. TP

Saturday, August 9, 2025 4:41 PM - Asked tech that did inspection about area of leak and he confirmed it was the hose i originally thought, i drained the coolant took the hose off inspected for damage and hose was good so i put it back on and repositioned it further into the fitting and re clamped it on then filled with coolant and tested and there are no signs of leaks anymore.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN06- Internal

COMPLAINT:

15 HYDRAULIC LEAK FROM HOSE CLAMPS ON PLASTIC TANK BETWEEN BOTTOM OF MEG AND HYD OIL TANK

CORRECTION:

Saturday, July 26, 2025 5:06 PM - Found leaking area, got prepared to possibly drain the oil to change hose, after cleaning area found no visible damage on hose, checked hose clamp and it was slightly loose so i tightened it and will recheck for leaks during final run up. TP

Labor: \$600.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$600.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/18/2025 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 8 of 12
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JENGAIRFILT JD X9 10 Internal

COMPLAINT:

16 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

Thursday, July 24, 2025 10:04 PM - Changed the filters while doing the oil change, took 10 minuets. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	477.72	477.72	\$477.72	N
HXE11091	Secondary EngAir Filter	1.00	337.08	337.08	\$337.08	N
Labor: \$50.00		Parts: \$814.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$864.80	


JENGOILCHNG JD X9 10 Internal

COMPLAINT:

17 REPLACE ENGINE OIL AND FILTER

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER.
 CLEAN AREA.
 INSTALL NEW OIL AND FILTER.
 RUN UNIT AND LEAK CHECK
 ADJUST OIL LEVEL AS REQUIRED.

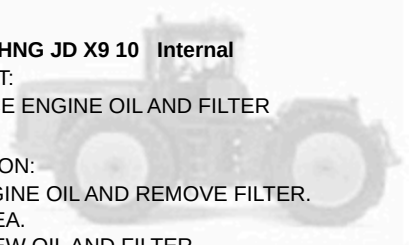

Thursday, July 24, 2025 10:04 PM - Changed the oil and filter, while oil was draining i changed the primary and secondary air filters.
 TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	156.67	156.67	\$156.67	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 8/18/2025 Location: Work Order Number: Payment Type: Account Page: 9 of 12
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JENGOILCHNG JD X9 10 Internal

EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
-------	------------	------	------	------	--------	---

Labor: \$125.00	Parts: \$669.25	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$804.50
------------------------	------------------------	-------------------------	----------------------	----------------------------

J10030100 JD X9 1000 Internal

COMPLAINT:

18 REPLACE ENGINE FUEL FILTERS.

CORRECTION:

REPLACED PRIMARY AND SECONDARY FUEL FILTERS.

REMOVED AND CLEANED FUEL STRAINER.

BLED FUEL SYSTEM.

FUNCTION AND LEAK CHECKED.

Friday, July 25, 2025 10:26 AM - Replaced Primary and Secondary fuel filters, and turned key on to pressurize fuel system and check for leaks. JM

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	168.89	168.89	\$168.89	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	162.25	162.25	\$162.25	N
H216169	BREATHER, FUEL TANK	1.00	47.04	47.04	\$47.04	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$80.00	Parts: \$378.18	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$460.68		

J06001009 JD X9 1000 Internal

COMPLAINT:

19 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CORRECTION:

PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To: [Redacted]	Deliver To: [Redacted]	Invoice Number: [Redacted]
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Date: 8/18/2025 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 10 of 12

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

J06001009 JD X9 1000 Internal

Remove drain plug.
Allow oil to drain.
Install the drain plug and torque to specification. 30 N·m (22 lb·ft)
Refill with Hy-Gard until visible in the sight glass.
Shift lever to opposite speed.
Run the separator for one minute.
Let the machine sit for five minutes.
Re-check oil level.
Torque the fill plug to specification. 30 N·m (22 lb·ft)
Shift lever back to original speed.

Saturday, July 26, 2025 6:10 PM - Drained and refilled oil. TP

Labor: \$40.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$40.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

JCABFILTER JD X9 10 Internal

COMPLAINT:
20 REPLACE CAB AIR FILTERS

CORRECTION:
REMOVE CAB AIR FILTERS
CLEAN FILTER HOUSING
INSTALL NEW AIR FILTERS

Saturday, July 26, 2025 5:48 PM - Changed filters and took old ones out to the garbage bin. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.49	40.49	\$40.49	N
TA32591	Cab FreshAir Filter	1.00	125.95	125.95	\$125.95	N
Labor: \$50.00		Parts: \$166.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$216.44	

JDRAGCHAIN JD X9 10 Internal

COMPLAINT:
21 INSTALL STATIC DRAG CABLE.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED]
		Invoice Date: 8/18/2025
		Location: 10
		Work Order Number: [REDACTED]
		Payment Type: Account
		Page: 11 of 12

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JDRAGCHAIN JD X9 10 Internal

CORRECTION:

Saturday, July 26, 2025 5:16 PM - Removed old cable and installed the new cable then installed the decals, identification decal above the cable holder, and the warning decal on the stairs to remind operator to lift cable before transport. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
STATIC	STATIC DRAG CABLE 3/8"	1.00	242.83	242.83	\$242.83	N
Labor: \$100.00		Parts: \$242.83	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$342.83	

JGEN07- Internal

COMPLAINT:

22 REPLACE F/H LIFT CYLINDER

CORRECTION:

Saturday, July 26, 2025 12:03 PM - I replaced the old ram that was leaking with the new ram then ran it up and down a few times to get any air out of the system. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC20836	X9 FEEDER HOUSE HYD LIFT CYL 90MM	1.00	3,564.83	3,564.83	\$3,564.83	N
AXE73035	X9 MC Coupler 1/2" FM	1.00	487.65	487.65	\$487.65	N
Labor: \$400.00		Parts: \$4,052.48	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,452.48	

JGEN23- Internal

COMPLAINT:

23 BELT TENSIONER PULLEY - REPLACE BEARING IF POSSIBLE; WHOLE PULLEY IF NOT

CORRECTION:

Monday, July 28, 2025 3:25 PM - removed and replaced bearing, reinstalled belt and re tensioned it. JM

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

[Redacted] Bus Phone: Prv Phone:	[Redacted] Bus Phone: Prv Phone:	Invoice Number: [Redacted] Invoice Date: 8/18/2025 Location: 10 Work Order Number: [Redacted] Payment Type: Account Page: 12 of 12
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	774	1H0X910XHP0825267	175888	

JGEN23- Internal

AXE87708	BEARING Peer W5308RRR56-A	1.00	140.22	140.22	\$140.22	N
Labor: \$200.00		Parts: \$140.22	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$340.22	

INVOICE CONTAINS \$125.67 DISCOUNT

Miscellaneous Charges:

SERVICE ACCESSORIES \$150.00

Customer PO No:

Tax Exempt No:

Advisor: Joe Cadieux

*** DOCUMENT COPY ***

Job Total: \$25,957.55
Grand Total: \$25,957.55

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: