

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 1 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000122469 Internal

COMPLAINT:

01 X9-Series Combine ValueMax Inspection

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____

ENGINE HOURS _____

SEPERATOR HOURS _____

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO

HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO

THIS UNIT HAS HAD THE CAB CLEANED _____ ED _____ (INITIAL)

THIS UNIT HAS HAD A FINAL CHECKOVER _____ BT _____ (INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ DF _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	85.83	0.00	\$0.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DISI	LAB DISC INTERN	-1.00	1,187.00	1,187.00	(\$1,187.00)	N

Labor: \$5,150.00 Parts: \$0.00 OL&M: \$0.00 Misc: (\$1,187.00) Sub-Total: \$3,963.00

JWASH JD X9 Internal

COMPLAINT:

02 WASH USED X9 COMBINE. READY FOR DISPLAY.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 2 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JWASH JD X9 Internal

INCLUDES THE FOLLOWING:

- BLOW OFF ALL CHAFF.
- WASHING OUT RADIATOR AND ALL COOLERS.
- CLEAN OUT GRAIN TANK AND UNLOADING AUGER.
- WASH EXTERIOR PANELS AND ALL SHIELDS.
- VACUUM CAB AND WASH FLOOR MAT
- CLEAN WINDOWS

DALTON ADDED 60L OF FUEL

ALL DONE

PARKED IN FRONT OF THE BAY 16

MECHANIC HAVE THE SHIELDS THEY'RE GONNA PUT IT BACK.

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
BULKFUEL	BULK FUEL CHARGE	60.00	1.79	1.79	\$107.40	N
Labor: \$1,495.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$107.40	Sub-Total: \$1,602.40	

JGEN05- Internal

COMPLAINT:

05 TOP UP COOLANT BEFORE RUNNING.

MAY NEED REPAIRED DURING VMI.

CORRECTION:

Friday, October 3, 2025 3:56 PM -

COOLANT WAS OVER FILLED.

SIPHONED OUT COOLANT TO GET LEVEL AT MAX COLD.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26576	COOL-GARD II 50/50 PRE-MIX JUG 9.46L	1.00	65.35	65.35	\$65.35	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	Page: 3 of 27
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN05- Internal

EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
-------	------------	------	------	------	--------	---

Labor: \$230.66	Parts: \$65.35	OL&M: \$0.00	Misc: \$1.50	Sub-Total: \$297.51
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JSOFTWARE JD X9 1000 Internal

COMPLAINT:

07 UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:

UPDATED SOFTWARE ON _FED HAD MG2 CONTROLLERS.
 HAD TO PREFORM THE FOLLOWING CALIBRATIONS.

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN03- Internal

COMPLAINT:

08 DIAGNOSE AND REPAIR UNLOAD AUGER ACTUATOR FAULT.

CORRECTION:

SWING OUT UNLOADING TUBE DIAGNOSE WHY THE EXTENSION UNLOADING NOT WORKING
 GO TO DTAC AND DO STEP BY STEP PROCEDURE ACCORDING TO THE DTAC
 FOUND THE ISSUE IS THE UNLOADING ACTUATOR NOT GOOD
 REPLACE NEW UNLOADING ACTUATOR ASSEMBLY
 RAN THE COMBINE AND CHECK FOR FUNCTIONALITY AND ITS ALL GOOD

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE94968	Actuator	1.00	2,012.14	2,012.14	\$2,012.14	N

Labor: \$500.00	Parts: \$2,012.14	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,512.14
------------------------	--------------------------	-------------------------	---------------------	------------------------------

JGEN04- Internal

COMPLAINT:

09 DIAGNOSE AND REPAIR ENGINE FAN CALIBRATION FAULT

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 4 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN04- Internal

CORRECTION:

START COMBINE AND CALIBRATE FAN COOLING SUCCESSFUL CALIBRATION

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN06- Internal

COMPLAINT:

10 MISC REPAIRS

- REPLACE MISSING HEADER LATCH SHEAR BOLTS. (2)
- MISSING FILLER PLATES (BOTH SIDES)
- MISSING FILLER PLATES FOR SEPARATOR GRATES (BOTH SIDES)
- GULL WINGS MISSING LOCK PINS

CORRECTION:

INSTALL MISSING SHEAR BOLTS
 INSTALL MISSING CONCAVE FILLER PLATES
 INSTALL MISSING SEPARATOR FILLER PLATES
 INSTALL MISSING GULL WING LOCK PIN



<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
14M7264	M4-0.75 NYLOCK NUT	2.00	0.52	0.52	\$1.04	N
19M9326	M4x30 HEXSOC 12.9 BOLT	2.00	2.08	2.08	\$4.16	N
45M7121	Clevis Pin M10x100	2.00	15.92	15.92	\$31.84	N
J16931	R-Clip	2.00	0.29	0.29	\$0.58	N

Labor: \$150.00	Parts: \$37.62	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$187.62
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN07- Internal

COMPLAINT:

11 REPAIR RH LATCH HANDLE WONT LOCK IN.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	Page: 5 of 27
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN07- Internal

Tuesday, September 30, 2025 4:08 PM - remove latch pin handle
 repair and clean latch pin handle

Labor: \$150.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$150.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001410 JD S790 Internal

COMPLAINT:
 12 CLEAN DEBRIS FROM HEADER LATCH PINS.

CORRECTION:
 RAISE FEEDERHOUSE AND ENGAGE CYLINDER STOP.
 UNHOOK CABLE, UNBOLT AND REMOVE HEADER LOCK PINS.
 CLEAN DEBRIS OUT FROM AROUND THE PINS.
 LUBRICATE AND RE-INSTALL PINS, RE-ATTACH CABLE AND ADJUST AS NECESSARY.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001040 JD X9 1000 Internal

COMPLAINT:
 13 REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.

CORRECTION:
 REMOVE FEEDER HOUSE CONVEYOR HALF LINK AND ADJUST FEEDER HOUSE CONVEYOR CHAIN

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN10- Internal

COMPLAINT:
 14 CLEAN OUT UNLOAD AUGER SUMP

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 6 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN10- Internal

Friday, October 3, 2025 11:30 AM -
 LOOSENED WING NUTS AND OPENED COVERS ON UNLOADING AUGER CLEANOUT.
 CLEANED OUT DEBRI.

Labor: \$86.25	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$86.25
-----------------------	----------------------	-------------------------	---------------------	---------------------------

JGEN11- Internal

COMPLAINT:
 15 REPAIR OIL LEAK AT CLEANING FAN VARIABLE FITTING

CORRECTION:
 REMOVE CLEANING FAN VARIABLE FITTING CHECK FOR THE O RING AND O RING IS LOOKING GOOD
 RE INSTALL CLEANING FAN VARIABLE FITTING TIGHTEN FITTINGS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
51M7040	O-RING M12	1.00	4.09	4.09	\$4.09	N
T77814	-4FF O-ring	1.00	2.81	2.81	\$2.81	N
Labor: \$200.00	Parts: \$6.90	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$206.90		

J06180021 JD X9 1000 Internal

COMPLAINT:
 16 CONCAVE REPAIR 1.0 HRS PER CONCAVE

- LH REPAIR CROSS BARS AND REPLACE 3 WIRES
 - RH CONCAVE REPAIRS BENT CROSS BARS AND 5 WIRES

CORRECTION:
 REPAIR CONCAVES AS NEEDED.
 (STRAIGHTENING AND WELDING)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7199	M12x35 CB 8.8 SN	2.00	2.52	2.52	\$5.04	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 7 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06180021 JD X9 1000 Internal

03M7358	M16x140 CB 10.9 SN	3.00	23.72	23.72	\$71.16	N
03M7676	M8x30 CB 10.9 SN	3.00	0.95	0.95	\$2.85	N
14M7298	M8-1.25 FLG NUT	3.00	1.54	1.54	\$4.62	N
14M7299	M12-1.75 FLG NUT	1.00	2.91	2.91	\$2.91	N
24M7024	Washer M9x28	2.00	2.06	2.06	\$4.12	N
HXE142914	Small Wire Nail X9	1.00	12.84	12.84	\$12.84	N
HXE148471	Bracket	1.00	49.54	49.54	\$49.54	N

Labor: \$600.00	Parts: \$153.08	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$753.08
------------------------	------------------------	-------------------------	---------------------	----------------------------

J06180268 JD X9 1000 Internal

COMPLAINT:

17 INSTALL CONCAVES, LEVEL AND CALIBRATE.

CORRECTION:

Thursday, October 2, 2025 10:32 AM -

INSTALLED CONCAVES (ENSURE THAT THE CONCAVES ARE TIGHT TO ONE ANOTHER AND THERE IS ADEQUATE BULKHEAD CLEARANCE)

LEVELED CONCAVES AS PER SERVICE ADVISOR.

PERFORMED CONCAVE CALIBRATION.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7298	M8-1.25 FLG NUT	2.00	1.54	1.54	\$3.08	N
24M7024	Washer M9x28	2.00	2.06	2.06	\$4.12	N

Labor: \$800.00	Parts: \$7.20	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$807.20
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06175204 JD X9 1000 Internal

COMPLAINT:

18 TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06175204 JD X9 1000 Internal

ROTATE TAILINGS ELEVATOR CONVEYOR CHAIN UNTIL CONNECTING LINK IS VISIBLE.
 DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
 RECONNECT TAILINGS ELEVATOR CONVEYOR CHAIN WITH CONNECTING LINK.
 ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.
 RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7099	M2x12 COTTER PIN	2.00	0.31	0.31	\$0.62	N
Labor: \$100.00		Parts: \$0.62	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.62	

JGEN15- Internal

COMPLAINT:

19 REPLACE ACTIVE TAILINGS CAMERA SEALS

- REPLACE SEALS
 - CLEAN CAMERA

CORRECTION:

REMOVE ACTIVE TAILING CAMERA DUST SEAL CLEAN TAILING CAMERA LENS
 INSTALL NEW ACTIVE TAILING DUST SEAL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE141213	GASKET	1.00	19.26	19.26	\$19.26	N
Labor: \$90.00		Parts: \$19.26	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$109.26	

J06180070 JD X9 1000 Internal

COMPLAINT:

20 ROTOR VARIABLE BELT, REMOVE AND REPLACE

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 9 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06180070 JD X9 1000 Internal

Thursday, October 2, 2025 10:32 AM -

Remove the unloading auger drive belt.

Remove the feeder house fixed or variable speed drive belt.

Loosen rotor variable drive belt.

Remove the rotor drive belt and install replacement belt.

Adjust the rotor drive belt.

Install the previously removed feeder house fixed or variable speed drive belt.

Install the previously removed unloading auger drive belt.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,347.29	1,347.29	\$1,347.29	N
Labor: \$400.00		Parts: \$1,347.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,747.29	

JGEN17- Internal

COMPLAINT:

21 REPLACE TORQUE SENSING INPUT SEAL

CORRECTION:



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0



Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 10 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN17- Internal

Tuesday, September 30, 2025 9:54 AM -
 FOUND THAT THE SHAFT SEAL ON THE INNER SUPPORT WAS LEAKING.
 DISCONNECTED DRIVE SHAFT AND HYDRAULIC HOSES.
 SET UP CRANE AND UNBOLTED THE SUPPORT ON ROTOR DRIVE.
 CRANED OFF ROTOR DRIVE AND PUT ON BENCH.
 REMOVED YOKE, BUSHING, AND OUTER SEAL.
 REMOVED THE SUPPORT WITH PULLER AND 20 TON JACK.
 REMOVED INNER SEAL ON SUPPORT.
 CHECKED BEARING BEARINGS LOOKED GOOD.
 FOUND A BAD SHAFT SEAL ON THE SHEAVE CAM COVER.
 REPLACED SHEAVE CAM SEAL AND GREASED THE SHEAVES.
 INSTALLED NEW INNER SEAL ON THE SUPPORT.
 INSTALLED SUPPORT, NEED TO USE PRESS TO GET SUPPORT IN PROPER POSITION.
 INSTALLED OUTER SEAL ON SUPPORT.
 CHANGED O RING IN BUSHING AND INSTALLED BUSHING.
 REINSTALLED YOKE AND TORQUED TO SPEC.
 CRANED BACK INTO COMBINE AND BOLTING IN PLACE.
 ADJUSTED DRIVE SHEAVE GAP AND TORQUED MOUNTING BOLTS.
 REINSTALLED HYDRAULIC LINES AND DRIVE SHAFT.
 RAN AND TESTED.

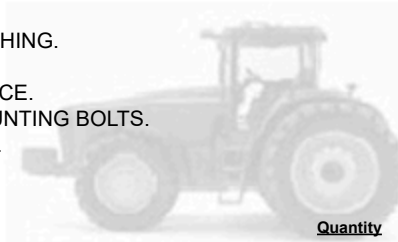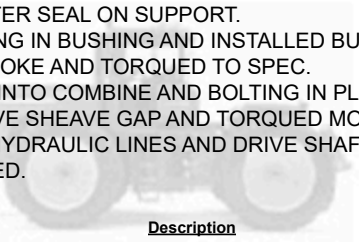

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24H1139	Washer 11/16 Flat	1.00	1.96	1.96	\$1.96	N
AHC11455	SEAL	1.00	52.30	52.30	\$52.30	N
DE31856	SEAL	1.00	31.97	31.97	\$31.97	N
DE31858	X9 ROTOR DRIVE SEAL	2.00	80.39	80.39	\$160.78	N
HXE121155	3/8x3/4 UNF gr8 12pt	4.00	14.74	14.74	\$58.96	N
R26282	O-RING	1.00	6.84	6.84	\$6.84	N
Labor: \$900.00		Parts: \$312.81	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,212.81	

JGEN18- Internal

COMPLAINT:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 11 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN18- Internal

22 REPAIR BENT CHAFFER LOUVERS.

- STRAIGHTEN BENT CHAFFER LOUVERS
- FACTORY CAL SIEVE AND CHAFFER

CORRECTION:

STRAIGHTEN BENT LOUVERS ON CHAFFER ELEMENTS
 OPEN AND CLOSE MANY TIMES TO MAKE IT SURE THERE IS NO BENT LOUVERS ON CHAFFER
 RE INSTALL SHOE SIEVE AND CHAFFER
 DO THE FACTORY CALIBRATION ON SHOE SIEVE AND CHAFFER

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000075383 Internal

COMPLAINT:

23 Discharge Beater Belt, Remove and Replace

CORRECTION:

Thursday, October 2, 2025 10:32 AM -
 Remove feeder house primary drive belt. See Feeder House Primary Drive Belt—Replacing.
 Remove rotor drive belt. See Rotor Drive Belt—Replacing.
 Remove chopper drive belt. See Chopper Drive Belt—Replacing.
 Remove tailings and cleaning fan drive belt. See Tailings and Cleaning Fan Drive Belt—Replacing.
 Loosen nuts to remove tension from the discharge beater belt.
 Remove discharge beater belt and install replacement belt.
 Adjust discharge beater belt. See Discharge Beater Belt—Adjusting.
 Install previously removed belts.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE124189	X9 DISCHARGE BEATER BELT	1.00	539.14	539.14	\$539.14	N

Labor: \$580.00	Parts: \$539.14	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,119.14
------------------------	------------------------	-------------------------	---------------------	------------------------------

JGEN20- Internal

COMPLAINT:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 12 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN20- Internal

24 REPAIR OIL LEAK AT HYDRAULIC RESERVOIR BLACK TANK

- CHECK CLAMPS

CORRECTION:

Friday, October 3, 2025 5:03 PM - TIGHTENED CLAMPS AND LEAK CHECKED.

Labor: \$60.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$60.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06001009 JD X9 1000 Internal

COMPLAINT:

25 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CORRECTION:

Friday, October 3, 2025 10:33 AM -

Remove drain plug.

Allow oil to drain.

Install the drain plug and torque to specification. 30 N·m (22 lb·ft)

Refill with Hy-Gard until visible in the sight glass.

Shift lever to opposite speed.

Run the separator for one minute.

Let the machine sit for five minutes.

Re-check oil level.

Torque the fill plug to specification. 30 N·m (22 lb·ft)

Shift lever back to original speed.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N

Labor: \$40.00	Parts: \$35.64	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$76.24
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 13 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000177849 Internal

COMPLAINT:

26 FLIP CHOPPER HAMMERS

CORRECTION:

Remove lock nut, cap screw, and bushings.

Remove and inspect blades and bushings.

Replace blade and install cap screw, bushings, and lock nut. Tighten lock nuts to specification.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE118760	M10x1.5 SqLck *see ALT	34.00	2.63	2.63	\$89.42	N
Labor: \$1,100.00		Parts: \$89.42	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,189.42	

JGEN22- Internal

COMPLAINT:

27 REPLACE RH SIEVE ARM SWING ARM

- REPLACE RH SWING ARM AXE85936

CORRECTION:



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number:	3492406
		Invoice Date:	10/15/2025
		Location:	01
		Work Order Number:	473676
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	14 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN22- Internal

Wednesday, October 1, 2025 2:48 PM -
 REMOVED SHIELDS, TENSIONER FOR SPREADER, AND CHOPPER BELT.
 REMOVED SPREADER AND REMOVED CHOPPER.
 REMOVED TAILBOARD
 DISCONNECTED WIRING AND REMOVED CHAFFER AND SIEVE ELEMENTS.
 REMOVED SHAKER PAN BOLTS AND SWUNG ARMS OUT OF THE WAY.
 UNBOLTED SIEVE PRECHAFFER AND REMOVED.
 REMOVED CHAFFER FRAME BOLTS AND BLOCKED THE HOLES.
 REMOVED CHAFFER FRAME.
 WAS TOLD BY TEAM LEAD TO DO SWING ARMS ON BOTH SIDES.
 ORDERED A SECOND ARM FOR THE LH SIDE.

Thursday, October 2, 2025 12:13 PM -
 REMOVED AND REPLACED SWING ARMS FOR SIEVE.
 DID ONE SIDE AT A TIME, NEED TO HOLD UP SIEVE FRAME TO GET BOLTS TO LINE UP.
 REINSTALLED CHAFFER FRAME.
 PUT TIMING IN MID STROKE AND TORQUED ALL SWING BOLTS. (18MM TO 96 FTLBS AND 24MM TO 236 FT LBS.)
 REINSTALLED THE SIEVE PRECHAFFER AND BOLTED IN PLACE.
 ATTACHED ARMS FOR SHAKER PAN AND TORQUED TO 96 FTLBS.
 INSTALLED SIEVE ELEMENT AND WIRING.
 CALIBRATED SIEVE. (HAD A ISSUE SETTING SIEVE TO 5MM, WHENEVER WE SET IT TO 5 IT WOULD CALIBRATE TO 7MM. THINKING THE VOLTAGE WAS TO LOW TO CALIBRATE. LET COMBINE CHARGE AND CLEANED CONNECTIONS ON SIEVE MOTOR. TRIED AGAIN, SAME ISSUE WAS HAPPENING. TRIED TO RESET THE SETTING ON DISPLAY, DIDNT SEEM TO HELP. AFTER A FEW TRIES OF CALIBRATING IT FINALLY CALIBRATED TO 5MM.)

Friday, October 3, 2025 9:10 AM -
 INSTALLED CHAFFER ELEMENT AND WIRING.
 CALIBRATED CHAFFER.
 INSTALLED TAILBOARD.
 INSTALLED CHOPPER, CONNECTED ALL WIRING AND TORQUED BOLTS TO SPEC.
 INSTALLED SPREADER AND MOUNTED IN PLACE.
 PUT CHOPPER BELT AND SPREADER BELT BACK ON AND SET TENSION.
 REINSTALLED SHEILDS.
 WILL NEED TO RUN AND RE TORQUE THE ARMS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7358	M16x140 CB 10.9 SN	5.00	23.72	23.72	\$118.60	N
14M7291	M16-2 FLG NUT	8.00	5.03	5.03	\$40.24	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN22- Internal

14M7299	M12-1.75 FLG NUT	2.00	2.91	2.91	\$5.82	N
19M7819	M12x90 FLG 10.9 BOLT	2.00	9.56	9.56	\$19.12	N
AXE85935	ARM	1.00	602.55	602.55	\$602.55	N
AXE85936	RH Shoe Arm	1.00	590.64	590.64	\$590.64	N
H227582	M16x135 FLG 10.9 BOLT	1.00	15.43	15.43	\$15.43	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$1,400.00	Parts: \$1,392.40	OL&M: \$0.00	Misc: \$35.00	Sub-Total: \$2,827.40
--------------------------	--------------------------	-------------------------	----------------------	------------------------------


EXPERT-1000000074332 Internal

COMPLAINT:

28 Clean Grain Elevator Housing Boot, Remove and Replace

- CENTER DEFLECTOR WORN AND LOOKS LIKE WILL BREAK SOON

CORRECTION:

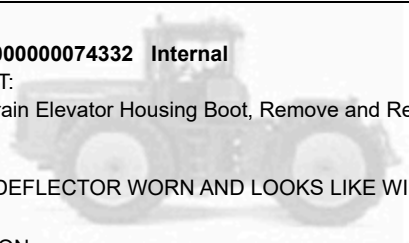

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 16 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000074332 Internal

Open the cleanout door, and remove the nut and pin from the paddle chain connecting link.
 Position paddle chain out of the way.
 Remove cap screws and cover.
 Loosen or remove nuts from the bearing housing.
 Loosen or remove nuts on adjusting screw and remove.
 Remove cap screw and washer.
 Remove nuts from plate and remove the plate from the lower housing.
 Remove cap screws and nuts, cap screws, and auger boot assembly.
 Install new seal between the auger housing and side sheet.
 Install boot assembly using cap screw and nuts, and cap screws.
 Install plate using nuts.
 Install cap screw and washer.
 Install adjusting screw and nuts.
 Install nuts onto the bearing housing. Do not tighten at this time.
 Install bearing cover using cap screws.
 Install pin and nut onto the paddle chain connecting link.
 Loosen nuts. Turning nut clockwise tightens chain, and turning nut counterclockwise loosens chain.
 Tighten nuts.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE87931	Lower Clean Grain Boot	1.00	2,142.29	2,142.29	\$2,142.29	N
H149099	SAFETY SIGN	1.00	20.87	20.87	\$20.87	N
H81330	FoamStrip 3/16x1/2" 10ft	1.00	34.32	34.32	\$34.32	N
HXE132742	Seal	1.00	59.52	59.52	\$59.52	N

Labor: \$850.00	Parts: \$2,257.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,107.00
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000291867 Internal

COMPLAINT:

29 Clean Grain Elevator Paddle Chain, Adjust

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 17 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000291867 Internal

Remove nuts, shield, and washers.

Loosen nuts on the bearing mount plate.

Loosen nuts on the adjusting screw.

Turn the adjusting nut to change the chain tension:

- Turning the nut counterclockwise tightens the chain.

- Turning the nut clockwise loosens the chain.

Ensure the chain is adjusted properly by checking that the lower end can move side-to-side on the sprocket but cannot be pulled away from it. If the chain loosens up to 6 mm (1/4 in) from the sprocket, readjust the chain.

Tighten all nuts.

Reinstall washers, shield, and nuts.

Labor: \$50.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

JGEN25- Internal

COMPLAINT:

30 REPAIR FEED ACCELERATOR IDLER

- REPLACE IDLER BEARING

CAUSE:

FEED ACCELERATOR PULLEY HAVE PLAY ON IT

REMOVE FEED ACCELERATOR BOLT ON PULLEY

CHECK FEED ACCELERATOR PULLEY SPLINE AND ITS LOOKING FINE

RE INSTALL FEED ACCELERATOR PULLEY

APPLY LOCKTITE ON BOLT TIGHTEN FEED ACCELERATOR PULLEY

TORQUE FEED ACCELERATOR PULLEY AS REQUIRED

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE64492	Bearing Peer 5006KRR50-SP1	1.00	76.84	76.84	\$76.84	N

Labor: \$200.00	Parts: \$76.84	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$276.84
------------------------	-----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000211821 Internal

COMPLAINT:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 18 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000211821 Internal

31 Rotary Screen / Vacuum Fan Drive Belt, Remove and Replace

CORRECTION:

Thursday, October 2, 2025 10:31 AM -

Pull lockout pin and rotate handrail up until the handrail locks into place.

Open engine access cover.

Remove engine access shield.

Use a breaker bar to relieve belt tension from the tensioner arm and remove the rotary screen driven belt.

Use a breaker bar to relieve tension from the tensioner arm and install the replacement rotary screen driven belt.

Install the previously removed shield.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE167991	Rotary Screen Drive V-Belt	1.00	178.88	178.88	\$178.88	N
Labor: \$250.00		Parts: \$178.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$428.88	

JGEN28- Internal

COMPLAINT:

32 REPLACE DAMAGED CONNECTOR ON TOP OF DEF TANK

CORRECTION:

Friday, October 3, 2025 1:43 PM -

REPLACED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
57M10319	AMP16 FM 12-16g terminal	2.00	5.75	5.75	\$11.50	N
57M7619	4pinFM Deutsch DT grey	1.00	1.29	1.29	\$1.29	N
57M7628	4pinFM Deutsch DT grey	1.00	7.30	7.30	\$7.30	N
57M9812	AMP16 ML pin 18-20ga gold	2.00	1.97	1.97	\$3.94	N
Labor: \$200.00		Parts: \$24.03	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$224.03	

JENGOILCHNG JD X9 10 Internal

COMPLAINT:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 19 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JENGOILCHNG JD X9 10 Internal

33 REPLACE ENGINE OIL AND FILTER

CORRECTION:
 DRAIN ENGINE OIL AND REMOVE FILTER.
 CLEAN AREA.
 INSTALL NEW OIL AND FILTER.
 RUN UNIT AND LEAK CHECK
 ADJUST OIL LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	151.30	151.30	\$151.30	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	9.92	9.92	\$9.92	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00		Parts: \$673.80	OL&M: \$0.00	Misc: \$10.40	Sub-Total: \$809.20	

JGEN30- Internal

COMPLAINT:
 34 MISC SERVICE

- TOP UP SPREADER GEARCASE OILS
- MEG IS OVERFULL (DRAIN SOME OIL OUT)
- DRAIN AND CLEAN OUT WATER SEP BOWL.
- TOP UP WASHER FLUID
- CHARGE UP WATER EXTINGUISHER - DRAIN IT INSTEAD, REPLACE THE FAILED GAUGE.

CORRECTION:
 TOP UP SPREADER GEAR CASE DOUBLE CHECK MEG GEAR CASE OIL TOP UP WASHER FLUID
 REPLACED EXTINGUISHER PRESSURE GAUGE AND SECURED EMPTY EXTINGUISHER ON COMBINE

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 20 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN30- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
45M7121	Clevis Pin M10x100	-2.00	15.92	15.92	(\$31.84)	N
TY6296	80W90 946ml GL5	1.00	15.99	15.99	\$15.99	N
6479	Extinguisher Gauge 100psi	1.00	36.64	36.64	\$36.64	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N

Labor: \$100.00	Parts: \$20.79	OL&M: \$0.00	Misc: \$0.15	Sub-Total: \$120.94
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN31- Internal

COMPLAINT:

35 DIAGNOSE AND REPAIR A/C OPERATION

- CHECK A/C CHARGE, CHECK FOR LEAKS

CORRECTION:

Tuesday, October 7, 2025 9:45 AM -

CHECKED FOR PROPER CLUTCH ENGAGEMENT ON COMPRESSOR, COMPRESSOR WAS WORKING.

CHECKED HIGH AND LOW SIDE PRESSURE.

HIGH SIDE WAS ABIT LOW, LOW SIDE WAS GOOD.

RECOVERED SYSTEM.

5.45LBS OF REF, 4.5 OZ OF OIL.

VACUUMED FOR 30 MINUTES.

ADDED 4.5 OZ OIL AND 5.75 LBS OF R134A TO RECHARGE.

TESTED AC BLOWS COLD.

Labor: \$700.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$700.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JENGAIRFILT JD X9 10 Internal

COMPLAINT:

36 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 21 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JENGAIRFILT JD X9 10 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	461.37	461.37	\$461.37	N
HXE11091	Secondary EngAir Filter	1.00	325.55	325.55	\$325.55	N
Labor: \$50.00		Parts: \$786.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$836.92	

J10030100 JD X9 1000 Internal

COMPLAINT:

37 REPLACE ENGINE FUEL FILTERS.

CORRECTION:

REPLACED PRIMARY AND SECONDARY FUEL FILTERS.

REMOVED AND CLEANED FUEL STRAINER.

BLED FUEL SYSTEM.

FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	171.28	171.28	\$171.28	N
DZ124786	Secondary Fuel Filter 13.6/18L	1.00	164.54	164.54	\$164.54	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$80.00		Parts: \$335.82	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$418.32	

J06001002 JD X9 1000 Internal

COMPLAINT:

38 HYDROSTATIC COOLER RETURN FILTER, REPLACE

CORRECTION:

Friday, October 3, 2025 3:20 PM -

REPLACED. AND TOPPED UP OIL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 22 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06001002 JD X9 1000 Internal

AXE73797	Hydraulic Filter	1.00	174.57	174.57	\$174.57	N
TY22062	HY-GARD J20C JUG 9.46L	1.00	85.28	85.28	\$85.28	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N

Labor: \$30.00 Parts: \$259.85 OL&M: \$0.00 Misc: \$2.75 Sub-Total: \$292.60

J06001003 JD X9 1000 Internal

COMPLAINT:

39 AUXILIARY HYDRAULIC RETURN FILTER, REPLACE

CORRECTION:

Friday, October 3, 2025 3:20 PM -
 REPLACED.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE73798	Hydraulic Filter	1.00	214.90	214.90	\$214.90	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$40.00 Parts: \$214.90 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$256.15

J06070004 JD X9 1000 Internal

COMPLAINT:

40 REPLACE HYDROSTATIC CHARGE FILTER.

CORRECTION:

REMOVE AND REPLACE HYDROSTATIC CHARGE FILTER AND SEAL

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
R564922	Oil Filter Seal Ring	1.00	12.01	12.01	\$12.01	N

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 23 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06070004 JD X9 1000 Internal

RE577612	Hydraulic Oil Filter	1.00	209.03	209.03	\$209.03	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$25.00 Parts: \$221.04 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$247.29

J06070003 JD X9 1000 Internal

COMPLAINT:

41 TRANSMISSION RETURN FILTER, REPLACE

CORRECTION:

REMOVE AND REPLACE TRANSMISSION RETURN FILTER AND O RING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC FILTER	1.00	157.96	157.96	\$157.96	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$45.00 Parts: \$157.96 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$204.21

J06001004 JD X9 1000 Internal

COMPLAINT:

42 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE

CORRECTION:

REMOVE AND REPLACE MAIN ENGINE GEARCASE FILTER AND SEAL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R567277	Oil Filter Seal Ring	1.00	17.84	17.84	\$17.84	N
RE577250	HYDRAULIC OIL FILTER	1.00	157.73	157.73	\$157.73	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 24 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

J06001004 JD X9 1000 Internal

EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
-------	------------	------	------	------	--------	---

Labor: \$30.00	Parts: \$175.57	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$206.82
-----------------------	------------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076099 Internal

COMPLAINT:

43 Feed Accelerator Gear Case Oil, Change

CORRECTION:

Friday, October 3, 2025 1:01 PM -

Remove the drain plug from the feed accelerator gear case.

Allow the feed accelerator gear case oil to drain.

Install the drain plug once the oil is drained.

Tighten the drain plug to specification.

Remove the fill plug from the feed accelerator gear case.

Add oil until the oil level is at the bottom of the check hole.

Tighten the fill plug to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	2.00	15.99	15.99	\$31.98	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N

Labor: \$75.00	Parts: \$31.98	OL&M: \$0.00	Misc: \$0.30	Sub-Total: \$107.28
-----------------------	-----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076097 Internal

COMPLAINT:

44 Cleaning Fan Variable Speed Driven Sheave Oil, Change

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 25 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

EXPERT-1000000076097 Internal

Friday, October 3, 2025 11:40 AM -

Rotate the cleaning fan variable speed driven sheave so fittings are in the twelve and six o'clock positions.

Remove the drain plug from the cleaning fan variable speed driven sheave.

Install the drain plug once the oil is drained.

Tighten the drain plug to specification.

Remove the fill plug from the cleaning fan variable speed driven sheave.

Add oil as needed.

Tighten the fill plug to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	1.00	15.99	15.99	\$15.99	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
Labor: \$35.00		Parts: \$15.99	OL&M: \$0.00	Misc: \$0.15	Sub-Total: \$51.14	

EXPERT-1000000073663 Internal

COMPLAINT:

45 Cabin Air Filter, Remove and Replace

CORRECTION:

Turn knob and lower access cover.

Remove fresh air filter.

Remove and replace cabin air filter.

Assemble in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	Cab Recirc Air Filter	1.00	40.66	40.66	\$40.66	N
TA32591	Cab FreshAir Filter	1.00	121.63	121.63	\$121.63	N
Labor: \$50.00		Parts: \$162.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$212.29	

JGEN46- Internal

COMPLAINT:

46REPLACE FEEDER HOUSE TOP DOOR SEAL

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 26 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN46- Internal

CORRECTION:

REMOVE AND REPLACE FEEDER HOUSE TOP DOOR SEAL

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE174701	Seal	1.00	72.80	72.80	\$72.80	N
Labor: \$120.00		Parts: \$72.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$192.80	

JGEN47- Internal

COMPLAINT:

47 BELTS, CHAINS , RUN
C.T.S

CAUSE:

TENSIONS NEED TO BE SET TO SPEC AFTER COMPLETION OF REPAIRS.

CORRECTION:

SET SEPARATOR BELT TENSION TO SPEC.
 SET CLEANING FAN BELT TENSION TO SPEC.
 SET PRIMARY COUNTER SHAFT BELT TENSION TO SPEC.
 SET CHOPPER BELT TENSION TO SPEC.
 SET SHAKER DRIVEN AND DRIVE BELTS TENSION TO SPEC.
 SET 2-SPEED FEED ACCELERATOR DRIVEN AND DRIVE BELTS TO SPEC.
 ROUTE AND SET CROSS AUGERS BELT TENSION TO SPEC.
 SET BEATER BELT TENSION TO SPEC.
 SET SPREADER MOTORS DRIVE BELT TENSION TO SPEC.
 RAN THE COMBINE AND CHECK FOR FUNCTIONALITY AND COMBINE IS GOOD

Friday, October 10, 2025 11:07 AM -
 INSTALLED SHEILDS.



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255481	Internal Used Stock No. 255481	Invoice Number: 3492406
		Invoice Date: 10/15/2025
		Location: 01
		Work Order Number: 473676
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 27 of 27

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	851	1H0X910XHP0825320	176266	

JGEN47- Internal

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

INVOICE CONTAINS \$85.83 DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

\$150.00

Customer PO No:	Labor: \$18,786.91
Tax Exempt No:	Parts: \$11,685.33
Advisor: Chris Therrien	OL&M: \$0.00
	Misc: (\$871.25)
	Grand Total: \$29,600.99

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: