

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 1 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGLSPR JD ALL Internal

COMPLAINT:

01 SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS 2275

DOES THIS UNIT GET A VALUEMAX STICKER ☐ XX ☐ YES ☐ NO
HAS THE STICKER BEEN INSTALLED ☐ XX ☐ YES ☐ NO
CAB HAS BEEN COMPLETELY CLEANED ☐ HD ☐ (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER ☐ CS ☐ (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB ☐ CP ☐ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:

COMPLETED GREENLIGHT ALL WENT WELL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N305634	SPRAYER WINTERIZER 9.46L	5.00	108.07	108.07	\$540.35	N
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	87.56	87.56	\$87.56	N
TY6341	SD POLYUREA GREASE	1.00	11.14	11.14	\$11.14	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF300	ENVIRO FEE	5.00	3.00	3.00	\$15.00	N
LABDIS	LAB DISC CUST	-1.00	748.70	748.70	(\$748.70)	N
Labor: \$2,600.00		Parts: \$639.05	OL&M: \$0.00	Misc: (\$733.70)	Sub-Total: \$2,505.35	

JFCC JD ALL Internal

COMPLAINT:

02 FREE CLEANUP OF CAB

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 2 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JFCC JD ALL Internal

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
LABDIS	LAB DISC CUST	-1.00	165.66	165.66	(\$165.66)	N
Labor: \$165.66		Parts: \$0.00	OL&M: \$0.00	Misc: (\$165.66)	Sub-Total: \$0.00	

JSOFTWARE JD R4038 Internal

COMPLAINT:

03 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON _____ CONTROLLERS.
HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CORRECTION:

UPDATED CONTROLLERS ALL TO DATE.

ALL OK COMPLETED

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J21001494 JD R4038 Internal

COMPLAINT:

04 CHECK AND ADJUST ENGINE VALVE CLEARANCE.

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 3 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21001494 JD R4038 Internal

REMOVED EXHAUST PIPE ON BACK OF SCR FILTER.
TOOK OUT ALL CLAMPS HOLDING ON WIRES ON FILTER BRACE.
TOOK OUT ALL BRACKETS HOOKE UP TO BRACE.
TOOK OUT OCV HOUSING AND PIPES.
TOOK OUT BRACKETS FOR TURBO OFF TOP OF COVER.
TOOK OUT BRACE AND TOOK OUT OIL PRESSURE HOSES.
TOOK OFF ALL OTHER PARTS TO ACCESS ROCKER COVER AND TOOK OFF ROCKER COVER AFTER BLOWING OFF.
DAMAGED TURBO DRAIN TUBE DURING REMOVAL OF ROCKER COVER. ORDERED NEW TUBE.

TURNED ENGINE TO TDC NO.1 AND THEN NO.6.
ADJUSTED INTAKE VALVE CLEARANCES TO 0.014 IN.
ADJUSTED EXHAUST VALVE CLEARANCES TO 0.025 IN.
TORQUED ALL ROCKER ARM LOCK NUTS TO 20 LB-FT.
TURNED ENGINE OVER TO TDC NO.1 AND THEN NO. 6 TO RE-CHECK ALL VALVE CLEARANCES.
INSTALLED ROCKER COVER WITH NEW GASKET. TORQUED SECURING BOLTS TO 97 LB-IN.
RE-INSTALLED ALL REMOVED PARTS.
RAN ENGINE TO CONFIRM NO ISSUES.
ALL OK COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R526607	SEAL	1.00	72.11	69.89	\$69.89	N
RE550200	Oil Line	1.00	459.82	459.82	\$459.82	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N
Labor: \$4,060.00		Parts: \$529.71	OL&M: \$0.00	Misc: \$35.55	Sub-Total: \$4,625.26	

JENGOILCHNG JD R4038 Internal

COMPLAINT:
05 REPLACE ENGINE OIL AND FILTER

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 4 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JENGOILCHNG JD R4038 Internal

DRAIN ENGINE OIL AND REMOVE FILTER.
CLEAN AREA.
INSTALL NEW OIL AND FILTER.
RUN UNIT AND LEAK CHECK
ADJUST OIL LEVEL AS REQUIRED.

COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE509672	Engine Oil Filter	1.00	50.55	50.55	\$50.55	N
TY26673	15W40 3.78L Plus-50II CK4/SN	1.00	37.78	37.78	\$37.78	N
TY26675	PLUS-50 II 15W-40 CK4/SN JUG 9.46L	1.00	89.73	89.73	\$89.73	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	1.00	170.86	170.86	\$170.86	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF300	ENVIRO FEE	1.00	3.00	3.00	\$3.00	N
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$100.00	Parts: \$348.92	OL&M: \$0.00	Misc: \$5.65	Sub-Total: \$454.57		

JGEN01- Internal

COMPLAINT:
06 TIE CRANKCASE BREATHER HOSE CLAMPS.

CORRECTION:
TIED CLAMPS. ALL OK COMPLETED

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 5 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21001151 JD R4038 Internal

COMPLAINT:

07 REPLACE ALTERNATOR BELT TENSIONER

CORRECTION:

CHANGED OUT PULLEY.

INSTALLED NEW ONE AND PUT BACK ON BELT, AND SIDE PANEL.

COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AL201362	IDLER	1.00	193.59	193.59	\$193.59	N
Labor: \$200.00	Parts: \$193.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$393.59		

JGEN02- Internal

COMPLAINT:

08 REPLACE INJECTOR WIRING HARNESS

CORRECTION:

TOOK OFF ROCKER COVER. TOOK OFF ALL CONNECTORS TO INJECTORS.

TOOK OFF OLD INJECTOR HARNESS AND CLIPS AND SCREWS. TOOK OFF MAIN CONNECTOR.

INSTALLED NEW HARNESS ONTO CONNECTOR. CLEANED OFF OIL FROM ALL CONNECTIONS AND CONNECTED UP.

INSTALLED ROCKER COVER AND TESTED. ALL OK COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE558115	WIRING HAR	1.00	638.54	638.54	\$638.54	N
Labor: \$250.00	Parts: \$638.54	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$888.54		

J21001310 JD R4038 Internal

COMPLAINT:

09 TIGHTEN ALL COOLANT HOSE CLAMPS

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 6 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21001310 JD R4038 Internal
TIED ALL HOSE CLAMPS.
COMPLETED.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN03- Internal
COMPLAINT:
10 REPLACE COOLANT RESERVOIR CAPS

CORRECTION:
CHANGED OUT COOLANT CAPS. COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE312969	FILLER CAP	2.00	72.92	72.92	\$145.84	N
Labor: \$50.00	Parts: \$145.84	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$195.84		

JGEN04- Internal
COMPLAINT:
11 REPLACE HOSES ON FRONT LEFT WHEEL MOTOR
P/N- AKK15749 AND AN404161

CORRECTION:
REMOVE CLAMPS FROM HOSES
REMOVE FAULTY HOSES
INSTALL NEW HOUSE
INSTALL CLAMPS AND CONFIGURE HOSES TO CORRECT POSITION

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK33872	Hydro Hose-Rear FWD Propel	1.00	955.86	955.86	\$955.86	N
AKK33873	Hydraulic Hose	1.00	830.27	830.27	\$830.27	N
T59014	-12_6xFlg O-ring	2.00	8.67	8.67	\$17.34	N

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	Page: 7 of 19
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN04- Internal

T78313	-16_6xFlg O-ring	2.00	8.28	8.28	\$16.56	N
--------	------------------	------	------	------	---------	---

Labor: \$600.00	Parts: \$1,820.03	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,420.03
------------------------	--------------------------	-------------------------	---------------------	------------------------------

J21060008 JD R4038 Internal

COMPLAINT:

12 REMOVE AND RESEAL RIGHT HAND STEERING CYLINDER.

CORRECTION:

REMOVE LINES FROM LEFT SIDE STEERING CYLINDER.
REMOVE CASTLE NUTS AND REMOVED CYLINDER FROM MACHINE.
DISASSEMBLE CYLINDER ON BENCH AND CLEAN ALL COMPONENTS.
REMOVE ALL OLD SEALS AND O'RINGS.
INSTALL ALL NEW SEALS AND O'RINGS.
LUBRICATE ALL SEALS AND REASSEMBLE CYLINDER.
REINSTALL CYLINDER ONTO MACHINE.
OPERATE STEERING TO BLEED AIR FROM SYSTEM.
TEST OPERATION.
COMPLETED



<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AHC16971	Hydraulic Cylinder Bore Seal Kit	1.00	184.38	184.38	\$184.38	N
AHC16982	HYDRAULIC	1.00	63.18	63.18	\$63.18	N

Labor: \$500.00	Parts: \$247.56	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$747.56
------------------------	------------------------	-------------------------	---------------------	----------------------------

J21060007 JD R4038 Internal

COMPLAINT:

13 REMOVE AND RESEAL LEFT HAND STEERING CYLINDER.

CORRECTION:

PATTISON AGRICULTURE LIMITED

Hwy 7 East, Box 1180
 Kindersley, SK S0L 1S0
 Phone: (306) 463-2683
 Fax: (306) 463-6131
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21060007 JD R4038 Internal

REMOVE LINES FROM LEFT SIDE STEERING CYLINDER.
 REMOVE CASTLE NUTS AND REMOVED CYLINDER FROM MACHINE.
 DISASSEMBLE CYLINDER ON BENCH AND CLEAN ALL COMPONENTS.
 REMOVE ALL OLD SEALS AND O'RINGS.
 INSTALL ALL NEW SEALS AND O'RINGS.
 LUBRICATE ALL SEALS AND REASSEMBLE CYLINDER.
 REINSTALL CYLINDER ONTO MACHINE.
 OPERATE STEERING TO BLEED AIR FROM SYSTEM.
 TEST OPERATION.
 COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC16971	Hydraulic Cylinder Bore Seal Kit	1.00	184.38	184.38	\$184.38	N
AHC16982	HYDRAULIC	1.00	63.18	63.18	\$63.18	N
KK12054	Nut	1.00	21.28	21.28	\$21.28	N
Labor: \$500.00		Parts: \$268.84	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$768.84	

JSOLUGAUGE JD R4038 Internal

COMPLAINT:
 14 REPLACE SOLUTION TANK SIGHT GAUGE

CORRECTION:
 REMOVE MOUNTING CLAMPS.
 REPLACE SIGHT GAUGE TUBE.
 INSTALL REMOVED HARDWARE.
 FUNCTION AND LEAK TEST.

ALL OK. COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK010-1216	3/4" Clear PVC /ft	6.00	3.54	3.54	\$21.24	N
Labor: \$140.00		Parts: \$21.24	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$161.24	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 9 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN16- Internal

COMPLAINT:

15 RESEAL HYDRAULIC MOTOR AND SOLUTION PUMP

CORRECTION:

TOOK OFF HOSES CONNECTING TO PUMP HYDRAULIC MOTOR.
TOOK OFF CASE DRAIN LINE.

TOOK OFF MOTOR MOUNTING BOLTS AND FOUND THAT THE PUMP HAS TO BE TAKEN APART TO TAKE OFF THE MOTOR. APPROVED TO GET ADDED TIME TO RESEAL PUMP AND MOTOR.
TOOK OFF HOSES TO PUMP. TOOK OFF ELECTRICAL CONNECTIONS.

TOOK OFF FRONT HOUSING. TOOK OFF IMPELLER. TOOK OFF WATER PUMP MECHANICAL SEAL.

TOOK OFF MOTOR. TOOK APART MOTOR AND FOUND THAT THE SHAFT IS WORN AND NEED TO REPLACE SHAFT OR MOTOR.

APPROVED TO ORDER NEW MOTOR. GOT NEW MOTOR AND CHANGED OVER FITTINGS. INSTALLED AND FOUND THAT MOTOR DOESN'T FIT.
LOOKED WITH PARTS AND FOUND MOTOR HAD BEEN UPDATED.
NEED TO CHANGED WHOLE PUMP TO FIT. RETURNED MOTOR TO PARTS AND ORDERED WHOLE PUMP.
TOOK OFF FITTING AND INSTALLED ON NEW PUMP MOTOR. INSTALLED PUMP ON MACHINE WITH HOSES PIPE AND ELECTRICAL.

CHECKED AND ALL OK. COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK36894	SOLUTION PUMP	1.00	3,375.75	3,375.75	\$3,375.75	N
AN206043	SoltnPumpSeals	1.00	267.56	267.56	\$267.56	N
KK14220	1/4mNPT_1/2HB90 FITTING	1.00	9.85	9.85	\$9.85	N
PM200G	200 EPDM gasket	1.00	1.73	1.73	\$1.73	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
Labor: \$450.00	Parts: \$3,654.89	OL&M: \$0.00	Misc: \$0.55	Sub-Total: \$4,105.44		

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 10 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN10- Internal

COMPLAINT:

16 REPLACE POLLER PINS AND BUSHINGS ON CENTER BOOM TILT

CORRECTION:

LIFT BOOM. REMOVE FRONT PIN AND REMOVE AND REPLACE BUSHING . REINSTALL BACK TOGETHER. TEST & WORKS GOOD .

LOWERED BOOM TO GROUND . REMOVE 2 REAR PINS . REPLACED BUSHING .INSTALLED BACK TOGETHER . TESTED & WORKS GOOD ..

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
KK10859	Pin	2.00	246.90	246.90	\$493.80	N
KK10860	Pin	2.00	379.43	379.43	\$758.86	N
N409788	Bushing	4.00	32.16	32.16	\$128.64	N
N409789	Bushing	4.00	28.33	28.33	\$113.32	N
Labor: \$800.00		Parts: \$1,494.62	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,294.62	

JGEN14- Internal

COMPLAINT:

17 REPLACE FENCE ROW NOZZLES ON LH AND RH

CORRECTION:

INSTALLED LEFT SIDE FENCE ROW NOZZLE.

RIGHT SIDE NOZZLE HOUSING BROKEN. HAD TO REPLACE HOUSING AND THEN INSTALL FENCE ROW NOZZLE.

APPROVED TO CHANGE OUT NOZZLE BODY.

TOOK OFF AND REPLACED BROKEN ONE AND INSTALLED RIGHT NOZZLE.

ALL OK COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AKK17746	NozzleQD bulkhead_1/2" PTC	1.00	75.97	75.97	\$75.97	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 11 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN14- Internal

PSXTIQ10	SPRAYER NOZZLE GREEN	2.00	141.06	141.06	\$282.12	N
----------	----------------------	------	--------	--------	----------	---

Labor: \$100.00	Parts: \$358.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$458.09
------------------------	------------------------	-------------------------	---------------------	----------------------------

JELECDIAG1 JD ALL Internal

COMPLAINT:

18 PERFORM ELECTRICAL SYSTEM DIAGNOSTICS-- AUTO FOLD SENSORS OUT OF SPEC. ADJUST AND RECALIBRATE AUTO FOLD

CORRECTION:

RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: JAREK .WARM AND TRY TO CALIBRATE NOT WANT CALIBRATE . ADJUST SENSOR CALIBRATE ALL ONLY AUTOBOOM WOULD NOT CALIBRATE . INNER BOOM SENSOR TO LOW RANGE VOLTS .1.1 ONLY CHECKED CONNECTORS AND SENSORS . REPLACE POTENTIOMETERS AND INSTALL NEW ARMS .WARM OIL AND NOT WANT CALIBRATE RANGE VOLTS 1.5 . SERVICE AND TELL MORE THAN 2 V . ASK HELP CENTER .

SEB: CALIBRATED ALL BOOM FUNCTIONS. WARMED UP OIL TO 60 DEGREES C.

RAN AND DID BOOM TILED, BOOM HIGHT, BOOM FOLD AND TILT SPEED CALIBRATION. ALL PASSED. TESTED AND FOUND ALL OK. COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE14246	Sensor	2.00	305.59	305.59	\$611.18	N
KK30858	Linkage	2.00	133.96	133.96	\$267.92	N
Labor: \$1,284.50		Parts: \$879.10	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,163.60	

J21001008 JD R4038 Internal

COMPLAINT:

19 REPLACE AIR DRYER CARTRIDGE FILTER

CORRECTION:

CHANGED OUT FILTER.
COMPLETED

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 12 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21001008 JD R4038 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK11031	Air Dryer Cartridge	1.00	320.43	320.43	\$320.43	N
Labor: \$35.00		Parts: \$320.43	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$355.43	

J21001090 JD R4038 Internal

COMPLAINT:
20 REPLACE ENGINE FUEL FILTERS

CORRECTION:
REPLACED PRIMARY AND SECONDARY FUEL FILTERS.
BLED FUEL SYSTEM.
FUNCTION AND LEAK CHECKED.
COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	FINAL FUEL FILTER	1.00	236.54	236.54	\$236.54	N
DZ130550	FILTER ELE	1.00	232.82	232.82	\$232.82	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$70.00		Parts: \$469.36	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$541.86	

JCABFILTER JD R4038 Internal

COMPLAINT:
21 REPLACE CAB AIR FILTERS

CORRECTION:
REMOVE CAB AIR FILTERS
CLEAN FILTER HOUSING
INSTALL NEW AIR FILTERS
COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 13 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JCABFILTER JD R4038 Internal

RE333567	CabFreshFilter Carbon	1.00	690.56	690.56	\$690.56	N
RE333569	CabRecircFilter Carbon	1.00	612.06	612.06	\$612.06	N

Labor: \$50.00 Parts: \$1,302.62 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,352.62

JENGAIRFILT JD R4038 Internal

COMPLAINT:

22 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

REMOVE OLD AIR FILTERS.

CLEAN FILTER HOUSING.

INSTALL NEW PRIMARY AND SECONDARY AIR FILTERS.

COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN403918	Primary Eng Air Filter	1.00	309.14	309.14	\$309.14	N
AN403919	Secondary Eng Air Filter	1.00	268.81	268.81	\$268.81	N
Labor: \$50.00		Parts: \$577.95	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$627.95	

JHYDOILCHG JD R4038 Internal

COMPLAINT:

23 REPLACE HYDRAULIC OIL AND FILTERS.

CORRECTION:

DRAIN HYDRAULIC RESERVOIR.

INSTALL NEW OIL.

CHECK AND ADJUST LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN203010	Hydraulic Filter	2.00	117.92	117.92	\$235.84	N
AT318160	HYDRAULIC OIL FILTER	1.00	209.99	209.99	\$209.99	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 14 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JHYDOILCHG JD R4038 Internal

TY27956	TORQ-GARD II 10W30 CK4 18.9L	5.00	144.50	144.50	\$722.50	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	5.00	3.00	3.00	\$15.00	N
EF50	ENVIRO FEE	2.00	0.55	0.55	\$1.10	N

Labor: \$210.00 Parts: \$1,168.33 OL&M: \$0.00 Misc: \$17.35 Sub-Total: \$1,395.68

J021030110 JD R4045 Internal

COMPLAINT:

24 REPLACE DEF DOSING FILTER.

CORRECTION:

FILTER LOCATED ON THE BOTTOM OF THE PUMP MODULE.

COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
DZ114640	Def Dosing Pump Filter	1.00	251.39	251.39	\$251.39	N

Labor: \$30.00 Parts: \$251.39 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$281.39

J06030111 JD R4045 Internal

COMPLAINT:

25 REPLACE DEF TANK HEADER SUCTION SCREEN.

CORRECTION:

REMOVED DEF PUMP MODULE FILTER.

REPLACED DEF PUMP MODULE FILTER.

BLED DEF SYSTEM.

FUNCTION AND LEAK CHECKED.

COMPLETED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J06030111 JD R4045 Internal

DZ111004	DefHeaderFilter 25micron -recta	1.00	121.38	121.38	\$121.38	N
----------	---------------------------------	------	--------	--------	----------	---

Labor: \$150.00	Parts: \$121.38	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$271.38
------------------------	------------------------	-------------------------	---------------------	----------------------------

JGEN23- Internal

COMPLAINT:

26 REPLACE AIR DRYER BREATHER FILTER

CORRECTION:

CHANGER OUT FILTER BREATHES.

ALL OK COMPLETED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KK18777	Air Muffler	1.00	184.47	184.47	\$184.47	N
Labor: \$25.00	Parts: \$184.47	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$209.47		

JGEN26- Internal

COMPLAINT:

27 TORQUE ALL TIRES

CORRECTION:

TORQUED ALL TIRE NUTS TO SPEC.

ALL OK COMPLETED

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J21001007 JD R4038 Internal

COMPLAINT:

28 REPLACE OIL IN PLANETARY WHEEL HUBS.

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 16 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

J21001007 JD R4038 Internal

DRAINED OIL FROM PLANETARY HOUSINGS.
INSTALLED NEW OIL.
LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	6.00	47.83	47.83	\$286.98	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	6.00	0.15	0.15	\$0.90	N
Labor: \$175.00		Parts: \$286.98	OL&M: \$0.00	Misc: \$0.90	Sub-Total: \$462.88	

JGEN29- Internal

COMPLAINT:
29 REPLACE QUICK FILL STRAINER AND O-RINGS.

CORRECTION:
CHANGED O-RINGS AND STRAINER. ALL OK COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMLS350	3" Strainer 50 mesh	1.00	230.11	230.11	\$230.11	N
PMMLS300ECG	GASKET	1.00	21.65	21.65	\$21.65	N
Labor: \$30.00		Parts: \$251.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$281.76	

JGEN21- Internal

COMPLAINT:
30 REPLACE BALL VALVE
P/N AN403564

CORRECTION:
DRAIN FLUID. DISCONNECT VALVES. REMOVE 2 VALVES TO GET TO THE 3RD VALVE. INSTALL NEW VALVE.
REINSTALL ALL BACK TOGETHER WITH NEW GASKET AND NEW CLAMPS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 17 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN21- Internal

AN403564	220 2-way Valve	1.00	292.98	292.98	\$292.98	N
PM200G	200 EPDM gasket	2.00	1.73	1.73	\$3.46	N

Labor: \$100.00	Parts: \$296.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$396.44
------------------------	------------------------	-------------------------	---------------------	----------------------------


JGEN27- Internal

COMPLAINT:

31 REPLACE LEAKING BOOM LIFT RAM HOSE. (LEFT SIDE)

CORRECTION:

INSTALL D SHACKLES TO THE CENTER RACK
INSTALL CRANE AND LIFT UP UNTIL WEIGHT IS OF LIFTING CYLINDERS
REMOVE THE FAULTY HOSE FORM THE LIFT CYLINDER
GIVE TO PARTS TO MAKE A NEW HOSE
INSTALL NEW HOSE TO THE LIFT CYLINDER
LOWER CRANE DOWN AND REMOVE
REMOVE THE D SHACKLES FROM THE CENTER RACK
TEST GOOD

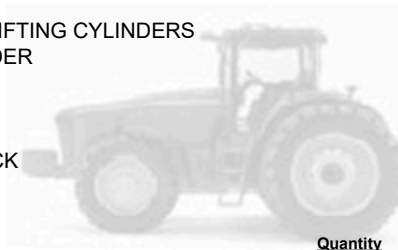

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
X1J743-6-6	-6FF 45	1.00	38.13	38.13	\$38.13	N
X1JS43-6-6	-6FF slideneck	1.00	25.37	25.37	\$25.37	N
X487-6-RL	-6 HOSE (3/8") 4000 PSI	26.00	0.85	0.85	\$22.10	N

Labor: \$300.00	Parts: \$85.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$385.60
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN34- Internal

COMPLAINT:

32 REPLACE LEAKING HYDRAULIC LINE
P/N AKK11225

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 18 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JGEN34- Internal

TOOK OFF BOTTOM PAN. TOOK OFF HOSE CLAMPS.
TOOK OFF HOSE ENDS.
INSTALLED NEW HOSE WITH NEW O-RINGS. TIED FLANGES. ALL OK

BLEED HYDRAULICS AND FOUND ALL OK. COMPLETED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK25064	Hydraulic Hose	1.00	494.41	494.41	\$494.41	N
T59014	-12_6xFlg O-ring	2.00	8.67	8.67	\$17.34	N
Labor: \$300.00		Parts: \$511.75	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$811.75	

JHYDDIAG2 JD ALL Internal

COMPLAINT:
33 REPLACE HOSE FROM HYDRAULIC TANK TO AUX PUMP

CORRECTION:
RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: _____ REMOVE HOSES INSTALL NEW AND NEW CLAMPS .

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK18003	HOSE, HYDR	1.00	489.20	489.20	\$489.20	N
F1870R	O-RING	1.00	9.03	9.03	\$9.03	N
Labor: \$400.00		Parts: \$498.23	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$898.23	

JHYDDIAG1 JD ALL Internal

COMPLAINT:
34 PERFORM HYDRAULIC SYSTEM DIAGNOSTICS LEAKING AT FILTER HOUSING

CORRECTION:
RECORD DIAGNOSTIC TESTS, PROCEDURES AND RESULTS: _____ TEST RUN AND WARMED OIL . LEAK O-RINGS IN FITTINGS .AND HOUSING . CLEAN AND REPLACE O RINGS AND SEALS . TEST NOT LEAK MORE .

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 7 East, Box 1180
Kindersley, SK S0L 1S0
Phone: (306) 463-2683
Fax: (306) 463-6131
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 254612	Internal Used Stock No. 254612	Invoice Number: 3342522
		Invoice Date: 3/31/2025
		Location: 03
		Work Order Number: 481082
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 19 of 19

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4038 120' 1000GL 650/65/R38	2275	1N04038RCK0204371	034371U	

JHYDDIAG1 JD ALL Internal

51M7048	O-RING M33	2.00	7.81	7.81	\$15.62	N
AN304847	Clamp	2.00	43.91	43.91	\$87.82	N
KK49221	O-Ring	1.00	60.98	60.98	\$60.98	N
R26375	-8ORB o-ring	1.00	4.25	4.25	\$4.25	N
T76938	-16FF O-ring	2.00	5.01	5.01	\$10.02	N

Labor: \$781.46 Parts: \$178.69 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$960.15

INVOICE CONTAINS \$2.22 DISCOUNT

Miscellaneous Charges:

SERVICE ACCESSORIES \$150.00

Customer PO No:

Tax Exempt No:

Advisor: Clayton Sorensen

Labor: \$15,406.62

Parts: \$17,745.40

OL&M: \$0.00

Misc: (\$686.86)

Grand Total: \$32,465.16

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: