

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 1 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____
 ENGINE HOURS 965 _____
 SEPERATOR HOURS _____

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
 HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
 THIS UNIT HAS HAD THE CAB CLEANED _____ JC _____ (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER _____ JC _____ (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ JC _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

VMC SEASON OF USE 2026

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	85.83	0.00	\$0.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DISI	LAB DISC INTERN	-1.00	1,444.50	1,444.50	(\$1,444.50)	N

Labor: \$5,407.50	Parts: \$0.00	OL&M: \$0.00	Misc: (\$1,444.50)	Sub-Total: \$3,963.00
--------------------------	----------------------	-------------------------	---------------------------	------------------------------

DIAG-100000090221 Internal

COMPLAINT:

03 Diagnose and Repair Stored Trouble Codes - PTP 523953.14

CORRECTION:

Diagnose stored trouble code.

Thursday, January 29, 2026 2:06 PM - tyson cleaned connector that had a bit of oil residue, verified fix after a few days no oil found no codes found. KB

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 2 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

DIAG-1000000090221 Internal

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JSOFTWARE JD X9 1000 Internal

COMPLAINT:

04 UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:

Friday, January 23, 2026 7:00 PM - Updated the ECU. Changed the cab air filters when i was doing updates. TP

Labor: \$420.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$420.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN05- Internal

COMPLAINT:

05 FEEDER HOUSE LIFT VALVE BLOCK HAVE A LEAK THROUGH ELECTRICAL CONNECTION

CORRECTION:

Saturday, January 24, 2026 12:58 PM -

located the harness that had oil in it

was a sealed electrical connection with a small bit of oil inside of it,

checked inside the connection to make sure it wasn't broke or cracked to be leaking oil in and no issues or damage

cleaned the connection out and re-attached the connector together. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
U15975	O-Ring	1.00	4.85	4.85	\$4.85	N
Labor: \$420.00	Parts: \$4.85	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$424.85		

JGEN06- Internal

COMPLAINT:

06 REPLACE FEEDER HOUSE DRIVEN BELT TENSION ROD

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 3 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN06- Internal

Thursday, January 29, 2026 9:45 AM - Picked new tension rod from shelf, took off old rod, installed new rod, put pin in and tightened belt. KP WH

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7276	M16-2.0 NUT	2.00	3.22	3.22	\$6.44	N
AXE88288	ROD	1.00	195.90	195.90	\$195.90	N
Labor: \$105.00		Parts: \$202.34	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$307.34	

J06001040 JD X9 1000 Internal

COMPLAINT:

07 REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.

CORRECTION:

Sunday, January 25, 2026 3:31 PM - checked the state of the chain and how much i could tension it without the half link in there was plenty of adjustment left without removing the half link, if removed there would barely be enough room to assemble the chain again so tensioned it to where it needs to be will last the next season. TP

Labor: \$315.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$315.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN08- Internal

COMPLAINT:

08 Lateral Tilt Frame Seal, Remove and Replace AND BRACKET DAMAGED ON RH SIDE

CORRECTION:

Remove header assembly.
 Remove and replace lateral tilt frame seal.
 Assemble in reverse order.

Tuesday, January 27, 2026 3:59 PM -

Removed the old seal and bracket and after riveting the new bracket and seal together reinstalled in reverse order of how I took it apart. KS

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 4 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN08- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE88180	Cover	1.00	230.25	230.25	\$230.25	N
HXE169446	SEAL	1.00	46.15	46.15	\$46.15	N
Labor: \$52.50		Parts: \$276.40	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$328.90	


JGEN09- Internal

COMPLAINT:

09 REPLACE TOP PLASTIC WEAR PADS FOR FRAME ON LATERAL TILT CYLINDERS

CORRECTION:

Tuesday, January 27, 2026 3:54 PM -
 removed the front deflector plates off the feeder house then the lateral tilt cylinder pins.
 Had to crack the hydraulic lines to get the pins to come out.
 Removed the sensor that detects where the tilt is at.
 Removed the little shield things held in my 4 8mm bolts on the inside.
 Hooked a cherry picker to the fount plate of the feeder house.
 Took out the lateral tilt cap bolts.
 Lifted the front plate out of the way.
 removed the old damaged wear pads.
 silicones the new ones in and did all steps in reverse.
 Torqued the cap screws down to 232 foot pounds. KS

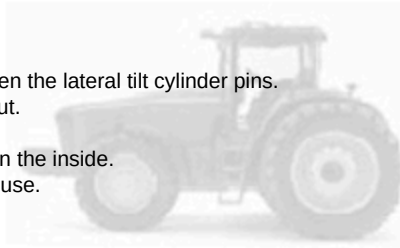

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE143008	Wear Plate	1.00	86.06	86.06	\$86.06	N
HXE143009	WEAR PLATE, TOP RH	1.00	86.11	86.11	\$86.11	N
Labor: \$210.00		Parts: \$172.17	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$382.17	

JGEN10- Internal

COMPLAINT:

10 NEED TO CLEAN FEEDER HOUSE TOP SHAFT FROM STRAW AND REPLACE MISSING LONG PLASTIC GUIDE ON LEFT SIDE

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 5 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN10- Internal

CORRECTION:

Sunday, January 25, 2026 3:02 PM -
 removed all of the straw and chaff to gain access to the gard,
 once cleaned installed the new guard. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M9269	M6x25 HEXSOC CTSK 10.9 BOLT	1.00	2.06	2.06	\$2.06	N
HXE169526	Feeder House Midfloor Runner	1.00	194.66	194.66	\$194.66	N
Labor: \$420.00		Parts: \$196.72	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$616.72	

JGEN11- Internal

COMPLAINT:

11 CLEAN OUT STONE TRAP

CORRECTION:

Saturday, January 24, 2026 8:08 PM - The stone trap was already open just had some flax that got wet and was stuck in there I dug it out and swept up my mess into a garbage can. KS

Labor: \$420.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$420.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06180021 JD X9 1000 Internal

COMPLAINT:

12 CONCAVE REPAIR 1.0 HRS PER CONCAVE- REPLACE ONE HALF AND FIX OTHER HALF AND RETORQUE ALL CONCAVE BOLTS

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 6 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06180021 JD X9 1000 Internal
 REPAIR CONCAVES AS NEEDED.
 (STRAIGHTENING AND WELDING)

Sunday, January 25, 2026 2:05 PM -
 removed the concave cover shields from either side of the combine
 located all 4 concaves that had damage.
 removed the 4 damaged concaves replaced the one with a brand new concave
 using a hammer and punch was able to straighten the other 3
 there was no welding that needed to be done on the 3 that I repaired to the best of my ability's. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE108906	X9 SMALL WIRE CONCAVE REG WEAR	1.00	800.50	800.50	\$800.50	N
Labor: \$420.00		Parts: \$800.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,220.50	

J06174025 JD S780 Internal
 COMPLAINT:
 13 AXE85935 ON LEFT SIDE HAVE SMALL CRACKS

CORRECTION:
 Thursday, January 29, 2026 2:07 PM - cracks are superstisal and not impacting machine or operation of shaker arms, no need to change verified with logan. KB

Labor: \$735.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$735.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN14- Internal
 COMPLAINT:
 14 TOP RETHRESHER HOUSING HAS A HOLE (NEEDS WELD) ALONG WITH SAFETY PROTECTION SHIELD

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number:	3533144
		Invoice Date:	1/30/2026
		Location:	10
		Work Order Number:	524790
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	7 of 25
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN14- Internal

Saturday, January 24, 2026 10:02 PM -

went up and started removing the plate that had a hole in it.

had to remove 2 pulleys and 2 belts to be able to properly access the bolts and pin for the plate,

once those were removed, removed the bolts holding the plate on and lastly removed the pin to get the plate out.

had the plate out

removed the insert from inside it

welded the hole shut.

painted it after welding

reinstalled in the reverse order as it was removed it.

have one more bracket to remove and weld the tab back on tomorrow. TP

Sunday, January 25, 2026 1:02 PM -

removed the bracket

buffed it up where the welds needed to be

welded it back together.

Once it was cooled off, painted it and then reinstalled it when the paint was dry enough. TP

Labor: \$630.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$630.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06175204 JD X9 1000 Internal

COMPLAINT:

15 TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST

CORRECTION:

ROTATE TAILINGS ELEVATOR CONVEYOR CHAIN UNTIL CONNECTING LINK IS VISIBLE.

DISCONNECT CONNECTING LINK. REMOVE HALF LINK.

RECONNECT TAILINGS ELEVATOR CONVEYOR CHAIN WITH CONNECTING LINK.

ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.

RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Saturday, January 24, 2026 5:55 PM -

removed the belt so i could freely turn the paddle chain to get to the half link

there was no half link left to remove on the tailings paddle chain

but there was plenty of adjustment left so i adjusted it

put the belt back on the top. TP

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06175204 JD X9 1000 Internal

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN16- Internal

COMPLAINT:

16 replace tensioner rod on tailings elevator drive belt tensioner

CORRECTION:

Saturday, January 24, 2026 6:04 PM -

Removed the old tensioner and replaced it with the new one. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7275	M12-1.75 NUT	2.00	1.81	1.81	\$3.62	N
AXE61705	ROD	1.00	96.66	96.66	\$96.66	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
CALLO	CALL OUT CHARGE	1.00	25.00	0.00	\$0.00	N
Labor: \$105.00	Parts: \$100.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$205.28		

J06180070 JD X9 1000 Internal

COMPLAINT:

17 ROTOR VARIABLE BELT, REMOVE AND REPLACE

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number:	3533144
		Invoice Date:	1/30/2026
		Location:	10
		Work Order Number:	524790
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	9 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06180070 JD X9 1000 Internal

Remove the unloading auger drive belt.

Remove the feeder house fixed or variable speed drive belt.

Loosen rotor variable drive belt.

Remove the rotor drive belt and install replacement belt.

Adjust the rotor drive belt.

Install the previously removed feeder house fixed or variable speed drive belt.

Install the previously removed unloading auger drive belt.

Saturday, January 24, 2026 5:31 PM - We removed the belts and the hydro hose in our way to get to the rotor belt, once we got there we relieved the hydraulic tension on the hydro side then we installed the separator bolts to spread the spring tension side on the belt. We then removed the old belt and installed the new belt. Once the new belt was on we installed everything we took off or loosened in reverse order. TP

Saturday, January 24, 2026 5:32 PM - Started by removing the 2 belts in front of the rotor belt by loosening off the tensioners then they pop off. Next we took the oil supply line off for the hydro tensioner for the rotor belt. Then put the spreader bolts in for the spring side of the rotor belt. Lastly loosed the tensioner for the rotor belt and removed the belt then did everything in reverse. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7397	M6-1.0 FLG NYLOCK NUT	1.00	1.18	1.18	\$1.18	N
19M7814	M12x50 FLG 10.9 BOLT	2.00	5.67	5.67	\$11.34	N
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,347.29	1,347.29	\$1,347.29	N
Labor: \$420.00		Parts: \$1,359.81	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,779.81	

JGEN18- Internal

COMPLAINT:

18 rotor drive tensioner needs a nut

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 10 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN18- Internal

Saturday, January 24, 2026 6:04 PM - Was provide the wrong nut I will go up to parts to reture the wrong one on monday I got the right one and the job is done wait to t-complete once M16 nut is returned. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7275	M12-1.75 NUT	1.00	1.81	1.81	\$1.81	N
M64720	Rivet for Rear Service Platform	6.00	1.35	1.35	\$8.10	N
Labor: \$105.00		Parts: \$9.91	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$114.91	

JCABFILTER JD X9 10 Internal

COMPLAINT:

19 REPLACE CAB AIR FILTERS

CORRECTION:

REMOVE CAB AIR FILTERS

CLEAN FILTER HOUSING

INSTALL NEW AIR FILTERS

Friday, January 23, 2026 7:01 PM - I changed the air filters when i was doing updates. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.66	40.66	\$40.66	N
TA32591	Cab FreshAir Filter	1.00	121.63	121.63	\$121.63	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$50.00		Parts: \$162.29	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$212.89	

JGEN20- Internal

COMPLAINT:

20 chopper housing - one bolt bent on housing and missing clip for spreader curtain on rh side

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 11 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN20- Internal

Tuesday, January 27, 2026 4:45 PM - Installed the new curtain clip and could not find the bent bolt set the curtain on RH side to match LH side. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE158759	Latch	2.00	37.73	37.73	\$75.46	N
HXE158762	Retainer	1.00	63.98	63.98	\$63.98	N
Labor: \$105.00		Parts: \$139.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$244.44	

JGEN21- Internal

COMPLAINT:

21 wheel angle sensor harness needs fixed - loom was pulled out

CORRECTION:

Friday, January 23, 2026 7:18 PM -
 The loom had pulled away exposing the wires,
 put it back into the loom and taped it back together to hold it properly. TP

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN22- Internal

COMPLAINT:

22 vacuum fan housing needs new seal

CORRECTION:

Friday, January 23, 2026 7:48 PM -
 I changed the boot from the old one to the new one and made sure that it fit and worked as intended. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE38720	: WEATHERSTRIP, ROTARY SCREEN DUCT SE	1.00	92.98	92.98	\$92.98	N
Labor: \$168.00		Parts: \$92.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$260.98	

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 12 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN23- Internal

COMPLAINT:

23 clean grain elevator drive belt tensioner is missing rod locking clip

CORRECTION:

Saturday, January 24, 2026 1:40 PM -

Part is on back order will change when arrives. TP

Tuesday, January 27, 2026 4:08 PM -

Part arrived and was changed,
 belt came off of the top pully
 had to feed it back up
 get back onto the pully then
 tightened the pully and finished job. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R94067	PIN FASTEN	1.00	30.63	30.63	\$30.63	N
Labor: \$52.50		Parts: \$30.63	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$83.13	

JGEN24- Internal

COMPLAINT:

24 right hand swinger arm has small cracks axe85936

CORRECTION:

Thursday, January 29, 2026 2:09 PM - cracks are superstisal and not impacting machine or operation of shaker arms, no need to change verified with logan. KB

Labor: \$630.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$630.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN25- Internal

COMPLAINT:

25 clean grain elevator boot needs welding

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 13 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN25- Internal

Saturday, January 24, 2026 3:41 PM -

I disconnected the batteries
 found where the crack was
 brought the welder over to the combine
 ran the extension cord out and welded the crack up,
 hooked the batteries back up
 watched it for a bit to make sure none of the chaff caught up on fire.
 All was good. TP

Labor: \$420.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$420.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001201 JD X9 1000 Internal

COMPLAINT:

26 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
 TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
 DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
 RECONNECT CONNECTING LINK.
 ADJUST TENSION TO SPEC.
 RUN UNIT AND READJUST TENSION AS REQUIRED.

Saturday, January 24, 2026 2:24 PM - I removed tension from the tension block and i removed belt tension to be able to sin the paddle chain and find the link, i found the link and removed the half ling and put the chain back together. The adjustment bolt on the tension block PN: 19M8241 was damaged and bent quite a bit so i removed the bolt which took a bit of time because the threads where it was bent did not want to let the nuts go past it so i had to force them past and was able to remove the bolt. I grabbed a new bolt from parts and installed it and tensioned it back properly. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M8241	M10x100 HH 8.8 BOLT	1.00	5.67	5.67	\$5.67	N

Labor: \$105.00	Parts: \$5.67	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$110.67
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN27- Internal

COMPLAINT:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 14 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN27- Internal

27 engine deck ladder shock has a damaged mounting hole and ladder lock needs adjusting

CORRECTION:

Saturday, January 24, 2026 7:27 PM -

Removed shocks to check for damage and there was no present damage
 reinstalled them and adjusted the latch and door opens and closes nicely now. TP

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06030020 JD X9 1000 Internal

COMPLAINT:

28 REPLACE ROTARY SCREEN DRIVE BELT, idler and tensioner

CORRECTION:

Friday, January 23, 2026 9:52 PM -

The belt was completely missing from the assembly.
 removed both the idle and tensioner pulley with help to start the nut on the tensioner pulley
 installed the new belt and double checked to make sure the belt was on all pulleys and the bolts were tight. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE23546	Belt Tensioner Engine Vacuum & Aux Air	1.00	567.46	567.46	\$567.46	N
AXE24984	Vacuum Fan Drive Idler	1.00	362.29	362.29	\$362.29	N
HXE167991	V-Belt	1.00	178.88	178.88	\$178.88	N
Labor: \$210.00	Parts: \$1,108.63	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,318.63		

JGEN29- Internal

COMPLAINT:

29 clean dirt from rotary screen

CORRECTION:

Saturday, January 24, 2026 7:27 PM -

Cleaned off rotary screen to the best of my ability. KS

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN29- Internal

Labor: \$230.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$230.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN30- Internal

COMPLAINT:

30 top up engine coolant

CORRECTION:

Sunday, January 25, 2026 4:01 PM -
 checked to see if i could find a point that the coolant was coming out of to make sure there was no leak
 couldnt find anywhere so i topped it up. TP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26576	COOL-GARD II 50/50 PRE-MIX JUG 9.46L	1.00	63.12	63.12	\$63.12	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
Labor: \$25.00	Parts: \$63.12	OL&M: \$0.00	Misc: \$1.50	Sub-Total: \$89.62		

JGEN31- Internal

COMPLAINT:

31 leak from two hoses on reel pump- possibly tighten or install second clamp

CORRECTION:

Sunday, January 25, 2026 4:08 PM -
 tightened all hose clamps on the reel drive pump 2 were very loose ran the combine and there was no leak. KS

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN32- Internal

COMPLAINT:

32 grain tank handrail pin is stuck

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 16 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN32- Internal

CORRECTION:

Friday, January 23, 2026 8:54 PM -
 remove the pin and buff it up
 clean out the hole the pin goes in as it was plugged with dirt and chaff,
 buffed the pin up
 ground just a little off the end of the pin so it wouldn't bind as easy
 reinstalled the pin and oiled it up
 slid it in and out
 cleaned the inside out
 pin moves freely, moves back far enough that the railing opens and closes smoothly now. TP

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN33- Internal

COMPLAINT:

33 unload auger sump needs cleaning

CORRECTION:

Thursday, January 29, 2026 2:05 PM -
 opened unloading auger sump
 ran unit no more coming out looks cleaned out. KB

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN35- Internal

COMPLAINT:

35 missing lock nut for radio in hole on roof

CORRECTION:

Tuesday, January 27, 2026 4:27 PM -
 Had to find what the problem nut was as I was provided a whole harness found that the nut on the end of the harness that locks the harness into something just needed to be slid down the harness and a decorative cap nut in the cab needed to be re installed
 found the decorative nut in the glove box in the cab.
 I returned the harness that was provided. KS

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 17 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JGEN35- Internal

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN36- Internal

COMPLAINT:

36 refrigerator needs cleaning

CORRECTION:

Friday, January 23, 2026 10:14 PM -
 The fridge had mold in it
 cleaned it out really good
 disinfected it
 used mothers to clean it finally. TP

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

DIAG-1000000164112 Internal

COMPLAINT:

37 Rotor Speed Adjust

CORRECTION:

Thursday, January 29, 2026 2:09 PM -
 ran up unit verified rotor speed adjust is working as intended. KB

Labor: \$315.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$315.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076147 Internal

COMPLAINT:

38 Chaffer and Sieve Actuator, Adjust

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 18 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

EXPERT-1000000076147 Internal

Use knob to adjust motor.
 Turn knob clockwise and counterclockwise to open and close chaffer and sieve.
 Adjust chaffer and sieve actuator.
 Assemble in reverse order.

Sunday, January 25, 2026 4:14 PM -

I started the combine and actuated the sieve and chaffer all the way open and close no faults came on. KS

Labor: \$105.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$105.00
------------------------	----------------------	-------------------------	---------------------	----------------------------


JENGAIRFLT JD X9 10 Internal

COMPLAINT:

39 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

Friday, January 23, 2026 7:11 PM -
 Removed the old filters
 installed the new ones
 wrote the hours on the new ones. KS

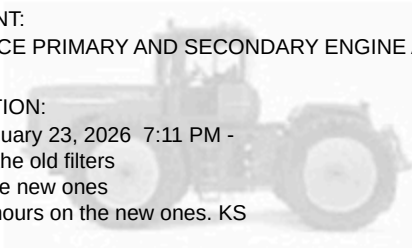

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	461.37	461.37	\$461.37	N
HXE11091	Secondary EngAir Filter	1.00	325.55	325.55	\$325.55	N

Labor: \$50.00	Parts: \$786.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$836.92
-----------------------	------------------------	-------------------------	---------------------	----------------------------

JENGOILCHNG JD X9 10 Internal

COMPLAINT:

40 REPLACE ENGINE OIL AND FILTER

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 19 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JENGOILCHNG JD X9 10 Internal

DRAIN ENGINE OIL AND REMOVE FILTER.
 CLEAN AREA.
 INSTALL NEW OIL AND FILTER.
 RUN UNIT AND LEAK CHECK
 ADJUST OIL LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	137.80	137.80	\$137.80	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00		Parts: \$650.38	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$785.63	

J10030113 JD S780 Internal

COMPLAINT:
 41 REPLACE DEF TANK VENT FILTER.

CORRECTION:

Friday, January 23, 2026 7:58 PM - spun the old one off and installed the new one threw old one in trash. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER, FUEL TANK	1.00	43.28	43.28	\$43.28	N
Labor: \$30.00		Parts: \$43.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$73.28	

J10030101 JD S780 Internal

COMPLAINT:
 42 REPLACE FUEL TANK BREATHES.

CORRECTION:

REPLACE FUEL TANK VENT FILTER.

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 20 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J10030101 JD S780 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER, FUEL TANK	1.00	43.28	43.28	\$43.28	N
Labor: \$30.00		Parts: \$43.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$73.28	

J06070005 JD X9 1000 Internal

COMPLAINT:

43 TRANSMISSION FILTER and return filter, REPLACE

CORRECTION:

Friday, January 23, 2026 8:48 PM -

Using a 1/2 drive ratchet removed the 2 spin on filters changed the o rings out installed the new filters for the other filter used the paper in the box showing how to take the filter out. using a 10 mm wrench removed the hose then spun the top cap off the filter housing allowing me to pull the canister style filter out of the hydraulic tank install the new one. replaced the seal on the cap as well. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	157.96	157.96	\$157.96	N
R567277	RING	2.00	17.84	17.84	\$35.68	N
RE577250	HYDRAULIC OIL FILTER	2.00	157.73	157.73	\$315.46	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	3.00	1.25	1.25	\$3.75	N
Labor: \$100.00		Parts: \$509.10	OL&M: \$0.00	Misc: \$3.75	Sub-Total: \$612.85	

J06070004 JD X9 1000 Internal

COMPLAINT:

44 REPLACE HYDROSTATIC CHARGE FILTER, cooler return filter, aux return filter

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 21 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06070004 JD X9 1000 Internal

CORRECTION:

Saturday, January 24, 2026 9:55 PM -

Removed all 3 filters

changed out the o-rings and keeper in the high pressure filter housing.

put the 3 new filters on

marked hours on the spin on filter. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE73797	Hydraulic Filter	1.00	174.57	174.57	\$174.57	N
AXE73798	Hydraulic Filter	1.00	214.90	214.90	\$214.90	N
R564922	Oil Filter Seal Ring	1.00	12.01	12.01	\$12.01	N
RE577612	Hydraulic Oil Filter	1.00	209.03	209.03	\$209.03	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	3.00	1.25	1.25	\$3.75	N
Labor: \$100.00		Parts: \$610.51	OL&M: \$0.00	Misc: \$3.75	Sub-Total: \$714.26	

J06001006 JD X9 1000 Internal

COMPLAINT:

45 REPLACE FRONT FINAL DRIVE OIL. (BOTH SIDES)

CORRECTION:

DRAINED OIL FROM BOTH FRONT FINAL DRIVES.

INSTALLED NEW OIL AND CHECKED LEVELS.

CHECKED FOR LEAKS.

Saturday, January 24, 2026 2:13 PM -

drained both final drives

re installed the bottom plugs

filled to the appropriate level with the supplied oil. KS/DS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26815	80W90 3.78L GL-5	3.00	51.75	51.75	\$155.25	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 22 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06001006 JD X9 1000 Internal

EF60	ENVIRO FEE	3.00	0.60	0.60	\$1.80	N
------	------------	------	------	------	--------	---

Labor: \$200.00	Parts: \$155.25	OL&M: \$0.00	Misc: \$1.80	Sub-Total: \$357.05
------------------------	------------------------	-------------------------	---------------------	----------------------------

J06001004 JD X9 1000 Internal

COMPLAINT:

46 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE and breather

CORRECTION:

Friday, January 23, 2026 7:48 PM -

Spun the old filter off and spun the new one on. KS

Labor: \$30.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$30.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06001009 JD X9 1000 Internal

COMPLAINT:

47 TWO SPEED CHOPPER GEARCASE OIL , feed accelerator gear case oil and cleaning fan variable speed driven sheave oil

CORRECTION:

Remove drain plug.

Allow oil to drain.

Install the drain plug and torque to specification. 30 N·m (22 lb·ft)

Refill with Hy-Gard until visible in the sight glass.

Shift lever to opposite speed.

Run the separator for one minute.

Let the machine sit for five minutes.

Re-check oil level.

Torque the fill plug to specification. 30 N·m (22 lb·ft)

Shift lever back to original speed.

Saturday, January 24, 2026 8:44 PM -

Using a 17 mm wrench

took the drain plug out the bottom to let the hydro oil drain into a pale on the chopper gear box.

took out the fill plug

re filled gear box till it was just to the top of the sight glass. KS

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 23 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

J06001009 JD X9 1000 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26815	80W90 3.78L GL-5	2.00	51.75	51.75	\$103.50	N
TY6354	HY-GARD J20C JUG 3.78L	1.00	32.16	32.16	\$32.16	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	4.00	0.60	0.60	\$2.40	N
Labor: \$100.00		Parts: \$135.66	OL&M: \$0.00	Misc: \$2.40	Sub-Total: \$238.06	

JGEN03- Internal

COMPLAINT:

48 install concave covers that are in rods office

CORRECTION:

Sunday, January 25, 2026 3:38 PM - I went and looked in rods office they were not there I got a hold of him he said he put them in joes office so I went and looked in there and they were not there. I then learned that they were given to keagan R to install when the inspection was being done but they were not installed and he had set them to the side. I took the front concave covers off on either side of the combine started the combine to raise the concaves all the way. I put the concave cover in 2 on either side and re installed the sheilds. KS

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JENGDIAG1 JD ALL Internal

COMPLAINT:

51 PERFORM ENGINE DIAGNOSTICS- COOLANT LEAK

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 24 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JENGDIAG1 JD ALL Internal

Tuesday, January 27, 2026 6:09 PM -

Found 2 coolant leaks



traced them back to 2 elbows 1 on either side of the rad stack
 we have parts coming for tomorrow to repair. KS

Tuesday, January 27, 2026 6:12 PM -

Found coolant leak it is coming from both bottom main rad hoses on the cooling system,
 we had one part in stock but the second hose is coming from swift
 will finish segment and fix coolant leak tomorrow. TP

Wednesday, January 28, 2026 4:25 PM -

The hoses showed up
 started on it by getting buckets and cleaning them to catch the coolant so we could reuse it,
 then we drained the coolant and started trying to get to the hoses
 front one was extremely difficult to get to so we decided to pull the bottom rad stack to change the elbow fittings.
 once the old ones were off we checked for cracks on the casting of the rad
 found nothing,
 proceeded to install the new hoses
 reinstall the bottom rad stack and as we put it back in the attached the other end of the elbows back to the down pipes.
 Got new hose clamps
 installed those ones
 filled it back with coolant
 test ran it to check for leaks and none are present.
 during final run up we will double check it for leaks to make sure. TP

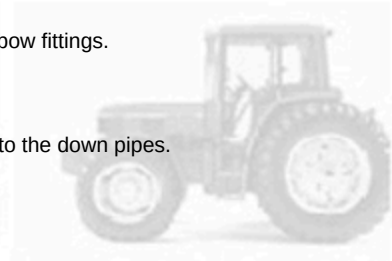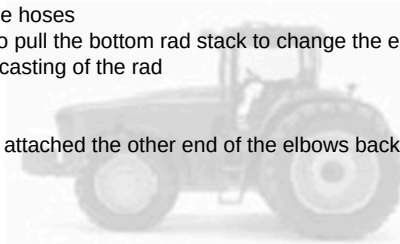

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK010-0507	Bulk Hose-PVC HOSE 5/16"ID X 716"OD JDS2	11.00	0.45	0.45	\$4.95	N
RE52703	Constant Tension CLAMP 3.74-4.65	4.00	31.73	31.73	\$126.92	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256544	Internal Used Stock No. 256544	Invoice Number: 3533144
		Invoice Date: 1/30/2026
		Location: 10
		Work Order Number: 524790
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 25 of 25

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	965	1H0X910XCP0825238	175886	

JENGDIAG1 JD ALL Internal

628N	FLOOR DRY	1.00	18.99	18.99	\$18.99	N
Labor: \$1,346.88	Parts: \$150.86	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,497.74		

INVOICE CONTAINS \$110.83 DISCOUNT

Miscellaneous Charges:

SERVICE ACCESSORIES \$150.00

Customer PO No:
Tax Exempt No:
Advisor: Joanne Thronberg

Labor: \$16,387.38
Parts: \$7,810.98
OL&M: \$0.00
Misc: (\$1,270.45)
Grand Total: \$22,927.91

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: