

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518 Bus Phone: Prv Phone:	Internal Used Stock No. 255518 Bus Phone: Prv Phone:	Invoice Number: 3464568 Invoice Date: 9/11/2025 Location: 01 Work Order Number: 473712 Payment Type: Account Page: 1 of 23
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

ENGINE HOURS _____
 SEPERATOR HOURS _____

DOES THIS UNIT GET A VALUEMAX STICKER X YES NO
 HAS THE STICKER BEEN INSTALLED X YES NO
 THIS UNIT HAS HAD THE CAB CLEANED AV (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER BT (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB CK (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

Job Total: \$3,860.00

JGEN03- Internal

COMPLAINT:

07 MISC REPAIRS

- REPLACE 3 MISSING HEADER LATCH SHEAR BOLTS
- MISSING CONCAVE FILLER PLATES (SEE IF SALES HAS SOME)
- TOP UP SPREADER MOTOR OILS
- WHEEL ANGLE SENSOR MISSING BOLT FOR P CLAMP
- TOP UP MEG OIL
- SECURE WIRE HARNESS ON HORIZONTAL UNLOAD AUGER
- CHARGE UP WATER EXTINGUISHER

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number:	3464568
		Invoice Date:	9/11/2025
		Location:	01
		Work Order Number:	473712
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	2 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN03- Internal

spreader oils are topped up
 header latch shear pins are replaced
 unload auger harness is secured
 MEG oil is topped up to mark.
 water fire extinguisher is full of water and charged.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7264	M4-0.75 NYLOCK NUT	3.00	0.52	0.52	\$1.56	N
19M9326	M4x30 HEXSOC 12.9 BOLT	3.00	2.22	2.22	\$6.66	N
TY6296	80W90 946ml GL5	1.00	15.99	15.99	\$15.99	N
TY6354	HY-GARD J20C JUG 3.78L	7.00	36.77	36.77	\$257.36	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF60	ENVIRO FEE	7.00	0.60	0.60	\$4.20	N
Labor: \$125.00		Parts: \$281.57	OL&M: \$0.00	Misc: \$4.35	Sub-Total: \$410.92	

J06001410 JD S790 Internal

COMPLAINT:
 08 CLEAN DEBRIS FROM HEADER LATCH PINS.

CORRECTION:
 RAISE FEEDERHOUSE AND ENGAGE CYLINDER STOP.
 UNHOOK CABLE, UNBOLT AND REMOVE HEADER LOCK PINS.
 CLEAN DEBRIS OUT FROM AROUND THE PINS.
 LUBRICATE AND RE-INSTALL PINS, RE-ATTACH CABLE AND ADJUST AS NECESSARY.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN07- Internal

COMPLAINT:
 11 DIAGNOSE AND REPAIR FEEDER HOUSE REVERSER MOTOR LEAK.

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number:	3464568
		Invoice Date:	9/11/2025
		Location:	01
		Work Order Number:	473712
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	3 of 23
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN07- Internal

CORRECTION:

- took off pulley assembly
- disconnected hydraulic lines
- disconnected pump
- loosened off brackets
- took reverser out cleaned up the housing
- took apart as much as i could waiting for long bolts for the puller to separate housing
- parts did not have that long of bolts and nothing open saturday
- got proper tools and separated housing and waiting on a specific sealant
- pulled housing with puller scraped the loctite off and cleaned up re added loctite 574 and torqued 13 bolts to 36 ftlb
- pressed bearing and put on the race and installed big nut and torqued to 30ftlb
- loctited and installed little nut torqued to 22 ftlbs and installed cap with gasket
- reinstalled snap ring and plug for hydraulic hose
- letting loctite sit so its sets
- installed gearcase
- torqued mounting bolts to 125 ftlbs
- installed pulley assembly and torqued the 13 bolts to 30 ftlbs and installed belt

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DE32664	Seal	1.00	36.39	36.39	\$36.39	N
H223849	Quad Ring	1.00	13.57	13.57	\$13.57	N
Labor: \$876.00		Parts: \$49.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$925.96	

EXPERT-1000000073841 Internal

COMPLAINT:

12 Feeder House Backshaft Bearing, Remove and Replace

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 4 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000073841 Internal

Loosen the feeder house drive chain tensioner.
 Remove chain from sprocket.
 Remove the shifter and the sprocket.
 Disconnect speed sensor.
 Remove the tone wheel.
 Remove bearing housing cap screws, bottom cap screw and nut.
 Install the new bearing and secure bearing holder with cap screws.
 Install bearing housing cap screws, bottom cap screw and nut. Tighten to specification.
 Apply Thread Lock and Sealer (High Strength) to the tone wheel. Install on the shaft and tighten to specification.
 Connect speed sensor.
 Apply Anti-Seize to the splines on the shaft.
 Install the sprocket, shifter, and chain.
 Use a pry bar in the holes on the inside plate and move the chain tensioner forward. Tighten the nut to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE86012	BEARING HO	1.00	619.97	619.97	\$619.97	N
HXE152597	Nut	1.00	223.59	223.59	\$223.59	N
544424	277 Red 36ml Threadlock	1.00	36.03	36.03	\$36.03	N
Labor: \$290.00		Parts: \$879.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,169.59	

JGEN09- Internal

COMPLAINT:
 13 REPLACE FEEDERHOUSE FRONT SEAL (RIGHT SIDE)

HXE138024

CAUSE:
 feeder house seal was completely missing

CORRECTION:
 remove four carriage head bolts and take out back bracket.
 install new seal in between back mount and front mount.
 install carriage head bolts.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 5 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN09- Internal

HXE138024	Seal	1.00	50.98	50.98	\$50.98	N
-----------	------	------	-------	-------	---------	---

Labor: \$170.00	Parts: \$50.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$220.98
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN10- Internal

COMPLAINT:

14 ADJUST LEFT HAND JACKSHAFT BELT IDLER PULLEY

CAUSE:

pulley was sitting to far to one side and could have lead to belt popping off

CORRECTION:

loosen 4 bolts for idler. slide it backwards and upwards to get the belt to ride in the center of the pulley.
 tighten bolts in new spot and torque to spec.

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000073962 Internal

COMPLAINT:

15 Feed Accelerator Bearing and Pulley, Repair

- JUST NEEDS BOLT FOR PULLEY AND TORQUE TO SPEC
- LOCK TITE BOLT AND TORQUE

CAUSE:

feed accelerator driven sheave cap screw was not tight causing pulley to have wobble.

CORRECTION:

Loosen belt tensioner nuts. Remove belts.
 Remove cap screw, washer, and sheave.
 Remove hardware and right-hand bearing assembly.
 Clean shaft of all nicks and burrs.
 Install right-hand bearing assembly, cap screws, and tighten.
 Install sheave, washer, and cap screw. Tighten to specification.
 Install belts. Adjust belt tensioner nuts.

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
Bus Phone:	Bus Phone:	Work Order Number: 473712
Prv Phone:	Prv Phone:	Payment Type: Account
		Page: 6 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000073962 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7794	M16x50 FLG 10.9 BOLT	1.00	9.10	9.10	\$9.10	N
Labor: \$200.00		Parts: \$9.10	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$209.10	

J06180111 JD X9 1000 Internal

COMPLAINT:

17 THRESHING ELEMENTS CONCAVES REMOVED, REPLACE

- 4 LH THRESHING ELEMENTS BROKE (REPLACE AS SETS)

CAUSE:

multiple elements had chunks missing or cracks.

CORRECTION:

Remove cap screws and threshing element.

If one element needs replaced, replace all in the group.

Install new elements and tighten cap screws to specification. 82 N·m (60 lb·ft)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10755	Threshing Element Kit LH	3.00	1,278.82	1,278.82	\$3,836.46	N
Labor: \$700.00		Parts: \$3,836.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,536.46	

EXPERT-1000000176686 Internal

COMPLAINT:

18 Left-Hand Separator Tines, Remove and Replace

REPLACE 4 BROKEN SEPARATOR TINES (REPLACE AS SETS)

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 7 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000176686 Internal

Remove separator grates for rotor access.
 Inspect wear on separator tines.
 Remove cap screws and separator tines.
 Use Threshing Elements and Separator Tine Location diagram for identifying elements and tines.
 Tighten the separator tine cap screws to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10959	X9 Rotor Tine Set	2.00	320.99	320.99	\$641.98	N
Labor: \$800.00		Parts: \$641.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,441.98	

J06175204 JD X9 1000 Internal

COMPLAINT:
 19 TAILINGS ELEVATOR PADDLE CHAIN ADJUST

CORRECTION:
 -if half link is out its to tight so just adjusted chain

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN16- Internal

COMPLAINT:
 20 CLEAN OUT TAILINGS CAMERA

PACKED WITH DEBRIS

CAUSE:
 camera was full of sludge and seal around full with debris

CORRECTION:
 scrape around seal to clear debris
 used glass cleaner to soak into sludge and break loose, once it was soaked in i used a plastic razor and scraped sludge off, once sludge was off i used glass cleaner to make lens spot free.

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	Page: 8 of 23
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN16- Internal

Labor: \$40.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$40.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06175045 JD X9 1000 Internal

COMPLAINT:
 21 ZERO ACTIVE TAILINGS CONCAVE

CORRECTION:
 ZERO ACTIVE TAILINGS CONCAVE.
 leveled concaves as per manual spec

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN19- Internal

COMPLAINT:
 23 REPAIR OIL LEAK AT MAIN HYDRAULIC RESERVOIR

SUCTION LINE CHECK CLAMPS AND HOSE.

CAUSE:
 loose clamp on hose

CORRECTION:
 cleaned area tightened clamp because it was loose and re cleaned area just has to be run check checked all surrounding hoses and clamps

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076128 Internal

COMPLAINT:
 24 Chopper Belt, Remove and Replace

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 9 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000076128 Internal

CORRECTION:

Remove chopper drive shields.

Loosen nuts to remove tension from the chopper drive belt and install replacement belt.

Adjust chopper drive belt. (See Supporting Document - Chopper Drive Belt—Adjusting).

Install previously removed chopper drive shields.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE124215	EXTRA FINE CUT CHOPPER DRV BELT	1.00	890.00	890.00	\$890.00	N
Labor: \$210.00		Parts: \$890.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,100.00	

J06001009 JD X9 1000 Internal

COMPLAINT:

25 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

- REPLACE OIL
- REPLACE SIGHT GAUGE (WITH PLUG)

CAUSE:

change oil

CORRECTION:

Remove drain plug.

Allow oil to drain.

Install the drain plug and torque to specification. 30 N·m (22 lb·ft)

Refill with Hy-Gard until visible in the sight glass.

Shift lever to opposite speed.

Run the separator for one minute.

Let the machine sit for five minutes.

Re-check oil level.

Torque the fill plug to specification. 30 N·m (22 lb·ft)

Shift lever back to original speed.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R39112	-8ORB plugHollow	1.00	14.23	14.23	\$14.23	N

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 10 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

J06001009 JD X9 1000 Internal

TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N
--------	------------------------	------	-------	-------	---------	---

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N

Labor: \$40.00	Parts: \$49.87	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$90.47
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000145874 Internal

COMPLAINT:

26 Replace Straw Chopper Stationary Knives

CAUSE:

knives needed to be changed due to wear

CORRECTION:

Remove knife bank
 Turn or replace knives
 Install knife bank

remove knife bank

remove cover on back of knife bank to gain access to knife bar. slide knife bar out and replace all knives assemble in reverse order.

time went over due confusion between parts and service.

A&I knives change bevel direction halfway through the knife bank and deere ones the bevels follow the same order the whole way along the bank.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7295	M8x90 CB 8.8 SN	1.00	4.80	4.80	\$4.80	N
A-H215004	Blade	61.00	8.24	8.24	\$502.64	N

Labor: \$300.00	Parts: \$507.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$807.44
------------------------	------------------------	-------------------------	---------------------	----------------------------

J06172010 JD X9 1000 Internal

COMPLAINT:

27 CHOPPER BLADES, REPLACE.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 11 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

J06172010 JD X9 1000 Internal

CAUSE:

chopper knives needed to be flipped not changed

CORRECTION:

Remove lock nut, cap screw, and bushings.

Remove and inspect blades and bushings.

Replace blade and install cap screw, bushings, and lock nut. Tighten lock nuts to specification.

Labor: \$620.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$620.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN24- Internal

COMPLAINT:

28 REPAIR COPPER COUNTER KNIFE ACTUATOR WIRING HARNESS.

CAUSE:

wire was cut up and needed replaced

CORRECTION:

remove cover on bottom of actuator, remove two connectors on actuator, remove connector for rest of harness, remove entire harness and install new harness and bolt in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70293	WIRING HAR	1.00	447.23	447.23	\$447.23	N

Labor: \$300.00	Parts: \$447.23	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$747.23
------------------------	------------------------	-------------------------	---------------------	----------------------------

JGEN25- Internal

COMPLAINT:

29 REPLACE RH SIDE PITMAN ARM

BUSHING CRACKED AXE88168

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 12 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN25- Internal

- unbolted bolts
- had to drill out rivets to pull rubber back to get bolts
- unbolted both arms then unbolted pitman arms
- installed new pitman arm put bolts back in made sure it was mid stroke
- everything tightened
- pitman arm was torqued to 236 ftlb (15/16 bolts)
- long pitman arms are torqued to 95 ftlb (18 bolts)
- had to re rivet rubber back on

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7358	M16x140 CB 10.9 SN	1.00	23.72	23.72	\$23.72	N
14M7291	M16-2 FLG NUT	2.00	5.03	5.03	\$10.06	N
19M7954	M16x150 HH 10.9 BOLT	2.00	19.01	19.01	\$38.02	N
AXE88168	RH SHOE ARM	1.00	1,087.26	1,087.26	\$1,087.26	N
M64720	3/16x1/2" RIVET	6.00	1.35	1.35	\$8.10	N
Labor: \$560.00		Parts: \$1,167.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,727.16	

EXPERT-100000074332 Internal

COMPLAINT:

30 Clean Grain Elevator Housing Boot, Remove and Replace

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0


Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 13 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000074332 Internal

Open the cleanout door, and remove the nut and pin from the paddle chain connecting link.
 Position paddle chain out of the way.
 Remove cap screws and cover.
 Loosen or remove nuts from the bearing housing.
 Loosen or remove nuts on adjusting screw and remove.
 Remove cap screw and washer.
 Remove nuts from plate and remove the plate from the lower housing.
 Remove cap screws and nuts, cap screws, and auger boot assembly.
 Install new seal between the auger housing and side sheet.
 Install boot assembly using cap screw and nuts, and cap screws.
 Install plate using nuts.
 Install cap screw and washer.
 Install adjusting screw and nuts.
 Install nuts onto the bearing housing. Do not tighten at this time.
 Install bearing cover using cap screws.
 Install pin and nut onto the paddle chain connecting link.
 Loosen nuts. Turning nut clockwise tightens chain, and turning nut counterclockwise loosens chain.
 Tighten nuts.
 - followed manual and did everything per manual spec and adjusted chain properly
 -sealed all seems with green combine sealant
 -made sure it everything was straight and nothing was touching

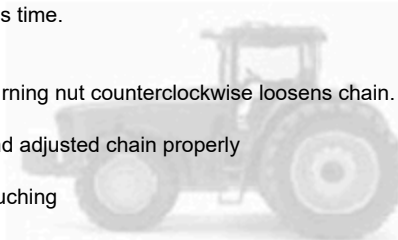

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE87931	Lower Clean Grain Boot	1.00	2,142.29	2,142.29	\$2,142.29	N
H81330	FoamStrip 3/16x1/2" 10ft	1.00	34.32	34.32	\$34.32	N
HXE132742	Seal	1.00	59.52	59.52	\$59.52	N
Labor: \$850.00		Parts: \$2,236.13	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,086.13	

J06001201 JD X9 1000 Internal

COMPLAINT:

31 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

-pulled a link out and adjusted to spec

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 14 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

J06001201 JD X9 1000 Internal

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000179732 Internal

COMPLAINT:

32 Right-Hand Separator Tines, Remove and Replace

REPLACE AS SETS (1 BROKE TINE)

CORRECTION:

Remove separator grates for rotor access.

Inspect wear on separator tines.

Remove cap screws and separator tine.

If one tine needs replaced, replace all in the group. Example: If replacing tine 2, replace tine 1 and 3 also.

Use Threshing Elements and Separator Tine Location diagram for identifying elements and tines.

Tighten the separator tine cap screws to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10959	X9 Rotor Tine Set	2.00	318.67	318.67	\$637.33	N

Labor: \$420.00	Parts: \$637.33	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,057.33
------------------------	------------------------	-------------------------	---------------------	------------------------------

JGEN29- Internal

COMPLAINT:

33 DIAGNOSE AND REPAIR ENGINE ACCESS LADDER DECK NOT LATCHING

CAUSE:

ladder was not latching and would just bounce in place

CORRECTION:

latch and cable needed lubrication to get all components back to working order. was lubricated the latch functions properly and the ladder now secures into place.

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

JGEN29- Internal

Labor: \$150.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$150.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JENGOILCHNG JD X9 10 Internal

COMPLAINT:

34 REPLACE ENGINE OIL AND FILTER

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER.

CLEAN AREA.

INSTALL NEW OIL AND FILTER.

RUN UNIT AND LEAK CHECK

ADJUST OIL LEVEL AS REQUIRED.

ran combine rechecked oil and added a little bit and let sit and rechecked everything and it was good

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	151.30	151.30	\$151.30	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	9.92	9.92	\$9.92	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00	Parts: \$673.80	OL&M: \$0.00	Misc: \$10.40	Sub-Total: \$809.20		

EXPERT-1000000074127 Internal

COMPLAINT:

35 Clean Grain Elevator Mass Flow Sensor Impact Plate, Remove and Replace

CAUSE:

impact plated needed to be replaced

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 16 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000074127 Internal

CORRECTION:

Disconnect connector.
 Remove sensor.
 Install in reverse order, tighten sensor to specification.

remove four bolts holding plate down
 remove two allen head screws holding impact plate to rest of components. remove plate and install in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE64829	Sensor	1.00	261.59	261.59	\$261.59	N
Labor: \$200.00		Parts: \$261.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$461.59	

EXPERT-1000000135714 Internal

COMPLAINT:

36 FACTORY CALIBRATION OF SIEVE AND CHAFFER

CORRECTION:

Menu Tab
 Machine Settings Tab
 Calibrations and Procedures Tab
 Harvest Tab go into factory calibrations.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076481 Internal

COMPLAINT:

37 Air Filter Elements, Change

CAUSE:

filters and housing and full of dirt and debris and require cleaning and changing

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 17 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000076481 Internal

Remove the air filter elements.
 Replace with new air filter elements .
 Check for leaks and for collapse of the aspirator tube.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	461.37	461.37	\$461.37	N
HXE11091	Secondary EngAir Filter	1.00	325.55	325.55	\$325.55	N
Labor: \$50.00		Parts: \$786.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$836.92	

EXPERT-1000000074148 Internal

COMPLAINT:

38 Fuel Filters, Remove and Replace

CORRECTION:

Close the valve on the fuel precleaner.
 Remove and replace the secondary fuel filter.
 Remove and replace the primary fuel filter.
 Disconnect the water sensor (if equipped).
 Remove the fuel from the filters and discard.
 Lubricate the replacement primary and secondary fuel filter seals with a thin film of oil or fuel.
 Align the filter slots on the primary and secondary fuel filters with housing tabs.
 Install and tighten the primary and secondary fuel filters until it is hand-tight.
 Tighten primary fuel filter by an additional 1/2 turn.
 Tighten secondary fuel filter by one additional full turn.
 Open the valve on the fuel precleaner.
 To prime the fuel system, turn the key switch to the ON position for 60 seconds.
 Start the engine and run 3—5 minutes at low idle.
 -primed good no leaks or anything after 5 minutes of running



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	171.28	171.28	\$171.28	N
DZ124786	Secondary Fuel Filter 13.6/18L	1.00	164.54	164.54	\$164.54	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 18 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000074148 Internal

EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
-------	------------	------	------	------	--------	---

Labor: \$80.00	Parts: \$335.82	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$418.32
-----------------------	------------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076101 Internal

COMPLAINT:

39 Hydrostatic Charge Filter, Replace

CORRECTION:

Remove the hydrostatic charge filter and discard.

Coat the seal on the replacement hydrostatic charge filter with oil.

Install the hydrostatic charge filter and tighten to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R564922	Oil Filter Seal Ring	1.00	12.01	12.01	\$12.01	N
RE577612	Hydraulic Oil Filter	1.00	209.03	209.03	\$209.03	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
Labor: \$25.00	Parts: \$221.04	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$247.29		

EXPERT-1000000076104 Internal

COMPLAINT:

40 Hydrostatic Cooler Return Filter, Replace

CORRECTION:

Remove the filter bowl.

Remove the hydrostatic cooler return filter and discard.

Coat the seal on the replacement hydrostatic cooler return filter with oil.

Install the replacement hydrostatic cooler return filter.

Install the previously removed filter bowl and tighten to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 19 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000076104 Internal

AXE73798	Hydraulic Filter	1.00	214.90	214.90	\$214.90	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$30.00 Parts: \$214.90 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$246.15


EXPERT-1000000076103 Internal

COMPLAINT:

41 Auxiliary Hydraulic Return Filter, Replace

CORRECTION:

Remove the drain plug from the bottom of the filter bowl.
 Allow the filter bowl hydraulic oil to drain.
 Install the plug in the filter bowl once the hydraulic oil is drained.
 Remove the filter bowl.
 Remove the auxiliary hydraulic return filter and discard.
 Coat the seal on the replacement auxiliary hydraulic return filter with oil.
 Install and tighten the replacement auxiliary hydraulic return filter until it is hand-tight.
 Install the previously removed filter bowl and tighten to specification.

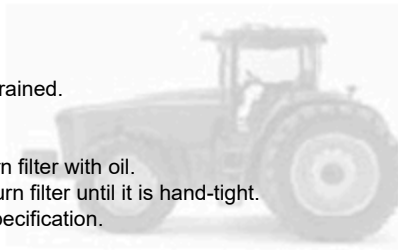

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE73797	Hydraulic Filter	1.00	174.57	174.57	\$174.57	N

Labor: \$40.00 Parts: \$174.57 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$214.57

EXPERT-1000000076099 Internal

COMPLAINT:

42 Feed Accelerator Gear Case Oil, Change

CAUSE:

oil was due for changing.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 20 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000076099 Internal

Remove the drain plug from the feed accelerator gear case.
 Allow the feed accelerator gear case oil to drain.
 Install the drain plug once the oil is drained.
 Tighten the drain plug to specification.
 Remove the fill plug from the feed accelerator gear case.
 Add oil until the oil level is at the bottom of the check hole.
 Tighten the fill plug to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26815	80W90 3.78L GL-5	1.00	51.75	51.75	\$51.75	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$75.00		Parts: \$51.75	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$127.35	

EXPERT-1000000076097 Internal

COMPLAINT:
 43 Cleaning Fan Variable Speed Driven Sheave Oil, Change

CAUSE:
 oil needed to be replaced with fresh oil

CORRECTION:
 Rotate the cleaning fan variable speed driven sheave so fittings are in the twelve and six o'clock positions.
 Remove the drain plug from the cleaning fan variable speed driven sheave.
 Install the drain plug once the oil is drained.
 Tighten the drain plug to specification.
 Remove the fill plug from the cleaning fan variable speed driven sheave.
 Add oil as needed.
 Tighten the fill plug to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	2.00	15.99	15.99	\$31.98	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 21 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000076097 Internal

EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N
------	------------	------	------	------	--------	---

Labor: \$35.00	Parts: \$31.98	OL&M: \$0.00	Misc: \$0.30	Sub-Total: \$67.28
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000137500 Internal

COMPLAINT:

44 Cab Air Filter, Change

CAUSE:

filters and housing were full of dirt and debris and required changing and cleaning

CORRECTION:

Turn the knob and lower the access cover.
 Remove the fresh air filter
 Replace the fresh air filter.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	Cab Recirc Air Filter	1.00	40.66	40.66	\$40.66	N
TA32591	Cab FreshAir Filter	1.00	121.63	121.63	\$121.63	N
Labor: \$50.00		Parts: \$162.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$212.29	

EXPERT-1000000154413 Internal

COMPLAINT:

45 Static Drag Cable, Install

CAUSE:

drag cable was worn off and requested to be replaced

CORRECTION:

Install a static drag cable at the customers request.

take old bolt , nut and cable off
 clean area for better contact
 install new drag cable and fasten with new bolt and nut.

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 22 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

EXPERT-1000000154413 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H217963	Green RTV 83ml	1.00	35.55	35.55	\$35.55	N
STATIC	STATIC DRAG CABLE 3/8"	1.00	242.83	242.83	\$242.83	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$100.00 Parts: \$278.38 OL&M: \$0.00 Misc: \$35.00 Sub-Total: \$413.38

J06030020 JD X9 1000 Internal

COMPLAINT:



46 REPLACE ROTARY SCREEN DRIVE BELT

CAUSE:

belt was missing

CORRECTION:

install new belt and make sure pulleys were in good shape then adjusted tensioner to spec.

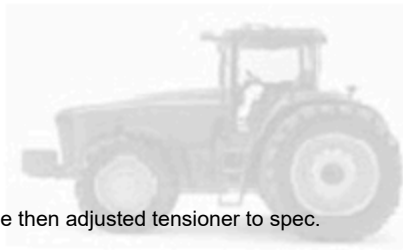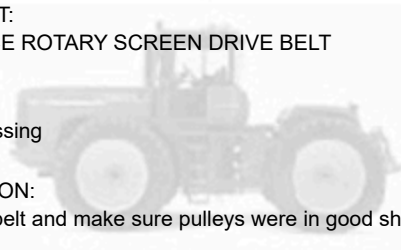

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 255518	Internal Used Stock No. 255518	Invoice Number: 3464568
		Invoice Date: 9/11/2025
		Location: 01
		Work Order Number: 473712
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 23 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	885	1H0X910XLP0825333	176264	

J06030020 JD X9 1000 Internal

HXE168680	Rotary Screen V-Belt X9	1.00	94.60	94.60	\$94.60	N
Labor: \$140.00	Parts: \$94.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$234.60		

Miscellaneous Charges:

SERVICE ACCESSORIES \$150.00

Customer PO No:

Tax Exempt No:

Advisor: Chris Therrien

Job Total: \$27,839.69

Grand Total: \$27,839.69

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: