
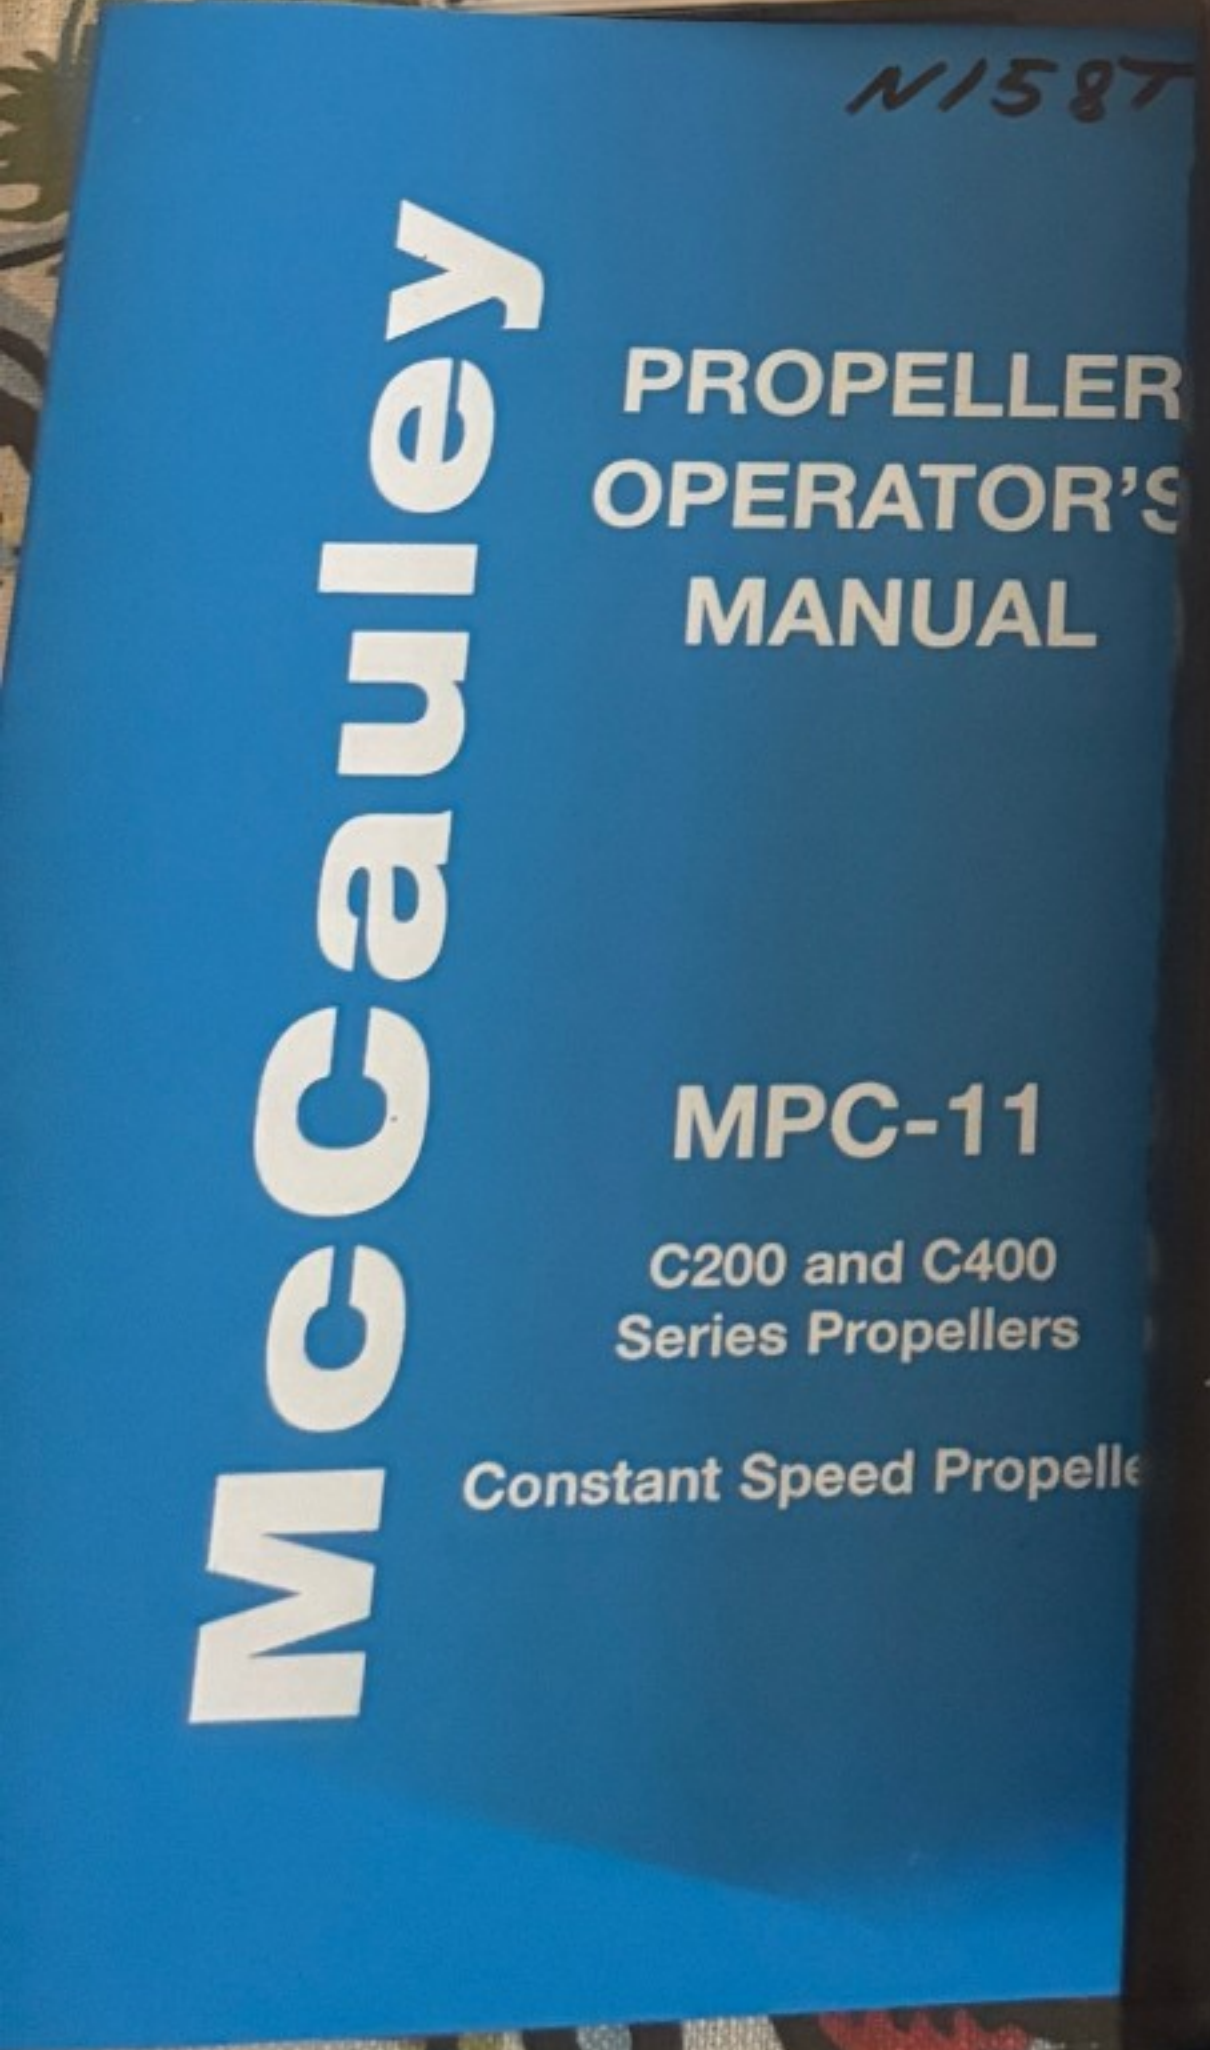
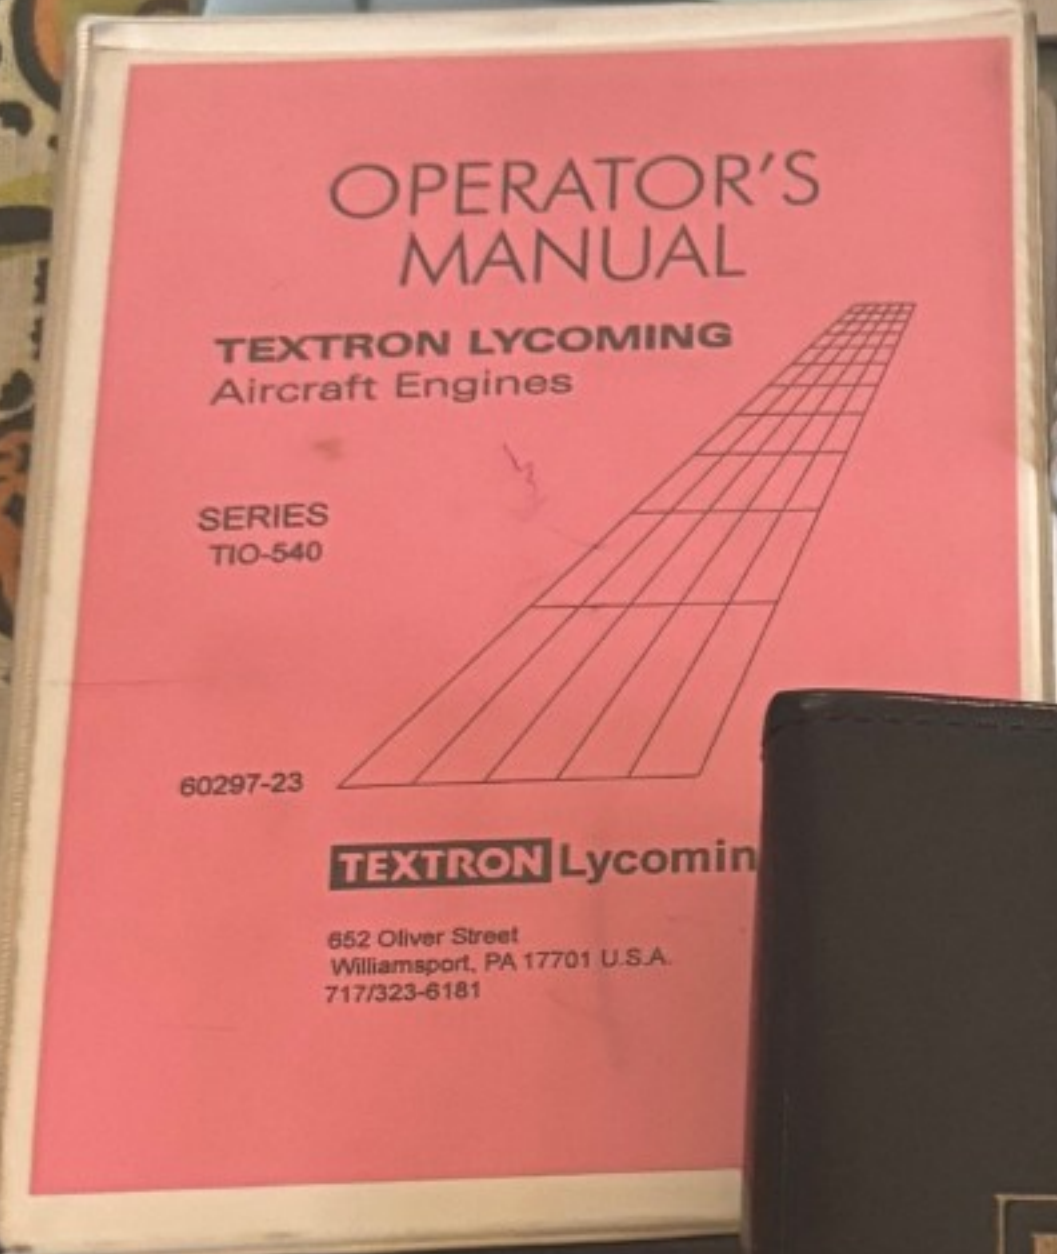


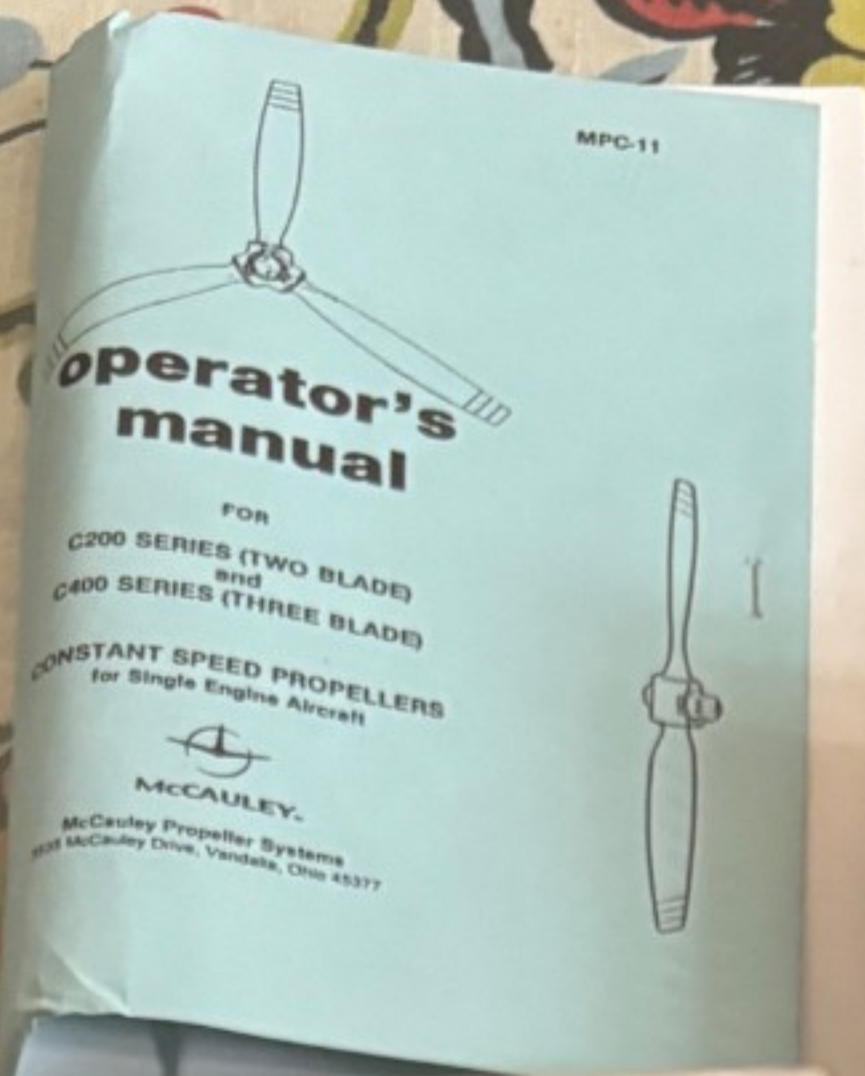

DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
------	-----------------------	------------------------------	---

Aerodyme Corporation • 274 Valley Road • South Burlington, VT 05403

N158TZ 29 Mar 2025

Installed 2 pcs hydraulic fitting MS20823-4 in new PMA P/N 48838-503 S/N 0478 (Gar-Kenyon 97240 Rev AE), ops checked 50 strokes at normal ops pressures, leak checked at pressure relief settings, then 200 additional strokes at normal ops pressures, no defects or leaks found.


Replaced bearing in aft end cap with AA306-03B in accordance with DER Report JDR-SR25-033 Step 8, balance of accomplishment deferred to installing agency.

Installation and adjustment of rod end, in accordance with Maintenance Manual, deferred to installing agency with attention to required operating cushion.


J. Richards Airframe 2333415

COMMANDER N158TZ APRIL 26, 2025 TACH TIME: 1057:3

- 1) Placed aircraft on jacks: Nose gear actuator cylinder removed and replaced with new PN: 9720AE, See attached FAA Form 8130-3 dated 8/5/2024.
- 2) Nose landing gear drag brace actuator cylinder clevis lug and trunnion cylinder clevis lugs removed and replaced with PN: AA306-RE03B-379 in all four locations. Replaced actuator rod ends with NEW PN: M81935/1-5. This was a service kit AC11-SK199-02. This work was performed in accordance with NLG Actuator Attach Report Number JDR-SR25-033.
- 3) Serviced the landing gear system with 5606 hydraulic fluid, cycled the gear numerous times with including manual extension with no defects noted. This was accomplished in accordance with the Commander Maintenance Manual, Section VI.

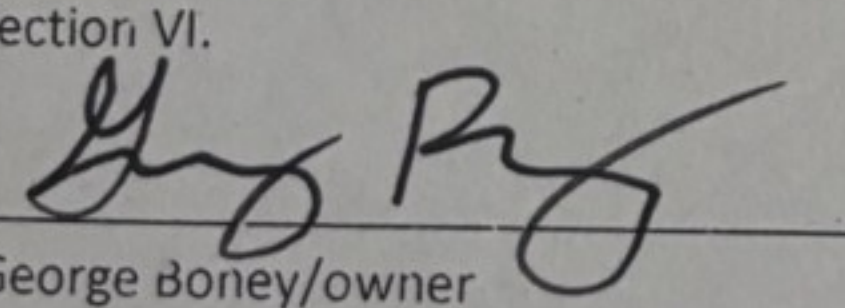
George Boney/owner

The above work was supervised by me.

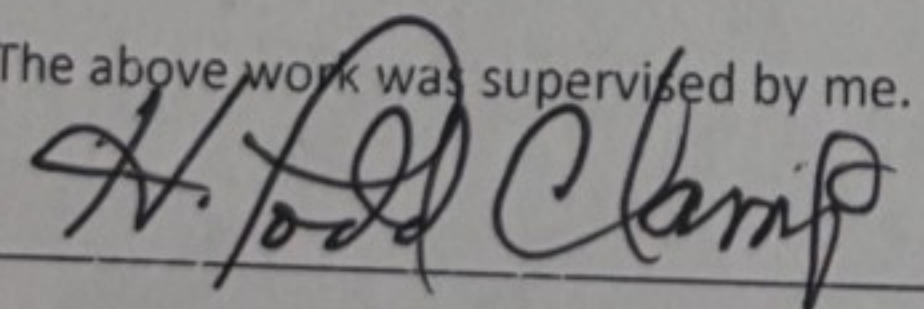
A&P 2705055

SUB-TOTAL this page

TOTAL—Carry forward to next page

AIRFRAME MAINTENANCE RECORDS

Log No. _____

Aircraft Registration No. N158TZ

Aircraft Mfg. COMMANDER Model 114TC Serial No. 20037

Engine Mfg. Lycoming Model TIO-540-AG1A Serial No. L-10733-61A

Engine Mfg. _____ Model _____ Serial No. _____

Propeller Mfg. McCauley Model B3D32C419-C Serial No. 002151

Hub Design No. G-82NHA-5 Hub Serial No. 002151

Blade Design No. _____ Blade Serial No's. UD010

UD033

SF107

Propeller Mfg. _____ Model _____ Serial No. _____

Hub Design No. _____ Hub Serial No. _____

Blade Design No. _____ Blade Serial No's. _____

(All applicable information must be filled in)



**AERO
TECH PUBLICATIONS INC.**

P.O. BOX 6005/FREEHOLD, N.J. 07728
(908) 462-5330