

001-OUT

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No.

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
		Page:	1 of 13

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

745

1H0X911XAN0820448

080448U

JGLC JD X SERIES ALL**COMPLAINT:**

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

HEADER SERIAL # _____

ENGINE HOURS - 745 HRS

SEPERATOR HOURS- 597

DOES THIS UNIT GET A VALUEMAX STICKER - YES

HAS THE STICKER BEEN INSTALLED - YES

THIS UNIT HAS HAD THE CAB CLEANED _____ (INITIAL)


THIS UNIT HAS HAD A FINAL CHECKOVER - TW (INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB - TW (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

DID NOT FILL FIRE EXTINGUISHER

DID NOT REPLACE BRACKET ON SIDE OF FEEDERHOUSE

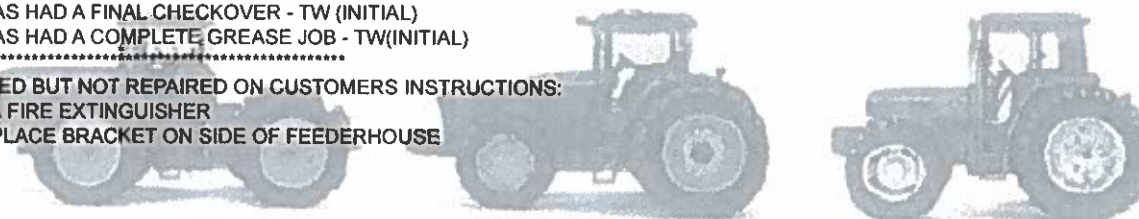**Job Total: \$3,834.25****JSOFTWARE JD X9 1100****COMPLAINT:**

02 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON _____ CONTROLLERS.

HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CORRECTION:

UPDATED SOFTWARE ON _____ CONTROLLERS.

HAD TO PREFORM THE FOLLOWING CALIBRATIONS.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355
Shaunavon, SK (306) 297-2639

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

		Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 2 of 13
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

745

1H0X911XAN0820448

080448U

JSOFTWARE JD X9 1100

Labor: \$400.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$400.00

JENGOILCHNG JD X9 11

COMPLAINT:

03 REPLACE ENGINE OIL AND FILTER

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER.

CLEAN AREA.

INSTALL NEW OIL AND FILTER.

RUN UNIT AND LEAK CHECK

ADJUST OIL LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	151.30	151.30	\$151.30	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N

Labor: \$125.00 Parts: \$663.88 OL&M: \$0.00 Misc: \$10.25 Sub-Total: \$799.13

JENGAIRFILT JD X9 11

COMPLAINT:

04 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

REMOVE AND REPLACE ENGINE AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	461.37	461.37	\$461.37	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 3 of 13
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JENGAIRFILTD JD X9 11

HXE11091	Secondary EngAir Filter	1.00	325.55	325.55	\$325.55	N
----------	-------------------------	------	--------	--------	----------	---

Labor: \$100.00	Parts: \$786.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$886.92
-----------------	-----------------	--------------	--------------	---------------------

JCABFILTER JD X9 11

COMPLAINT:
05 REPLACE CAB AIR FILTERS

CORRECTION:
REMOVE CAB AIR FILTERS
CLEAN FILTER HOUSING
INSTALL NEW AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.66	40.66	\$40.66	N
TA32591	Cab FreshAir Filter	1.00	121.63	121.63	\$121.63	N
Labor: \$100.00		Parts: \$162.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$262.29	

J10030100 JD X9 1100

COMPLAINT:
06 REPLACE ENGINE FUEL FILTERS.

CORRECTION:
REPLACED PRIMARY AND SECONDARY FUEL FILTERS.
REMOVED AND CLEANED FUEL STRAINER.
BLED FUEL SYSTEM.
FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	171.28	171.28	\$171.28	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	164.54	164.54	\$164.54	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 4 of 13
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

J10030100 JD X9 1100

EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
-------	------------	------	------	------	--------	---

Labor: \$160.00 Parts: \$335.82 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$498.32

J06001004 JD X9 1100

COMPLAINT:

07 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE

CORRECTION:

REMOVE AND REPLACE MAIN ENGINE GEARCASE FILTER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R567277	RING	1.00	17.84	17.84	\$17.84	N
RE577250	HYDRAULIC	1.00	157.73	157.73	\$157.73	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
Labor: \$30.00 Parts: \$175.57 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$206.82						

J06070005 JD X9 1100

COMPLAINT:

08 TRANSMISSION FILTER, REPLACE

CORRECTION:

REMOVE AND REPLACE TRANSMISSION FILTER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R564922	RING	1.00	12.01	12.01	\$12.01	N
R567277	RING	1.00	17.84	17.84	\$17.84	N
RE577250	HYDRAULIC	1.00	157.73	157.73	\$157.73	N
RE577612	HYDRAULIC OIL FILTER	1.00	209.03	209.03	\$209.03	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 5 of 13
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

J06070005 JD X9 1100					
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50 N
Labor: \$90.00	Parts: \$396.61	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$489.11	

J06180070 JD X9 1100
COMPLAINT:
 09 ROTOR VARIABLE BELT, REMOVE AND REPLACE

CORRECTION:
 REMOVE UNLOADING AUGER DRIVE BELT.
 LOOSEN ROTOR VARIABLE DRIVE BELT
 REMOVE AND REPLACE BELT
 ADJUST THE SHEAVE GAP TO SPEC (10MM)
 INSTALL UNLOADING AUGER BELT
 RUN UNIT
 CHECK SHEAVE GAP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,347.29	1,347.29	\$1,347.29	N
Labor: \$400.00	Parts: \$1,347.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,747.29		

J06001009 JD X9 1100
COMPLAINT:
 10 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CORRECTION:
 REMOVE DRAIN PLUG AND DRAIN OIL, REINSTALL
 FILL GEARCASE WITH HY GAURD UNTIL VISIBLE IN SIGHT GLASS
 RUN SEPARATOR
 LET SIT AND CHECK OIL LEVEL

Labor: \$80.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$80.00	
-----------------------	----------------------	-------------------------	---------------------	---------------------------	--

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 6 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

J06070004 JD X9 1100**COMPLAINT:**

11 REPLACE HYDROSTATIC CHARGE FILTER.

CORRECTION:

REMOVE OLD FILTER
CLEAN AREA
INSTALL NEW FILTER AND O RING

Labor: \$50.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000076128**COMPLAINT:**

12 REMOVE AND REPLACE SPREADER BELTS

CORRECTION:

REMOVE SHIELDS
LOOSEN TENSION PULLEY AND REMOVE OLD BELT
INSTALL NEW BELT AND TIGHTEN PULLEY
INSTALL SHIELDS



<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>							
HXE176243	V-Belt	1.00	177.22	177.22	\$177.22	N							
<table> <tr> <td>Labor: \$210.00</td><td>Parts: \$177.22</td><td>OL&M: \$0.00</td><td>Misc: \$0.00</td><td>Sub-Total: \$387.22</td><td colspan="2"></td></tr> </table>							Labor: \$210.00	Parts: \$177.22	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$387.22		
Labor: \$210.00	Parts: \$177.22	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$387.22									

EXPERT-1000000139767**COMPLAINT:**

13 Concave Level and Adjust

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3491350 Invoice Date: 10/14/2025 Location: 08 Work Order Number: 512137 Payment Type: Page: 7 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

EXPERT-1000000139767

Start engine and press the threshing clearance adjust switch.
Set threshing clearance to 0.
Remove the front separator grate deflector.
Remove cap screws, cap screws and nuts, and the front separator grate.
Move handle to shift the rotor gear case in the neutral position.
Loosen the lower lock nut, lower adjustment nut, and the upper lock nut on the front and rear concave cylinders.
While turning the left-hand rotor clockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements "tick" against the rotor. Back off the nut one full turn. Tighten nut finger tight.
While turning the right-hand rotor counterclockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements "tick" against the rotor. Back off the nut one full turn. Tighten nut finger tight.
Tighten the lower adjustment nut on the front and rear concave cylinders to specification.
Tighten the upper and lower lock nuts.
Perform the calibration. (See Supporting Documents - User Calibrations - Procedures).

Labor: \$1,070.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,070.00
--------------------------	----------------------	-------------------------	---------------------	------------------------------

JGEN14-

COMPLAINT:
14 SHEAR BOLT ON MULTICOUPLER

CORRECTION:
REMOVE BROKEN SHEAR BOLT
INSTALL NEW SHEAR BOLT

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7264	M4-0.75 NYLOCK NUT	1.00	0.52	0.52	\$0.52	N
19M9326	M4x30 HEXSOC 12.9 BOLT	1.00	2.08	2.08	\$2.08	N
Labor: \$32.00		Parts: \$2.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$34.60	

JGEN16-

COMPLAINT:
16 FEEDERHOUSE REVERSER MOTOR LEAKING

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
		Page:	8 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JGEN16-

REMOVE MOTOR
TAKE APART AND INSTALL SEAL KIT
PUT MOTOR BACK ON FEEDERHOUSE
RUN FEEDERHOUSE
CHECK FOR LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AA46577	REEL DRIVE MOTOR SEAL KIT	1.00	434.51	434.51	\$434.51	N
Labor: \$800.00						
Parts: \$434.51						
OL&M: \$0.00						
Misc: \$0.00						
				Sub-Total:	\$1,234.51	

JGEN18-

COMPLAINT:
18 RIGHT SIDE OF CHOPPER CRACKED

CORRECTION:

REMOVE WIRING HARNESS
REMOVE HYDRAULIC HOSES
REMOVE CHOPPER
REMOVE CHOPPER PULLEY AND LOCK NUT AND BEARING ASSEMBLY
REMOVE RIGHT SIDE OF CHOPPER
INSTALL NEW CHOPPER SIDE
INSTALL NEW BEARING
SET BEARING BY TORQUING LOCK NUT TO 277 lb-ft WITHOUT LOCK WASHER REMOVE LOCK NUT
INSTALL LOCK WASHER AND LOCK NUT AND TORQUE TO 258 lb-ft
BEND LOCK WASHER TAB
INSTALL PULLEY
PUT CHOPPER BACK ON TO COMBINE, HOOK UP HYDRAULIC LINES AND WIRING HARNESS
INSTALL TAILBOARD AND PULLEY ASSEMBLY
PUT SIDE SHIELDS BACK ON



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE106842	Side Wall	1.00	3,477.47	3,477.47	\$3,477.47	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355
Shaunavon, SK (306) 297-2639

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
		Page:	9 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JGEN18-

AXE78091	BEARING WI	1.00	492.99	492.99	\$492.99	N
----------	------------	------	--------	--------	----------	---

Labor: \$3,000.00	Parts: \$3,970.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$6,970.46
-------------------	-------------------	--------------	--------------	-----------------------

JGEN19-**COMPLAINT:**

19 REPLACE BUBBLE UP AUGER

CORRECTION:

REMOVE BOLTS

USE OVERHEAD CRANE TO REMOVE AUGER FLIGHTING

REPLACE BEARING AND INSTALL ONTO NEW FLIGHTING

INSTALL AUGER

BOLT TOGETHER

RUN AUGER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE85993	Bearing With Housing	1.00	223.46	223.46	\$223.46	N
AXE89023	X9 LOADING AUGER EXT WEAR	1.00	4,042.26	4,042.26	\$4,042.26	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$1,000.00	Parts: \$4,265.72	OL&M: \$0.00	Misc: \$35.00	Sub-Total: \$5,300.72
-------------------	-------------------	--------------	---------------	-----------------------

JGEN20-**COMPLAINT:**

20 RIGHT SIDE BUSHING CRACKED, SWING ARM

CORRECTION:

REMOVE SWING ARM AND INSTALL A NEW ONE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: 3491350
Invoice Date: 10/14/2025
Location: 08
Work Order Number: 512137
Payment Type:
Page: 10 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JGEN20-

AXE88168	RH SHOE ARM	1.00	1,087.26	1,087.26	\$1,087.26	N
----------	-------------	------	----------	----------	------------	---

Labor: \$1,452.00	Parts: \$1,087.26	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,539.26
-------------------	-------------------	--------------	--------------	-----------------------

J06171080 JD X9 1100

COMPLAINT:

21 REPLACE FEEDERHOUSE CONVEYOR DRIVE CHAIN.

CORRECTION:

REMOVED DRIVE CHAIN.

INSTALLED NEW DRIVE CHAIN.

ADJUSTED TO PROPER TENSION.

RAN MACHINE WITH FEEDERHOUSE ENGAGED, RECHECKED AND ADJUSTED CHAIN AS NECESSARY.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE90399	X9 FEEDER CHAIN DRIVE 80H BSN 83000	1.00	1,101.36	1,101.36	\$1,101.36	N
Labor: \$200.00	Parts: \$1,101.36	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,301.36		

JGEN22-

COMPLAINT:

22 REPLACE CHOPPER GEARCASE

CORRECTION:

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355
Shaunavon, SK (306) 297-2639

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

		Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
Bus Phone:	Bus Phone:	Page:	11 of 13
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JGEN22-

DRAIN CHOPPER GEARCASE OIL
REMOVE HYDRUALIC LINES
REMOVE SHEAVE AND SHIMS
REMOVE HYDRUALIC FITTING
REMOVE SNAP RING AND LOCKING COVER
REMOVE NUT AND WASHER
REMOVE CHOPPER GEARCASE
INSTALL GEAR CASE
INSTALL GEAR CASE MOUNTING NUT
INSTALL HYDRUALIC FITTING, SNAP RING, LOCKING COVER, SHEAVE AND SHIMS
FILL WITH HY GAURD
HOOK UP HYDRAULIC HOSES

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DE32706	X9 CHOPPER GEAR CASE XFCUT	1.00	12,472.85	12,472.85	\$12,472.85	N
H165447	LOCK NUT	1.00	21.63	21.63	\$21.63	N
HXE118421	Gauge	1.00	56.54	56.54	\$56.54	N
M72598	QUICK LOCK	2.00	4.58	4.58	\$9.16	N
TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$1,068.00		Parts: \$12,595.82	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$13,664.42	

JGEN23

COMPLAINT:
23 REPLACE CHOPPER DOOR

CORRECTION:
REMOVE AND INSTALL NEW CHOPPER DOOR/HOUSING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE100233	Bracket	1.00	598.70	598.70	\$598.70	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
		Page:	12 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

JGEN23-

AXE85673	Housing	1.00	1,976.53	1,976.53	\$1,976.53	N
----------	---------	------	----------	----------	------------	---

Labor: \$634.00	Parts: \$2,575.23	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,209.23
------------------------	--------------------------	-------------------------	---------------------	------------------------------

J06172010 JD X9 1100

COMPLAINT:

24 CHOPPER BLADES, REPLACE.


CORRECTION:

Remove lock nut, cap screw, and bushings.

Remove and inspect blades and bushings.

Replace blade and install cap screw, bushings, and lock nut. Tighten lock nuts to specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10761	S7 SERIES CHOPPER KNIFE KIT 8/CS	12.00	431.51	431.51	\$5,178.12	N

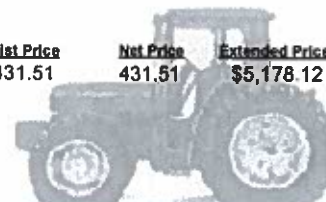

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3491350
		Invoice Date:	10/14/2025
		Location:	08
		Work Order Number:	512137
		Payment Type:	
		Page:	13 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	745	1H0X911XAN0820448	080448U	

J06172010 JD X9 1100
KXE11195 X9 CHOPPER KNIFE KIT 8PCS 4.00 374.93 374.93 \$1,499.72 N

Labor: \$620.00 Parts: \$6,677.84 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$7,297.84

Miscellaneous Charges:
SERVICE ACCESSORIES \$150.00

Customer PO No:
Tax Exempt No:
Advisor:

Job Total: \$52,413.75
Grand Total: \$52,413.75

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: