



WELCH EQUIPMENT COMPANY INC
2181 S 3200 W
SALT LAKE CITY, UT 84119

INVOICE

173051

SENT
4/2/26

P: (801) 972-9272

Invoice
V31010686

Date
03/19/2026

Customer
101656

Sold to :

CATE RENTAL & SALES LLC
PO BOX 27073
SALT LAKE CITY, UT 84127

Shipped to :

CATE RENTAL & SALES LLC
2055 PIONEER RD
SALT LAKE CITY, UT 84127

Page 1 of 2

P: (801) 973-2900

To View an Pay Your Bills Online:
<https://welcheq.billtrust.com>

Branch Invoiced: **Salt Lake City**
Dept Invoiced: **Service**

Salesperson :

Registration : 87-0653307

Notes :

Quantity	Product Id	Description	Unit Price	Total Price				
Cust PO# : CRP827KF12826			Entered by : Dottie Whitehorn					
Work Order :W3103281			Service Van : VAN341					
Seg 1: WON'T GO INTO 1ST GEAR			01/27/26	WO - Road				
Make	Model	Serial ID/Plate	Year	Date	Odometer	H-Meter	Dealer ID	Customer Eq ID
Z-Clark	C75L	P680L-0125-9827KF				0.00	1703563	
1	CLA 8091340	SWITCH IGNITION					46.86	46.86
1	CLA 8113034	LEVER ASSY-DIRECTIONAL					477.18	477.18
Total Parts								524.04
Total Labor								2,988.00
FI		FREIGHT IN						29.43
Total Misc								29.43
SS		Environmental Fee						50.00
Total Other Charges								50.00

P6801-0125-9827*

01/27/2026 Already at customer location and located unit. Verified that unit had drivability issues and starting issues as well. Just not exactly what WO was created for, spoke with Austin about unit. Also found that spicer box was flagging LH and fault light. Trouble shot issue verifying solenoids weren't the issue. Using diagnostic interface with box showed inputs for column switch has failed. Verified key switch was intermittently not working correctly by checking resistance at key switch posts. Spoke with Austin and recommend replacement parts key switch / column switch for repairs. Austin approved parts with ordering ground. 02/10/2026 Picked up parts. Arrived at customer location. Checked in with Austin and located unit. Prepped for job. Removed and replaced parts that need replacement. Verified with key on engine off that the spicer box was no longer flagging LH "limp home" while flashing fault. Tested key switch and showing no issues starting unit directly from off to cranking but when cranked from accessory position it will not crank. Start issue shows multiple issues. Also unit still has drivability issues with just wanted to drive backwards in any gear or selected direction. Spoke with Austin and informed him of existing issues still. 03/10/2026 Arrived at customer location. Contacted Joe with Clark. Explained to him my issues with the starting and drivability issues. We narrowed the starting issue to a bad alternator due to the unit not seeing return voltage to the system. We performed multiple tests for the drivability issue and found that even with it wanting to move in reverse consistently there is less than 20 psi in reverse test port and in no pressure in forward port. Showing that there is a mechanical failure, also verified that there is possibly another issue followed due to when in gear and direction is applied pressure should be diverted and seen on those test ports and there is the same reading of 20 psi with out any change. Spoke with Austin and informed him that transmission would need to come out and sent off to be rebuilt. Austin requested quote. Got with parts manager and got quote together and sent to customer.

827KFF
CLARK C75L
501409
401501



173051

Invoice	Date	Customer
V31010686	03/19/2026	101656

Page 2 of 2


CATE RENTAL & SALES LLC
2055 PIONEER RD
SALT LAKE CITY, UT 84127

<https://welcheq.billtrust.com>

Dept Invoiced : **Service**

Notes :

Detach at line and return with payment

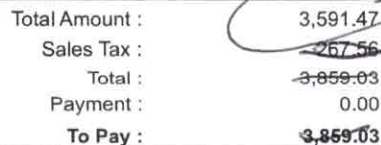

WELCH EQUIPMENT COMPANY, INC
PO BOX 676292
DALLAS, TX 75267-6292

Invoice	V31010686
Date	03/19/2026
Customer	101656
All amounts are in US Dollars (\$)	

*** All credit card payments are subject to a 3% processing fee. There is no fee on ACH, check, and debit card transactions. ***