

QST	QUAN	PART NO	PARTS/ MATERIAL	DESCRIPTION	AMT	PARTS
	1	Head			9423	33
	1	Engine kit			10969	35
	2	cans	Cummins red		92	00
	6	5298564	g h i m s		617	58
	1		block cut		500	00
	1	3688012	oil drain tube		87	13
	11	3678506	Head bolt sets		917	62
	4	3678804	Head bolts		109	20
	1	4298629	Cam		3820	66
	1		Cam bolt		15	22
	6	3679102	Injector hold down ^{bolt}		57	24
	3	5484230	Rocker lever		768	15
	3	5484231	Rocker lever		741	54
	3	548229	Rocker lever		697	17
	3	548228	Rocker lever		697	17
	1	6303	Bearing		38	45
	1	3691476	Crankcase ^{filter}		198	14
	1	WF2187	coolant filter ^{PA 35}		58	04
	4		oil pump bolts		209	20
	1	5680039RX	oil pump		1420	15
	1	K37-1004	fuel filter		75	00
	52	Litres	red coolant		210	60
	50	Litres	break in oil		512	50
	35		zipties		35	00
	1	4101884	vibration damper		1521	81

Ralph's Diesel Repair Inc.

P.O. BOX 82

TEL. 366-4720 ST. GREGOR, SK. SOK 3X0

TERMS:

Account payable by 20th of month following. Interest of 2% per month will be charged on overdue accounts.

GST 887 063 352

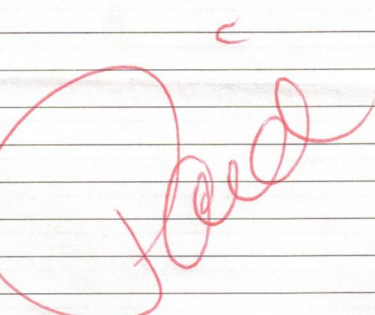
M. G+B Friesen

DATE Nov 9/23

ADDRESS Watson SK

TEL.

MAKE & MODEL Pete	ODOMETER	SERIAL NUMBER
LICENSE	PROMISED	30244

WORK TO BE DONE / DESCRIPTION		AMOUNT	
- check engine for compression in cooling system. found head gasket leaking and cylinder liners were worn in block. Rebuild engine after cutting counterbores. Head also was cracked.			
			
78 hrs labor @ \$130.00/hr		10140	00
		TOTAL LABOUR	10140 00
I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE TOGETHER WITH NECESSARY MATERIALS. SIGNATURE _____		TOTAL PARTS	38612 25
		SUBLET LABOUR	
		P.S.T.	2625 14
		G.S.T.	2187 61
I HEREBY ACKNOWLEDGE MY INDEBTEDNESS IN THE AMOUNT OF			