

W02-83

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:	
Prv Phone:	

Bus Phone:	
Prv Phone:	

Invoice Number:	3341918
Invoice Date:	3/29/2025
Location:	11
Work Order Number:	480704
Payment Type:	
Page:	1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGLC JD X SERIES ALL**COMPLAINT:**

X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:**VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST**

HEADER SERIAL # _____ no header _____
ENGINE HOURS _____ 781.6 _____
SEPERATOR HOURS _____ 532.3 _____

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
THIS UNIT HAS HAD THE CAB CLEANED _____ yes _____ (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER _____ yes _____ (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ yes _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

See quote

WARRANTY DATES ON REPAIRS COMPLETED
STARTS: August 1, 2025
ENDS: August 1, 2026

Job Total: \$3,860.00

JSOFTWARE JD X9 1100**COMPLAINT:**

UPDATE ALL CONTROLLER SOFTWARE

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No.

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3341918**
Invoice Date: **3/29/2025**
Location: **11**
Work Order Number: **480704**
Payment Type:
Page: **2 of 14**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JSOFTWARE JD X9 1100

CORRECTION:

UPDATED SOFTWARE ON 11 CONTROLLERS.

**DID 11 SOFTWARE UPDATES INCLUDING GEN 4, RADIO AND MTG.

MTG AND RADIO TOOK ADDITIONAL TIME AS IT'S NOT DONE THROUGH SERVICE ADVISOR - ADDITIONAL DOWNLOADS AND WAIT TIME WERE NECESSARY

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

J06180268 JD X9 1100

COMPLAINT:

REPLACE 4 LARGE WIRE CONCAVES, LEVEL AND CALIBRATE.

CORRECTION:

NOTE: THERE WAS NOT ENOUGH TIME FOR THIS SEGMENT GIVEN THE ADDITIONAL WORK AND REPAIRS NECESSARY

PREVIOUS OWNER INSTALLED CONCAVES COMPLETELY RANDOM ORIENTATION
MACHINE SHOULD HAVE 4 SMALL WIRE CONCAVES FOLLOWED BY TWO LARGE WIRES
RHS OF MACHINE HAD 2 SMALL WIRES AND THE REST HAD LARGE WIRES

LHS HAD ALL LARGE WIRE CONCAVES INSTALLED

REMOVED REMAINDER OF CONCAVES, TRANSFERRED OVER TRANSITION LIP AND OTHER ADDITIONAL WORK IN ORDER TO PROPERLY SET UP CONCAVES

ONCE ALL CONCAVES WERE INSTALLED AND HARDWARE TIGHT - PERFORMED LEVELING PROCEDURE AS WELL AS DISPLAY LEVELING AND CONCAVE THRESHING CLEARANCE CALIBRATION

Labor: \$1,200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,200.00
-------------------	---------------	--------------	--------------	-----------------------

JSEDIMENT JD S790

COMPLAINT:

CLEAN OUT THE WATER SEPERATOR/SEDIMENT BOWL ON X9 1100

CORRECTION:

SHUT OFF FUEL

REMOVE WATER SEPARATOR BOWL AND REMOVE WATER AND DIRT FROM FILTER AND BOWL

REINSTALL INTO PLACE

RELIEVE AIR FROM BOWL AND TIGHTEN INTO PLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3341918**
Invoice Date: **3/29/2025**
Location: **11**
Work Order Number: **480704**
Payment Type:
Page: **3 of 14**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JSEDIMENT JD S790

Labor: \$53.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$53.00
----------------	---------------	--------------	--------------	--------------------

JGEN02-

COMPLAINT:

REPAIR OIL LEAKS NEAR ENGINE GEARCASE

CORRECTION:

THOROUGHLY CLEAN AREA WHERE LEAKS WERE PRESENT
BLOW AREA CLEAN OF ALL DIRT AND DEBRIS
TIGHTEN AND ADD ADDITIONAL HOSE CLAMPS TO PREVENT FUTURE LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY22486	ROSE CLAMP	2.00	6.02	6.02	\$12.04	N

Labor: \$400.00	Parts: \$12.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$412.04
-----------------	----------------	--------------	--------------	---------------------

JGEN03-

COMPLAINT:

TIGHTEN FINAL DRIVE TRUSS ROD

CORRECTION:

HARDWARE WAS ALL LOOSE FOR FINAL DRIVE TRUSS ROD
TENSION BOLTS PROPERLY AND TORQUE TO SPEC

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

JGEN04-

COMPLAINT:

REPLACE LHR SEPERATOR GRATE INSPECTION DOOR KNOB

CORRECTION:

REMOVE INCORRECT BOLT AND INSTALL PROPER KNOB ONTO REAR LHS ACCESS DOOR

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3341918
		Invoice Date:	3/29/2025
		Location:	11
		Work Order Number:	480704
		Payment Type:	
		Page:	4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGEN04-

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE167838	KNOB	1.00	16.67	16.67	\$16.67	N
Labor: \$100.00		Parts: \$16.67	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$116.67	

JGEN05-

COMPLAINT:
REPLACE MISSING GULL WING KNOB

CORRECTION:
REPLACE MISSING KNOB ON LH REAR GULL WING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
Z63847	HANDLE	1.00	21.16	21.16	\$21.16	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N
Labor: \$50.00		Parts: \$21.16	OL&M: \$0.00	Misc: \$35.00	Sub-Total: \$106.16	

J06070044 JD S790

COMPLAINT:
REPLACE ONE SINGLE POINT MULTI COUPLER CARTRIDGE

CORRECTION:
THOROUGHLY CLEAN AREA WHERE COUPLER IS TO BE REMOVED
REMOVE AND REPLACE COUPLER USING SPECIAL SOCKET
VERIFIED NO FURTHER LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE73035	X9 MC Coupler 1/2" FM	1.00	490.20	490.20	\$490.20	N
Labor: \$90.00		Parts: \$490.20	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$580.20	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3341918
		Invoice Date:	3/29/2025
		Location:	11
		Work Order Number:	480704
		Payment Type:	
		Page	5 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGEN06-

COMPLAINT:

REPLACE MISSING UNLOADING AUGER SHEAR BOLTS

CORRECTION:

INSTALL MISSING SHEAR BOLTS INTO STORAGE POSITION ON SIDE OF MACHINE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE158348	X9 UNLOADING AUGER SHEARBOLT M10	2.00	14.50	14.50	\$29.00	N
Labor: \$100.00		Parts: \$29.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$129.00	

JGEN07-

COMPLAINT:

REPLACE LEAKING UNLOADING AUGER HYD CYLINDER

CORRECTION:

OLD CYLINDER WAS LEAKING EXCESSIVELY FROM ROD END OF CYLINDER
RELIEVE HYDRAULIC PRESSURE FROM CYLINDER
REMOVE MOUNTING PINS AND COTTER PINS FROM CYLINDER
REMOVE HYDRAULIC LINES AND REMOVE CYLINDER
INSTALL NEW CYLINDER INTO PLACE, SWAP OVER FITTINGS
INSTALL LINES INTO PLACE AND REINSTALL MOUNTING PINS
VERIFY OPERATION OF CYLINDER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC18538	HYDRAULIC	1.00	709.26	709.26	\$709.26	N
Labor: \$400.00		Parts: \$709.26	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,109.26	

JGEN08-

COMPLAINT:

REROUTE AND PROPERLY SECURE HARNESS ABOVE TAILINGS

CORRECTION:

HARNESS WAS NOT SECURED NEAR UNLOADING AUGER/TAILINGS AREA ALLOWING CONNECTOR TO CONTACT BELT
USING ZIP TIES, SUPPORTED HARNESS OUT OF THE WAY OF BEING DAMAGED BY BELT

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3341918
		Invoice Date:	3/29/2025
		Location:	11
		Work Order Number:	480704
		Payment Type:	
		Page:	6 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGEN08-

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
-----------------	---------------	--------------	--------------	---------------------


J06001009 JD X9 1100

COMPLAINT:

TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CORRECTION:

REMOVE DRAIN PLUG
ALLOW OIL TO DRAIN
INSTALL THE DRAIN PLUG AND TORQUE TO SPECIFICATION. 30 N·m (22 lb·ft)
REFILL WITH HY-GARD UNTIL VISIBLE IN THE SIGHT GLASS
SHIFT LEVER TO OPPOSITE SPEED
RUN THE SEPARATOR FOR ONE MINUTE
LET THE MACHINE SIT FOR FIVE MINUTES
RE-CHECK OIL LEVEL
TORQUE THE FILL PLUG TO SPECIFICATION. 30 N·m (22 lb·ft)
SHIFT LEVER BACK TO ORIGINAL SPEED

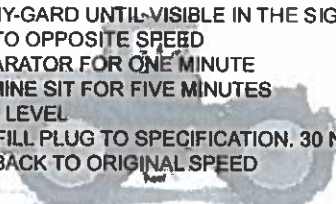

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N

Labor: \$400.00	Parts: \$35.64	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$436.24
-----------------	----------------	--------------	--------------	---------------------

J06001201 JD X9 1100

COMPLAINT:

ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK

CORRECTION:

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3341918**
Invoice Date: **3/29/2025**
Location: **11**
Work Order Number: **480704**
Payment Type:
Page: **7 of 14**

Make/Model	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

J06001201 JD X9 1100

REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
RECONNECT CONNECTING LINK.
ADJUST TENSION TO SPEC.
RUN UNIT AND READJUST TENSION AS REQUIRED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
-----------------	---------------	--------------	--------------	---------------------

J06175204 JD X9 1100

COMPLAINT:

TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST

CORRECTION:

ROTATE TAILINGS ELEVATOR CONVEYOR CHAIN UNTIL CONNECTING LINK IS VISIBLE.
DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
RECONNECT TAILINGS ELEVATOR CONVEYOR CHAIN WITH CONNECTING LINK.
ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.
RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
-----------------	---------------	--------------	--------------	---------------------

J06001040 JD X9 1100

COMPLAINT:

REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.

CORRECTION:

LOOSEN OFF CHAIN TENSION AND REMOVE 1/2 LINKS FROM FEEDERCHAIN
REINSTALL HARDWARE AND TENSION CHAIN TO SPEC.
REINSTALL NOSE CONE INTO POSITION

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
-----------------	---------------	--------------	--------------	---------------------

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3341918 Invoice Date: 3/29/2025 Location: 11 Work Order Number: 480704 Payment Type: Page: 8 of 14
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGEN09-

COMPLAINT:

SECURE AXLE HARNESS TO PREVENT DAMAGE

CORRECTION:

ROUTE AND SECURE HARNESS ON REAR AXLE TO PREVENT FUTURE ISSUES WITH IT CATCHING OR BEING DAMAGED
 SECURED INTO PLACE AND VERIFIED IT HAD ENOUGH SLACK FOR FULL MOTION OF REAR AXLE

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J10171050 JD S790

COMPLAINT:

REPLACE FEEDERHOUSE DRUM

CORRECTION:

REMOVED CONVEYOR CHAIN.
 REMOVED AND REPLACED FRONT DRUM.
 REINSTALLED CONVEYOR CHAIN AND ADJUSTED TENSION TO SPEC.
 TEST RAN AND RECHECKED TENSION.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed/Ind
AXE88163	DRUM	1.00	2,721.04	2,721.04	\$2,721.04	N
<hr/>						
Labor: \$800.00	Parts: \$2,721.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,521.04		

J06171080 JD X9 1100

COMPLAINT:

REPLACE FEEDERHOUSE CONVEYOR DRIVE CHAIN AND GUIDES. (DAMAGED FROM NOT ADJUSTING CHAIN)

CORRECTION:

REMOVED DRIVE CHAIN.
 INSTALLED NEW DRIVE CHAIN.
 ADJUSTED TO PROPER TENSION.
 RAN MACHINE WITH FEEDERHOUSE ENGAGED, RECHECKED AND ADJUSTED
 CHAIN AS NECESSARY.

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Baiearres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Prescaville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3341918**
Invoice Date: **3/29/2025**
Location: **11**
Work Order Number: **480704**
Payment Type:
Page: **9 of 14**

Make/Model: Meter: Serial Number: Eq ID: Fleet No:

JOHN DEERE X9 1100 781 1H0X911XCNB820279 104598

J06171080 JD X9 1100

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE90399	X9 FEEDER CHAIN DRIVE 80H BSN 83000	1.00	1,183.16	1,183.16	\$1,183.16	N
HXE159287	Guide	1.00	79.64	79.64	\$79.64	N
HXE160082	BOTTOM CHAIN GUIDE	1.00	105.92	105.92	\$105.92	N

Labor: \$300.00 Parts: \$1,368.72 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,668.72

J06180111 JD X9 1100

COMPLAINT:

REPLACE DAMAGED THRESHING ELEMENTS X2 (MATCHED SET OF 3) CONCAVES REMOVED, REPLACE

CORRECTION:

Remove and replace threshing elements from RH and LH rotors.
Followed balancing pattern when replacing to ensure rotors remained balanced.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10755	Threshing Element kit LH	1.00	1,306.50	1,306.50	\$1,306.50	N
KXE10756	THRESHING ELEMENT KIT RH	1.00	1,306.50	1,306.50	\$1,306.50	N

Labor: \$240.00 Parts: \$2,613.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,853.00

JGEN10-

COMPLAINT:

REPLACE 2 BENT FEED ACCELERATOR WINGS

CORRECTION:

REPLACED 2 BENT FEED ACCELERATOR WINGS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE174444	X9 FEED ACCELERATOR/BEATER STRIP ASN 82K	1.00	434.81	434.81	\$434.81	N

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kevington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3341918 Invoice Date: 3/29/2025 Location: 11 Work Order Number: 480704 Payment Type: Page: 10 of 14
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JGEN10-						
HXE177730	X9 FEED ACC/BEATER STRIP ASN 82K	1.00	601.68	601.68	\$601.68	N
Labor: \$150.00		Parts: \$1,036.49	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,186.49	

JGEN11-
COMPLAINT:
REPAIR ENGINE ACCESS PANEL SO IT CLOSSES PROPERLY

CORRECTION:
REPAIRED ENGINE ACCESS PANEL SO IT CLOSSES PROPERLY

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN26-
COMPLAINT:
REPLACE CHOPPER KNIVES
While performing RIP found several chopper knives with large chunks missing from knives.

CORRECTION:
While performing PIP found several chopper knives with large chunks missing from knives.
Got box of knives and replaced in proper sequence and torque to spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10761	S7 SERIES CHOPPER KNIFE KIT 8/CS	1.00	446.81	446.81	\$446.81	N
Labor: \$130.00		Parts: \$446.81	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$576.81	

JCABFILTER JD X9 11
COMPLAINT:
REPLACE CAB AIR FILTERS

CORRECTION:

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Prescaville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3341918 Invoice Date: 3/29/2025 Location: 11 Work Order Number: 480704 Payment Type: Page 11 of 14
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

JCABFILTER JD X9 11
 REMOVE CAB AIR FILTERS
 CLEAN FILTER HOUSING
 INSTALL NEW AIR FILTERS
 MARK WITH HOURS AND DATE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.49	40.49	\$40.49	N
TA32591	Cab FreshAir Filter	1.00	125.95	125.95	\$125.95	N
Labor: \$50.00		Parts: \$166.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$216.44	

JENGOILCHNG JD X9 11
 COMPLAINT:
 REPLACE ENGINE OIL AND FILTER

CORRECTION:
 DRAIN ENGINE OIL AND REMOVE FILTER.
 CLEAN AREA.
 INSTALL NEW OIL AND FILTER.
 RUN UNIT AND LEAK CHECK
 ADJUST OIL LEVEL AS REQUIRED.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	156.67	156.67	\$156.67	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00		Parts: \$669.25	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$804.50	

J06070003 JD X9 1100
 COMPLAINT:
 TRANSMISSION RETURN FILTER, REPLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3341918
		Invoice Date:	3/29/2025
		Location:	11
		Work Order Number:	480704
		Payment Type:	
		Page:	12 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

J06070003 JD X9 1100

CORRECTION:
REMOVED AND REPLACED FILTER FROM HYDRAULIC TANK

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R567277	RING	1.00	18.41	18.41	\$18.41	N
RE577250	HYDRAULIC	1.00	161.70	161.70	\$161.70	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$45.00 Parts: \$180.11 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$226.36

J10030100 JD X9 1100

COMPLAINT:
REPLACE ENGINE FUEL FILTERS.

CORRECTION:
REPLACED PRIMARY AND SECONDARY FUEL FILTERS.
REMOVED AND CLEANED FUEL STRAINER.
BLED FUEL SYSTEM.
FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	168.89	168.89	\$168.89	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	162.25	162.25	\$162.25	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$80.00 Parts: \$331.14 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$413.64

J06070005 JD X9 1100

COMPLAINT:
TRANSMISSION FILTER, REPLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3341918
		Invoice Date:	3/29/2025
		Location:	11
		Work Order Number:	480704
		Payment Type:	
		Page:	13 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
-------------	--------	----------------	--------	-----------

JOHN DEERE X9 1100	781	1H0X911XC�B820279	104598	
--------------------	-----	-------------------	--------	--

J06070005 JD X9 1100

CORRECTION:
 REMOVED AND REPLACED FILTER
 MARKED WITH HOURS AND DATE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R567277	RING	1.00	18.41	18.41	\$18.41	N
RE577250	HYDRAULIC	1.00	161.70	161.70	\$161.70	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$45.00	Parts: \$180.11	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$226.36
-----------------------	------------------------	-------------------------	---------------------	----------------------------

J06001004 JD X9 1100
 COMPLAINT:
 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE

CORRECTION:
 REMOVED AND REPLACED FILTER
 MARKED WITH HOURS AND DATE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	173.37	173.37	\$173.37	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3341918**
Invoice Date: **3/29/2025**
Location: **11**
Work Order Number: **480704**
Payment Type:
Page: **14 of 14**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	781	1H0X911XCNB820279	104598	

J06001004 JD X9 1100								
EF100	ENVIRO FEE		1.00	1.25	1.25	\$1.25	N	

Labor: \$30.00	Parts: \$173.37	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$204.62
----------------	-----------------	--------------	--------------	---------------------

Miscellaneous Charges:
SERVICE ACCESSORIES \$150.00

Customer PO No:
Tax Exempt No:
Advisor:

Job Total: \$21,650.55
Grand Total: \$21,650.55

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: _____ Date: _____