

PATTISON AGRICULTURE LIMITED
Box 550
Wynyard, SK S0A 4T0
Phone: (306) 554-2536
Fax: (306) 554-3153
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preecaville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

JGLC JD X SERIES ALL Internal

COMPLAINT:

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO


HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO

THIS UNIT HAS HAD THE CAB CLEANED ☒ (INITIAL)

THIS UNIT HAS HAD A FINAL CHECKOVER ☒ (INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB ☒ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

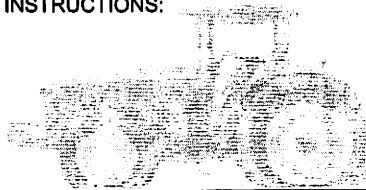

Job Total: \$3,963.00

JFCC JD ALL Internal

COMPLAINT:

02 CLEANUP OF CAB

CORRECTION:

Labor: \$172.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$172.50
-----------------	---------------	--------------	--------------	---------------------

EXPERT-1000000134344 Internal

COMPLAINT:

03 Feederhouse Top Door Seal, Replace

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No: [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: Work Order Number: Payment Type: Page: 2 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000134344 Internal

CORRECTION:

- Removed cover, removed rubber from both sides.
- Installed new rubber.
- Installed cover.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7275	M12-1.75 NUT	2.00	1.81	1.81	\$3.62	N
HXE174701	SEAL	1.00	72.80	72.80	\$72.80	N
Labor: \$136.50		Parts: \$76.42	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$212.92	

EXPERT-1000000073963 Internal

COMPLAINT:

04 Feeder House Conveyor Drive Chain, Remove and Replace

CORRECTION:

- Removed old chain.
- Installed new chain and adjusted to spec adding half links and master.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH223578	LATCH	1.00	187.97	187.97	\$187.97	N
SW80HCOUS	80H Chain Connector link	1.00	15.10	15.10	\$15.10	N
SW80HOLUS	80H Chain Offset Link	2.00	39.16	39.16	\$78.32	N
SW80HX50US	80H ROLLER CHAIN (PER LINK)	158.00	4.05	4.05	\$639.90	N
Labor: \$105.00		Parts: \$921.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,026.29	

EXPERT-1000000213917 Internal

COMPLAINT:

05 Feeder House Lower Drive Chain Guide, Remove and Replace

CORRECTION:

- Installed lower guide plate.

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
 Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
 Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
 Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
 Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
 Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
 North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
 Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
 Kelvington, SK (306) 327-4355
 Shaunavon, SK (306) 297-2639



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 3 of 14
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000213917 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE160082	BOTTOM CHAIN GUIDE	1.00	101.29	101.29	\$101.29	N
Labor: \$105.00		Parts: \$101.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$206.29	

EXPERT-1000000216411 Internal

COMPLAINT:

06 Feeder House Conveyor Chain, Remove half link and tension.

CORRECTION:

- Removed tension from both sides.
- Removed half links from all 4 chains and reattached chain.
- Set tension on both sides to spec.

Labor: \$315.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$315.00
-----------------	---------------	--------------	--------------	---------------------

EXPERT-1000000074009 Internal

COMPLAINT:

07 Feeder House Fore/Aft Sensor, Repair(Loose nut)

CORRECTION:

- Tightened bolt.

Labor: \$157.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$157.50
-----------------	---------------	--------------	--------------	---------------------

EXPERT-1000000139767 Internal

COMPLAINT:

08 Concave Level and Adjust

CORRECTION:

- Install concaves and zed bars
- Level and calibrate

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED]
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Page: 4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000139767 Internal

Labor: \$525.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$525.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000185717 Internal

COMPLAINT:

09 Diagnose concave hydraulic nuts coming loose both sides

CORRECTION:

-Nuts were not torqued correctly previously. Ensure proper torque is applied to lock nuts.

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
----------------------	----------------------	-------------------------	---------------------	--------------------------

DIAG-1000000169009 Internal

COMPLAINT:

10 Concave, REPAIR X3

CORRECTION:

Straighten and repair bent bars

Labor: \$630.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$630.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000075437 Internal

COMPLAINT:

11 Clean bushings in concave supports. Very stiff both sides

CORRECTION:

-Pulled all components and cleaned all then applied graphite but it is still stiff.

Labor: \$840.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$840.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: Work Order Number: Payment Type: Page: 5 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

DIAG-1000000173074 Internal

COMPLAINT:

12 Replace Cleaning Fan Variable Drive Belt

CORRECTION:

Replace cleaning fan variable speed drive belt

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE171894	CLEANING FAN DRIVE BELT	1.00	302.74	302.74	\$302.74	N
Labor: \$315.00		Parts: \$302.74	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$617.74	

EXPERT-1000000076097 Internal

COMPLAINT:

13 Cleaning Fan Variable Speed Driven Sheave Oil, Change

CORRECTION:

-Drained oil
 -Filled with 100ml of 85w140

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6345	85W140 LUBRICANT 946ML GL5	1.00	15.86	15.86	\$15.86	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
Labor: \$35.00		Parts: \$15.86	OL&M: \$0.00	Misc: \$0.15	Sub-Total: \$51.01	

DIAG-1000000173093 Internal

COMPLAINT:

14 Replace hydraulic hose o rings at rotor drive. Damp

CORRECTION:

-Removed and replaced hydraulic o-ring on rotor drive sheave.
 -Torqued to spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: Work Order Number: Payment Type: Page: 6 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

DIAG-1000000173093 Internal						
51M7039	O-RING M10	1.00	4.09	4.09	\$4.09	N
Labor: \$210.00		Parts: \$4.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$214.09	

EXPERT-1000000154413 Internal

COMPLAINT:

15 Static Drag Cable, Install

CORRECTION:

-On hold waiting on parts. possibly a week away

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
STATIC	STATIC DRAG CABLE 3/8"	1.00	242.83	242.83	\$242.83	N
Labor: \$105.00		Parts: \$242.83	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$347.83	

EXPERT-1000000177849 Internal

COMPLAINT:

16 Chopper Blades, Flip

CORRECTION:

- Removed knife bank and flipped knives.
- Installed knife bank.
- Removed, flipped and reinstalled all hammers on chopper.
- Torqued all bolts to spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7868	M8x30 FLG 10.9 BOLT	1.00	1.96	1.96	\$1.96	N
Labor: \$1,155.00		Parts: \$1.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,156.96	

EXPERT-1000000074298 Internal

COMPLAINT:

17 Clean Grain Elevator Chain Sprocket, Remove and Replace Shaft Key

NO LABOR IF DOING SEG 18

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 7 of 14
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000074298 Internal

CORRECTION:

- Removed master link.
- Removed tension bolt and front plate with bearing.
- Moved sprocket over and removed and replace key. Applied lots of green loctite.
- Reassembled and setup to spec. Torqued all bolts to spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
49M6480	SHAFT KEY	1.00	5.07	5.07	\$5.07	N
Labor: \$0.00		Parts: \$5.07	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$5.07	

EXPERT-1000000074332 Internal

COMPLAINT:

18 Clean Grain Elevator Housing-Boot, Repair

CORRECTION:

- Removed master link.
- Moved paddle chain out of the way.
- Ground down area.
- Applied welding capacitor clamp tool to battery terminals.
- Welded crack.
- Ground weld.
- Applied paint.
- Moved chain back down.
- Setup chain installing master link.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7296	M10-1.5 FLG NUT	1.00	2.16	2.16	\$2.16	N
Labor: \$892.50		Parts: \$2.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$894.66	

EXPERT-1000000075959 Internal

COMPLAINT:

19 Rotor Variable Belt, Remove and Replace

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Prescaville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/15/2025 Location: Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 8 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000075959 Internal

CORRECTION:

- Removed rotor hydraulic hose and capped.
- Removed tensioner.
- Removed other belt.
- Installed long bolts onto driven sheave.
- Marked and moved rotor driven backwards with the bolt after loosening the 4 bolts.
- Pushed the sheave with the hydraulic back in releasing all the oil.
- Removed belt.
- Installed new belt.
- Moved driven sheave assembly forwards to spec.
- Removed long bolts from sheave rotating slowly to prevent binding.
- Installed belt back into place.
- Installed tensioner.
- Installed hydraulic hose back on.
- Tested.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE107859	X9 ROTOR DRIVE BELT	1.00	1,347.29	1,347.29	\$1,347.29	N
Labor: \$420.00		Parts: \$1,347.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,767.29	

EXPERT-1000000211821 Internal

COMPLAINT:

20 Rotary Screen / Vacuum Fan Drive Belt, Remove and Replace

CORRECTION:

- Remove and replace rotary screen jackshaft/ vacuum fan drive belt

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE167991	V-Belt	1.00	178.88	178.88	\$178.88	N
Labor: \$262.50		Parts: \$178.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$441.38	

EXPERT-1000000074743 Internal

COMPLAINT:

21 Rotary Screen Driveshaft Bearing, Remove and Replace

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 9 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000074743 Internal

CORRECTION:

- Remove pulleys.
- Cleaned shaft.
- Removed bearings.
- Installed bearings.
- Installed pulleys.
- Torqued all to spec

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70716	Bearing With Housing	2.00	144.84	144.84	\$289.68	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N
Labor: \$525.00		Parts: \$289.68	OL&M: \$0.00	Misc: \$35.00	Sub-Total: \$849.68	

EXPERT-10000000211823 Internal

COMPLAINT:

22 Rotary Screen / Vacuum Fan Drive Belt Tensioner, Remove and Replace

CORRECTION:

- Removed Rotary screen jackshaft / vacuum fan Idler and tensioner.
- Installed rotary screen jackshaft / vacuum fan idler and tensioner.
- Replaced nut on back of tensioner.
- Torqued all to spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE23546	BELT TENS	1.00	567.46	567.46	\$567.46	N
AXE24984	Vacuum Fan Drive Idler	1.00	362.29	362.29	\$362.29	N
Labor: \$105.00		Parts: \$929.75	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,034.75	

DIAG-1000000163658 Internal

COMPLAINT:

23 Service Brake Diagnose and Repair - HAD 517584.6, PTP 523347.18, HAD 1488.7

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Prescerville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 10 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

DIAG-1000000163658 Internal

CORRECTION:

Checked out all the codes on service advisor
 Doesn't seem like anything serious
 None of the codes were active
 Clear codes and run combine to see if any come back

Labor: \$87.32	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$87.32
----------------	---------------	--------------	--------------	--------------------

EXPERT-1000000076465 Internal

COMPLAINT:

24 Chopper Gear Case Oil, Change

CORRECTION:

-Drained oil
 -Filled to capacity.
 -Service Center advised GL-5 for chopper gearcase.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6345	85W140 LUBRICANT 946ML GL5	2.00	15.86	15.86	\$31.72	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N

Labor: \$17.00	Parts: \$31.72	OL&M: \$0.00	Misc: \$0.30	Sub-Total: \$49.02
----------------	----------------	--------------	--------------	--------------------

EXPERT-1000000076099 Internal

COMPLAINT:

25 Feed Accelerator Gear Case Oil, Change

CORRECTION:

-Drained oil.
 -Filled to capacity.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
Box 550
Wynyard, SK S0A 4T0
Phone: (306) 554-2536
Fax: (306) 554-3153
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 12/15/2025
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 11 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000076099 Internal

TY6345	85W140 LUBRICANT 946ML GL5	2.00	15.86	15.86	\$31.72	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N

Labor: \$75.00 Parts: \$31.72 OL&M: \$0.00 Misc: \$0.30 Sub-Total: \$107.02

EXPERT-1000000076100 Internal

COMPLAINT:

26 Main Engine Gear Case Breather, Replace

CORRECTION:

-Removed and replaced MEG breather

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE82230	BREATHER	1.00	135.12	135.12	\$135.12	N

Labor: \$25.00 Parts: \$135.12 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$160.12

EXPERT-1000000074132 Internal

COMPLAINT:

27 Fuel Tank Breather, Remove and Replace

CORRECTION:

-Removed and replaced fuel tank breather.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
H216169	BREATHER	1.00	43.28	43.28	\$43.28	N

Labor: \$17.00 Parts: \$43.28 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$60.28

EXPERT-1000000074129 Internal

COMPLAINT:

28 Diesel Exhaust Fluid Tank Breather, Remove and Replace

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 12 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000074129 Internal

CORRECTION:

-Removed and replaced DEF breather.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER	1.00	43.28	43.28	\$43.28	N
Labor: \$15.00		Parts: \$43.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$58.28	

EXPERT-1000000076481 Internal

COMPLAINT:

29 Air Filter Elements, Change

CORRECTION:

-Removed and replaced primary and secondary filters.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	461.37	461.37	\$461.37	N
HXE11091	Secondary EngAir Filter	1.00	325.55	325.55	\$325.55	N
Labor: \$50.00		Parts: \$786.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$836.92	

EXPERT-1000000073663 Internal

COMPLAINT:

30 Cabin Air Filter, Remove and Replace

CORRECTION:

-Removed and replaced cabin air filter

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.66	40.66	\$40.66	N
TA32591	Cab FreshAir Filter	1.00	121.63	121.63	\$121.63	N
Labor: \$17.00		Parts: \$162.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$179.29	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preaceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 12/15/2025 Location: Work Order Number: Payment Type: Page: 13 of 14
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

EXPERT-1000000118660 Internal

COMPLAINT:

31 Top Up All Fluids TOP UP ALL FLUIDS

CORRECTION:

- Topped up coolant, pressure tested 15psi on system and held for 15min no leaks.
- Pressure tested cap would only hold 13psi and spec is 15psi. Replaced cap.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AT310335	Filler Cap	1.00	54.28	54.28	\$54.28	N
TY22062	HY-GARD J20C 9.46L	1.00	85.28	85.28	\$85.28	N
TY26575	COOL-GARDII 3.78L 50/50 PREMIX	1.00	26.38	26.38	\$26.38	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF25	ENVIRO FEE	1.00	0.25	0.25	\$0.25	N
Labor: \$50.00		Parts: \$165.94	OL&M: \$0.00	Misc: \$1.75	Sub-Total: \$217.69	

EXPERT-1000000135714 Internal

COMPLAINT:

32 Perform Factory Calibration of Sieve and Chaffer

CORRECTION:

Perform factory calibration of sieve and chaffer

Labor: \$210.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$210.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN01- Internal

COMPLAINT:

33 THINGS TO NOTE THAT DO NOT REQUIRE REPAIR YET

- clean grain elevator top sprocket starting to hook
- rotor gearcase was not staying in gear, was diagnosed on another ro

PATTISON AGRICULTURE LIMITED
 Box 550
 Wynyard, SK S0A 4T0
 Phone: (306) 554-2536
 Fax: (306) 554-3153
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Internal Used Stock No. [REDACTED] Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 12/15/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 14 of 14
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	936	1H0X911XEP0825334	176997	#1

**JGEN01- Internal
CORRECTION:**

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
---------------	---------------	--------------	--------------	-------------------

Miscellaneous Charges:
 SERVICE ACCESSORIES \$150.00

Customer PO No:
 Tax Exempt No:
 Advisor: Tyler Ford

Job Total: \$17,544.90
Grand Total: \$17,544.90

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: