

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351 Yorkton, SK (306) 783-9459
 Maple Creek, SK (306) 662-2233 Balcarres, SK (306) 334-2492
 Kindersley, SK (306) 463-2683 Moosomin, SK (306) 435-3301
 Kyle, SK (306) 375-2302 Preeceville, SK (306) 547-2007
 Leader, SK (306) 628-3889 Russell, MB (204) 773-2149
 Unity, SK (306) 228-2696 Wynyard, SK (306) 554-2536
 North Battleford, SK (306) 445-4468 Kamsack, SK (306) 542-2814
 Humboldt, SK (306) 682-2572 Swan River, MB (204) 734-3466
 Kelvington, SK (306) 327-4355
 Shaunavon, SK (306) 297-2639



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
Bus Phone:	Bus Phone:	Invoice Date: 4/16/2020
Prv Phone:	Prv Phone:	Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
		Page: 1 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGLSPR JD R4045 Internal

COMPLAINT:

01 SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
 OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
 IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS 1449

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
 HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
 CAB HAS BEEN COMPLETELY CLEANED ☐ NA (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER ☐ KL (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB ☐ KL (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	77.14	77.14	\$77.14	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
LABDIS	LAB DISC CUST	-2.00	391.07	391.07	(\$782.14)	N
Labor: \$1,860.00		Parts: \$77.14	OL&M: \$0.00	Misc: (\$782.14)	Sub-Total: \$1,155.00	

JFCC JD ALL Internal

CORRECTION:

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
LABDIS	LAB DISC CUST	-1.00	157.50	157.50	(\$157.50)	N
Labor: \$157.50		Parts: \$0.00	OL&M: \$0.00	Misc: (\$157.50)	Sub-Total: \$0.00	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 4/16/2020 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 2 of 8
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	


JGEN03- Internal
 COMPLAINT:
 REMOVE CROP DIVIDER BRACKETS

CORRECTION:

Labor: \$232.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$232.50
-----------------	---------------	--------------	--------------	---------------------

JHUBMAINT JD R4045 Internal
 COMPLAINT:
 04 SPRAYER PLANETARY MAINTENANCE.

CORRECTION:
 DRAINED PLANETARY WHEEL HUB OIL.
 REMOVED PLANETARY HUB COVERS.
 REMOVED AND SWAPED INTERNAL GEARS.
 INSTALLED HUB COVERS.
 INSTALLED NEW PLANETARY OIL.
 FUNCTION AND LEAK CHECKED.

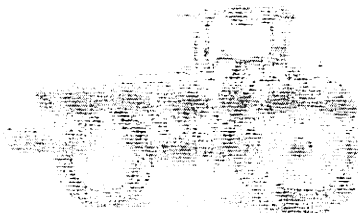

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	11.00	27.23	27.23	\$299.53	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	11.00	0.15	0.15	\$1.65	N

Labor: \$713.00	Parts: \$299.53	OL&M: \$0.00	Misc: \$1.65	Sub-Total: \$1,014.18
-----------------	-----------------	--------------	--------------	-----------------------

JGEN05- Internal
 COMPLAINT:

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 4/16/2020
		Location: [REDACTED]
Bus Phone:	Bus Phone:	Work Order Number: [REDACTED]
Prv Phone:	Prv Phone:	Payment Type: [REDACTED]
		Page: 3 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN05- Internal ENGINE

- Replace engine oil and filter
- Replace engine air filters
- Diagnose on board air compressor oil leak
- Oil pan gasket leaking very slightly (about a 30 hr job, need to discuss)
- Top up coolant, low
- Replace fuel filters
- Replace 2 coolant hoses, damaged
- Replace on board air dryer cartridge

CORRECTION:

- Replaced engine oil and filter
- Replaced engine air filters
- on board air leak was the discharge fitting had come loose and was leaking oil. Only way to access the compressor to repair the fitting is through the cab floor, removed floor mat, cab floor panel, repaired compressor, re-sealed floor panel, installed floor mat.
- Topped up coolant
- Replaced fuel filters
- coolant hose had a very bad spot on it where it was rubbing on the corner of the engine. The other hose was folded over by the hood, that hose would not regain its proper shape and remained pinched off. Both hoses required replacement. Drained coolant, replaced hoses, installed coolant and ran machine. topped off coolant
- Replaced on board air dryer cartridge

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK11031	Air Dryer Cartridge	1.00	191.32	191.32	\$191.32	N
AN403918	Primary Engine Air Filter	1.00	206.70	206.70	\$206.70	N
AN403919	Secondary Engine Air Filter	1.00	179.76	179.76	\$179.76	N
KK21906	Hose	1.00	87.75	87.75	\$87.75	N
KK25452	Hose	1.00	54.63	54.63	\$54.63	N
R44302	Tie Band 8" 100/pk	10.00	0.31	0.31	\$3.10	N
RE509672	Engine Oil Filter	1.00	31.49	31.49	\$31.49	N
RE533910	Fuel Filter Final	1.00	184.08	184.08	\$184.08	N
RE539465	Primary Fuel Filter	1.00	128.47	128.47	\$128.47	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 4/16/2020 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 4 of 8
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN05- Internal

TY26575	COOL-GARDII 3.78L 50/50 PREMIX	1.00	17.83	17.83	\$17.83	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	6.39	6.39	\$6.39	N
TY26675	PLUS-50 II 15W-40 CK4/SN JUG 9.46L	1.00	57.80	57.80	\$57.80	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	1.00	110.05	110.05	\$110.05	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.00	1.00	\$2.00	N
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF25	ENVIRO FEE	1.00	0.25	0.25	\$0.25	N
EF300	ENVIRO FEE	1.00	3.00	3.00	\$3.00	N
EF50	ENVIRO FEE	1.00	0.50	0.50	\$0.50	N

Labor: \$1,007.50 Parts: \$1,259.37 OL&M: \$0.00 Misc: \$7.40 Sub-Total: \$2,274.27

JGEN06- Internal

COMPLAINT:
HYDRAULICS

- Replace hydraulic filters(x3)
- Replace o rings on high pressure lines, leaking
- Reseal full boom breakaway cylinder
- Replace hydraulic oil

CORRECTION:

- Replaced hydraulic filters(x3)
- Replaced o rings on high pressure lines, to do this hyd. oil had to be drained out. Replaced all o-rings where there was signs of leaking.
- relived accumulator pressure, removed pins and lines. Removed cylinder, disassembled and resealed. installed onto machine and checked for leaks.
- Replaced hydraulic oil

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preecerville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 4/16/2020 Location: XXXXXXXXXX Work Order Number: XXXXXXXXXX Payment Type: XXXXXXXXXX Page: 5 of 8
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN06- Internal

AH212089	Hydraulic Cylinder Kit	1.00	128.34	128.34	\$128.34	N
AHC11572	Hyd Cyl Rod Seal Kit 45mm	1.00	142.70	142.70	\$142.70	N
AN203010	Hydraulic Filter	2.00	79.60	79.60	\$159.20	N
AT318160	Hydraulic Oil Filter	1.00	139.68	139.68	\$139.68	N
T59014	-12_6xFlg O-ring	8.00	7.18	7.18	\$57.44	N
TY26797	DONT USE ***10W30 18.9L Torq-Gard CJ4/SM	6.00	99.30	99.30	\$595.80	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.00	1.00	\$1.00	N
EF300	ENVIRO FEE	6.00	3.00	3.00	\$18.00	N
EF50	ENVIRO FEE	2.00	0.50	0.50	\$1.00	N

Labor: \$736.25 Parts: \$1,223.16 OL&M: \$0.00 Misc: \$20.00 Sub-Total: \$1,979.41

JGEN07- Internal

COMPLAINT:
 OPERATORS STATION

- Diagnose no cab pressure
- Replace cab filters
- Replace rear window seal
- Diagnose washer fluid pump, not working

CORRECTION:

- Diagnose no cab pressure- combination of plugged cab filters, dirty pressure indicator and bad window seal all contributed to no cabin pressure. After all issues were resolved cab pressure was in spec.
- placed cab filters in cab for next spraying operation.
- Replaced rear window seal
- replaced windshield washer fluid pump.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AL205623	WasherReservoirPump	1.00	26.76	26.76	\$26.76	N
PM37532	Weatherstrip Adhesive 147ml	1.00	10.41	10.41	\$10.41	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Internal Used Stock No. XXXXXXXXXX Bus Phone: Prv Phone:	Invoice Number: XXXXXXXXXX Invoice Date: 4/16/2020 Location: Work Order Number: Payment Type: Page: 6 of 8
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN07- Internal

R545598	ISOLATOR	1.00	148.93	148.93	\$148.93	N
RE333567	CabFreshFilter Carbon	1.00	509.80	509.80	\$509.80	N
RE333569	CabRecircFilter Carbon	1.00	405.26	405.26	\$405.26	N

Labor: \$426.25	Parts: \$1,101.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,527.41
------------------------	--------------------------	-------------------------	---------------------	------------------------------

JGEN08- Internal

COMPLAINT:
CHASSIS

- Clean, lube and adjust all 4 axles
- Clean debris from air bag folds

CORRECTION:

Jacked up machine one corner at a time, stretched out airbag and cleaned out debris.

Cleaned up all 4 axles, lubed, jacked up each corner and adjusted gaps. Checked operation.

Labor: \$465.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$465.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN09- Internal

COMPLAINT:
SOLUTION SYSTEM/BOOMS

- Replace tank level tube
- Repair solution air bleed valve, damaged
- Reseal solution pump(will leave this till it warms up to do additional testing)

CORRECTION:

-Replaced tank level tube
 -solution pump air bleed valve had the hose fallen out, valve was full of dirt and a fitting was broken on it. Disassembled and cleaned up, replaced damaged fitting, Cleaned up electrical connections (connector was also left unplugged and was very dirty). Installed onto machine and checked operation.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preecaville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED]
		Invoice Date: 4/16/2020
		Location: [REDACTED]
		Work Order Number: [REDACTED]
		Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	Page: 7 of 8
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN09- Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN303283	Hose Fitting	1.00	22.56	22.56	\$22.56	N
PMHB02505090	Fitting	1.00	1.37	1.37	\$1.37	N
PMK010-1216	3/4" Clear PVC /ft	5.00	2.03	2.03	\$10.15	N
Labor: \$465.00		Parts: \$34.08	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$499.08	

JGEN10- Internal

COMPLAINT:
ELECTRICAL

-Update 5 control units
 -Repair aux battery posts, no power

CORRECTION:
updated control units

Aux battery post positive wire was broken off. While removing nut install new eyelet, stud broke off. New terminal post was required. Installed new post and checked operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 Box 860
 Moosomin, SK S0G 3N0
 Phone: (306) 435-3301
 Fax: (306) 435-3082
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. [REDACTED]	Internal Used Stock No. [REDACTED]	Invoice Number: [REDACTED] Invoice Date: 4/16/2020 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED]
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4045 120' W/710/65R46	1449	1N04045RHH0176457	758795	

JGEN10- Internal						
AN205832	Positive Power Bulkhead Post	1.00	55.84	55.84	\$55.84	N

Labor: \$465.00	Parts: \$55.84	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$520.84
------------------------	-----------------------	-------------------------	---------------------	----------------------------

Miscellaneous Charges:
 SERVICE ACCESSORIES \$150.00

Customer PO No:
Tax Exempt No:
Advisor: KARLEE KARAKOCHUK

Labor: \$6,528.00
Parts: \$4,050.28
OL&M: \$0.00
Misc: (\$760.59)
Grand Total: \$9,817.69

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: