

CW-9



10491 Finning Frontage Road
 Fort St John BC V1J 8A9
 Phone: 250-784-7966
 E-mail: gary@total-inspection.ca

HOSE TEST CERTIFICATE

Customer RELiance VENTURE INC

Unit # T129

Invoice # _____

**THIS CERTIFICATE IS PROOF THAT ALL ASSEMBLIES LISTED BELOW HAVE BEEN TESTED
 HYDROSTATICALLY**

SERIAL #	TEST PRESSURE	WORKING PRESSURE	HOLD TIME	VISUAL EXTERNAL INSPECTION
2578	180 PSI	150 PSI	5 MINS	PASSED
2579	180 PSI	150 PSI	5 MINS	PASSED
2580	180 PSI	150 PSI	5 MINS	PASSED

STEWART SKAFTE

AUG 5 2026

Tested By _____

Signature _____

Date Tested _____

External Visual Inspections (14260)

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Dean
Reliance Ventures Inc.

9514 158 ave
Grande Prairie, AB, T8X0B9
Ph. No. - 780-814-0274

Tank

Ser. No.	14260	Unit Number	T129
TC Spec.	TC/DOT 407	Service Type	["Dedicated Service"]
Date of mfr.	2014-08	Cert. date	2014-08
VIN	1T9DL4835FS588029	Tank mfr.	Tremcar
Assembler	Tremcar	MDIN	14258
MAWP	172 kPa	Test P.	310.10 kPa
Mfd. head thick	9.525 mm	Min. head thick	6.985 mm
Mfd. shell thick	6.350 mm	Min. shell thick	5.969 mm
Exposed Surface	93 m2	Cap.	45850 litres
Design Temp. Range	-40 C to 93 C	Max. Lading Density	1.20 kg/L
Shell Material	SB209-A95454-H32	Head Material	SB209-A5454-0
Weld Material	ER5356	Max. Payload	37195 kg
Max. Load Rate	1893 L/m at 172.28 kPa	Max. Unload Rate	1893 L/m at 172.28 kPa
Original Test Date	2014-08		

External Visual Inspection

Inspection Date	2025-07-07	Inspection Expiry Date	2026-07-31
Manway Pressure	30 psi		

Inspection

Inspect jacketing for dents, digs, scrapes, gouges, perforations, stains, or other defects or signs of damage to the inner vessel or any other condition that might make it unsafe as per 7.2.1(a)
Pass

Inspect the entire area of head and shell for dents, gouges, bulges, corrosion, abrasion, cracks, or signs of leakage or other conditions that might render it unsafe for transport as per 7.2.1(a)
Pass

Inspect the entire length of every weld for cracks, defects or signs of leakage as per 7.2.1(a)
Pass

Ensure devices for tightening manhole covers are operative and covers are leak tight as per 7.2.1(b)
Pass

Check all valves, vents, emergency devices and remote closures for corrosion, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(c)
Pass

Ensure all required markings are legible including manway, PRV, couplings, valves and specification plate as per 7.2.1(e)
Pass

Inspect supporting structures, pads, bolsters, tie-downs and protective devices for dents, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(f)
Pass

Ensure accompanying or mounted hoses comply with inspection and marking requirements as per 7.2.10.4 and 7.2.10.6
Pass

Check to ensure voids are unplugged and show no signs of leakage as per 7.2.1.2
Not Applicable

Corroded or abraded areas are thickness tested as per 7.2.1.3

Not Applicable

All pressure relief devices are inspected for corrosion or damage as per 7.2.1.4

Pass

If lading is corrosive to PRV: re-closing pressure relief valves are replaced or tested as per 7.2.1.4(b)

Not Applicable

Gaskets on full opening rear head is inspected and replaced if cut, cracked or split as per 7.2.1.5

Not Applicable

Internal self closing valve and off truck emergency shut down system tested as per 7.2.1.6

Not Applicable

Ensure that all bolts or nuts on any flanged connection or blank flange are in place and properly tightened

Pass

Defects

No defects found.


Tank Disposition

Current Disposition	Passed / No Defects Found
---------------------	---------------------------

Approval



Inspector
Signed by Richard Beeler

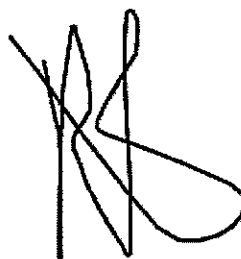

Tester
Signed by Richard Beeler

Service provided by **eStandardSolutions**

Leakage Tests (14260)

Created By: **Richard Beeler**

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Dean
Reliance Ventures Inc.

9514 158 ave
Grande Prairie, AB, T8X0B9
Ph. No. - 780-814-0274

Tank

Ser. No.	14260	Unit Number	T129
TC Spec.	TC/DOT 407	Service Type	["Dedicated Service"]
Date of mfr.	2014-08	Cert. date	2014-08
VIN	1T9DL4835FS588029	Tank mfr.	Tremcar
Assembler	Tremcar	MDIN	14258
MAWP	172 kPa	Test P.	310.10 kPa
Mfd. head thick	9.525 mm	Min. head thick	6.985 mm
Mfd. shell thick	6.350 mm	Min. shell thick	5.969 mm
Exposed Surface	93 m2	Cap.	45850 litres
Design Temp. Range	-40 C to 93 C	Max. Lading Density	1.20 kg/L
Shell Material	SB209-A95454-H32	Head Material	SB209-A5454-0
Weld Material	ER5356	Max. Payload	37195 kg
Max. Load Rate	1893 L/m at 172.28 kPa	Max. Unload Rate	1893 L/m at 172.28 kPa
Original Test Date	2014-08		

Leakage Test

Inspection Date	2025-07-07	Inspection Expiry Date	2026-07-31
Test Medium	Air	No. of Compartments	1

Compartment #	Start (psi)	End (psi)	Hold Time (min)	Capacity
1	20	20	5	45850L

Venting devices hold pressure as required, if removed they are bench tested and hold pressure as required

Pass

Product piping and valves hold pressure without leakage

Pass

Manways and closures inspected for leaks or deformation

Pass

Flanged connections checked for leakage

Pass

Inspect the entire area of the head, shell and welds for leaks or deformation including voids and adjacent compartments

Pass

Test pressure maintained for minimum of 5 minutes

Pass

All leaks are repaired before the tank is marked

Not Applicable

Inspect head shell


Defects

No defects found.


Tank Disposition

Current Disposition	Passed / No Defects Found
---------------------	---------------------------

Approval

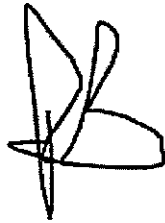

Inspector
Signed by Richard Beeler

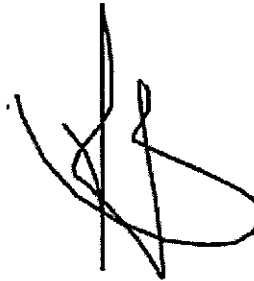

Tester
Signed by Richard Beeler

Service provided by **eStandardSolutions**



Test and Inspection Report in Accordance with CSA B620

Facility Name:	Total Inspection Services Inc.	Work Order Number:	5987
Address:	10491 Finning Frontage Road Fort St John BC V1J 8A9	Date:	AUG 7 2026
Telephone:	250-784-7966	Transport Canada	
Tank Owner:	RELIANCE VENTURES INC	Facility Registration #:	25-0847
Address:	PO BOX 6242 FORT ST JOHN BC V1J 4H6	331 Construction:	N/A
Telephone:	250-793-1009	Tank TCRN/MDIN:	14258
		Unit #:	T129

Tank Serial #:	14260	Tank Spec:	TC / DOT 407
Manufacturer:	TREMCAR USA INC	Mfr. Date:	08/2014
Special Service:	N/A	Lined:	Yes ☐ No ☒
MAWP or Design Pressure:	172 KPA	Insulated:	Yes ☐ No ☒
Min Shell thickness:	5.969 MM	Min Head Thickness:	6.985 MM

Cert. Date: 08/2014 Assembler: TREMCAR USA INC

Gauge Calibration Checked: Yes ☒ No ☐ Gauge #: D2

Capacity: ☐ Total US gals ☒ Total Litres ☐ Total Imp gals

Compartments: 1. 45850 2. 3. 4.

TEST PERFORMED ☒ V – shall signify external inspection ☒ K – shall signify leakage test

EXTERNAL VISUAL INSPECTION "V"

	Complies	Reject	N/A	Complies on Retest
Data plate, present and legible	☒	☐	☐	☐
Shell & Heads, corrosion, abrasion, dents, overlay patches, leaks etc.	☒	☐	☐	☐
Structural members, outriggers, cross members, etc.	☐	☒	☐	☒
Piping and valves for leakage, damage, corrosion	☒	☐	☐	☐
Remote closures, emergency shut off decals, thermal devices	☒	☐	☐	☐
Hoses for defects, identification and test dates	☒	☐	☐	☐
Gaskets on full opening rear heads for damage or cuts	☐	☐	☒	☐
Tank attachments to frame or running gear	☒	☐	☐	☐
Ladders, walkways, etc.	☒	☐	☐	☐
Fill covers, manways and closure devices	☒	☐	☐	☐
Relief valves and vents (replace or test if tank in service where lading corrosive to relieve device)	☐	☒	☐	☒

Accident damage protection	☒	☐	☐	☐
----------------------------	-------------------------------------	--------------------------	--------------------------	--------------------------

LEAKAGE TEST "K"

Test Pressure: 137.6 KPA (80% of MAWP Min.) Test Medium: AIR Hold Time: 5 MINS

Item Tested				Item Tested			
	Pass	Fail	Complies on Retest		Pass	Fail	Complies on Retest
Compartment # 1	☒	☐	☐	Compartment # 1 Piping	☒	☐	☐
Compartment # 2	☐	☐	☐	Compartment # 2 Piping	☐	☐	☐
Compartment # 3	☐	☐	☐	Compartment # 3 Piping	☐	☐	☐
Compartment # 4	☐	☐	☐	Compartment # 4 Piping	☐	☐	☐

Defects found, location and corrective action (use additional sheets if necessary)

VENT PIPE CRACKED
RHS FENDER BRACKET CRACKED
HOSE TRAY VRACKED LHS
MANUAL VENT VALVE

Defects corrected and released
Tank successfully retested after repair

☒ Yes ☐ No
☒ Yes ☐ No

Tank Disposition: ☐ Returned to service as no defects or damage was discovered
☒ Returned to service after retest
☐ Removed from service

Tank Marking: 08 26 VK 847

Month, year and service symbol (MMYY XXXXXX 000) after all defects are corrected.

Tank markings applied

☒ Yes ☐ No

Tank Tester Name:

Stewart Skafte

Signature:



Date: AUG 7 2026