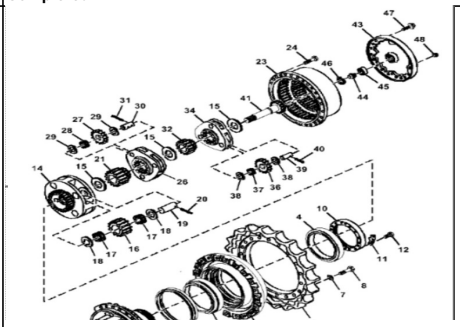
Sage Creek
Oilfield Services
Integrity Respect Excellence

2019 Hitachi ZX350LCK-6
SN#HCMDDQA5J0080535

Date	Purchase Price	Maintenance Item	Odometer	Description
November 10 2024		PM#1	3248	Engine oil, final drive oil, oil filter, fuel filters
January 30 2025		PM#2	3791	Engine oil, final drive oil, oil filter, fuel filters, cabin air, primary air, secondary air
April 5 2025		PM#1	4226	Engine oil, final drive oil, oil filter, fuel filters
July 12 2025		PM#2	4653	Engine oil, final drive oil, oil filter, fuel filters, swing oil, cabin air, primary air, secondary air
July 17 2025		Tensioner spring removal	4660	Removed track pads, removed track tensioner spring to be shipped to union tractor
July 19 2025		Tensioner spring replaced	4660	Cleaned mud from track frame, installed new track tensioner, cleaned yoke faces and torqued idler, reinstalled track pads
November 1 2025		Air Seat Installation	4937	Install aftermarket seat, wire to 24V system
November 13 2025		Carrier Rollers	5025	Replace both right carrier rollers, adjust track
November 17 2025		Track Tensioners	5070	Release track tension, heat and chip away to expose roller bolts, jack up track, block track, remove carrier rollers, buff and clean mating surfaces, tap out bolt holes, buff bolts for reuse, install carrier roller, tension track
November 28 2025		PM#2 + Hyd. Oil	5151	PM#2 +
November 30 2025		After treatment alarms	5155	Diagnose after treatment alarms, clear codes and preform ECM ma ster reset, run unit, preform forced regen successfully and monitor stats, diagnnose ECM ERPROM abnormaility code, code clears successfully, code continues to become active upon key cycle, inspect ECM connector harness, function test unit with active code no derate
February 28 2026		PM#1	5645	Preformed PM#1
August 25 2026		Engine Codes	6403	10013-02 abnormal ECU, ECM detects problems with EEPROM, active for 200hrs, 20101-02 engine code present
September 26 2026		PM#2	6500	Completed PM#2
October 2 2026		Travel Motor Shaft	6500	 Exchanged external travel motor shaft #41
October 14 2026		ECM		Removed ECM and sent to Triple Threat Diesel for tuning