

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 1 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

JBLOW JD ALL Internal

COMPLAINT:

02 BLOW OFF COMBINE AND CLEAN HOPPER

CORRECTION:

Done.

Labor: \$800.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$800.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076277 Internal

COMPLAINT:

05 Engine Oil and Filter, Change.

CORRECTION:

1. Remove and replace the oil filter.
2. To remove the oil, open the drain valve.
3. To fill the oil, remove the cap.
4. Check the oil level after filling with dipstick.
5. The oil level should be at the "FULL" mark on the dipstick.



Wednesday, April 2, 2025 8:11 PM - DRAINED OLD OIL AND REMOVED FILTER, install new filter and filled oil to full mark on dipstick- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	156.67	156.67	\$156.67	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	9.92	9.92	\$9.92	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
Labor: \$125.00	Parts: \$679.17	OL&M: \$0.00	Misc: \$10.40	Sub-Total: \$814.57		

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	2 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000211821 Internal

COMPLAINT:

06 Rotary Screen / Vacuum Fan Drive Bearings and Shaft Replace

CORRECTION:

Thursday, April 3, 2025 1:10 PM - nts

1. Pull lockout pin and rotate handrail up until the handrail locks into place.
2. Open engine access cover.
3. Remove engine access shield.
4. Use a breaker bar to relieve belt tension from the tensioner arm and remove the rotary screen driven belt.
5. Use a breaker bar to relieve tension from the tensioner arm and install the replacement rotary screen driven belt.
6. Install the previously removed shield.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
49M4100	Shaft Key, M6x25	1.00	6.03	6.03	\$6.03	N
49M5606	Shaft Key M6x50	1.00	3.70	3.70	\$3.70	N
AXE70716	BEARING WITH HOUSING, 25 ID W/ SET	2.00	144.20	144.20	\$288.40	N
HXE166406	SHAFT	1.00	517.08	517.08	\$517.08	N
Labor: \$900.00		Parts: \$815.21	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,715.21	

DIAG-1000000171161 Internal

COMPLAINT:

07 Hydraulic Reservoir, Repair Leaking Hose

CORRECTION:

- Thursday, April 3, 2025 3:39 PM - nts
- Remove line
 - Clean up
 - Tighten

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	3 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

DIAG-1000000171161 Internal

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000073791 Internal

COMPLAINT:

08 Feeder House Conveyor Chain Wear Strips, Remove and Replace.

CORRECTION:

Tuesday, April 1, 2025 2:04 PM - nts

1. Lower the feeder house. Loosen lock nuts and slide latches toward the center of the machine. Remove the top inspection cover and position on the rotor cover.
2. Install wooden block between conveyor slat and frame on both sides.
3. Remove cap screw and washer and wear strip. Replace as necessary.
4. Install wear strip using cap screw and washer.
5. Remove wooden blocks on both sides.
6. Install top door.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE144929	Fixed Frame Strip	8.00	78.94	78.94	\$631.52	N

Labor: \$400.00	Parts: \$631.52	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,031.52
------------------------	------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000074132 Internal

COMPLAINT:

09 Fuel Tank Breather, Remove and Replace.

CORRECTION:

1. Remove the cap, breather, and O-ring from the fuel tank.
2. Check for leaks.
3. Inspect and replace as necessary.
4. Install in reverse order following these special instructions.
5. - Install the O-ring and breather. Tighten the breather to specification.
6. - Install the cap and tighten to specification.

Wednesday, April 2, 2025 12:25 PM - replaced fuel tank breather-KB

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 4 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074132 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H216169	BREATHER, FUEL TANK	1.00	47.04	47.04	\$47.04	N
Labor: \$17.00		Parts: \$47.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$64.04	

EXPERT-1000000088467 Internal

COMPLAINT:

10 Update All Controller Software.

CORRECTION:

1. Update all available controller software.

Friday, March 28, 2025 6:02 PM - nts

-Update all software

-Display software not downloading

Tuesday, April 1, 2025 2:27 PM - nts

-Went through diagnostic steps to update display software, after several attempts software finally downloaded

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000176686 Internal

COMPLAINT:

13 Left-Hand Separator Tines, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 5 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000176686 Internal

Wednesday, April 2, 2025 4:24 PM - nts

1. Remove separator grates for rotor access.
2. Inspect wear on separator tines.
3. Remove cap screws and separator tines.
4. Use Threshing Elements and Separator Tine Location diagram for identifying elements and tines.
5. Tighten the separator tine cap screws to specification. took extra time, bolt cross threaded
6. Install separator grates back on

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KXE10959	X9 Rotor Tine Set, UNIVERSAL	13.00	316.54	316.54	\$4,115.02	N
Labor: \$800.00		Parts: \$4,115.02	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,915.02	

EXPERT-1000000076478 Internal

COMPLAINT:

14 Loading Auger Pivoting Gear Case Oil, Add.

CORRECTION:

1. Top up loading auger pivoting gear case oil.

Wednesday, April 2, 2025 9:04 PM - checked fluid level and topped up as needed-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6296	80W90 946ml GL5	1.00	15.99	15.99	\$15.99	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
Labor: \$25.00		Parts: \$15.99	OL&M: \$0.00	Misc: \$0.15	Sub-Total: \$41.14	

EXPERT-1000000074803 Internal

COMPLAINT:

15 Engine Deck Access Ladder, Remove and Replace.

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 6 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074803 Internal

CORRECTION:

Friday, April 4, 2025 4:30 PM - nts

- Remove top step ladder
- Repair bend in lock mechanism
- Repair pin
- Install ladder and check functionality
- Tighten shock bolts for ladder to get to top of combine

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

DIAG-10000000169847 Internal

COMPLAINT:

16 Clean Grain Elevator Housing and Boot, Diagnose and Repair 2.

CORRECTION:

Friday, April 4, 2025 1:58 PM - inspected lower clean grain elevator boot and found cracked center panel, removed boot from unit and cleaned and welded crack shut, reinstalled lower boot to unit and re installed half link for grain elevator adjusted tension to spec. -KB

Labor: \$600.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$600.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-10000000139767 Internal

COMPLAINT:

17 Concave Level and Adjust.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 7 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000139767 Internal

Wednesday, April 9, 2025 6:05 PM - nts

1. Start engine and press the threshing clearance adjust switch.
2. Set threshing clearance to 0.
3. Remove the front separator grate deflector.
4. Remove cap screws, cap screws and nuts, and the front separator grate.
5. Move handle to shift the rotor gear case in the neutral position.
6. Loosen the lower lock nut, lower adjustment nut, and the upper lock nut on the front and rear concave cylinders.
7. While turning the left-hand rotor clockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements "tick" against the rotor. Back off the nut one full turn. Tighten nut finger tight.

Thursday, April 10, 2025 5:55 PM - nts

8. While turning the right-hand rotor counterclockwise by hand, tighten the upper adjustment nut slowly on the front concave cylinder until the elements "tick" against the rotor. Back off the nut one full turn. Tighten nut finger tight.
9. Tighten the lower adjustment nut on the front and rear concave cylinders to specification.
10. Tighten the upper and lower lock nuts.
11. Perform the calibration. (See Supporting Documents - User Calibrations - Procedures).

Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000075643 Internal

COMPLAINT:

18 Right-Hand Concave, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 8 of 30


Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000075643 Internal

Thursday, April 3, 2025 6:00 PM - nts

1. Start engine and press threshing clearance adjust switch.
2. To allow easier access to "Z" bar hardware, touch plus (+) or minus (-) symbol, or rotate the selection dial to set threshing clearance to 5.
3. Using the handle, shift the rotor gear case to the neutral position.
4. Remove cap screw and cover support.
5. Remove cap screws and nuts and the side hill divider from the front chaffer crop divider.
6. Remove the cap screws and nuts from the "Z" bar.
7. Remove cap screws from the concave and concave support.
8. Slide and remove the concaves out the side of the machine.
9. Repair or replace as necessary.

Friday, April 4, 2025 11:18 AM - nts

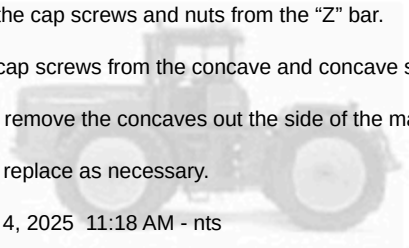

10. Install in reverse order following these special instructions.
11. Guide and install concaves onto the concave supports using cap screws and tighten.
12. Verify ends of concaves fit snug into "Z" bar; then tighten cap screws and nuts.
13. Adjust concave level. (See Supporting Document - Adjust Concave Level).
14. Install separator covers and shift rotor drive handle to previous position.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE87792	FRONT LIP - RH	1.00	325.06	325.06	\$325.06	N
AXE96613	X9 SMALL WIRE CONCAVE REG WEAR	2.00	928.71	928.71	\$1,857.42	N

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 9 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000075643 Internal

HXE142914	CONCAVE WIRE	1.00	13.80	13.80	\$13.80	N
-----------	--------------	------	-------	-------	---------	---

Labor: \$600.00	Parts: \$2,196.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,796.28
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000076341 Internal

COMPLAINT:

19 Fast Fill Fuel Cap and Valve, Remove and Replace.

CORRECTION:

1. Drain fuel and close fuel tank shutoff valve.
2. Remove cap screws and clamps from fuel line brackets.
3. Remove and replace fast fill fuel cap and valve.
4. Assemble in reverse order.

Wednesday, April 2, 2025 12:26 PM - remove and replace fuel cap-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AT346094	Cap	1.00	208.75	208.75	\$208.75	N
Labor: \$20.00		Parts: \$208.75	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$228.75	

EXPERT-1000000213916 Internal

COMPLAINT:

20 Feeder House Upper Drive Chain Guide, Remove and Replace.

CORRECTION:

1. Loosen and remove drive chain, if necessary.
2. Remove cap screws, nuts, and chain guide bracket.
3. Remove and replace feeder house drive chain plastic guide.
4. Assemble in reverse order.
5. Adjust chain tension by using a pry bar in the holes on the inside plate to move the sprocket forward and tighten nut to specification.

Wednesday, April 2, 2025 12:08 PM - replaced same time as chain-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 10 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000213916 Internal

HXE159287	Guide	1.00	79.64	79.64	\$79.64	N
-----------	-------	------	-------	-------	---------	---

Labor: \$100.00	Parts: \$79.64	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$179.64
------------------------	-----------------------	-------------------------	---------------------	----------------------------

DIAG-1000000173136 Internal

COMPLAINT:

21 Chopper Stationary Knife Actuator and Wiring Harness, Diagnose and Repair 1.

CORRECTION:

Thursday, April 3, 2025 2:49 PM - checked harness no issues found manual actuator on stationary knives-KB

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000175771 Internal

COMPLAINT:

22 Feeder House Top Shaft, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	11 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000175771 Internal

1. Raise the feeder house.
2. Remove shields from both sides of the feeder house.
3. Loosen nut on both sides of the feeder house.
4. Remove quick-lock pin and move lever down to open the stone trap.
5. Install the quick-lock pin into hole locking the stone trap in the open position.
6. Using drive belt, turn conveyor chain until connecting links are near top shaft sprockets.
7. Remove the slip clutch assembly. (See Supporting Document - Remove and Install Top Shaft Slip Clutch).
8. Loosen nuts and remove belt.
9. Lower the feeder house. Remove cap screws and bracket. Remove cap screws and nuts and brackets. Loosen lock nuts and slide latches toward the center of the machine. Remove the top inspection cover.
10. Remove cap nuts, connection link plates, and threaded connecting links. Secure conveyor chain inside the feeder house.
11. Remove cap screws from the bearing housing.
12. Remove support bracket. Reposition hoses and wiring harnesses for clearance.
13. Remove cap screws and bearing housing from shaft.
14. Move top shaft towards the left-hand side. Raise the right-hand end and remove from the feeder house. Inspect parts and replace as necessary.
15. Replace top shaft bearings.
16. Install top shaft into the feeder house.
17. Install bearing assembly and cap screws. Do not tighten at this time.
18. Install hoses, and support bracket.
19. Install bearing assembly and cap screws. Tighten bearing assembly cap screws on both sides to specification.
20. Install conveyor chain onto sprockets. Connect chain ends with threaded connecting link and connecting link plate. Apply medium strength thread lock to connecting link. Install cap nuts and tighten to specification.
21. Install top inspection cover. Slide latches out and tighten lock nuts. Install brackets and cap screws and nuts. Place bracket and install cap screws. Raise the feeder house.
22. Install belt and tighten belt tensioner nuts.
23. Install the slip clutch assembly. (See Supporting Document - Remove and Install Top Shaft Slip Clutch).
24. Close stone trap door.
25. Adjust conveyor chain tension using nut evenly on both sides of the feeder house.
26. Install shields on both sides of the feeder house.
27. Adjust conveyor chain tension using nut on both sides of the feeder house. (See Supporting Document - Feeder House Conveyor Chain—Adjusting).

Thursday, April 3, 2025 6:41 PM - removed feeder house drive chain and then slip clutch, removed feeder chain links to get feeder chain off top shaft, removed left side bearing and slid top shaft over to remove right side bearing, replaced right side bearing and slid shaft back in to position, installed left side bearing and shaft assembly, torqued slip clutch bolt to 223 FT/Lbs reinstalled feeder house chain and drive chain, tightened slack adjuster to spec for feeder house chain and foun needed half link removed, removed half links from feeder house chain and re installed, re tightened tensioner well within spec and room for adjustment if needed down the line.-KB

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 12 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000175771 Internal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7789	M12x30 FLG 10.9 BOLT	4.00	2.67	2.67	\$10.68	N
19M7814	M12x50 FLG 10.9 BOLT	3.00	5.97	5.97	\$17.91	N
44M7060	Pin M12x24	2.00	9.81	9.81	\$19.62	N
AXE93046	LH Bearing With Housing	1.00	482.40	482.40	\$482.40	N
AXE93047	RH Bearing With Housing	1.00	578.84	578.84	\$578.84	N
Labor: \$1,000.00		Parts: \$1,109.45	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,109.45	

DIAG-1000000090224 Internal

COMPLAINT:

23 Diagnose and Repair Active Trouble Codes 1.

CORRECTION:

1. Diagnose active trouble code.

Friday, April 4, 2025 5:45 PM - nts

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000074129 Internal

COMPLAINT:

25 Diesel Exhaust Fluid Tank Breather, Remove and Replace.

CORRECTION:

1. Access exhaust fluid tank.
2. Remove and replace diesel exhaust fluid tank breather.
3. Assemble in reverse order.

Wednesday, April 2, 2025 12:29 PM - replaced DEF tank breather- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 13 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074129 Internal

H216169	BREATHER, FUEL TANK	1.00	47.04	47.04	\$47.04	N
---------	---------------------	------	-------	-------	---------	---

Labor: \$15.00	Parts: \$47.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$62.04
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

DIAG-1000000192338 Internal

COMPLAINT:

26 Rotor Grain Loss Sensor and Wiring Harness, Diagnose and Repair 2.

CORRECTION:

1. Diagnose rotor grain loss monitoring system.

Thursday, April 3, 2025 2:53 PM - cleaned up existing broken wires and made look factory-KB

Labor: \$600.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$600.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000146159 Internal

COMPLAINT:

27 Tailings Elevator Paddle Chain Remove Half Link & Adjust.

CORRECTION:

Tuesday, April 1, 2025 10:27 AM - nts

1. Rotate tailings elevator conveyor chain until connecting link is visible.
2. Disconnect connecting link. Remove half link.
3. Reconnect tailings elevator conveyor chain with connecting link.
4. Adjust tailings elevator conveyor chain tension to specification.
5. Run the machine and readjust tension if required.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7099	M2x12 COTTER PIN	2.00	0.26	0.26	\$0.52	N

Labor: \$100.00	Parts: \$0.52	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.52
------------------------	----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	14 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

DIAG-1000000172946 Internal

COMPLAINT:

28 Vertical Unloading Auger Gearcase, Diagnose and Repair 1.

CORRECTION:

Thursday, April 3, 2025 2:48 PM - checked pulleys and tightened and checked fluid level all good working as intended-KB

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000073760 Internal

COMPLAINT:

29 Feeder House Conveyor Chain Slat, Remove and Replace.

CORRECTION:

1. Raise the feeder house and tilt the hydraulic feeder house fore/aft tilt frame as needed. Push the safety lock button.
2. Rotate drive belt and access the damaged slat.
3. Remove cap screws and lock nuts on each end of slat. Remove slat.
4. Install slat in same direction as removed and retain with cap screws and lock nuts. Tighten to specification.

Thursday, April 3, 2025 9:53 AM - removed damaged slat and installed a new slat in the same orientation, torqued nuts to 54lbft and marked. DP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7517	M10-1.5 NYLOCK NUT	4.00	2.45	2.45	\$9.80	N
19M7402	M10x25 HH 10.9 BOLT	4.00	2.37	2.37	\$9.48	N
HXE113327	X9 FEEDER CHAIN SLAT	1.00	69.66	69.66	\$69.66	N
Labor: \$100.00	Parts: \$88.94	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$188.94		

EXPERT-1000000074148 Internal

COMPLAINT:

30 Fuel Filters, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 15 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074148 Internal

1. Close the valve on the fuel precleaner.
2. Remove and replace the secondary fuel filter.
3. Remove and replace the primary fuel filter.
4. Disconnect the water sensor (if equipped).
5. Remove the fuel from the filters and discard.
6. Lubricate the replacement primary and secondary fuel filter seals with a thin film of oil or fuel.
7. Align the filter slots on the primary and secondary fuel filters with housing tabs.
8. Install and tighten the primary and secondary fuel filters until it is hand-tight.
9. Tighten primary fuel filter by an additional 1/2 turn.
10. Tighten secondary fuel filter by one additional full turn.
11. Open the valve on the fuel precleaner.
12. To prime the fuel system, turn the key switch to the ON position for 60 seconds.
13. Start the engine and run 3—5 minutes at low idle.

Thursday, April 3, 2025 1:27 PM - completed my sammy- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ104864	SEDIMENT B	1.00	303.60	303.60	\$303.60	N
DZ109897	DRAIN VALVE, SECONDARY FILTER	1.00	57.35	57.35	\$57.35	N
DZ124761	Primary Fuel Filter 13.6L	1.00	168.89	168.89	\$168.89	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	162.25	162.25	\$162.25	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$80.00		Parts: \$692.09	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$774.59	

EXPERT-1000000213917 Internal

COMPLAINT:

31 Feeder House Lower Drive Chain Guide, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 16 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000213917 Internal

1. Loosen and remove drive chain, if necessary.
2. Remove cap screws, nuts, and chain guide bracket.
3. Remove and replace feeder house drive chain plastic guide.
4. Assemble in reverse order.
5. Adjust chain tension by using a pry bar in the holes on the inside plate to move the sprocket forward and tighten nut to specification.

Wednesday, April 2, 2025 12:07 PM - replaced same time as chain-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE160082	BOTTOM CHAIN GUIDE	1.00	105.92	105.92	\$105.92	N
Labor: \$100.00		Parts: \$105.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$205.92	

EXPERT-1000000073663 Internal

COMPLAINT:
 32 Cabin Air Filter, Remove and Replace.

CORRECTION:

1. Turn knob and lower access cover.
2. Remove fresh air filter.
3. Remove and replace cabin air filter.
4. Assemble in reverse order.

Thursday, April 3, 2025 9:17 AM - removed old filter and housing, blew out the housing and reinstalled with a new filter. DP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TA32591	Cab FreshAir Filter	1.00	125.95	125.95	\$125.95	N
Labor: \$17.00		Parts: \$125.95	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$142.95	

DIAG-1000000163329 Internal

COMPLAINT:
 33 Service Light Diagnose and Repair 1.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 17 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

DIAG-1000000163329 Internal

Wednesday, April 2, 2025 5:17 PM - nts

-Check functionality of lights

-After some diagnostic found that light was working

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000076465 Internal

COMPLAINT:

34 Chopper Gear Case Oil, Change. OMHXE162878 SN(815001-820000)

OMDXE11330 SN(820001-825000)

OMDXE11749 SN(825001-)

CORRECTION:

1. Release latch and rotate shield to open.
2. Remove the drain plug from the two-speed chopper gear case.
3. Allow the two-speed chopper gear case oil to drain.
4. Install the drain plug once the oil is drained.
5. Tighten the drain plug to specification
6. Remove the fill plug from the two-speed chopper gear case.
7. Add oil until the oil level is visible at sight glass.
8. Tighten the fill plug to specification.
9. Start the machine and run the separator for a maximum of 1 minute.
10. Shut OFF the engine and let the machine sit for 5 minutes, allowing the air to settle from the two-speed chopper gear case.
11. Verify that oil is visible at sight glass.
12. Repeat the procedures as needed until the oil level is visible at sight glass.

Wednesday, April 2, 2025 5:40 PM - drained fluid going to double check with viktor about fill procedure-KB

Thursday, April 3, 2025 2:46 PM - double checked with viktor and logan it auto fills from reservoir wen running-KB

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY6354	HY-GARD J20C JUG 3.78L	1.00	35.64	35.64	\$35.64	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 18 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000076465 Internal

EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
------	------------	------	------	------	--------	---

Labor: \$17.00	Parts: \$35.64	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$53.24
-----------------------	-----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000074585 Internal

COMPLAINT:

35 Unloading Auger Drive Belt Pulley, Remove and Replace.

CORRECTION:

1. Loosen nuts to remove tension from the unloading auger drive belt.
2. Remove the unloading auger drive belt.
3. Remove the unloading auger shear bolt.
4. Remove the snap ring, washers and outer sheave.
5. Install the new outer sheave, washers and new snap ring.
6. Install the unloading auger shear bolt and tighten to specification.
7. Install the unloading auger drive belt.
8. Tighten nut until the washer is positioned between the end of the gauge and the bottom of the step.
9. Tighten lock nut to specification.

Wednesday, April 2, 2025 7:32 PM - loosened unload auger tensioner and removed belt, remove snap ring and washers holding pulley on unload auger and removed pulley, replaced bushings and shear pin, reinstall pulley and put new belt on and adjusted tensioner to spec- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE124278	UNLOADING AUGER BELT X9	1.00	659.05	659.05	\$659.05	N
HXE158348	X9 UNLOADING AUGER SHEARBOLT M10	4.00	14.50	14.50	\$58.00	N
HXE161359	Bushing	2.00	174.06	174.06	\$348.12	N
HXE165783	Bushing	1.00	47.72	47.72	\$47.72	N
Labor: \$250.00		Parts: \$1,112.89	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,362.89	

EXPERT-1000000074401 Internal

COMPLAINT:

36 Grain Tank Loading Auger Bearing, Remove and Replace.

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 19 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074401 Internal

CORRECTION:

1. Open grain tank covers fully.
2. Remove cap screw and washer.
3. Remove carriage bolts and bearing assembly.
4. Install parts in reverse order.

Wednesday, April 2, 2025 11:22 AM - removed and replaced old bearing with new-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE85993	Bearing With Housing, GRAINTANK CRO	1.00	238.55	238.55	\$238.55	N
Labor: \$100.00		Parts: \$238.55	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$338.55	

EXPERT-1000000076099 Internal

COMPLAINT:

37 Feed Accelerator Gear Case Oil, Change.

CORRECTION:

1. Remove the drain plug from the feed accelerator gear case.
2. Allow the feed accelerator gear case oil to drain.
3. Install the drain plug once the oil is drained.
4. Tighten the drain plug to specification.
5. Remove the fill plug from the feed accelerator gear case.
6. Add oil until the oil level is at the bottom of the check hole.
7. Tighten the fill plug to specification.

Thursday, April 3, 2025 11:05 AM - Removed drain and fill plugs and drained all oil. Put in 2L of GL5 SAE 80W90. tightened plugs back down and wiped gear case clean. DP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26815	80W90 3.78L GL-5	1.00	51.75	51.75	\$51.75	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
Labor: \$75.00		Parts: \$51.75	OL&M: \$0.00	Misc: \$0.60	Sub-Total: \$127.35	

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 20 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000073665 Internal

COMPLAINT:

38 Cabin Recirculation Filter, Remove and Replace.

CORRECTION:

1. Remove cover.
2. Remove recirculating filter.
3. Remove and replace cabin recirculation filter.
4. Assemble in reverse order.

Thursday, April 3, 2025 9:26 AM - removed filter housing and filter, blew out the housing and reinstalled with a new filter. DP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	40.49	40.49	\$40.49	N
Labor: \$17.00		Parts: \$40.49	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$57.49	

EXPERT-1000000076481 Internal

COMPLAINT:

39 Air Filter Elements, Change.

CORRECTION:

- Tuesday, April 1, 2025 - Sammy
1. Remove the air filter elements.
 2. Replace with new air filter elements .
 3. Check for leaks and for collapse of the aspirator tube.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	477.72	477.72	\$477.72	N
HXE11091	Secondary EngAir Filter	1.00	337.08	337.08	\$337.08	N
Labor: \$50.00		Parts: \$814.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$864.80	

DIAG-1000000230251 Internal

COMPLAINT:

40 Feed Accelerator Shaft and Bearings, Diagnose and Repair 1.

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	21 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

DIAG-1000000230251 Internal

CORRECTION:

Friday, April 4, 2025 2:25 PM - removed bolt holding pulley on found was slightly loose, pulled pulley and cleaned threads of shaft
 reinstalled pulley and bolt no more play to be found everything else checked out fine, forgot to sign into segment at 1pm -KB

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000147071 Internal

COMPLAINT:

41 Clean Grain Elevator Paddle Chain, Remove Half Link & Adjust. REMOVE HALF LINK AND ADJUST CLEAN GRAIN
 ELEVATOR PADDLE CHAIN

CORRECTION:

Tuesday, April 1, 2025 9:33 AM - nts

1. REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.
2. TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.
3. DISCONNECT CONNECTING LINK. REMOVE HALF LINK.
4. RECONNECT CONNECTING LINK.
5. ADJUST TENSION TO SPEC.
6. RUN UNIT AND READJUST TENSION AS REQUIRED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

DIAG-1000000170933 Internal

COMPLAINT:

42 Air Conditioning System, Diagnose and Repair 1.

CORRECTION:

Saturday, April 5, 2025 10:56 PM - heads up keithan says he recharged system when roof was replaced and fixed a leak at the
 same time may just need to be ran for a while to work.-KB

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 22 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

DIAG-1000000170933 Internal

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000215869 Internal

COMPLAINT:

43 Tailboard Shaft Bearing, Remove and Replace.

CORRECTION:

1. Lower tailboard assembly.
2. Remove cap screws and spreader drive shield.
3. Relieve spreader drive belt tensioner and remove belt.
4. Remove cap screw, nut, and spreader drive pulley from shaft.
5. Remove bearing mounting cap screws and nuts.
6. Remove and replace tailboard shaft bearing.
7. Assemble in reverse order.

Wednesday, April 2, 2025 3:40 PM - removed belt, pulled pully and replaced bearing, rinstalled pully and drive belt- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7375	M10x30 CB 10.9 SN	3.00	2.61	2.61	\$7.83	N
AXE86015	Bearing With Housing	1.00	105.63	105.63	\$105.63	N
H135891	M10x1.5 FlgLck	3.00	2.43	2.43	\$7.29	N
Labor: \$200.00		Parts: \$120.75	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$320.75	

EXPERT-1000000076402 Internal

COMPLAINT:

44 Feed Accelerator Drive Belt Tensioner, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 23 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000076402 Internal

1. Loosen belt tensioner and remove belt.
2. Remove nut to dismantle rod and spring hardware from yoke.
3. Remove all hardware connecting arm to idler and rod.
4. Remove and replace feed accelerator drive belt tensioner.
5. Assemble in reverse order.

Wednesday, March 19, 2025 11:39 AM -Located parts am going to removed shields off combine now. KS

Thursday, April 3, 2025 10:25 AM - removed tensioner and replaced bearing in pully, reinstalled tensioner and set to spec-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE64492	BEARING, IDLER BEARING, DRAC, HIGH	2.00	82.03	82.03	\$164.06	N
Labor: \$150.00		Parts: \$164.06	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$314.06	

EXPERT-1000000134307 Internal

COMPLAINT:

45 Final Drives Oil, Top Up.

CORRECTION:

Tuesday, April 1, 2025 - Sammy

1. Remove the fill plug from the final drive.
2. Add or drain oil until the oil level is within 12 mm (1/2 in) of the bottom check hole.
3. Install the previously removed plugs.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26815	80W90 3.78L GL-5	1.00	51.75	51.75	\$51.75	N
TY6296	80W90 946ml GL5	3.00	15.99	15.99	\$47.97	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	3.00	0.15	0.15	\$0.45	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 24 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000134307 Internal

EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N
------	------------	------	------	------	--------	---

Labor: \$50.00	Parts: \$99.72	OL&M: \$0.00	Misc: \$1.05	Sub-Total: \$150.77
-----------------------	-----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000154413 Internal

COMPLAINT:

46 Static Drag Cable, Install.

CORRECTION:

1. Install a static drag cable at the customers request.

Wednesday, March 19, 2025 11:22 AM - Removed old static drag cable and installed new one. KS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
STATIC	STATIC DRAG CABLE 3/8"	1.00	242.83	242.83	\$242.83	N
Labor: \$100.00		Parts: \$242.83	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$342.83	

EXPERT-1000000073963 Internal

COMPLAINT:

47 Feeder House Conveyor Drive Chain, Remove and Replace.

CORRECTION:

1. Loosen nut and move the sprocket rearward.
2. Loosen cap screws and remove spacers from between the plates.
3. Remove and replace chain.
4. Align the previously removed spacers and cap screws in the slots on the plates.
5. Use a pry bar in the holes on the inside plate to move the sprocket forward and tighten nut to specification.

Wednesday, April 2, 2025 12:05 PM - removed old chain and guides and replaced upper and lower guide and new chain-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 25 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000073963 Internal

AXE90399	X9 FEEDER CHAIN DRIVE 80H BSN 83000	1.00	1,183.16	1,183.16	\$1,183.16	N
----------	-------------------------------------	------	----------	----------	------------	---

Labor: \$100.00	Parts: \$1,183.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,283.16
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000076484 Internal

COMPLAINT:

48 Fuel Precleaner Filter, Clean.

CORRECTION:

1. Close the valve on the fuel precleaner.
2. Remove the fuel precleaner filter and clean the screen.
3. Install the screen and fuel precleaner filter.
4. To fill the bowl, open the valve on the fuel precleaner.

Labor: \$25.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$25.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

EXPERT-1000000075379 Internal

COMPLAINT:

49 Left-Hand Concave, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	26 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000075379 Internal

Friday, April 4, 2025 3:23 PM - nts

1. Start engine and press threshing clearance adjust switch.
2. To allow easier access to "Z" bar hardware, touch plus (+) or minus (-) symbol, or rotate the selection dial to set threshing clearance to 5.
3. Using the handle, shift the rotor gear case to the neutral position.
4. Remove cap screw and cover support.
5. Remove cap screws and nuts and the side hill divider from the front chaffer crop divider.
6. Remove the cap screws and nuts from the "Z" bar.
7. Remove cap screws from the concave and concave support.
8. Slide and remove the concaves out the side of the machine.
9. Repair or replace as necessary.
10. Install in reverse order following these special instructions.
11. Guide and install concaves onto the concave supports using cap screws and tighten, took extra time concave had trouble latching.
12. Verify ends of concaves fit snug into "Z" bar; then tighten cap screws and nuts.

waiting on concaves on order

13. Adjust concave level. (See Supporting Document - Adjust Concave Level).
14. Install separator covers and shift rotor drive handle to previous position.

Wednesday, April 9, 2025 4:40 PM - nts
 -Finish installing left hand concaves

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M8011	M12x30 HH 10.9 BOLT	2.00	2.61	2.61	\$5.22	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 27 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000075379 Internal

24H1211	Washer 9/16	1.00	2.69	2.69	\$2.69	N
AXE87791	Concave	1.00	306.48	306.48	\$306.48	N
AXE96610	CONCAVE	6.00	907.46	907.46	\$5,444.76	N
AXE96613	X9 SMALL WIRE CONCAVE REG WEAR	2.00	928.71	928.71	\$1,857.42	N
HXE142914	CONCAVE WIRE	1.00	13.80	13.80	\$13.80	N
HXE143505	Wire	6.00	15.85	15.85	\$95.10	N

Labor: \$600.00	Parts: \$7,725.47	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$8,325.47
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000074386 Internal

COMPLAINT:

50 Feeder House Belt Idler Pulley, Remove and Replace.

CORRECTION:

- Loosen belt tensioner. Remove belt from sheaves.
- Remove cap screws, plate, and idler assembly.
- Remove lock nut, inner support, and outer support.
- Remove retaining ring and bearing from outer support.
- Remove nut, washer, and retaining ring.
- Remove bearing and sheave from shaft.
- Repair or replace as needed.
- Install in reverse order. Tighten nut to specification.
- Install outer support, inner support, and new lock nut, tighten to lock nut specification.
- Install idler support assembly, plate, and cap screws, tighten cap screws to specification.
- Check idler alignment. (See Supporting Documents - Front-End Equipment Upper Idler (Fixed)).



Thursday, April 3, 2025 12:37 PM - loosened tensioner removed pulley and replaced tensioner pulley, remove and replace idler pulley reinstalled new and aligned pulleys re-tension- KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70699	Idler	1.00	1,223.35	1,223.35	\$1,223.35	N

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	28 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000074386 Internal

AXE82530	Idler	1.00	710.53	710.53	\$710.53	N
----------	-------	------	--------	--------	----------	---

Labor: \$580.00	Parts: \$1,933.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,513.88
------------------------	--------------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000076102 Internal


COMPLAINT:

51 Transmission Return Filter, Replace.

CORRECTION:

Wednesday, April 2, 2025 6:00 PM - nts

1. Loosen clamp and remove the hose from the fitting.
2. Remove cap.
3. Use the wire handle on the transmission return filter to remove.
4. Discard the transmission return filter.
5. Coat the seal on the replacement transmission return filter with oil.
6. Install the transmission return filter.
7. Push wire handle down onto the transmission return filter and verify that wire handle locks into place.
8. Install the previously removed cap and tighten to specification.
9. Install previously removed hose and retain with clamp.

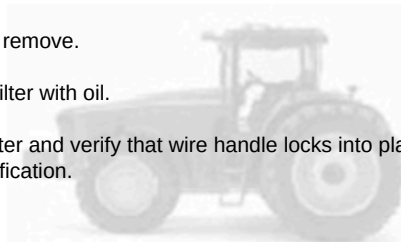

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	173.37	173.37	\$173.37	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$50.00	Parts: \$173.37	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$224.62
-----------------------	------------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000079184 Internal

COMPLAINT:

52 Loading Auger Drive Belt Tensioner, Remove and Replace.

CORRECTION:

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3354602
		Invoice Date: 4/23/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 29 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000079184 Internal

1. Loosen nuts to remove tension from the loading auger belt.
2. Remove the loading auger belt.
3. Remove and replace loading auger drive belt tensioner.
4. Install the loading auger belt.
5. Adjust the loading auger belt. Tighten lock nut to specification.

Wednesday, April 2, 2025 1:38 PM - removed loading auger belt tensioner and replaced bearing in pulley, reinstalled tensioner and set tension-KB

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE64492	BEARING, IDLER BEARING, DRAC, HIGH	1.00	82.03	82.03	\$82.03	N
Labor: \$150.00		Parts: \$82.03	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$232.03	

DIAG-1000000230678 Internal

COMPLAINT:

53 Repair Harness By Tow Hook

CORRECTION:

Thursday, April 3, 2025 2:49 PM - harness repair was in progress, heat shrink was on the connections, just had to shrink it down to the wire. after that i taped the repair so no exposed wiring was showing. DP

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN54- Internal

COMPLAINT:

54 Remove hitch and trailer wiring. These will be installed on their new units as they arrive

CORRECTION:

Thursday, April 3, 2025 2:25 PM - removed hitch an wiring hitch bolts still in unit to hold axle in place need to remove and replace with ones that come off new unit-KB DP

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3354602
		Invoice Date:	4/23/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	30 of 30

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

JGEN55- Internal

COMPLAINT:

55 repair feeder house inspection plate

CORRECTION:

Friday, April 4, 2025 11:09 AM - cut off old broken bolt from lock cleaned up and welded new bolt into lock.-KB

Friday, April 4, 2025 11:49 AM - reinstalled inspection cover everything functions as intended-KB

Labor: \$285.66	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$285.66
------------------------	----------------------	-------------------------	---------------------	----------------------------

Miscellaneous Charges:

SERVICE ACCESSORIES \$150.00

Customer PO No:

Tax Exempt No:

Advisor: Joanne Thronberg

Labor: \$12,898.66
Parts: \$24,977.92
OL&M: \$0.00
Misc: \$166.55
Grand Total: \$38,043.13

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: