

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

Unit AT462 – Deere 460E Rock Truck

8:21 AM 16/06/2023

HOURS 7977 NEXT SERVICE DUE AT 8280

SERVICE TECH WESTLY

INSTALLED THE ROAD RADIO

INTAGRA INSTALLED FOUR NEW TIRES TECKING

9:21 AM 26/06/2023

HOURS 7976

SERVICE TECH WES

NEEDS SERVICE

NO VISIBLE HYDRAULIC LEAKS

INSTALLED 2 WAY RADIO

NEEDS DECALS

MAY NEED ENGINE SERVICE

3:47 PM 29/06/2023

HOURS 7980 NEXT SERVICE DUE AT 8280

SERVICE TECH SLADE


BRANDT CHANGED THE TRANSMISSION OIL AND FILTERS TOOK OIL SAMPLE

7:16 AM 06/07/2023

HOURS 7980 NEXT SERVICE DUE AT 8280

SERVICE TECH SLADE

BROUGHT INTO SHOP

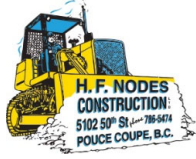

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

RAD HOSES LOOK ROTTEN, CHANGED ALL RAD HOSES AND HEATER LINES

CHANGED OIL AND FILTERS IN DIFFS

INSPECT AND CLEAN SUCTION SCREENS

RAN RAD FLUSH THROUGH UNIT TO CLEAN OIL FILM

INSTALLED BLOCK HEATER AND CORD

REMOVED SCREENS OFF LIFT/LOWER SOLENOIDS ON CONTROL VALVE

INSTALLED NEW CAB POWER RELAY

NEW BATTERIES

ADJUSTED DOOR LATCH

NEW CAB FILTERS

9:33 AM 29/09/2023

HOURS 8292 NEXT SERVICE DUE AT 8592

SERVICE TECH SLADE

SERVCE THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

REPLACED THE CAB FILTER

FIRE EXT JUNE 2023

7:27 AM 06/11/2023

HOURS 8500 NEXT SERVICE DUE AT 8800


SERVICE TECH SLADE

300 HR SERVICE 10/30

CHANGED AIR AND CAB AIR FILTERS

FIRE EXTINGUISHER JUNT 2023

REPLACED WIPER BLADES

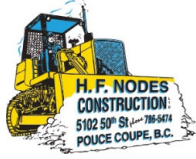

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | VOC 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

7:10 AM 01/12/2023

HOURS 8714 NEXT SERVICE DUE AT 9014

SERVICE TECH WESTLY

SERVICED THE ENGINE 10/30

REPLACED THE OIL AIR AND FUEL FILTERS

BOX LIFT CYLINDERS ARE WEEPING A LITTLE BIT

FIRE EXT JUNE 2024

1:58 PM 05/02/2024

HOURS 8742 NEXT SERVICE DUE AT 9014

SERVICE TECH SLADE

REPLACED THE BLOWN HYD OIL LINE IN THE REAR FRAME

2:57 PM 17/04/2024

HOURS 9007 NEXT SERVICE DUE AT 9307

SERVICE TECH ROB

SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

8:44 AM 21/06/2024

HOURS 9243 NEXT SERVICE DUE AT 9543

SERVICE TECH WESTLY


SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

BOX LIFT CLYINDERS ARE WEEPING A LITTLE BIT

FRONT DIFF INPUT SEAL IS WEEPING

FIRE EXT JUNE 2025

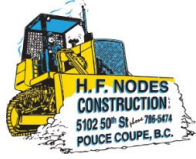

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

11:42 AM 24/07/2024

HOURS 9384 NEXT SERVICE DUE AT 9543

SERVICE TECH AYDEN

CHECKED THE MACHINE OVER

REMOVED THE BOX HEATER

FOUND TRANSMISSION CODES

CLUTCH C SLIPPING

CUT THE TRANSMISSION FILTER AND FOUND CLUTCH MATERIAL IN THEM

TALKED TO BRANDT TRACTOR

THEY WANT THE TRUCK IN F.S.J. TO TROUBLE SHOOT

BRANDT CHECKED IT OUT AND SAID IT WAS OK TO RUN

THEY DID A TRANSMISSION CALIBRATION

2:27 PM 08/09/2024

HOURS 9494 NEXT SERVICE DUE AT 9794

SERVICE TECH WESTLY

SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

FIRE XT JUNE 2025

8:59 AM 25/10/2024


HOURS 9567 NEXT SERVICE DUE AT 9794

SERVICE TECH MURRAY

CHECKED THE TRUCK OVER

HAD TO CLEAN UP THE MESS IN THE CAB

5 LITER JUB OF OIL TIPPED OVER AND LEAKED ALL OVER THE FLOOR MAT

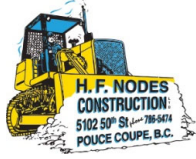

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

HAD TO REMOVE THE FLOOR MAT AND WASH IT

HAD TO WASH OUT THE FLOOR BOARDS IN THE CAB

INSTALLED THE FLOOR MAT

9:08 AM 09/07/2025

HOURS 10099 NEXT SERVICE DUE AT 10367