

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

Unit AT463 – Deere 460E Rock Truck

1:08 PM 23/08/2023

HOURS 6877 NEXT SERVICE DUE AT 7174

SERVICE TECH SLADE

UNIT CAME FROM BRANDT TRACTOR

300HR SERVICE

INSTALLED ROAD RADIO

MOUNTED FIRE EXTINGUISHER

FIRE EXTINGUISHER AUG 2023

CHANGED OIL IN ALL DIFFS & PLANETARYS

CHANGED ALL FILTERS AND CLEANED SUCTION SCREENS

CHANGED HYDRAULIC OIL AND FILTERS

CHANGED TRANSMISSION OIL AND FILTERS, FOUND CUTTINGS IN FILTER & SENT PICS TO BRANDT

INSTALLED BLOCK HEATER AND CORD

REPAIR A/C, REPLACED THE RECIEVER DRYER AND THERMAL EXPANSION VALVE

REMOVED AND CLEANED EVAPORATOR CORE AS IT WAS PLUGGED SOLID. A/C WORKS NOW

REPLACED BACK UP CAMERA HARNESS

REPLACED BROKEN CLAMP THAT SUPPORTS AIR TO AIR PIPE

REPLACED ONE FAN HOSE TO R/H HYDRAULIC FAN MOTOR


INSTALL NEW END GATE ASSEMBLY FROM HEADWATER EQUIPMENT

CALIBRATED TRANSMISSION

1:02 PM 22/09/2023

HOURS 6981

SERVICE TECH BRANDT

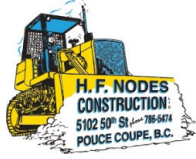

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

REPLACED THE SENSOR FOR THE REAR DIFF OIL FILTER

7:29 AM 06/11/2023

HOURS 7203 NEXT SERVICE DUE AT 7503

SERVICE TECH SLADE

300HR SERVICE 10/30

REPLACED AIR AND CAB AIR FILTERS

1:56 PM 07/12/2023

HOURS 7423 NEXT SERVICE DUE AT 7723

SERVICE TECH SLADE

SERVICED THE ENGINE 10/30

REPLACED THE OIL AIR AND FUEL FILTERS

REPAIR THE OPERATORS SEAT

REPLACED THE EGR VALVE

CUT THE TRANSMISSION FILTERS (CLEAN)

INSTALLED THE REPAIRED TAIL GATE

FIRE EXT NOV 2023

5:24 PM 04/03/2024

HOURS 7592 NEXT SERVICE DUE AT 7723

SERVICE TECH SLADE


FOUND THE EXHAUST MANIFOLD GASKETS LEAKING

REPLACED THE EXHAUST MANIFOLD GASKETS AND INSTALLED BOLTS

THE THREADED HOLES IN THE HEAD WHERE STRIPPED

REPLACED THE COOLANT VALVE FOR THE DEF TANK HEAT

REPLACED THE TWO POOR DIFF FILTER HOSES

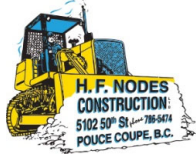

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

TEST RUN CHECK FOR LEAKS

FIRE EXT NOV 2023

2:52 PM 05/04/2024

HOURS 7727 NEXT SERVICE DUE AT 8027

SERVICE TECH ROB

SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

FIRE EXT NOV 2023

1:34 PM 03/05/2024

HOURS 7860 NEXT SERVICE DUE AT 8027

SERVICE TECH WESTLY

CHECKED THE TRUCK OVER

REPLACED THE LOWER RIGHT HAN RAD HOSE

REPAIR THE DOOR LATCH

REMOVED THE BOX HEATER

9:03 AM 21/06/2024

HOURS 7973 NEXT SERVICE DUE AT 8273

SERVICE TECH WESTLY


SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

FIRE EXT NOV 2024

5:19 PM 25/07/2024

HOURS 7995 NEXT SERVICE DUE AT 8273

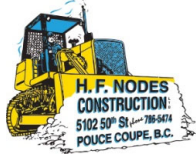

H.F. Nodes Construction Ltd.

Box 373 | Pouce Coupe | British Columbia | V0C 2C0
Phone: 250-786-5474 | Fax: 250-786-5807 | Email: info@hfnodes.com

SERVICE TECH AYDEN

CHECKED THE TRUCK OVER

FIRE EXT NOV 2023

2:46 PM 24/09/2024

HOURS 8181 NEXT SERVICE DUE AT 8273

SERVICE TECH AYDEN

REPAIRED THE WIRING HARNESS AT THE HINGE JOINT ON THE TRUCK

6:08 AM 02/10/2024

HOURS 8217 NEXT SERVICE DUE AT 8517

SERVICE TECH AYDEN

SERVICED THE ENGINE 15/40

REPLACED THE OIL AIR AND FUEL FILTERS

REPLACED THE DAMAGED REAR CAMERA HARNESS

REPLACED THE REAR FRAME WIRING HARNESS

REPLACED ONE BRAKE HOSE ON THE REAR DIFF

FIRE EXT NOV 2023

9:53 AM 17/10/2024

HOURS 8219 NEXT SERVICE DUE AT 8517

SERVICE TECH WESTLY

INSTALLED A NEW WABASTO COOLANT HEATER

CHANGED TRANSMISSION OIL AND FILTERS

CUT THE FILTERS THEY WERE CLEAN

CALIBRATED THE TRANSMISSION