

H02-90
SEP



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

- WINCH CONTROL ASSEMBLY

(DRIVE PRODUCT P/N VM-7-P-DPI)

EP08-12.

- PTO ENGAGE LIGHT

FORT CARRY ? N/A

DRIVE PRODUCT (BACK ORDERED)

MID to LATE JAN 2015

TRACTION HD PARTS

\$593.06

PO# 10539

plus shipping

\$

1647.27

\$126.92

PTO & PUMP \$1918.35

GEORGE C DRIVE PRODUCTS ATCHESEN

ahopaluk@brothershd.ca

(SHAWNE) TIRES ?

REQUESTED BY:

DATE:



SEMI (WINCH)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

805 - Winch Truck

BHDD Shop

Tuesday, June 23rd 2026, 7:00 AM (MDT -06:00)

Unit Information

Date:  March 10, 2026

Select Unit Number:  805 - Winch Truck

KMs:  584974

Hours:  15452

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Cvip, pto tank rusted and leaking, d-sign frame rusted out, swing out light housings rusted out, webasto needs replaced, pto tank leaking

- replaced fuel tank crossover hose
- replaced front kingpins
- replaced windshields
- replaced turbo air boot
- replaced 5th wheel jaws and pins
- replaced rear jackshaft u joints
- replaced rear axle v-rod bushings
- replaced rear axle quick release valve
- replaced rear trailer plug
- replaced back up alarm
- installed pullout lights
- replaced deck door handle
- replaced steer axle s-cams and bushings
- removed headache rack and winch
- removed pto tank for replacement (rusted and leaking)
- installed new pto tank
- installed headache rack

Engine was just overhauled

Serial/Part # if applicable.

no response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Luke Jacobsen, *Mechanic*

 June 23rd 2026, 7:00 AM (MDT -06:00)

 52.8511916, -110.8420342





SEMI (WINCH)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 805 - Winch Truck

 BHDD Shop

 Thursday, December 18th 2025, 4:23 PM [MST -07:00]

Unit Information

Date:  December 18, 2025

Select Unit Number:  805 - Winch Truck

MS:  581232

Hours:  15352

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Exhaust bellow broken

-replaced turbo down pipe exhaust bellow

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

 Wainwright Shop

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*

 December 18th 2025, 4:23 PM (MST -07:00)

 52.8513307, -110.8421375





SEMI (WINCH)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

805 - Winch Truck

W/O # 62103790852

BHDD Shop

Monday, December 1st 2025, 9:14 AM (MST -07:00)

Unit Information

Date: November 30, 2025

Select Unit Number: 805 - Winch Truck

KMs: # 576293

Hours: # 15192

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Turbo actuator not working

- removed old actuator
- calibrated and installed new actuator
- changed engine oil and fuel filters

Took for test run builds 30psi of boost without hauling anything. Should be fine but will see if wayne is good with it while he hauls

Had a tick/knock at idle. Sounds smoother after oil change

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

ENTERED
DEC 19 25
CC

Location of repairs being completed:

Pick the location where the repairs were completed:

 Wainwright Shop

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*

 December 1st 2025, 9:14 AM [MST -07:00]

 52.8513038, -110.8421791



Northern Trailer and Truck
 2210 - 19 Avenue
 Wainwright, AB T9W 1L2, CA
 service1.northern@gmail.com
 780-842-0080



Invoice: **13552**
 Date: **4/11/2025**

Bill To
 Brothers HDD
 2002 23 Avenue
 Wainwright, AB T9W 0B8, CA
 P: (780) 214-7711

Ship To
 Brothers HDD
 2002 23 Avenue
 Wainwright, AB T9W 0B8,
 CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
8137	COD	4/11/2025	Ron Jerome		Cornish, Shane	805

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Diagnose - Transmission Grinds when shifting back from High Range to Low Range?

Cause: Grinds from Hi Range to Low Range - Synchro worn out **Type:** Unscheduled repair

Labor	Correction:	16.50000	\$135.00	\$2,227.50
-------	--------------------	----------	----------	------------

Powertrain - Clutch/ Transmission/ Aux / Driveline/ Differentials/ Axles / Clutch and Transmission - Service / repair / shifter / controls / Trans Assembly R&R - With Dual Exhaust | Main | Manual Trans | With Conventional Cab | With Meritor Freedom Line Transmission | Includes: Removal of Trans and all necessary components for access. Time for transferring of components, make necessary adjustments, and to add fluid. Does not include: System diagnosis and testing, or a vehicle road test. (026-012)

- Remove driveline.
- Remove cross member.
- Remove exhaust elbow
- Remove shift tower.
- Remove air lines and electrical to transmission.
- Remove rear trans support.
- Remove clutch linkage and clutch bolts.
- Remove transmission cooler.
- Support with transmission jack and remove bell housing bolts.
- Remove transmission.
- Install transmission. Clutch bolts torqued 45 ft.lbs. Bell housing bolts torqued 45 ft.lbs
- Driveline strap bolts torqued 125 ft.lbs. U-joints greased

Extra time.

1. Remove bell housing and pressure wash.
- Swapped to new transmission. Nuts torqued 140 ft.lbs. Bolts torqued 80 ft.lbs.
2. Remove seized clutch linkage to free up and adjust for correct free pedal.
3. Raise front axle and remove driver side wheel to remove transmission.

Item	Description	Quantity	Rate	Amount
	Wheel reinstalled and torqued ft.lbs 475 ft.			
	4. Replaced Transmission supply line was restricted			
	5. Vehicle road test after repairs completed. - Completed: 4/14/2025			
Parts	TRANSMISSION - RTLO-18918B	1.00000	\$4,495.00	\$4,495.00
Parts	Inherent Core for TRANSMISSION - RTLO-18918B-CORE	1.00000	\$4,400.00	\$4,400.00
Parts	Dirty Core for TRANSMISSION - RTLO-18918B-CORE	-1.00000	\$4,400.00	-\$4,400.00
Parts	3/8" TUBE X 3/8" MPT PUSH CONNECT UNION - PC1468-6C	2.00000	\$5.46	\$10.92
Parts	1/2" MPT X 3/8" FPT REDUCER BUSHING - 110-DC	1.00000	\$1.62	\$1.62
Parts	5" DPF GASKET 4.75" ID X 5.75" OD X .072" THICKNESS - 562.U85591	2.00000	\$8.08	\$16.16
Parts	3/8" AIR BRAKE HOSE SYNIFLEX - 1485-6-100	5.00000	\$1.02	\$5.10
Parts	U-JOINT STRAP KIT SPL250 - 250-70-18X	2.00000	\$29.42	\$58.84
Parts	12" BLACK CABLE TIES - 83-6021	7.00000	\$0.09	\$0.63
Parts	CHEVRON DELO SYN- TRANS XE 75W90 (PER LITER) - 22307905-1L	18.00000	\$17.37	\$312.66
Parts	TRANSMISSION SPEED SENSOR - K4148	1.00000	\$66.96	\$66.96
Parts	1/4" PUSH CONNECT UNION - PC1462-4	3.00000	\$6.78	\$20.34
Parts	7/16" GR8. LOCK WASHER - GR8LW716	20.00000	\$0.19	\$3.80
Parts	7/16" GR8. FLAT WASHER - GR8FW716	1.00000	\$0.06	\$0.06
Parts	1/4" PUSH CONNECT UNION - PC1462-4	1.00000	\$6.78	\$6.78
Parts	8" BLACK CABLE TIES - 83-6019	8.00000	\$0.05	\$0.40
Parts	5/8" GR8. FLAT WASHER - GR8FW58	6.00000	\$0.33	\$1.98
Parts	3/8" X 1-1/2" NC GR8. BOLT - GR8NC38112	1.00000	\$0.51	\$0.51
Parts	5/8" X 1-1/2" NC GR8. BOLT - GR8NC58112	2.00000	\$1.51	\$3.02
Parts	12" BLACK CABLE TIES - 83-6021	3.00000	\$0.09	\$0.27
Labor	Correction:	4.00000	\$135.00	\$540.00
	Chassis / Auxiliary Equipment - Components Mounted on Back Of Unit /			
	PTO Swap over (May require complete cleaning and flush - particles from			
	transmission failure)			
	- remove Hydraulic Pump or PTO shaft to access			
	- remove PTO - clean and inspect for reuse			
	- mount PTO on Transmission - check and adjust lash (.08-.012")			
	- Install hardware and torque to spec			
	- install Hydraulic Pump or driveshaft			
	Checked gear lash before removal. Measured 0.010"			
	Clean out PTO. Old transmission oil was bad.			
	- Installed PTO with new gasket.			
	Backlash measured 0.006".			

Item	Description	Quantity	Rate	Amount
	- Bolts torqued 45 ft.lbs - PTO airline checked for leaks. OK.			
	Extra time.			
	1. Installed pump and had to cut and modify rear pump support bracket. - Cut bracket and reweld to fit. - Completed: 4/14/2025			
Parts	PTO GASKET 8 HOLE - 35P15-2	1.00000	\$2.68	\$2.68
Parts	7/16" X 1-1/2" NC GR8. BOLT - GR8NC716112	7.00000	\$0.57	\$3.99
Parts	7/16" GR8. FLAT WASHER - GR8FW716	7.00000	\$0.06	\$0.42
Parts	3/8" GR8. LOCK WASHER - GR8LW38	2.00000	\$0.17	\$0.34
Labor	Correction: Powertrain - Clutch/ Transmission/ Aux / Driveline/ Differentials/ Axles / Clutch and Transmission - Service / repair / shifter / controls / Clutch Inspection For Reuse (Transmission already removed) *If clutch is worn more than 50% or showing evidence of fatigue (Take pics and attach) - advise customer that clutch should be replaced INSPECT Clutch and Components while transmission is out - ALL COMPONENTS AND ADD TASKS IF REQUIRED WITH PARTS REQUIRED Inspect flywheel for machining and runout (Add Task for Flywheel R&R if required) *Arrange to have Flywheel sent for machining if required! - check rear engine seal for leaks (Add Task for Rear Engine Seal R&R if required) - check engine mount condition (Add Task for Rear Engine Mounts R&R if required) Repairs required: 1. Engine mounts ok for reuse. 2. No evidence of rear engine seal leak. 3. Flywheel runout measured 0.002" on friction surface. Max runout spec. 0.008". Flywheel ok. Replace pilot bearing. 4. Some wear found on clutch springs. Highly recommend replace clutch while trans is out. - Clutch replaced. 5. Replace cross shaft bushings. Only minor wear found on cross shafts, would still recommend replace. 6. Pressure test cooling system to verify trans oil cooler is good. OK. - Have coolant leak at rad. Found during pressure test. - Completed: 4/14/2025	2.00000	\$135.00	\$270.00
Parts	CLUTCH 15.5 X 2 EP 2050TQ EASY PEDAL - 308925-25	1.00000	\$1,500.00	\$1,500.00
Parts	PILOT BEARING - 306VV	1.00000	\$56.45	\$56.45
Parts	CLUTCH CROSS SHAFT BUSHING - 12815	4.00000	\$5.56	\$22.24
Parts	6.5" CLUTCH SHAFT - 106C1498	1.00000	\$27.13	\$27.13
Parts	CLUTCH CROSS SHAFT (KENWORTH) - M-1984	1.00000	\$74.30	\$74.30
Parts	2" CLUTCH BRAKE - SB200	1.00000	\$59.37	\$59.37
	Subtotal			\$9,789.47

Complaint: Coolant leak at rad. Ask customer if they've noticed leak or have been adding coolant.

Item	Description	Quantity	Rate	Amount
Cause: Coolant leak Type: Unscheduled repair				
(Inspection)				
Labor	Correction: Engine / Engine Cooling System / Coolant leak at rad. - Found leak while pressure testing system to check transmission cooler. - Tightened upper rad hose. - Still have leak. Found upper plastic tank leaking at crimp to core. - Test drove unit and had engine at operating temp. No leak was observed. - Monitor for future leaks. - Completed: 4/14/2025	0.15000	\$135.00	\$20.25
			Subtotal	\$20.25
Unit: 805 VIN: 1XKDD40X5DJ961434				
License Plate: (AB) CND3706			Labor	\$3,057.75
2013 Kenworth T8 Series			Parts	\$6,751.97
Chassis: 567,125 Kilometers			Shop Supplies	\$214.04
Engine: 14,311 Hours			Pre-Charge Subtotal	\$10,023.76
			GST	\$501.19
			(5% of \$10,023.76)	
			Total	\$10,524.95
			Payments & Credits	\$0.00
			Balance Due	\$10,524.95

WE ACCEPT DEBIT AND CREDIT CARD PAYMENT

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection.

Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of the repairs there to.

All parts removed will be discarded unless instructed otherwise: save all parts ____.

NORTHERN TRAILER AND TRUCK SALES LTD. IS NOT RESPONSIBLE FOR LOSS OF OR DAMAGE TO VEHICLES OR ARTICLES LEFT IN VEHICLES IN THE CASE OF FIRE, THEFT, OR ANY OTHER CAUSE.

NORTHERN TRAILER AND TRUCK SALES ASSUMES THE RIGHT TO CHARGE 2% ON ANY INVOICE OUTSTANDING OVER 30 DAYS.



SEMI

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 805

 BHDD Shop

 Thursday, April 3rd 2025, 8:12 AM (MDT -06:00)

Unit Information

Date:  April 3, 2025

Select Unit Number:  805

KMs:  567123

Hours:  14972

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Install fuel tank
 - installed fuel tank straps
 - installed fuel tank
 - tightened straps
 - connected fuel lines
 - installed pull out clearance lights

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



April 3rd 2025, 8:12 AM (MDT -06:00)



52.8513412, -110.8421866

A handwritten signature in black ink, likely belonging to Luke Jacobsen, positioned to the right of the printed name.



SEMI

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

805

NewForce MM 2502-006

Thursday, February 27th 2025, 6:27 PM (MST -07:00)

Unit Information

Date: February 27, 2025

Select Unit Number: 805

KMs: # 500000

Hours: # 0

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

High range to low range gear splitter grinding badly
NT 1/2 T
TRANS & CLUTCH FRIDAY APR 4

* DRIVERS FUEL CELL
* WIDE LOAD MARKER
LAMP ASSEMBLY

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

Requested by:

Worker Requesting Repairs:



Myles MacMillan

Signatures

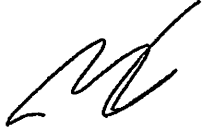
Myles MacMillan, *Supervisor*



February 27th 2025, 6:27 PM (MST -07:00)



54.3928497, -116.8011227

A handwritten signature in black ink, appearing to be 'M' followed by a stylized flourish.

Order Section

Amount

1,050.00 CAD

Invoice Number

JOHN @ RED RAM

UNIT #805

Q2500222

Confirmation

BRINGING IN OLD TANK
TO MATCH

Your payment has been approved.

Payment Type

RETURNING 3RD USED TANK

CREDITCARD

Transaction Type

2 7 3/8 TANK STRAPS @

SALE

Card Type

GREATLY REDUCED PRICE

VISA

Card Number

46*****1679

Transaction ID

190225C18-6231BDA9-7475-4807-834E-683DFBF96FF7

Date / Time

02/19/2025 01:54:54 PM

Message

APPROVAL

Approve Code

036495

AVS Response

Z

CVV2 Response

M

Billing Address

Brothers HDD

James McClennon

Box 3473

Wainwright AB, T9W 1T4

rjerome@brothershdd.ca

UNIT #805 CNP

[Go Back to Red Ram](#)



SEMI

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

805

NewForce MM 2502-006

Thursday, February 27th 2025, 6:27 PM (MST -07:00)

Unit Information

Date: February 27, 2025

Select Unit Number: 805

KMs: # 500000

Hours: # 0

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

High range to low range gear splitter grinding badly
NT 1/2 T
TRANS & CLUTCH FRIDAY APR 4

* DRIVERS FUEL CELL
* WIDE LOAD MARKER
LAMP ASSEMBLY

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

Requested by:

Worker Requesting Repairs:



Myles MacMillan

Signatures

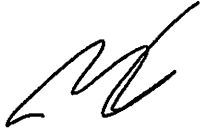
Myles MacMillan, *Supervisor*



February 27th 2025, 6:27 PM (MST -07:00)



54.3928497, -116.8011227

A handwritten signature in black ink, likely belonging to Myles MacMillan, the supervisor mentioned in the text.

Order Section

Amount

1,050.00 CAD

Invoice Number

JOHN @ RED RAM

UNIT #805

Q2500222

Confirmation

BRINGING IN OLD TANK
TO MATCH

Your payment has been approved.

Payment Type

RETURNING 3RD USED TANK

CREDITCARD

Transaction Type

2 7 3/8 TANK STRAPS @

SALE

Card Type

GREATLY REDUCED PRICE

VISA

Card Number

46*****1679

Transaction ID

190225C18-6231BDA9-7475-4807-834E-683DFBF96FF7

Date / Time

02/19/2025 01:54:54 PM

Message

APPROVAL

Approve Code

036495

AVS Response

Z

CVV2 Response

M

Billing Address

Brothers HDD

James McClennon

Box 3473

Wainwright AB, T9W 1T4

rjerome@brothershdd.ca

UNIT #805 CNP

[Go Back to Red Ram](#)



MAINTENANCE WORK ORDER

Nº 3370

UNIT #: 805
ENGINE HOURS: 14928
MILEAGE: 565288
WORK LOCATION: Warrington
WORK REQUESTED: _____

ORDER DATE: Feb 3 2025
COMPLETED DATE: Feb 25 2025
JOB #: _____

W.O. TYPE (Circle): PM ☒ CVIP Reactive

REPAIRS REQUIRED: CVIP
Service, Driver side fuel tank leaking

TECH COMMENTS: _____

ENTERED CC
Feb 25 2025

LABOUR DESCRIPTION: _____ HOURS
CVIP Inspection, removed wheels, measured brakes & drums 30
Replaced rear axle brakes & drums, Replaced front steer brakes
Replaced middle axle wheel seals, Replaced rack lights, replaced
2 brake pots, changed hub oils, Replaced driver side fuel tank

LABOUR TOTAL 30

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Ron WORK COMPLETED BY: Mike Jackson
UNIT RETURNED TO SERVICE: Feb 25 2025 OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____
Needs driver side fuel tank



MAINTENANCE WORK ORDER

Nº 3365

UNIT #: 905
ENGINE HOURS: 14890
MILEAGE: 563501
WORK LOCATION: Wannwright
WORK REQUESTED: _____

ORDER DATE: Jan 23 2025
COMPLETED DATE: Jan 23 2025
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Air to Air hose rubbing on hood
checkover
Fan belt cracked
Air shutdown hose cut

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

Removed hoses, installed new hoses, repositioned
elbow on turbo. Tightened hose clamps
verified no contact with hood
Replaced A/C and fan belt
Repaired Air shutdown hose

LABOUR TOTAL

4

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
--------	----------	-------	--------

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: RonWORK COMPLETED BY: Mike Jackson

UNIT RETURNED TO SERVICE: _____

OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____



SEM 1

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B6
780-214-7711

Maintenance Request Form

Information

805

BHDD Shop

Monday, January 13th 2025, 8:35 AM (MST -07:00)

Unit Information

Date: January 12, 2025

Unit Number: # 805

KMs: # 557557

Hours: # 14743

Repairs Required

Description of Repairs Required:

CVIP due by Jan 31/2025 - windshields/ frt drive tires / 5th wheel has play / pull out lights / Rectangle spot mirrors need to be removed NFG / Low side transmission not selecting properly/ drivers wiper / Cabin filter needs replaced / Front bumper road lamps are useless/ Tool kit (wrenches sockets screwdrivers 14-16 inch alignment pry bar / Thanks

Requested By:

Worker Requesting Repairs: Steven Nontell

Additional Photos



Signatures

Steven Nontell, Driver

January 13th 2025, 8:35 AM (MST -07:00)

① OF ②



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM 555290

14699.6

DESCRIPTION OF REPAIRS REQUIRED

- ① TRANSMISSION NOT SHIFTING TO LOW SIDE WITH ALOT OF NOISE FLIP BACK TO HIGH ITS OK, HARD TO DOWN SHIFT.
- ② WINCH BOX + CONTROL DOES NOT WORK WITHOUT GETTING OUT TO SHIFT FROM BACK.
- ③ NEED A 2 WAY RADIO TO WORK FOR RADIO CONTROLLED ROADS

REQUESTED BY:

DATE:



2022

MAINTENANCE REQUEST FORM

UNIT# 805 HRS/KM 555290

HRS 14699.6

DESCRIPTION OF REPAIRS REQUIRED

① RIGHT ^{SIGNAL} TAIL LAMP NOT WORKING

② WORK LIGHT ON HEADACHE

RACK NOT WORKING ~~FIXED OLD~~

REPLACE ALL THREE TO LED

REQUESTED BY:

DATE:



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

-ENGINE SERVICE

-TIRES (SHAYNE) FRONT & REAR

- 4 to 5 SHIFTING ? (OIL SAMPLE)

DROP TRANS FLUID INTO
CLEAN WHITE PAILS.

-TURBO

4 to 5 "SHIFT DOWN"

THIS IS THE HIGH/LOW SHIFT (AIR)??

0 5 UP to 0
0 0 to 4 DOWN

← VALVE

REQUESTED BY:

DATE:



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

- ① AIR TO AIR HOSES NEED REPLACED -
- ② ROAD LAMPS FOR MOOSE

REQUESTED BY:

DATE: JAN. 22/2025



Brothers HDD Inc.
2002 23 Avenue,
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

805

805

BHDD Shop

Friday, January 10th 2025, 1:42 PM (MST -07:00)

Unit Information

Date:

January 10, 2025

Unit Number:

805

KMs:

556232

Hours:

14721

Repairs Required

Description of Repairs Required:

DONE

Front steer/ Rear
Axle wheels retorque done by Integra Tire Dawson Creek.

Requested By:

Worker Requesting Repairs:

Steven Nontell

Signatures

Steven Nontell, Driver

January 10th 2025, 1:42 PM (MST -07:00)

ADDITIONAL COMMENTS: _____

① OF ②



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM 555290

14699.6

DESCRIPTION OF REPAIRS REQUIRED

- ① TRANSMISSION NOT SHIFTING TO LOW SIDE WITH ALOT OF NOISE FLIP BACK TO HIGH ITS OK, HARD TO DOWN SHIFT.
- ② WINCH BOX + CONTROL DOES NOT WORK WITHOUT GETTING OUT TO SHIFT FROM BACK.
- ③ NEED A 2 WAY RADIO TO WORK FOR RADIO CONTROLLED ROADS

REQUESTED BY:

DATE:

20#2



MAINTENANCE REQUEST FORM

UNIT# 805 HRS/KM 555290

HRS 14699.6

DESCRIPTION OF REPAIRS REQUIRED

- ① RIGHT TAIL LAMP NOT WORKING
- ② WORK LIGHT ON HEADACHE
RACK NOT WORKING

REQUESTED BY:

DATE:



SEM 1

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B6
780-214-7711

Maintenance Request Form

Information

805

BHDD Shop

Monday, January 13th 2025, 8:35 AM (MST -07:00)

Unit Information

Date: January 12, 2025

Unit Number: # 805

KMs: # 557557

Hours: # 14743

Repairs Required

Description of Repairs Required:

- CVIP due by Jan 31/2025 - windshields/ frt drive tires / 5th wheel has play / pull out lights / Rectangle spot mirrors need to be removed NFG / Low side transmission not selecting properly/ drivers wiper / Cabin filter needs replaced / Front bumper road lamps are useless/ Tool kit (wrenches sockets screwdrivers 14-16 inch alignment pry bar / Thanks

Requested By:

Worker Requesting Repairs: Steven Nontell

Additional Photos



Signatures

Steven Nontell, Driver

January 13th 2025, 8:35 AM (MST -07:00)

① OF ②



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM 555290

14699.6

DESCRIPTION OF REPAIRS REQUIRED

- ① TRANSMISSION NOT SHIFTING TO LOW SIDE WITH ALOT OF NOISE FLIP BACK TO HIGH ITS OK, HARD TO DOWN SHIFT.
- ② WINCH BOX + CONTROL DOES NOT WORK WITHOUT GETTING OUT TO SHIFT FROM BACK.
- ③ NEED A 2 WAY RADIO TO WORK FOR RADIO CONTROLLED ROADS

REQUESTED BY:

DATE:



2022

MAINTENANCE REQUEST FORM

UNIT# 805 HRS/KM 555290

HRS 14699.6

DESCRIPTION OF REPAIRS REQUIRED

① RIGHT ^{SIGNAL} TAIL LAMP NOT WORKING

② WORK LIGHT ON HEADACHE

RACK NOT WORKING FIXED OLD

REPLACE ALL THREE TO LED

REQUESTED BY:

DATE:



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

-ENGINE SERVICE

-TIRES (SHAYNE) FRONT & REAR

- 4 to 5 SHIFTING ? (OIL SAMPLE)

DROP TRANS FLUID INTO
CLEAN WHITE PAILS.

-TURBO

4 to 5 "SHIFT DOWN"

THIS IS THE HIGH/LOW SHIFT (AIR)??

0 5 UP to 0
0 0 to 0 DOWN

← VALVE

REQUESTED BY:

DATE:



MAINTENANCE REQUEST FORM

UNIT# 805

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

- ① AIR TO AIR HOSES NEED
REPLACED -
- ② ROAD LAMPS FOR MOOSE

REQUESTED BY:

DATE: JAN. 22/2025



Brothers HDD Inc.
2002 23 Avenue,
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

805

805

BHDD Shop

Friday, January 10th 2025, 1:42 PM (MST -07:00)

Unit Information

Date:

January 10, 2025

Unit Number:

805

KMs:

556232

Hours:

14721

Repairs Required

Description of Repairs Required:

DONE

Front steer/ Rear

Axle wheels retorque done by Integra Tire Dawson Creek.

Requested By:

Worker Requesting Repairs:

Steven Nontell

Signatures

Steven Nontell, Driver

January 10th 2025, 1:42 PM (MST -07:00)



MAINTENANCE WORK ORDER

Nº 3221

UNIT #: 805
ENGINE HOURS: 14423.7
MILEAGE: 340346
WORK LOCATION: Wainwright Shop
WORK REQUESTED: _____

ORDER DATE: NOV/18/24
COMPLETED DATE: NOV/20/24
JOB #: _____

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: No power

TECH COMMENTS: _____

LABOUR DESCRIPTION: replaced turbo HOURS 5RON 3LABOUR TOTAL 8

PARTS & MATERIALS

P.O. # QUANTITY PRICE AMOUNT

P.O. #	QUANTITY	PRICE	AMOUNT
<u>turbo</u>	<u>1</u>		
<u>oil</u>	<u>44L</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Share/ron WORK COMPLETED BY: chaseUNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: _____



ENTERED
FEB 11 2025

MAINTENANCE WORK ORDER

Nº 3216

UNIT #: 805
ENGINE HOURS: 14368.2
MILEAGE: 33952.6
WORK LOCATION: Wainwright Shop
WORK REQUESTED:

ORDER DATE: NOV/8/24
COMPLETED DATE: NOV/8/24
JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: full service change oil fuel filter change

TECH COMMENTS:

LABOUR DESCRIPTION: changed oil fuel filter greased
inspected Radio HOURS 3.5

LABOUR TOTAL

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
filters		3		
oil		49L		

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Ron WORK COMPLETED BY: Chase

UNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS:



MAINTENANCE WORK ORDER
Nº 3208

UNIT #: 806 895
ENGINE HOURS: 14311.9
MILEAGE: 337681
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: Oct/23/24
COMPLETED DATE: Oct/28/24
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION: _____ HOURS

TEST PTO SWITCH / AIR CONTROLS, CHECK PTO / HYD PUMP OPERATIONS RON 4
(LOCATE PART NUMBERS / SOURCE AND ORDER PARTS
took off pto and pump replaced winch in and out
receiver case 4.5

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. # QUANTITY PRICE AMOUNT

_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: ron/stane WORK COMPLETED BY: chase

UNIT RETURNED TO SERVICE: VAS OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____



WORK ORDER

Nº 2974

UNIT #: 805
ENGINE HOURS: 14139.4
MILEAGE: 53185
WORK LOCATION: Wilmington
WORK REQUESTED: _____

ORDER DATE: SEP/9/24
COMPLETED DATE: SEP/10/24
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: ~~TRANS MISSION~~ TRANS MISSION MOVES
WHA SHIFTER

TECH COMMENTS: Motor mounts are broken

LABOUR DESCRIPTION: REPLACED both motor mounts 6 HOURS

LABOUR TOTAL _____

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>MOTOR MOUNTS</u>		<u>2</u>		
<u>BOLTS</u>		<u>4</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Shane WORK COMPLETED BY: Chase

UNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: GOOD

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 2972

UNIT #: 805
ENGINE HOURS: 14125.2
MILEAGE: 530 862
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: SEP/5/24
COMPLETED DATE: SEP/5/24
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: fix Air leak

TECH COMMENTS: _____

LABOUR DESCRIPTION: replace Air runs for the design 1.5 HOURS

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
	2		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Shane/ron WORK COMPLETED BY: chaseUNIT RETURNED TO SERVICE: yes OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N° 2031

UNIT #: 805ENGINE HOURS: 13709MILEAGE: 513158WORK LOCATION: HWY 16 RR 192

WORK REQUESTED: _____

ORDER DATE: Marh 22 24COMPLETED DATE: Marh 22 24

JOB #: _____

W.O. TYPE (Circle): PM CVIR ReactiveREPAIRS REQUIRED: Coolant leak.

TECH COMMENTS: _____

LABOUR DESCRIPTION:

LABOUR DESCRIPTION:	HOURS
<u>Drive to location Remove Broken coolant line</u>	<u>4</u>
<u>Install new and top with coolant</u>	

LABOUR TOTAL 4

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
	<u>12L.</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Carly WORK COMPLETED BY: CarlyUNIT RETURNED TO SERVICE: Yes OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 2112

UNIT #: 805
ENGINE HOURS: 13537.2
MILEAGE: ~~50084~~ 500843
WORK LOCATION: Shop
WORK REQUESTED: _____

ORDER DATE: Jan 31 24
COMPLETED DATE: Jan 31 24
JOB #: _____

W.O. TYPE (Circle): PM CVIR Reactive

REPAIRS REQUIRED: No pre heater screen.
Passenger side deck lights. ~~BS~~ not working

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
<u>Checked wiring harness and both ground</u>	<u>1</u>
<u>wire</u>	
<u>Removed light Installed new one</u>	

LABOUR TOTAL 5

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>2.5" Yellow clearance</u>		<u>2</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Con L WORK COMPLETED BY: Con L
UNIT RETURNED TO SERVICE: _____ OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: waiting on Design Air Ram



MAINTENANCE WORK ORDER

Nº 1097

UNIT #: 805ENGINE HOURS: 12978MILEAGE: 485 384WORK LOCATION: Shop

WORK REQUESTED: _____

ORDER DATE: Aug 1 2023COMPLETED DATE: Aug 10 23

JOB #: _____

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: Rad cap leak

TECH COMMENTS: _____

LABOUR DESCRIPTION:

Change Rad cap and over flow psi cap 1 HOURS
bp up clear

LABOUR TOTAL _____

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
<u>Kenworth</u>	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: _____ WORK COMPLETED BY: _____

UNIT RETURNED TO SERVICE: Aug 10 2023 OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 1036

UNIT #: 805
ENGINE HOURS: _____
MILEAGE: 461580 KM
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: DEC 30/2022
COMPLETED DATE: DEC 30/2022
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
- CHECK FOR ENGINE OIL LEAK	
(SOAP AND WASH UNDERCHASSIS)	2
- CHECK FOR OIL LEAKS	

LABOUR TOTAL 2

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: DES WORK COMPLETED BY: RON JEROME

UNIT RETURNED TO SERVICE: DEC 30/2022 OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: _____

