



402-215
SEP

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SMI (PICKER)

Maintenance Request / Report Form

Information

803

Grand Prairie - Shop

Wednesday, June 10th 2026, 4:03 PM (MDT -06:00)

Unit Information

Date:  June 10, 2026

Select Unit Number:  803

KMs:  153919

Hours:  10865

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Complete wheels off drum removed CVIP
- Replace both steering axel hub caps/gaskits/oil and dust cover
- Top off coolant
- Repair bent step (passenger side)
- Replace left air ride leveling valve
- Remove broke off key from Ignition
- Both windshields got replaced
- Torque all wheels
- Grease/set brakes

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ completed

Location of repairs being completed:

Pick the location where the repairs were completed:



Grande Prairie Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:



Dewitt (David) Steinbrenner

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome, Jason Brown, Jon Archibald.

Signatures

Dewitt (David) Steinbrenner, *Mechanic/Driller*



June 10th 2026, 4:03 PM (MDT -06:00)

D.S.



SEMI (PICKUP)

Brothers HDD Inc.
2002 23 Avenue,
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

803

Grand Prairie - Shop

Thursday, March 26th 2026, 1:01 PM (MDT -06:00)

Unit Information

Date: March 26, 2026

Select Unit Number: 803

KMs: # 152349

Hours: # 10818

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

- Add oil
- Install new oil fill cap
- Wash engine bay
- Verify no blow by or other issues

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Grande Prairie Shop

☒ FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs: Dewitt (David) Steinbrenner

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Dewitt (David) Steinbrenner, *Mechanic/Driller*



March 26th 2026, 1:01 PM (MDT -06:00)



55.3095492, -118.7974264



3511 (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 803

 BHDD Shop

 Wednesday, October 1st 2025, 4:06 PM (MDT -06:00)

Unit Information

Date:  October 1, 2025

Select Unit Number:  803

KMs:  145227

Hours:  10450

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Replace pto hyd tank

- removed hydraulic tank
- installed new tank
- filled with new oil

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



October 1st 2025, 4:06 PM (MDT -06:00)



52.8514601, -110.8422623

A handwritten signature in black ink, likely belonging to Luke Jacobsen, the mechanic.



SCM1 (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 803

 BHDD Shop

 Saturday, July 26th 2025, 4:39 PM (MDT -06:00)

Unit Information

Date:  July 26, 2025

Select Unit Number:  803

KMs:  143077

Hours:  10386.1

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Replace 5 brake pots

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Ft St. John Shop

Requested by:

Worker Requesting Repairs:



Chase Atkinson

Signatures


Chase Atkinson, *Laborer*



July 26th 2025, 4:39 PM (MDT -06:00)



56.2291507, -120.8348416

A handwritten signature in black ink, appearing to be 'Chase Atkinson', written over a horizontal line.



SEMI (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 803

 FSJ Shop

 Friday, July 25th 2025, 1:55 PM (MDT -06:00)

Unit Information

Date:  July 25, 2025

Select Unit Number:  803

KMs:  143067

Hours:  10385

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Inland Kw replace all v bar bushings,
reprogram Jake brake parameters lights off to prevent electric trailer brake excessive wear,

Fix ABS, clear codes

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Worker Requesting Repairs:



Kirk Bauming

Additional Photos

[illegible][illegible][illegible][illegible][illegible]

Signatures

Kirk Bauming, *Construction Coordinator - BC*



July 25th 2025, 1:55 PM (MDT -06:00)



56.2288283, -120.833365

A handwritten signature in black ink, appearing to be 'K. Bauming'.

FTSJ

SEMI

ESTIMATE VERSION 4 - POSTED TO FLEET

Updated at: 2025-07-24 08:40:44 -0600



Inland Truck & Equipment Ltd - Fort St. John

Mile 49 Alaska Highway Fort St. John, BC V1J 4H8

Phone: (250) 785-6105



Case Number: 18368117

Repair Order Number: 15777FJS

Purchase Order Number: N/A

Service Advisor: LaBoucane, Haley - Case Date 2025-07-23 10:26:23 -0600

ETR: 7/25/2025 at 07:00 pm MDT

Customer: Brothers H D D Inc	Unit Number: 803
Address: 2002 23 AVE WAINWRIGHT, AB T9W0B8 Phone: N/A Fax: N/A Customer Number: 25029207	Asset: 2015 Kenworth T800 Serial Number: FR975534 VIN: 1NKDX4EX4FR975534 Engine: ISX15 Engine Hours: 10384 Odometer: 143067 KMs Warranty Start: N/A In Service: N/A

1 A: Recall Campaign: [20KWB] Recall 20KWB: Tractor Anti-Lock Brake System (ABS) Lamp Issue [WARRANTY] [013-000-000]

Includes: [20KWB]
Complaint: - PERFORM Recall Campaign: [20kwb] Recall 20kwb: Tractor Anti Lock Brake System (Abs) Lamp Issue
Cause: - REQUIRED
Correction: - CONNECT TO CECU
- NO UPDATE REQUIRED, SOFTWARE ABOVE THE MIN LEVEL OF -120
- CURRENT VERSION P30-1031-121

	Quantity	Price	Totals
Labor:			\$0.00
Operation Total:			\$0.00

2 B: 010 COURTESY INSPECTION [GOODWILL-MANUFACTURER] [999-000-000]

Includes: [010-010-029]
Complaint: - PERFORM COURTESY INSPECTION
Cause: - COURTESY SERVICE
Correction: - WHILE DRIVING UNIT IN NOTICED THAT THE ABS LIGHT WAS ON
- CHECKED LIGHTS, ALL GOOD
- WENT UNDER UNIT EVRTHING WAS GOOD DID NOTICED THE #3, #4 AXLE V-ROD BUSHINGS ARE PUSHED OUT AND CRACKING, THE #2 AXLE V-ROD BUSHINGS ARE STARTING TO PUSH OUT, RECOMMEND REPLACING THEM ALL AT THE SAME TIME
- ADVISE CUSTOMER

	Quantity	Price	Totals
Labor:			\$0.00
Operation Total:			\$0.00

3 C: 045 ADJUST CUSTOMER PARAMETERS (ECM) [045-000-000]

Includes: [CUMMINS]
Complaint: - PARAMETER UPDATE: TURN OFF BRAKE LIGHTS WHEN JAKING
Cause: - REQUESTED

ESTIMATE VERSION 4 - POSTED TO FLEET

Updated at: 2025-07-24 08:40:44 -0600



Inland Truck & Equipment Ltd - Fort St. John

Customer: Brothers H D D Inc	Unit Number: 803
Case Number: 18368117	Asset: 2015 Kenworth T800 VIN: 1NKDX4EX4FR975534

Correction: - SET PARAMETER FOR BRAKE LIGHTS WHILE JAKING TO DISABLE

	Quantity	Price	Totals
Labor:			\$209.00
Operation Total:			\$209.00

4 D: 016 #2 AXLE V-ROD BUSHINGS R&R (INCLUDES ROD R&R) [016-000-000]

Includes: [016-007-010]

Complaint: - REPLACE FAILED #2 AXLE V-ROD BUSHINGS

Correction: - CUSTOMER DECLINED

	Quantity	Price	Totals
Labor:			\$497.50
Parts: KIT-SERVICE REPAIR (SRK645)	1.0		
Additional Charges: DISC, GOOD WILL DISCOUNT	n/a	-\$41.50	-\$41.50
Operation Total:			\$756.72

5 E: 016 #3 AXLE V-ROD BUSHINGS R&R (INCLUDES ROD R&R) [016-000-000]

Includes: [016-007-010]

Complaint: - REPLACE FAILED #3 AXLE V-ROD BUSHINGS

Correction: - CUSTOMER DECLINED

	Quantity	Price	Totals
Labor:			\$497.50
Parts: KIT-SERVICE REPAIR (SRK645)	1.0		
Additional Charges: DISC, GOOD WILL DISCOUNT	n/a	-\$41.50	-\$41.50
Operation Total:			\$756.72

6 F: 016 #4 AXLE V-ROD BUSHINGS R&R (INCLUDES ROD R&R) [016-000-000]

Includes: [016-007-010]

Complaint: - REPLACE FAILED #4 AXLE V-ROD BUSHINGS

Correction: - CUSTOMER DECLINED

	Quantity	Price	Totals
Labor:			\$497.50
Parts: KIT-SERVICE REPAIR (SRK645)	1.0		
Additional Charges: DISC, GOOD WILL DISCOUNT	n/a	-\$41.50	-\$41.50
Operation Total:			\$756.72

7 G: 013 TROUBLESHOOTING AND REPAIR BRAKE SYSTEMS [013-000-000]

Includes: [013-TS]

Complaint: - DIAGNOSE AND REPAIR ABS LIGHT

ESTIMATE VERSION 4 - POSTED TO FLEET

Updated at: 2025-07-24 08:40:44 -0600



Inland Truck & Equipment Ltd - Fort St. John

Customer: Brothers H D D Inc	Unit Number: 803
Case Number: 18368117	Asset: 2015 Kenworth T800 VIN: 1NKDX4EX4FR975534

- Cause:** - PLUGGED TONE RINGS, EXCESSIVE AIR GAP FOR WHEEL SPEED SENSORS
- Correction:**
- HOOKED UP WITH BENDIX
 - ACTIVE CODES FOR REAR AXLE PASSENGER SIDE SPEED SENSOR AIR GAP
 - REMOVED WHEELS & DRUM
 - CLEANED TONE RING ADJUSTED AIR GAP
 - REFITTED DRUM & WHEELS ADJUSTED BRAKES
 - TORQUED WHEEL NUTS FITTED INDICATORS
 - TOOK TRUCK DRIVE AROUND BUILDING ABS LIGHT CAME ON AGAIN
 - HOOKED UP TO BENDIX
 - FOUND FAULT CODE FOR ADDITIONAL AXLE PASSENGER SIDE SPEED SENSOR
 - REMOVED WHEELS & DRUM
 - CLEANED TONE RING & ADJUSTED AIR GAP
 - REFITTED DRUM & WHEELS ADJUSTED BRAKE
 - TORQUED WHEEL NUTS & FITTED INDICATORS
 - DROVE TRUCK AROUND BUILDING NO ABS LIGHT
 - INSTALLED RETORQUE LABEL
 - TEST DRIVE AFTER REPAIRS, PASS

Quantity	Price	Totals
----------	-------	--------

Labor:		\$418.00
Operation Total:		\$418.00

Parts	\$902.16
Labor	\$2,119.50
DISC	-\$124.50
Shop Supplies	\$211.95
Taxes	\$373.09
Total	\$3,482.20

ESTIMATE VERSION 4 - POSTED TO FLEET

Updated at: 2025-07-24 08:40:44 -0600

**Inland Truck & Equipment Ltd - Fort St. John**

Customer: Brothers H D D Inc	Unit Number: 803
Case Number: 18368117	Asset: 2015 Kenworth T800 VIN: 1NKDX4EX4FR975534

Notes:

[7/23/2025 at 10:38 am MDT] - Unit 883 was checked in at Inland Truck & Equipment Ltd - Fort St. John. Arrival time: 7/23/2025 at 09:00 am MDT. NOTE: KIRK DROPPED OFF Case status set to Checked-in.

[7/23/2025 at 10:41 am MDT] - Approval Requested for the estimate version 1. Total \$257.49. NOTE: KIRK REQUESTED PARAMETERS Repair status set to Pending Approval.

[7/23/2025 at 11:10 am MDT] - Approval Requested for the estimate version 2. Total \$3,621.64. NOTE: KIRK APPROVED TO TROUBLESHOOT THE ABS LIGHT, BUT DECLINED REPLACING THE V-ROD BUSHINGS AT THIS TIME Repair status set to Pending Approval.

[7/23/2025 at 01:59 pm MDT] - Approval Requested for the estimate version 3. Total \$3,482.20. NOTE: Hey there as per our phone call, Please see the attached quote for your consideration. Please let me know if you have any questions Repair status set to Pending Approval.

[7/24/2025 at 08:40 am MDT] - Approval Requested for the estimate version 4. Total \$3,482.20. NOTE: Good morning Kirk, I was wondering if you had a chance to review the case? Do you have any questions? Thank you Repair status set to Pending Approval.

This estimate is subject to teardown and inspection and is valid for 30 days from date above. I, the undersigned, authorize you to perform the repairs and furnish the necessary materials. I understand any costs verbally quoted are an estimate only and not binding. Your employees may operate vehicle for inspecting, testing and delivery at my risk. You will not be responsible for loss or damage to vehicle or articles left in it. AUTHORIZED BY: _____ DATE: ____/____/____



SEMI (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 803

 BHDD Shop

 Saturday, July 26th 2025, 12:59 PM (MDT -06:00)

Unit Information

Date:  July 22, 2025

Select Unit Number:  803

KMs:  143061

Hours:  10382

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Cvip, 5 brake pots cracked, front steer tire worn out
-repaired front fender light
-replaced 5 cracked brake pots

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



July 26th 2025, 12:59 PM (MDT -06:00)



56.246676, -120.8538442





SEMI (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

FTST

Maintenance Request / Report Form

Information

803

Excel RZ 2507-004

Friday, July 18th 2025, 9:12 AM (MDT -06:00)

Unit Information

Date: July 18, 2025

Select Unit Number: 803

Ms: # 001

Hours: # 001

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

Picker remote on/off switch spinning in remote. ✓

✓ TIRES?

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Ft St. John Shop

requested by:

Work Requesting Repairs:

 Randy Zaiser

signatures

Kirk Bauming, *Construction Coordinator - BC*



 July 18th 2025, 9:12 AM (MDT -06:00)

 56.2291128, -120.8326727



SEMI

CNIP SEASON

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

803

Paramount/WPW - D Hennig

Thursday, February 27th 2025, 1:38 PM (MST -07:00)

Unit Information

Date: February 27, 2025

Select Unit Number: 803

KMs: # 138516

Hours: # 10185.6

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

ABS light on
Antifreeze leak passenger side (Webasto and at firewall)

STEERING WHEEL SHAKE
(FRONT TUBE?)

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

Requested by:

Worker Requesting Repairs:



Greg Spicer

Signatures

Greg Spicer, *Driller*

A handwritten signature in black ink, appearing to be 'G. Spicer'.

February 27th 2025, 1:38 PM (MST -07:00)



54.7966516, -119.0513008



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEM 1
DAVE
Maintenance Request Form

Information

~~809~~ 803

Fort Saint John shop

Friday, January 17th 2025, 8:11 AM (MST -07:00)

Unit Information

Date: January 16, 2025

Unit Number: # ~~809~~ 803


KMs: # 137550

Hours: # 10045.3

REPAIRS REQUIRED
JONATHAN HDD PRO BRINGING A HEADLAMP UP
FOR THIS UNIT

Description of Repairs Required:

Low beam passenger side head light burnt out

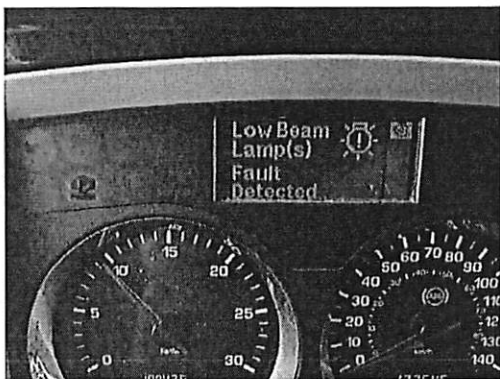

Requested By:

Worker Requesting Repairs: Greg Spicer



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

125

Maintenance Request Form

Information

803

Fort Saint John shop

Wednesday, January 15th 2025, 7:37 AM (MST -07:00)

Unit Information

Date: January 15, 2025

Unit Number: # 803

KMs: # 137538

Hours: # 10033.7

Repairs Required

Description of Repairs Required:

ABS light on display

CVIP SEASON (TRUCK CODES).

Requested By:


Worker Requesting Repairs: Greg Spicer

Signatures

Greg Spicer, Driller

January 15th 2025, 7:37 AM (MST -07:00)

54.583536, -116.5565172

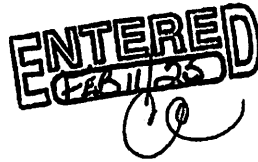

MAINTENANCE WORK ORDER

Nº 2774

UNIT #: 803
ENGINE HOURS: 9990 hrs
MILEAGE: 137036 kms
WORK LOCATION: Fort St. John
WORK REQUESTED: Kirk

ORDER DATE: Dec. 20/24
COMPLETED DATE: Jan. 3/25
JOB #:

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: Service - Engine Oil, oil filter, Fuel filters, grease

TECH COMMENTS:

LABOUR DESCRIPTION:

HOURS

LABOUR TOTAL

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
Fuel Filter ~~#11104~~ #600515	11104	1		
Oil Filter #17746xd	11104	1		
Fuel Filter Cartridge	11124	1		

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Kirk WORK COMPLETED BY: KirkUNIT RETURNED TO SERVICE: ✓ OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS:



MAINTENANCE WORK ORDER

Nº 1887

UNIT #: 803
ENGINE HOURS: 9758.3
MILEAGE: 129710
WORK LOCATION: Wainwright Shop
WORK REQUESTED: _____

ORDER DATE: May 2 2024
COMPLETED DATE: May 2 2024
JOB #: _____

W.O. TYPE (Circle): ☒ PM ☐ CVIP ☐ Reactive

REPAIRS REQUIRED: Oil Change, Change fuel filter, re torque
fires, Change transmission oil, put on wheel indicators

TECH COMMENTS: _____

LABOUR DESCRIPTION:

ENTERED
MAY 06 2024

HOURS

Oil Change
fuel filter
transmission oil
re torque
wheel indicators

0.5
1
0.5
0.5

LABOUR TOTAL

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
--------	----------	-------	--------

fuel filter
oil filter
OW-40 oil

2
1
40L

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Roh

WORK COMPLETED BY: Lucas

UNIT RETURNED TO SERVICE: yes

OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 1738

UNIT #: 603
ENGINE HOURS: 9469.4
MILEAGE: 125740
WORK LOCATION: Brothers HDD
WORK REQUESTED: _____

ORDER DATE: SEP/15/23
COMPLETED DATE: SEP/15/23
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: heater hose was leaking

TECH COMMENTS: heater hose for pro heat was leaking

LABOUR DESCRIPTION: Replaced heater hose for pro heat HOURS 1

LABOUR TOTAL 1

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>hose</u>	<u>SHOP</u>	<u>2 feet</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Cory WORK COMPLETED BY: chase

UNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____

(22)



MAINTENANCE WORK ORDER

Nº 1662

UNIT #: 803
ENGINE HOURS: 9120
MILEAGE: _____
WORK LOCATION: Edson
WORK REQUESTED: _____

ORDER DATE: Feb 18 2023
COMPLETED DATE: March 5 2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Hydraulic leak on right out rigger.
Consumed leak, order hoses

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
<u>Feb 18 2023 confirm Hyd leak.</u>	<u>2</u>
<u>March 5 2023 Change hoses</u>	<u>6</u>

LABOUR TOTAL 8

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>ARC</u>	<u>2686</u>			<u>767.08</u>

PARTS & MATERIALS TOTAL 767.08

WORK AUTHORIZED BY: Cam R WORK COMPLETED BY: Cam R.

UNIT RETURNED TO SERVICE: March 5 2023 OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: Seq. valve needs to be changed



TRUCK EQUIPMENT LTD.



ARW TRUCK EQUIPMENT LTD.
9410 51 Avenue Edmonton, AB T6E 5A6
Ph: 780-436-1406 Fax: 780-436-9132
WWW.ARWTRUCK.COM

SOLD TO
987207 BROTHERS HDD INC.
2002 23 AVENUE (780)
WAINWRIGHT, AB T9W 0B214-7711

SHIP TO
HIAB 211.
S/N# 21101911
UNIT 803

Sold By: FLT PO #: 2686 Date 2/21/23 PARTS INVOICE KI51252
Ship By: PICKUP Tax #: 766603732 10:00:00 PRT: 1

Tax	D	Qty	Description	Price	Amount
Group: 01					
PARTS HIAB					
NK	N	4	HTB 9859969 HOSE P4H04	98.83	395.32
NK	N	1	HIB 9864067 VALVE V2A04	335.23	335.23
** TOTAL PARTS HIAB					730.55

ALL PARTS SALES ARE FINAL-NO RETURNS ACCEPTED.
TERMS:PARTS & SERVICE ARE NET 30 DAYS.
A SERVICE CHARGE OF 18% ANNUM(1 1/2% PER MONTH)WILL BE ADDED TO OVERDUE ACCOUNTS.
PROVINCIAL SALES TAX,WHERE APPLICABLE,IS THE CUSTOMER'S RESPONSIBILITY.

** SUBTOTAL 730.55

** GST 36.53

88301 9176
Charge Sale

X

PAY THIS
AMOUNT

\$767.08

CALGARY | EDMONTON | GRANDE PRAIRIE





MAINTENANCE WORK ORDER
Nº 1041

UNIT #: 803
ENGINE HOURS: _____
MILEAGE: 118976
WORK LOCATION: WAINWRIGHT SHOP
WORK REQUESTED: _____

ORDER DATE: JAN 17/2023
COMPLETED DATE: JAN 17/2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
<u>REPAIR MARIGETE LAMP WIRING HARNESS AND</u>	
<u>REPLACE AMBOL LAMPS</u>	<u>2</u>
_____	_____
_____	_____
_____	_____
_____	_____

LABOUR TOTAL 2

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>LAMPS AND PIGTAILS (B to B INVOICE#</u>	<u>2541</u>			
<u>1-4560565)</u>				

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: CORY R WORK COMPLETED BY: RON JEROME

UNIT RETURNED TO SERVICE: JAN 17/2023 OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 1609

UNIT #: 803
ENGINE HOURS: _____
MILEAGE: _____
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: Dec 16 2022
COMPLETED DATE: _____
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

Plug on Picker Broken.

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

_____	_____
_____	_____
_____	_____
_____	_____
_____	_____
_____	_____

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. # QUANTITY PRICE AMOUNT

_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Shupce

WORK COMPLETED BY: _____

UNIT RETURNED TO SERVICE: _____

OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: _____

