

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 1436	Customer: JAYMAR	Start Date: June 15 /2026
Unit #: 707	Location: Slave Lake	End Date: June 15 /26
Grouch List Checked:		Grouch List Checked with Dave:
Front cab supports		
loosened off Rear support bars to jack up the cab took off windshield washer reservoir & disconnected lines		
Pulled front cab support out, prepared for weld, stuck a chunk of pipe inside cab support, then stacked once it was backed pulled out to weld then install.		
Replaced windshield washer motor x1 ✓		
Greased crit, eddie adjusted brakes,		
checked fluids		
Greased fill back pedal		
When installing USED parts, please specify.		
x1 motor (wind shield washer motor)		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 16.5

Assigned Mechanic: **COLT SHAY**
Entered By:

Signature: CG

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:	Sign: <u>[Signature]</u>
-------	--------------------------

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 1425	Customer: JAYMAR	Start Date: June 13/2026
Unit #: 707	Location: Slave Lake	End Date: June 17 26
Grouch List Checked:		Grouch List Checked with Dave:

Spring bushings, second axle. Replace with new DS
- First drive axle DS missing center bolt
for the spring. Replace center bolt with new
DS cab mount for the air bag. Broke off
frame, take out, and repair on bench
cab and repair air bag mount. then re-install
- Replace U joint on input yoke first diff
- 3rd axle DS Replace ABS sensor
and ABS holder

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 23

Assigned Mechanic: EDDIE
Entered By: SHAY

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:

Sign: 

☐ Check if you put on the retorque tags after working on tires

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 1366	Customer: JAYMAR	Start Date: May 28 /2026
Unit #: 707	Location: Slave Lake	End Date: May 28/26
Grouch List Checked:		Grouch List Checked with Dave:

Tim cherot changed the back up alarm in the truck himself.

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours _____

Assigned Mechanic: Dave
Entered By: Katie

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:

Sign:



☐ Check if you put on the retorque tags after working on tires



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

73

Work Order Pending

WO # <u>1060 1304</u>	Customer: JAYMAR	Start Date: <u>May 15</u> /2026
Unit #: <u>707</u>	Location: Slave Lake	End Date: <u>May 15/26</u>
Grouch List Checked:		Grouch List Checked with Dave:

✓ Service 500 hour

Topped up trans, topped up middle diff (middle axle)

Helped wire up ~~tail~~ tail lights

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 2

Assigned Mechanic:
Entered By:

Signature: CG

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name: <u>Colton Helping Yoshi</u>	Sign: _____
-----------------------------------	-------------

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # <u>1147</u>	Customer: JAYMAR	Start Date: <u>April 8</u> /2026
Unit #: <u>707</u>	Location: Slave Lake	End Date: <u>April 9</u> 2026
Grouch List Checked: <u>yes.</u>	Grouch List Checked with Dave:	

Replace starter.

From grouch list: license plate letters worn off.

- interior light won't come on when door opens
- Reverse light gone
- Airline behind air comp closest to black rubbed
- Rear left brake pot leaking air
- Starter no crank, smoke from driver side when cranking
- Reverse light fell out, needs to be fixed
- No tail lights on tractor.

- removed and replaced License plate used 4 new bolts + 8 washers + 14 nuts
- trimmed back air line used 2 feet of new $\frac{1}{4}$ " air line + $\frac{1}{4}$ " union and ferrul. fastened nuts. no leak.

- Diagnosed, issued w/ brake lights and markers found corrosion in junction box and in ~~the~~ the connections @ the rear end of the truck
fixed all connections, When installing USED parts, please specify.

Lights working.

- removed starter and installed new one hooked up all connections and cleared up battery terminals. fixed loose ground. w/ the

~~---~~ Diagnosed issue EXCESSIVE TIME DESCRIPTION

w/ reverse light not coming on and fixed wiring @ the rear end. Also replaced backup alarm. Used DNE backup light

- replaced right tail light

CVIP Hours _____ Repair Hours 14

Assigned Mechanic: YOSHI

Signature: [Signature]

Entered By: SHAY

Qty	Parts Requested/Parts Nos. /Parts Details			
1	starter	DR-8200308	1	Brake Shoe Hardware
1	ABS wire	✓	1	S-Cam seal
1	backup alarm	✓	1	Zipties
1	4" incan. tail light		1	Shrink tube

I certify that the above unit was repaired under my supervision

Name: _____

Sign: [Signature]

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3534	Customer: JAYMAR	Start Date: Feb 28/2026
Unit #: 707	Location: Slave Lake	End Date: <i>Feb 28/26</i>
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,265,935	Hours: 35,651	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Fuel filter housing		
<i>Remove housing & find it Broken & Broken Bolts. Order New housing. finish at Later Date.</i>		
<i>→ pending w/o inv# 00104391165</i>		
<u>When installing USED parts, please specify.</u>		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours _____

Assigned Mechanic: Dave
Entered By: Shay

Signature: *[Signature]*

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name: _____	Sign: <i>[Signature]</i>
-------------	--------------------------

LB



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3532 // 3525	Customer: JAYMAR	Start Date: Feb 28/2026
Unit #: 707	Location: Slave Lake	End Date: Feb 28/26
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,265,935	Hours: 35,651	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Drive line installed		
Ground Cable (frame)		
Assembled drive line - Greased unit		
Re-made Ground Cable to frame		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Colt
Entered By: Shay

Signature: Colt

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name: _____	Sign: <u>[Signature]</u>
-------------	--------------------------



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3387	Customer: JAYMAR	Start Date: Jan 20/2026
Unit #: 707	Location: Slave Lake	End Date: Jan 2026
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,253,631	Hours: 35,323	Requested by: Dave
Grouch List Checked: Yes		Grouch List Checked with Dave: Yes

Change driver side steering spring & accessories

~~Work~~ - Raised frame and supported on Jack stands

- removed driver side steer wheel.

- removed U-bolts and Spring pins/shackles

- removed and replaced Spring

- installed new pins/shackles When installing USED parts, please specify.

- installed new U-bolts

- torqued installed wheel torqued wheel nuts to 500-ftlbs. torqued U-bolts to 600-ftlbs.

- installed new shock

EXCESSIVE TIME DESCRIPTION

bracket

- installed new ABS sensor

CVIP Hours _____ Repair Hours 3

Assigned Mechanic: Yoshi

Signature: 

Entered By: Shay

Qty	Parts Requested/Parts Nos. /Parts Details
✓ 1	Spring #094131400
✓ 3	Spring pins # 371213419 @ 371213418 ①
✓ 2	U-bolts # 14B7832
✓ 1	Shock bracket # 373033417
✓ 1	straight ABS sensor # R955338

I certify that the above unit was repaired under my supervision

Name: _____

Sign: 



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 1100	Customer: JAYMAR	Start Date: Mar 23/2026
Unit #: 707	Location: Slave Lake	End Date: Mar 23/26
Grouch List Checked:		Grouch List Checked with Dave:
Fix Coolant Leak		
12 Jugs Coolant		
1 cork seal		
Travel to design Rig in Marten Hills - found		
Radiator outlet leaking		
Travel back to Slave Lake - Got parts & unit		
109 back to Marten Hills & reworked		
Unit 110 2		
Unit 109 5		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

Drove out to km 685 road to find coolant leak came back to Jaymar grabbed coolant and cork seal took service truck back up and changed seal, drove back to Jaymar

CVIP Hours _____ Repair Hours 7

Assigned Mechanic: TRAE
Entered By: SHAY

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:	Sign:
-------	-------



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

March 17, 26

WO # 1077	Customer: JAYMAR	Start Date: /2026
Unit #: 707	Location: Slave Lake	End Date: March 17 26
		Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
* replaced right tail light w/ new 11" incandescent traced wiring for short short wire causing all lights to flicker w/ signal on trailer. found broken wires in the back end of the truck within the connections for tilt lights. fixed wiring by and installed heat shrink tube to secure wiring. fixed other corroded wires rubbing on frame and wrapped wiring w/ electrical tape for better protection. Lights working properly		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Yoshi
Entered By: SHAY

Signature: [Signature]

Qty	Parts Requested/Parts Nos. /Parts Details
	Shrink tube
	Tail Light

I certify that the above unit was repaired under my supervision

Name:	Sign:
-------	-------



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 1060	Customer: JAYMAR	Start Date: Mar 13 /2026
Unit #: 707	Location: Slave Lake	End Date: Mar 13 2026
Grouch List Checked:		Grouch List Checked with Dave:

Diagnosed and found Leak coming from power steer Hose on the top of the power steer pump. removed hose and had new one made @ HERB'S. installed new hose and fastened nuts filled power steer reservoir w/ 4L of ATF. reservoir full and turned steering wheel.

1-hydraulic hose from Herb's

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 1

Assigned Mechanic: YOSHI
Entered By: SHAY

Signature: [Signature]

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:	Sign:
-------	-------



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3528	Customer: JAYMAR	Start Date: Feb 27/2026
Unit #: 707	Location: Slave Lake	End Date: Feb 28 2026
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,265,437	Hours: 35,640	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Driver side step took off and weld tabs on bottom of step		
Helping Yoshi		
Replace male plug for block heater		
Replace driver's side windshield		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 5

Assigned Mechanic: Eddie
Entered By: Shay

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
1	515PVLIT male plug
1	DW01279GTN windshield

I certify that the above unit was repaired under my supervision

Name: _____	Sign: 
-------------	---



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3525 113532	Customer: JAYMAR	Start Date: Feb 27/2026
Unit #: 707	Location: Slave Lake	End Date: Feb 27 2026
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,265,437	Hours: 35,640	Requested by: Dave
Grouch List Checked: yes.		Grouch List Checked with Dave:
500 Hour Service		
Worn license plate		
Interior light (if part is in)		
greased + inspected unit		
change fuel filters & oil filter		
removed disconnected When installing USED parts, please specify.		
and removed drive shaft in between first and second drive		
to do seals. installed new seals and coltin finished the		
rest of the job.		
EXCESSIVE TIME DESCRIPTION		

CVIP Hours _____ Repair Hours 4

Assigned Mechanic: Yoshi
Entered By: Shay

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
1	2 piece input seal - A11205x2728
1	2 piece output seal - A1120542729
1	P551319 fuel filter / P550467 fuel filter / DIR1808 oil filter
333	Bulk oil

I certify that the above unit was repaired under my supervision

Name:

Sign: 

4/3



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3372	Customer: JAYMAR	Start Date: Jan 17/2026
Unit #: 707	Location: Slave Lake	End Date: Jan 17/26
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,253,630	Hours: 35,322	Requested by: Dave
Grouch List Checked: Yes		Grouch List Checked with Dave: Yes
Call in, fix antifreeze on bottom rad hose Change Both hoses @ fill with Antifreeze		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____

Repair Hours 2.5

Assigned Mechanic:

Dave

Signature: _____

Entered By: Shay

Qty	Parts Requested/Parts Nos. /Parts Details
4	5490350 Clamps

I certify that the above unit was repaired under my supervision

Name: _____	Sign: <u>DJ</u>
-------------	-----------------



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3297 // 3290	Customer: JAYMAR	Start Date: Dec 22 /2025
Unit #: 707	Location: Slave Lake	End Date: Dec 23 2025
Equip Desc: Semi	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model: Tri Drive
KM: 1,249,354	Hours: 35,169	Requested by: Dave
Grouch List Checked: yes.		Grouch List Checked with Dave:
Full Service ← All Filter and oil on Colts wo #3290		
- greased and inspected unit		
- changed oil and oil filter		
- replaced yoke and output shaft seal on forward diff.		
- fixed issue w/ wiring in tail lights		
- replaced left tail light		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 44.5

Assigned Mechanic: Yoshi LEAD & Colt
Entered By: Shay

Signature:

Qty	Parts Requested/Parts Nos. /Parts Details
1	Yoke nut + washer kit KIT 2637
1	out put shaft seal 10049X5
3	Shrink tube 775 0316, 775014,
1	tail light 4" incandescent
1	Yoke + R40F 18N43381X

I certify that the above unit was repaired under my supervision

Name: _____	Sign:
-------------	-------



Dave
Shay had wrong unit #, km + the all possibly
1249354 km
25169 hr

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3290	Customer: JAYMAR	Start Date: Dec 22 /2025
Unit #: 705 707 2B	Location: Slave Lake	End Date: 22/25
Equip Desc: Tri Drive Semi	Year: 2012	Make: Western Star
VIN: 5KJRALDR1CPBN5785	Plate #: L10458	Model: 4900
KM: 1,727,238	Hours: 5706	Requested by: Dave
Grouch List Checked: yes.		Grouch List Checked with Dave:
250 hr service		
Repair air line 500 hrs Service was done 38.3 litres oil		
Repair diesel line Replaced oil filters and Diesel filters		
Found broke air line - Repaired broken air line		
Diesel line was sweating, Repaired Diesel line.		
Left signal light flashing - Yoshi repaired it.		
Towed Tires - filled out tag.		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 3

Assigned Mechanic: Colt
Entered By: Shay

Signature: CG

Qty	Parts Requested/Parts Nos. /Parts Details
1	1K1808 Filter
1	P5 5319 filter
1	P550467 filter
38.3L	oil 5W40

I certify that the above unit was repaired under my supervision

Name:	Sign:
-------	-------

☐ Check if you put on the retorque tags after working on ti.



00 Hrs Service Inspection Form

JAY-013

Hrs: 35184

Date: Dec 22/25 Unit # 705 Odometer: 243956.4

Multipoint Inspection

Front Left			Front Right			Under Hood		
Pass	Fail		Pass	Fail		Pass	Fail	
/		Headlight	/		Headlight	/		Horn
/		Signal Light	/		Signal Light	/		Antifreeze Level
/		Hazard Light	/		Hazard Light	/		Drive Belt
/		Windshield	/		Windshield	/		Radiator Condition
/		Cracked	/		Cracked	PSI	Duration	Coolant Pressure test
/		Chipped	/		Chipped			
/		Washer System	/		Washer System	Under Vehicle		
/		Wiper	/		Wiper	/		Suspension Comp
/		Tire Tread	/		Tire Tread	/		Exhaust System
/		Tire Pressure	/		Tire Pressure	/		Shocks
/		PSI	/		PSI	/		Fuel Leaks
Rear Left			Rear Right					Oil Leaks
/		Brake Light	/		Brake Light	Y/N		Engine Oil Replaced
/		Signal Light	/		Signal Light	Y/N		Oil Filter Replaced
/		Hazard Light	/		Hazard Light	Y/N		Replace Air Filter
/		Back-Up Light	/		Back-Up Light	Y/N		Torque all Wheels
/		Tire Tread	/		Tire Tread	Fire Extinguisher (Check & Initial)		
/		Tire Pressure	/		Tire Pressure	Expiry Date: Feb 25 1667		
/		PSI	/		PSI	CVIP Exp Date:		
Fluids			Steering Components					
Checked Added			Pass Fail					
Front Differential	Y/N	Y/N	Left Ball Joints/King Pins					
Rear Differential	Y/N	Y/N	Right Ball Joints/King Pins					
Transfer Case	Y/N	Y/N	Left Tie Rods Ends					
Transmissions	Y/N	Y/N	Right Tie Rods Ends					
Power Steering	Y/N	Y/N	Center Link					
Brake Fluid	Y/N	Y/N	Pitman Arm					
Brakes		Pass Fail	Steering Arm					
Left Front	/		Stabilizer Shock					
Left Rear	/		Sway Bars					
Right Front	/		Wheel Alignment					
Right Rear	/		Comments:					
Emergency Brake	/							
Brake Cables	/							
Mechanic's Signature								
Next Service Due:								
Reviewed By:								

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3160	Customer: JAYMAR	Start Date: Oct 28/2025
Unit #: 707	Location: Slave Lake	End Date: Oct 28 / 25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,233,198	Hours: 34,689	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Change cab support rubbers 📌		
<u>When installing USED parts, please specify.</u>		

changed cab support rubbers

2

Signature: Hos

Qty	Parts Requested/Parts Nos. /Parts Details
1	0703286 Poly Rubber Mnt Center

Name:	Sign:
-------	-------

☐ Check if you put on the retorque tags after working on tires



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3159	Customer: JAYMAR	Start Date: Oct 28/2025
Unit #: 707	Location: Slave Lake	End Date: Oct 29/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,233,198	Hours: 34,689	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Install tarp solenoid with a switch		
- install tarp solenoid and breaker in battery box		
- Used 4 ga. wire for the battery to the solenoid and to the head axle rack.		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

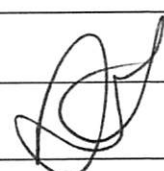
CVIP Hours _____ Repair Hours 5.5

Assigned Mechanic: Eddie
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
1	Tarp Solenoid BUY 1306600
1	80 Amp Breaker 54873PLP

I certify that the above unit was repaired under my supervision

Name:	Sign: 
-------	--

☐ Check if you put on the retorque tags after working on tires



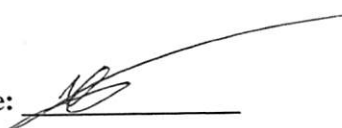
1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3123	Customer: JAYMAR	Start Date: Oct 20/2025
Unit #: 707	Location: Slave Lake	End Date: Oct 21 2025
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,231,860	Hours: 34,651	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Diagnose/replace purge line		
- removed/ replaced Air Hose w/ 13 ft synflex air hose used 2 new 90° fittings.		
- replaced unloader line w/ 1/4" air hose (Black synflex)		
- diagnosed coolant leak. found leak coming from upper rad pipe lower hose. Drained coolant and replaced hose. Filled engine w/ coolant		
- topped up as required. Cleaned up wiring on passenger side.		
- removed old purge line. trimmed back passenger side steer brake hose.		
- Re-Torqued passenger steer U-bolts		
- greased and inspected before sending truck out		
EXCESSIVE TIME DESCRIPTION		
Pressure tested Coolant Reservoir for 15 min. found no other leaks.		

CVIP Hours _____ Repair Hours 8

Assigned Mechanic: Yoshi
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
13 ft	1/2" Air Hose (Black)
6 ft	1/4" Air Hose (Black)
6 ft	1/4" Loom
✓ 2	1/4" ferruls 88414604
1	1/4" synflex nut
2	Sugs of Coolant

I certify that the above unit was repaired under my supervision

Name:

Sign: 



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3121	Customer: JAYMAR	Start Date: Oct 20/2025
Unit #: 707	Location: Slave Lake	End Date: Oct 20/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,231,860	Hours: 34,651	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Driver seat armrest		
Replace left and right windshields ✓		
Leaking airline in no.1 axle 4 th diff. ✓		
Clearance light in cab ✓ Replace bulb ✓		
Upper hose clamp on lower rad hose leaking Yoshi did the work		
Driver side mirror light flickers ?		
cleaned female plug for trailer light		
When installing USED parts, please specify.		
3rd D/S axle Replace ball Valve for the air		
Bag		
grease steady Bearing to the 3rd diff		
EXCESSIVE TIME DESCRIPTION		
check tranny and diff fluids, they were good		

CVIP Hours _____ Repair Hours 7

Assigned Mechanic: Eddie

Signature: 

Entered By: Emmanuel

Qty	Parts Requested/Parts Nos. /Parts Details
1	Windshield DW01279GTN
1	Windshield DW01278GTN
1	Bulb 912cp

I certify that the above unit was repaired under my supervision

Name:

Sign: 

☐ Check if you put on the retorque tags after working on tires

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3082	Customer: JAYMAR	Start Date: Oct 7/2025
Unit #: 707	Location: Slave Lake	End Date: _____
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,227,376	Hours: 34,551	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
500 Hrs full service		
- Replace Oil and Fuel Filters		
Coil Replace Air Filters		
Replace purge Valve for air dryer		
When installing USED parts, please specify.		

EXCESSIVE TIME DESCRIPTION

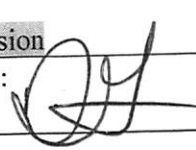
CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Eddie
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
	1R1808
	P550467 Filter
	P551319 Purge Valve R284358X
	5W40 Bulk oil
	AF25247FLG

I certify that the above unit was repaired under my supervision

Name: _____ Sign: 

☐ Check if you put on the retorque tags after working on tires



500 Hrs Service Inspection Form

JAY-013

Hrs: 34551
 Date: Oct 7 2008 Unit # 707 Odometer: 1227376

Multipoint Inspection

Front Left			Front Right			Under Hood		
Pass	Fail		Pass	Fail		Pass	Fail	
☒		Headlight	☒		Headlight	☒		Horn
☒		Signal Light	☒		Signal Light			Antifreeze Level
☒		Hazard Light	☒		Hazard Light	☒		Drive Belt
		Windshield			Windshield	☒		Radiator Condition
		Cracked			Cracked	PSI	Duration	Coolant Pressure test
		Chipped			Chipped			
☒		Washer System	☒		Washer System	Under Vehicle		
☒		Wiper	☒		Wiper	☒		Suspension Comp
☒		Tire Tread	☒		Tire Tread	☒		Exhaust System
☒		Tire Pressure	☒		Tire Pressure	☒		Shocks
		PSI	☒		PSI	☒		Fuel Leaks
Rear Left			Rear Right					Oil Leaks
☒		Brake Light	☒		Brake Light	Y/N		Engine Oil Replaced
☒		Signal Light	☒		Signal Light	Y/N		Oil Filter Replaced
☒		Hazard Light	☒		Hazard Light	Y/N		Replace Air Filter
☒		Back-Up Light	☒		Back-Up Light	Y/N		Torque all Wheels
☒		Tire Tread			Tire Tread	Fire Extinguisher (Check & Initial)		
☒		Tire Pressure			Tire Pressure	Expiry Date:		
		PSI			PSI	CVIP Exp Date:		
Fluids			Steering Components					
Checked Added			Pass Fail					
Front Differential	Y/N	Y/N	Left Ball Joints/King Pins					
Rear Differential	Y/N	Y/N	Right Ball Joints/King Pins					
Transfer Case	Y/N	Y/N	Left Tie Rods Ends					
Transmissions	Y/N	Y/N	Right Tie Rods Ends					
Power Steering	Y/N	Y/N	Center Link					
Brake Fluid	Y/N	Y/N	Pitman Arm					
Brakes			Steering Arm					
Left Front			Stabilizer Shock					
Left Rear			Sway Bars					
Right Front			Wheel Alignment					
Right Rear			Comments: 					
Emergency Brake								
Brake Cables								
Mechanic's Signature								
Next Service Due:								
Reviewed By:								

203



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3054 / 3052	Customer: JAYMAR	Start Date: Sep 30/2025
Unit #: 707	Location: Slave Lake	End Date: 8 Oct 1st 2025
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,225,376	Hours: 34,509	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Help Trae replace leaf springs		
Grease and general check		
Helped Trae		
Greased Unit / Inspected		
replaced 2 dust shields BHKDSH601G		
- replaced yoke, yoke nut/washer, replaced forward diff output		
- replaced seal. resealed output shaft housing		
- replaced U-Joint When installing USED parts, please specify.		
- replaced Axle 4 passenger side shoes/drum.		
(DNC Nut/washer)		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 7

Assigned Mechanic: Yoshi
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
1	Yoke (diff output) 18N43381X
2	Diff output seals 100495
1	Brake Shoe kit
1	Drum
1	U-Joint 5281X
1	Tube of grease

I certify that the above unit was repaired under my supervision

Name: _____

Sign: 

☐ Check if you put on the retorque tags after working on tires

704



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 3016	Customer: JAYMAR	Start Date: Sep 19/2025
Unit #: 707	Location: Slave Lake	End Date: Sept 19
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,223,011	Hours: 34,454	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
☒ Change charger cooler removed grille and multiple components to remove CAC replaced CAC and cleaned out condensor. Used a series of new bolts to install all components.		
When installing USED parts, please specify. 104326229 oil Cooler 10R2112		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 4.5

Assigned Mechanic: Yoshi
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details

I certify that the above unit was repaired under my supervision

Name:	Sign: 
-------	--

☐ Check if you put on the retorque tags after working on tires



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

25
aug 27

Work Order Pending

WO # 2926	Customer: JAYMAR	Start Date: Aug 25/2025
Unit #: 707	Location: Slave Lake	End Date: Aug 25 2025
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,216,935	Hours: 34,313	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
250 hrs full service		
greased truck and completed inspection.		
Driver had complaint of both steps being loose		
installed 2 new bolts on right step had to disassemble and		
exchange brackets for driver step, steps secure. Diagnosed and replaced		
Tail light lamp w/ new light. fixed issue w/ ground on mirror lamp.		
removed and replaced 2 clearance light bulbs and replaced 1 clearance light		
assembly.		
When installing USED parts, please specify.		

housing

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Yoshi
Entered By: Emmanuel

Signature: 

Qty	Parts Requested/Parts Nos. /Parts Details
1	Clearance / marker light assembly
2	marker light bulbs
1	Tail Light lamp

I certify that the above unit was repaired under my supervision

Name: _____	Sign: 
-------------	--

☐ Check if you put on the retorque tags after working on tires



73

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2684	Customer: JAYMAR	Start Date: June 11/2025
Unit #: 707	Location: Slave Lake	End Date: June 12/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,194,902	Hours: 33,742	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
250 Hrs full service		
3635 ✓ Windshield wiper actuators eccentric		
✓ Slack adjuster		
When installing USED parts, please specify.		
AS		

EXCESSIVE TIME DESCRIPTION

changed slack adjuster and windshield wiper actuators
Greased unit adjusted brakes checked lights

CVIP Hours _____ Repair Hours 6

Assigned Mechanic: Trae Klassen

Signature:

Entered By: Emmanuel

☐ Check if you put on the retorque tags after working on tires



250 HRS Service Inspection Form

JAY-012

Hrs: _____
 Date: June 11 Unit # 707 Odometer: _____

Multipoint Inspection									
Front Left			Front Right			Under Hood			
Pass	Fail		Pass	Fail		Pass	Fail		
☒		Headlight	☒		Headlight	☒			Horn
☒		Signal Light	☒		Signal Light	☒			Hood Light
☒		Hazard Light	☒		Hazard Light	☒			Drive Belt
☒		Windshield	☒		Windshield	☒			Radiator Condition
		Cracked			Cracked	☒			Hose Clamps
		Chipped			Chipped	☒			Heater Hose
☒		Washer System	☒		Washer System	Under Vehicle			
☒		Wiper	☒		Wiper				Suspension Comp
☒		Tire Tread	☒		Tire Tread				Exhaust System
☒		Tire Pressure	☒		Tire Pressure				Shocks
<u>90</u>		PSI	<u>90</u>		PSI				Fuel Leaks
Rear Left			Rear Right						Oil Leaks
☒		Brake Light	☒		Brake Light	Y/N			Engine Oil Replaced
☒		Signal Light	☒		Signal Light	Y/N			Oil Filter Replaced
☒		Hazard Light	☒		Hazard Light	Y/N			Replace Air Filter
☒		Back-Up Light	☒		Back-Up Light	Y/N			Torque all Wheels
☒		Tire Tread	☒		Tire Tread				
☒		Tire Pressure	☒		Tire Pressure				
<u>100</u>		PSI	<u>100</u>		PSI				
Fluids			Steering Components						
Checked Added			Pass Fail						
Front Differential	Y/N	Y/N	Left Ball Joints/King Pins						
Rear Differential	Y/N	Y/N	Right Ball Joints/King Pins						
Transfer Case	Y/N	Y/N	Left Tie Rods Ends						
Transmissions	Y/N	Y/N	Right Tie Rods Ends						
Power Steering	Y/N	Y/N	Center Link						
Brake Fluid	Y/N	Y/N	Pitman Arm						
Brakes			Steering Arm						
Left Front	☒		Stabilizer Shock						
Left Rear	☒		Sway Bars						
Right Front	☒		Wheel Alignment						
Right Rear	☒								
Emergency Brake									
Brake Cables									
Mechanic's Signature									
Next Service Due:									
<u>250 hr</u>									

Comments:

Reviewed By



4B

702 OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2656	Customer: JAYMAR	Start Date: June 3 /2025
Unit #: 707	Location: Slave Lake	End Date: June 3 / 25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,193,097	Hours: 33,699	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

Replace hose off thermostat

- Used 7 jugs of anti freeze ✓
- Replace 2 #4 gear clamps ✓ 5354
- Replace Hose on thermostat Housing

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

Had to drive On Site

CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Eddie Schafer
Entered By: Emmanuel

Signature:



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2805	Customer: JAYMAR	Start Date: July 18/2025
Unit #: 707	Location: Slave Lake	End Date: July 19/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,206,476	Hours: 34,037	Requested by: Dave

Grouch List Checked:

Grouch List Checked with Dave:

✓ Change AC compressor (ABP) 1183202504756

✓ Change evaporator ~~filter~~ Clean heater Core RD240327
✓ Change Expansion Valve RD59513

When installing USED parts, please specify.

Charge AC heater blower & AC works
Good.

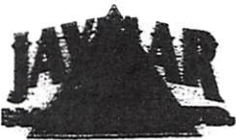
EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours _____

Assigned Mechanic: Dave
Entered By: Emmanuel

Signature: 

☐ Check if you put on the retorque tags after working on tires



30 Hrs Service Inspection Form

JAY-013

Hrs: 39 032

Date: 07/17/2022 Unit # 707

Odometer: 1206 339

Multipoint Inspection

Front Left			Front Right			Under Hood		
Pass	Fail		Pass	Fail		Pass	Fail	
✓		Headlight	✓		Headlight	✓		Horn
✓		Signal Light	✓		Signal Light	✓		Antifreeze Level
✓		Hazard Light	✓		Hazard Light	✓		Drive Belt
✓		Windshield	✓		Windshield	✓		Radiator Condition
		Cracked			Cracked	PSI	Duration	Coolant Pressure test
		Chipped			Chipped			
✓		Washer System	✓		Washer System	Under Vehicle		
✓		Wiper	✓		Wiper	✓		Suspension Comp
✓		Tire Tread	✓		Tire Tread	✓		Exhaust System
✓		Tire Pressure	✓		Tire Pressure	✓		Shocks
100		PSI	100		PSI	100		Fuel Leaks
Rear Left			Rear Right					Oil Leaks
✓		Brake Light	✓		Brake Light	Y/N		Engine Oil Replaced
✓		Signal Light	✓		Signal Light	Y/N		Oil Filter Replaced
✓		Hazard Light	✓		Hazard Light	Y/N		Replace Air Filter
✓		Back-Up Light	✓		Back-Up Light	Y/N		Torque all Wheels
✓		Tire Tread	✓		Tire Tread	Fire Extinguisher (Check & Initial) ✓		
✓		Tire Pressure	✓		Tire Pressure	Expiry Date:		
100		PSI	100		PSI	CVIP Exp Date:		
Fluids			Steering Components					
Checked Added			Pass Fail					
Front Differential	Y/N	Y/N	Left Ball Joints/King Pins					
Rear Differential	Y/N	Y/N	Right Ball Joints/King Pins					
Transfer Case	Y/N	Y/N	Left Tie Rods Ends					
Transmissions	Y/N	Y/N	Right Tie Rods Ends					
Power Steering	Y/N	Y/N	Center Link					
Brake Fluid	Y/N	Y/N	Pitman Arm					
Brakes			Steering Arm					
Left Front	✓		Stabilizer Shock					
Left Rear	✓		Sway Bars					
Right Front	✓		Wheel Alignment					
Right Rear	✓		Comments: 					
Emergency Brake	✓							
Brake Cables	✓							
Mechanic's Signature								
Next Service Due:								
Reviewed By:								



CB

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2703	Customer: JAYMAR	Start Date: June 16/2025
Unit #: 707	Location: Slave Lake	End Date: June 16/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,195,396	Hours: 33,758	Requested by: Dave

Grouch List Checked:	Grouch List Checked with Dave:
----------------------	--------------------------------

Replace starter

cleaned bolt holes with a 5/8 Tap

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Eddie Schafer
Entered By: Emmanuel

Signature:

☐ Check if you put on the retorque tags after working on tires



OSP #:

Work Order Pending

3544 (2)
3545 (1)

Signature: [Signature]



OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2566	Customer: JAYMAR	Start Date: April 25/2025
Unit #: 707	Location: Slave Lake	End Date: April 25/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,184,300	Hours: 33,490	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

Replace air compressor seal

Fab. Rear Bracket For air compressor

Drain Hyd. tank then Remove tank from truck
took to Herb to fix leak

Installed tank Back on truck

When installing USED parts, please specify.

Replace one tank strap with new

Grease unit

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 20

Assigned Mechanic: Eddie Schafer

Signature:

Entered By: Emmanuel



OSP #:

3520,

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2464	Customer: JAYMAR	Start Date: March 19/2025
Unit #: 707	Location: Slave Lake	End Date: 3/26/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: AB - L42393	Model:
KM: 1,178,942	Hours: 33,351	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

500HR SERVICE NEW MUFFLAP'S R&L REAR (2)

Replace with new oil cooler and gasket kit

INSTALLED NEW OIL COOLER & O-RINGS 3515

NOTICED EXHAUST MANIFOLD ON CYLINDER STUD IS BROKE
NEED TO REMOVE MANIFOLD & REPAIR EXHAUST MANIFOLD

INSTALLED BOTH PRECOOLER WATER HOSES 2470266 / 2470055

When installing USED parts, please specify.

NEW EXHAUST STUDS & NUTS

NEW MANIFOLD EXHAUST BASKETS

NEW TURBO EXHAUST BASKET 2246851

REPLACED PURGE VALVE (FULL OF CARBON)

NEEDS ANTIFREEZE FLUSH W/ WATER & DISH SOAP

ADDED 12.5 GALLONS OF NEW COOLANT

AND REFILLED W/ NEW ANTIFREEZE

REPLACED PURGE LINE CHECK VALVE (STUCK OPEN)

DNC TRANS COOLER LINES NEED TO BE REPLACED

RUBBED THROUGH

22545805 REPLACED 20LB ABC-P EXTINGUISHER HAD A BROKEN

EXCESSIVE TIME DESCRIPTION

HANDLE REPLACED GOVERNOR (KEEPS EXHAUSTING)

CLUTCH ADJUSTMENT & BRAKE ADJUSTMENT

REPLACED BOTH POWER STEERING LINES

REPLACED UNLOADER VALVE ON TURBO 2000

VALVE WAS FULL OF CARBON

CVIP Hours _____ Repair Hours 8 + 7 + 7.5 + 7

Assigned Mechanic: Roland Signature:

Entered By: Martine

Dave said to put here

a/c compressor - which 24/25 (DQ/Roland) ??
may be on ES up as well (match) if found.
RM did not install.



500 Hrs Service Inspection Form

JAY-013

Hrs: 33,351Date: 3/25/25 Unit # 707Odometer: 1,178,942

Multipoint Inspection

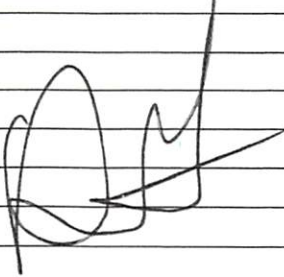
Front Left			Front Right			Under Hood		
Pass	Fail		Pass	Fail		Pass	Fail	
✓		Headlight	✓		Headlight	✓		Horn
✓		Signal Light	✓		Signal Light	✓		Antifreeze Level
✓		Hazard Light	✓		Hazard Light	✓		Drive Belt
✓		Windshield			Windshield	✓		Radiator Condition
		Cracked		✓	Cracked	PSI 23 MERCURY 1 HR	Duration	Coolant Pressure test
		Chipped			Chipped	JACOBY TEST	PASSED	
✓		Washer System	✓		Washer System	Under Vehicle		
✓		Wiper	✓		Wiper	✓		Suspension Comp
✓		Tire Tread	✓		Tire Tread	✓		Exhaust System
100	1	Tire Pressure	100		Tire Pressure	✓		Shocks
		PSI			PSI	✓		Fuel Leaks
Rear Left			Rear Right			✓		Oil Leaks
✓		Brake Light	✓		Brake Light	Y/N		Engine Oil Replaced
✓		Signal Light	✓		Signal Light	Y/N		Oil Filter Replaced
✓		Hazard Light	✓		Hazard Light	Y/N		Replace Air Filter
✓		Back-Up Light	✓		Back-Up Light	Y/N		Torque all Wheels 500 ft/lbs
✓		Tire Tread	✓		Tire Tread	Fire Extinguisher (Check & Initial) ✓ FEB. 25		
✓		Tire Pressure	✓		Tire Pressure	Expiry Date: 2031 FEBRUARY		
100 PSI	100 100	PSI	100 PSI	100 100	PSI	CVIP Exp Date:		
Fluids			Steering Components			NOV 2025		
Checked Added			Pass Fail			CU 8140214		
Front Differential	Y/N Y/N	✓	Left Ball Joints/King Pins					
Rear Differential	Y/N Y/N	✓	Right Ball Joints/King Pins			EXTINGUISHER S/N		
Transfer Case	Y/N Y/N	✓	Left Tie Rods Ends			22545805		
Transmissions	Y/N Y/N	✓	Right Tie Rods Ends			TYPE		
Power Steering	Y/N Y/N	✓	Center Link			20LB ABC-P		
Brake Fluid	Y/N Y/N	✓	Pitman Arm					
Brakes	Pass Fail	✓	Steering Arm					
Left Front	✓		Stabilizer Shock					
Left Rear	✓		Sway Bars					
Right Front	✓		Wheel Alignment					
Right Rear	✓							
Emergency Brake	✓							
Brake Cables								
Mechanic's Signature						Comments:		
Next Service Due						38.3L OF 5W40		
33,851 HRS						BOTH FUEL FILTERS CHANGED		
Reviewed By:						EXTINGUISHER FADED HANDLE BROKEN		
						ADDED 12.5 GALLONS OF NEW ANTIFREEZE		
						COOLANT SYSTEM WAS FLOSHED TWICE		
						CLUTCH ADJUSTMENT NEEDED		
						REPLACED GOVERNOR		
						REPLACED PURGE LINE CHECK VALVE		
						REPLACED PURGE VALVE		



JP

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2697	Customer: JAYMAR	Start Date: June 16/2025
Unit #: 707	Location: Slave Lake	End Date: June 16/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,195,352	Hours: 33,754	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Change clutch brake		
<u>When installing USED parts, please specify.</u>		
		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 1

Assigned Mechanic: Zack Brownless
Entered By: Emmanuel

Signature: 

☐ Check if you put on the retorque tags after working on tires



1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2681	Customer: JAYMAR	Start Date: June 10/2025
Unit #: 707	Location: Slave Lake	End Date: June 10/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,194,902	Hours: 33,742	Requested by: Dave

Grouch List Checked:

Grouch List Checked with Dave:

Repair air leaks

change air line from Compressor to Air Dryer (Herts direct)
Tighten Starter Bolts. (Inv 899531)

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours _____

Assigned Mechanic: Dave
Entered By: Emmanuel

Signature:

☐ Check if you put on the retorque tags after working on tires



SP

702 OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2640	Customer: JAYMAR	Start Date: May 28/2025
Unit #: 707	Location: Slave Lake	End Date: May 28/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,192,652	Hours: 33,688	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

Fixing blower motor heater

Search wire harness in dash, check Relays and they were good. Fuse was good to check connector from control panel to fuse Box

When installing USED parts, please specify.

Found a bad connector splice Both positive ~~and~~ together

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 5

Assigned Mechanic: Eddie Schafer
Entered By: Emmanuel

Signature:



702 OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2642	Customer: JAYMAR	Start Date: May 28/2025
Unit #: 707	Location: Slave Lake	End Date: 28/25
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,192,652	Hours: 33,688	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

General check

Greased & checked fluids

When installing USED parts, please specify.**EXCESSIVE TIME DESCRIPTION**CVIP Hours _____ Repair Hours 2

Assigned Mechanic: Coltin Gagnon

Signature: CG

Entered By: Emmanuel



3545

Work Order Pending

EXCESSIVE TIME DESCRIPTION

[illegible]

Signature: [Signature]



OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2461	Customer: JAYMAR	Start Date: March 18/2025
Unit #: 707	Location: Slave Lake	End Date: <i>march 24/25</i>
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: 33,351	Model:
KM: 1,178,942	Hours: 33,351	Requested by: Dave
Grouch List Checked: Yes		Grouch List Checked with Dave:
Anti freeze leak ✓		
Oil leak		
Braided line Broken from engine to compressor		
<i>Fix air leak under cab</i>		
✓ <i>Replace power steering lines</i>		
When installing USED parts, please specify.		
✓ <i>Replace transmission lines</i>		
✓ <i>positive Battery harness 8.5"</i>		
✓ <i>belt 4060528</i>		
		

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 10Assigned Mechanic: Eddie Signature: 
Entered By: Martine



OSP #:

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2440	Customer: JAYMAR	Start Date: Mar 12/2025
Unit #: 707	Location: Slave Lake	End Date:
Equip Desc: Tri Drive	Year: 2007	Make: Western Star
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,175,161	Hours: 33,266	Requested by: Dave
Grouch List Checked: Yes		Grouch List Checked with Dave:

Change plug

- ✓ Changed 8-Hole Plug Male End
- ✓ Bolted Female end back on with
- ✓ 2 5/16 Bolts 4 3/16 Washers 2 5/16 Lock nuts

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours

Repair Hours

1.75

Assigned Mechanic: John

Signature:

Entered By: Martine



OSP #:

3347, 3348

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2190	Customer: JAYMAR	Start Date: Dec 10 20224
Unit #: 707	Location: Slave Lake	End Date: Dec 10/24
Equip Desc: Tri Drive	Year: 2007	Make: WS
VIN: X69163	Plate #: L42393	Model: Tri Drive
KM: 714 952	Hours: 32 720	Requested by:
Grouch List Checked: Y	Grouch List Checked with Dave:	

Fix Crack on Cross Member on 5th Wheel

Grease ✓

Check over
set brakes

When installing USED parts, please specify.

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 3

Assigned Mechanic: Zack Brownless
Entered By: Emmanuel

Signature:



OSP #:

Jan 27

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2282	Customer: JAYMAR	Start Date: Jan 24/2025
Unit #: 707	Location: Slave Lake	End Date:
Equip Desc: Western Star	Year: 2007	Make: WS
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,158,820	Hours: 32,914	Requested by: Dave

Grouch List Checked: Yes

Grouch List Checked with Dave:

Full Service provided 500hr sheet

- Ty did service
- Help Fab up fender Bracket and mounted
New fenders Passenger and driver side.

When installing USED parts, please specify.

- Steer U-joint worn Replace with new

EXCESSIVE TIME DESCRIPTION

CVIP Hours _____ Repair Hours 3.5

Assigned Mechanic: Eddie

Signature:

Entered By: Martine

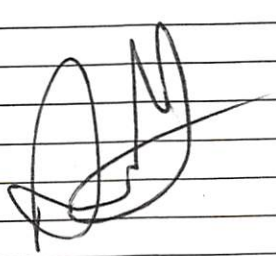


OSP #:


Jan 27 2025

1400 Tamarack Rd
Slave Lake, AB T0G 2A1 Canada
Phone: 780-849-3466

Work Order Pending

WO # 2285	Customer: JAYMAR	Start Date: Jan 24/2025
Unit #: 707	Location: Slave Lake	End Date: 1/24/25
Equip Desc: Western Star	Year: 2007	Make: WS 1/24/25
VIN: 5KJRALAV77PX69163	Plate #: L42393	Model:
KM: 1,158,821	Hours: 32,914	Requested by: Dave
Grouch List Checked:		Grouch List Checked with Dave:
Full Service REPAIRS BROKEN REAR FENDERS REAR FENDERS INSTALLED ALL NEW REINFORCES BRACKETS FOR MUD FLAPS & HANGERS IN FRONT OF 1ST AXLE 2 NEW FLAT FENDERS 2 NEW CURVED FENDERS When installing USED parts, please specify. 2 NEW MUD FLAPS 2 NEW ANTI SAIL BRACKETS		
		
EXCESSIVE TIME DESCRIPTION		

CVIP Hours _____ Repair Hours 4 HRS

Assigned Mechanic: Roland Signature: 
Entered By: Martine

Signature: