

001-134



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Presceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	1 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JELECDIAG3 JD ALL**COMPLAINT:**

04 DIAGNOSE MULTIPLE ACTIVE CODES, LOTS FOR THE EXACT APPLY.

CORRECTION:

HAD 518080.00

HAD 518080.08 ACTIVE ALL TIMES

TRIED CLEARING CODES AND DOING STEERING RECALIBRATION AFTER ALIGNMENT CODE KEPT POPPING UP AND WOULD LET RELEARN. HOPING RELEARN WOULD CLEAR IT.

Friday, February 27, 2026 10:02 PM - LOGAN

-BROUGHT UP WIRING AND FLOW CHART

-CHECKED DTAC

-DTAC 225084 FOUND

-CHECKED SENSOR NUMBER WITH PARTS AND FOUND DIGITAL UPDATED SENSOR INSTALLED

-TOOK CONNECTOR SHIELD OFF ATX MODULE CONNECTOR

- FOUND WIRING HAS NOT BEEN CHANGED

-MOVED 9108 TO J1

-MOVED 9107 TO K1

-PUT CONNECTOR BACK TOGETHER

-REPROGRAMMED ATX MODULE

-FOUND DID 4400 AND CHANGED TO 1

-COMPLETED AUTOTRAC CALIBRATION

-Cleared CODES AND RETESTED.

- REPAIR COMPLETED

2HR DIAG

2.5HR REPAIR

Labor: \$1,000.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,000.00
-------------------	---------------	--------------	--------------	-----------------------

JSOFTWARE JD 616R**COMPLAINT:**

05 UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:

CONTINUED ON NEXT PAGE->



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		SERVICE INVOICE	
		Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	2 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JSOFTWARE JD 616R

HAD TO INSTALL 11 UPDATES ON SOFTWARE
HAD TO SPENT 3 HOURS ON THE PHONE WITH IT TRYING TO SORT MY JOHN DEERE SOFTWARE PAYLOAD
COULD NOT INSTALL ANY OTHER SOFTWARE AS I COULD NOT DOWNLOAD THE PAYLOAD
ON MONDAY MORNING THE 3RD IT CALL SOLVED MY PAYLOAD PROBLEM AND I COULD INSTALL SOFTWARE
ALSO THE NTZ NOZZLE SOFTWARE HAD TO BE REPEATED AS IT DID NOT INSTALL THE FITRST TIME

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

JGEN01-

COMPLAINT:

06 X2 DUST CAPS MISSING FOR THE ENGINE AIR FILTER HOUSING.

CORRECTION:

REMOVE AND REPLACE BOTH DUST CAPS
CLEAN DUST OFF BEFORE INSTALLING DUST CAPS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK37895	AirFilterHousing Dust Valve	2.00	152.78	152.78	\$305.56	N
Labor: \$100.00		Parts: \$305.56	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$405.56	

JGEN02-

COMPLAINT:

07 MISC REPAIRS.

- INSTALL MISSING HARDWARE ON THE MUFFLER BRACKET.X
- REPLACE BOTH COOLANT RESERVOIR CAPS.X
- REPLACE THE UNDER SIDE MIRROR.X
- REPLACE THE DECAL, N403721.X
- REPLACE MULTIPLE RIVETS ON BOTH INNER BOOMS. parts on order.
- RIVETS FOR THE YELLOW PLASTIC END CAP ON BOOM.x
- STRAIGHTEN OR REPLACE THE BENT LADDER PIN.x
- REPLACE X4 HYDRO HOSE PIVOT BALLS AND HARDWARE.X

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeseville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	3 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JGEN02-

Thursday, February 12, 2026 10:28 AM - LOGAN

-OPENED HOOD

-REMOVED COVER

-BOTH COOLANT CAPS REPLACED, CHECKED COOLANT LEVEL, BACK DEGAS TANK EMPTY.

Saturday, February 14, 2026 9:00 AM -

REMOVE AND REPLACE BROKEN MIRROR

INSTALL MISSING BOLT

REPLACE PIVOT POINT HARDWARE PIVOT POINTS WAS STILL GOOD

Thursday, February 19, 2026 3:00 PM - LOGAN

-WENT THROUGH AND IDENTIFIED ALL BROKEN RIVETS AND LOCATION FOR PARTS, TO GET CORRECT ONE ORDERED

-ORDER PARTS FOR STAIR PIN

Friday, February 20, 2026 8:57 AM - LOGAN

-HAD TO DRILL OUT 1 RIVIT

-ABLE TO POUND 6 IN

-2 BEHIND SPRAYER BANK

-REMOVED 2 SPRAYER BANK ASSEMBLY

-1 BEHIND SPRAYER HEAD

-REMOVED SPRAYER HEAD

-OBTAINED SEALS

RIVITS BE HERE MONDAY

-REMOVED AND REPLACED BENT LADDER PIN

Monday, February 23, 2026 3:22 PM - LOGAN

-OBTAINED PARTS

-INSTALLED RIVITS

-INSTALLED NEW SEALS

-INSTALLED 2 SPRAYER BANK ASSEMBLIES

-INSTALLED 1 SPARYER HEAD

-CHECKED SPRAYER HEADS ALL IN A STRAIGHT LINE.

-DIELECTRIC GREASED AND ZIP TIED ALL CONNECTORS AND HARNESS



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK11747	Quick Lock Pin	1.00	30.13	30.13	\$30.13	N
AKK18564	3/16x.925 Rivet SS	5.00	4.01	4.01	\$20.05	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	4 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JGEN02-

AKK19630	Rivet - 3/16 Dome Head	1.00	7.62	7.62	\$7.62	N
AKK24281	Rivet	15.00	7.02	7.02	\$105.30	N
AT486327	Mirror Glass	1.00	220.15	220.15	\$220.15	N
KK46485	Steel Ball Half Clamp	2.00	55.23	55.23	\$110.46	N
KK54365	Screw	1.00	14.51	14.51	\$14.51	N
N403721	Warning-don't fall or rid	2.00	22.23	22.23	\$44.46	N
PM150GV	150 Viton gasket	2.00	18.82	18.82	\$37.64	N
PMM100GV	100 Viton gasket	1.00	9.54	9.54	\$9.54	N
RE312969	Coolant Cap-Black15psi	2.00	61.91	61.91	\$123.82	N

Labor: \$700.00	Parts: \$723.68	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,423.68
-----------------	-----------------	--------------	--------------	-----------------------

J21070100 JD R4080

COMPLAINT:

08 HYDRO DRIVE HOSES THAT NEED TO BE REPLACED.

- AKK30404
 - AKK30963
 - AKK60406

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: _____ Prv Phone: _____	Bus Phone: _____ Prv Phone: _____	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	5 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21070100 JD R4060

Thursday, February 12, 2026 3:09 PM - LOGAN

- MOVED VEHICLE
- CLEANED BAY
- BOUGHT INTO SHOP
- PICKED PARTS
- TRACKED OUT

Tuesday, February 17, 2026 1:57 PM -

USED 2 HOURS ON THIS SEGMENT TO FIND COMBINE AND BRING IT INTO THE SHOP
 AKK 304404- REPLACE LEFT SIDE HOSE ON PROPULSION MOTOR AND REPLACE THE SAME HOSE ON THE RIGHT SIDE
 THE SEGMENT SAID 404406 BUT THAT HOSE WAS GOOD AND NOT MARKED AS DAMGED
 ALSO REPLACE THE RIGHT SIDE AKK 30963 HOSE
 REPLACE ONE OF THE HOUSING BRACKETS ON THE LEFT SIDE HOLDING THE BALLS ON THE PIPE
 REPLACE TWO PLASTIC BALLS ON RIGHT SIDE WITH HARDWARE
 REPLACE FOUR BOLTS ON THE STEEL BALLS WHICH WAS BROKEN
 REPLACE 4 BOLTS ON THE LEFT SIDE ON THE STEEL BOLTS
 INSTALL NEW O-RINGS ON ALL THREE HOSES
 ZIP TIE HOSES
 HAD DIFFICULTY WITH PARTS AS THE ONE HYDRAULIC LINE FITTING WAS ORDERED A WEEK AGO AND STILL DID NOT ARRIVE. WE MADE THE HOSE IN TOWN AND INSTALL IT AS WE CAN'T START THE SPRAYER TO DO THE REST OF THE WORK SEGMENTS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7297	M5-0.8 NUT	4.00	0.36	0.36	\$1.44	N
14M7832	M5-0.8 NUT blk	6.00	2.19	2.19	\$13.14	N
AKK30404	Hydro Hose -Front FWD Propel	2.00	1,101.40	1,101.40	\$2,202.80	N
KK126277	Screw M5x20 Flg10.9	10.00	1.04	1.04	\$10.40	N
T59014	-12_6xFlg O-ring	2.00	8.40	8.40	\$16.80	N
T77858	-12FF O-ring	1.00	3.55	3.55	\$3.55	N
T77932	-10FF O-ring	1.00	3.67	3.67	\$3.67	N
T78313	-16_6xFlg O-ring	2.00	7.99	7.99	\$15.98	N
X1JS43-12-12	-12FF slideneck	1.00	55.10	55.10	\$55.10	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	6 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21070100 JD R4060

SUBLET PART	OUTSIDE PART	1.00	280.63	280.63	\$280.63	N
<i>Comments: hose made AKK30963 12-12forx 12-10forx90 3/4 hose 138"</i>						

Labor: \$1,800.00	Parts: \$2,322.88	OL&M: \$0.00	Misc: \$280.63	Sub-Total: \$4,403.51
-------------------	-------------------	--------------	----------------	-----------------------

JTREADADJ1 JD 616R

COMPLAINT:

09 ADJUST AXLE TREAD ADJUST SHIMS. FRONT AND REAR

CORRECTION:

Saturday, February 14, 2026 1:56 PM -
 -TRACKED OUT TO 136MM
 -OBTAINED JACK AND LIFTED AT A TIME
 -REMOVED GAP SCREW AND ANIT SIEZED, REINSTALLED LOOSE
 -GOT WEDGES MOVING
 -TIGHTEN ADJUSTING SCREW 100FT LBS TILL NO MOVEMENT WAS ACHIVED
 -TIGHTENED FIXED WEDGE BOLT TO 184 FT LBS
 -BACKED OFF ADJUSTING BOLT 1/8 TO 1/4 TURN
 -TIGHTENED JAM NUT 350FT LBS
 -LOWERED DOWN, CHECKED SHIM GAP LOWER NO MORE THAN 1.5MM
 -SIDE GAP MORE THAN 3MM
 -MARKED BOLTS
 -COMPLETED STEPS ON ALL WHEELS
 -TESTED ALL IS GOOD



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
KK46303	6 Hose Block Clamp	2.00	14.79	14.79	\$29.58	N
KK48247	Plastic Ball Half Clamp	4.00	3.17	3.17	\$12.68	N
Labor: \$500.00	Parts: \$42.26	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$542.26		

JWHLTOEADJ JD 616R

COMPLAINT:

10 ADJUST FRONT WHEEL TOE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	7 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JWHLTOEADJ JD 616R

CORRECTION:

Thursday, February 26, 2026 8:24 PM -
 -REPHASED STEERING
 -DROVE 20FT STRAIGHT LINE
 -CHECKED TOE 1" 1/4 TOE IN
 -ADJUST HALF TURN, BOTH SIDES
 -DROVE 20 FT WITH OUT AND IN TOUCHING STEERING WHEEL
 -CHECKED TOE WAS 3/8"-10MM TOE IN

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

J21140041 JD R4060

COMPLAINT:

11 REPLACE ON-BOARD AIR COMPRESSOR. INTRODUCING OIL INTO THE AIR SYSTEM.
 REPAIR LEAK ON THE ONE FITTING ALSO.

CORRECTION:



CONTINUED ON NEXT PAGE->



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 810708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone:	Bus Phone:	Invoice Number:	3542387
Prv Phone:	Prv Phone:	Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	8 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21140041 JD R4060

Friday, February 13, 2026 10:58 AM -

- REMOVED SIDE GUARD
- REMOVED ACCESSORY DRIVE BELT
- CLAMPED OFF COOLANT HOSES AND REMOVED LINE
- REMOVED REST OF LINES ON COMPRESSOR
- UNBOLTED COMPRESSOR
- PLUGGED COMPRESSOR OUT THE SIDE
- UPDATED PUMP
- OBTAINED NEW FITTINGS AS PER UPDATED PART
- INSTALLED NEW FITTING ON PUMP WITH NEW O-RINGS
- 1 O-RING IN PART BOOK SEEM WRONG AFTER TALK WITH FOREMAN, ORDERED NEW FITTING WILL BE HERE TOMORROW

Tuesday, February 17, 2026 9:04 AM -

- INSTALLED THE UPDATED FITTINGS FOR COMPRESSOR CHANGE UP
- SPRING BUSHING STUCK AND COULDN'T GET OUT OF OLD COMPRESSOR
- OBTAINED NEW SPRING BUSHING
- VERIFIED BOTH SPRING BUSHINGS IN WHEN INSTALLING COMPRESSOR
- INSTALLED COMPRESSORS
- INSTALLED TIGHTENED BOLTS HOLDING COMPRESSOR DOWN
- INSTALLED LAST FITTING THATS IN WAY OF BOLT HOLE
- INSTALLED LINES AND TIGHTENED
- CUT AIR LINE TO NEW POSITION SIZE AND INSTALLED
- INSTALLED ACCESSORY DRIVE BELT
- INSTALLED SKID PLATE
- INSTALLED GUARD ON THE SIDE
- CLOSE AIR TANK VALVE

JUST NEED TO RUN CHECK

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M8300	M8x40 HEXSOC 8 8 BOLT	1.00	2.81	2.81	\$2.81	N
24M7420	Washer	1.00	0.64	0.64	\$0.64	N
38H5037	-6mFF_M16mORB	2.00	21.48	21.48	\$42.96	N
51M7039	O-RING M10	1.00	4.09	4.09	\$4.09	N
51M7042	O-RING M16	2.00	4.78	4.78	\$9.56	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: t Page: 9 of 23
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21140041 JD R4060

51M7045	O-RING M22	1.00	4.60	4.60	\$4.60	N
51M7047	O-RING M27	1.00	6.08	6.08	\$6.08	N
AKK49580	OBA Compressor	1.00	1,702.83	1,702.83	\$1,702.83	N
AN404909	-4mFF_M10mORB	1.00	19.97	19.97	\$19.97	N
L115093	SPRING PIN M11X8	1.00	2.52	2.52	\$2.52	N
N306191	5/8HB_-8mNPT	1.00	39.18	39.18	\$39.18	N
R559696	RING	2.00	10.48	10.48	\$20.96	N
RE243410	-6mFF_M22mORB90	1.00	77.86	77.86	\$77.86	N
T77613	-6FF O-ring	2.00	3.04	3.04	\$6.08	N
T77814	-4FF O-ring	1.00	2.81	2.81	\$2.81	N
T77857	-8FF O-ring	1.00	3.10	3.10	\$3.10	N
TR139461	Sealing Crush Ring	2.00	37.26	37.26	\$74.52	N

Labor: \$1,400.00	Parts: \$2,020.57	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,420.57
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

J21130012 JD R4060

COMPLAINT:

12 BOOM FRAME INNER TO OUTER HINGE BUSHINGS REPLACE. LH

CORRECTION:

UNFOLD BOOM.

REMOVE ALL CONNECTIONS BETWEEN INNER AND OUTER BOOM ON LEFT SIDE.

USING CRANE, SUPPORT LEFT HAND OUTER AND BREAKAWAY.

REMOVE PINS ON HINGE.

PULL OUTER BOOM AWAY FROM INNER.

REMOVE WORN BUSHINGS FROM OUTER HINGE.

INSTALL NEW BUSHINGS IN TO HINGE

RE-INSTALL OUTER BOOM ON TO INNER BOOM.

RE-INSTALL ALL CONNECTIONS.

EXERCISED BOOM TO ENSURE WORKING CORRECTLY

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
Bus Phone:	Bus Phone:	Page:	10 of 23
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21130012 JD R4060

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N409842	Bushing	2.00	27.80	27.80	\$55.60	N
Labor: \$800.00		Parts: \$55.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$855.60	

J21130101 JD R4060

COMPLAINT:

13 BOOM BREAKAWAY ROPE, REPLACE BOTH SIDES.

CORRECTION:

REMOVE AND REPLACE BOOM BREAKAWAY LIMIT ROPE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK22689	Rope, Breakaway Stop	4.00	335.82	335.82	\$1,343.28	N
KK54203	M10x25 Flg10.9T black	1.00	2.87	2.87	\$2.87	N
Labor: \$160.00		Parts: \$1,348.15	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,506.15	

J21130013 JD R4060

COMPLAINT:

14 BOOM FRAME INNER TO OUTER HINGE BUSHINGS (RH), REPLACE

CORRECTION:

UNFOLD BOOM.

REMOVE ALL CONNECTIONS BETWEEN INNER AND OUTER BOOM ON RIGHT SIDE.

USING CRANE, SUPPORT RIGHT HAND OUTER AND BREAKAWAY.

REMOVE PINS ON HINGE.

PULL OUTER BOOM AWAY FROM INNER.

REMOVE WORN BUSHINGS FROM OUTER HINGE.

INSTALL NEW BUSHINGS IN TO HINGE

RE-INSTALL OUTER BOOM ON TO INNER BOOM.

RE-INSTALL ALL CONNECTIONS.

EXERCISED BOOM TO ENSURE WORKING CORRECTLY

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Belcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	11 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21130013 JD R4060

N409842	Bushing	2.00	27.80	27.80	\$55.60	N
---------	---------	------	-------	-------	---------	---

Labor: \$800.00	Parts: \$55.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$855.60
------------------------	-----------------------	-------------------------	---------------------	----------------------------

J21130213 JD R4060

COMPLAINT:

15 RH BREAKAWAY BOOM, RE-VISIT AND REPORT BEFORE REPLACE.
 ENSURE THE BOOM NEEDS REPLACED VS. REPAIR BEFORE ORDERING.
 NOT TRYING TO QUESTION SCOTT, ITS JUST VERY EXPENSIVE.

CORRECTION:

Thursday, February 19, 2026 2:29 PM -
 REMOVE BREAKAWAY BOOM.
 INSTALLED EPOXY/CARBON FIBRE REPAIR KIT
 REINSTALLED BOOM.
 (TAKES LONGER THAN THE REPLACEMENT WOULD HAVE BEEN.)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11H312	1/8x3/4 COTTER PIN	1.00	1.10	1.10	\$1.10	N
14M7415	M12-1.75 JAM NUT	1.00	1.00	1.00	\$1.00	N
24M7260	Washer M8.4x24	1.00	1.52	1.52	\$1.52	N
34M7216	SPRING PIN M6X35	1.00	1.87	1.87	\$1.87	N
57M10233	BarbMnt 4.5" ZipTie	5.00	1.37	1.37	\$6.85	N
AKK18564	3/16x.925 Rivet SS	4.00	4.01	4.01	\$16.04	N
AKK19370	RETAINER	1.00	330.24	330.24	\$330.24	N
AKK22616	REPAIR KIT, OUTER/BREAKAWAY, CARBON FIBR	1.00	3,759.78	3,759.78	\$3,759.78	N
AKK24280	Rivet	16.00	6.84	6.84	\$109.44	N
AKK24281	Rivet	-8.00	7.02	7.02	(\$56.16)	N
KK35733	Pin	1.00	29.74	29.74	\$29.74	N
KK40792	Bumper	1.00	123.83	123.83	\$123.83	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: Page: 12 of 23
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21130213 JD R4060

KK41008	Rail	2.00	314.61	314.61	\$629.22	N
KK53905	M8x20 Flg10.9T blk	1.00	2.35	2.35	\$2.35	N
KK54765	M8x1.25 DT Locknut T black	1.00	0.49	0.49	\$0.49	N
KK54921	WASHER	1.00	1.32	1.32	\$1.32	N
RE258807	7" Ziptie w/ Slide Tree	5.00	1.86	1.86	\$9.30	N
LOCTITE398466	Hysol 9460 200ml Epoxy	1.00	134.95	134.95	\$134.95	N

Labor: \$4,400.00 Parts: \$5,102.88 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$9,502.88

JRINSEGAUGE JD R4045

COMPLAINT:

17 REPLACE RINSE TANK SIGHT GAUGE

CORRECTION:

REMOVE MOUNTING CLAMPS.
 REPLACE SIGHT GAUGE TUBE.
 INSTALL REMOVED HARDWARE.
 FUNCTION AND LEAK TEST.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN205159	Hose Clamp sz12 18-32mm Full SS	4.00	6.97	6.97	\$27.88	N
PMK010-1216	3/4" Clear PVC /ft	4.00	2.51	2.51	\$10.04	N

Labor: \$140.00 Parts: \$37.92 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$177.92

JSOLUGAUGE JD R4060

COMPLAINT:

18 REPLACE SOLUTION TANK SIGHT GAUGE

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account N

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: Page: 13 of 23
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JSOLUGAUGE JD R4060
 REMOVE MOUNTING CLAMPS.
 REPLACE SIGHT GAUGE TUBE.
 INSTALL REMOVED HARDWARE.
 FUNCTION AND LEAK TEST.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK010-1216	3/4" Clear PVC /ft	6.00	2.51	2.51	\$15.06	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$140.00 Parts: \$15.06 OL&M: \$0.00 Misc: \$35.00 Sub-Total: \$190.06

JENGAIRFIL JD 616R

COMPLAINT:

19 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

REMOVE AND REPLACE PRIMARY AND SECONDARY AIR FILTERS
 CLEAN AIR FILTER HOUSING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK37892	PRIMARY ENGINE AIR FILTER	1.00	507.26	507.26	\$507.26	N
AKK37893	Secondary EngAir Filter	1.00	298.84	298.84	\$298.84	N

Labor: \$50.00 Parts: \$806.10 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$856.10

JENGOILCHNG JD 616R

COMPLAINT:

20 REPLACE ENGINE OIL AND FILTER

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:		
		Page:	14 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JENGOILCHNG JD 616R

Thursday, February 12, 2026 2:58 PM -

- DRAINED OIL
- REPLACED FILTER AND GASKET
- REPLACED DRAIN PLUG GASKET
- INSTALLED PLUG
- FILLED OIL
- RAN ENGINE
- NO LEAKS
- ADJUSTED LEVEL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE509672	Engine Oil Filter	1.00	51.27	51.27	\$51.27	N
TY26673	PLUS-50 II 15W-40 CK4/SN JUG 3.78L	2.00	37.78	37.78	\$75.56	N
TY26674	PLUS-50 II 15W-40 CK4/SN BOTTLE 946ml	1.00	9.92	9.92	\$9.92	N
TY26675	PLUS-50 II 15W-40 CK4/SN JUG 9.46L	1.00	89.73	89.73	\$89.73	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	1.00	170.86	170.86	\$170.86	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	1.00	0.15	0.15	\$0.15	N
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF300	ENVIRO FEE	1.00	3.00	3.00	\$3.00	N
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
EF60	ENVIRO FEE	2.00	0.60	0.60	\$1.20	N
Labor: \$100.00		Parts: \$397.34	OL&M: \$0.00	Misc: \$6.40	Sub-Total: \$503.74	

J10030112 JD S670

COMPLAINT:

21 REPLACE DEF HEADER FILTER AND VENT.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	15 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J10030112 JD S670

Friday, February 13, 2026 1:04 PM -

-INSTALLED NEW VENT

-AFTER SEARCHING PARTS DIAG USING PART PROVIDED FOUND. INTERNAL TO TANK, BOOM IN WAY AT THIS TIME

Thursday, February 19, 2026 11:41 AM -

-MOVED BOOM OUT OF WAY

-BLEW TOP OFF

-CRIMPED OFF COOLANT LINES

-DISCONNECTED COOLANT LINES

-DISCONNECTED TO ELECTRICAL CONNECTORS

-UN BOLTS LINE BRACKET

-DISCONNECTED DEF LINES

-REMOVED BREATHER HOSE

-UN BOLTED HEADER ASSEMBLY

- CRACKED SEAL SEAT SLIGHTLY, BLEW OUT DIRT UNDER CAP

-REMOVED HEADER

-REMOVED DEF HEADER ASSEMBLY, NO SOCK FILTER

-SPOKE WITH FOREMAN, HE SAID THERE SHOULD BE ON THIS MODEL

-WENT TO PARTS AND GOT EXTERNAL FILTER FOR DEF HEADER

-REPLACED HEADER O-RING SEAL

-CHECKED FOR CONTAMINATES

-CLEANED SEAL AREA

-INSTALLED HEADER IN REVERSE, HEATER HOSE CLAMPS INSTALLED IN SAME ORIENTATION REMOVED

-RETURNED WRONG PARTS

-REMOVED FILTER AND FILTER CAP

-REMOVED AND INSTALLED FILTER FOAM PUCK AND SEALS

-CLEANED CAP

-INSTALLED NEW FILTER

-CHECKED AND VERIFIED NO LEAKS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Incl
A-H216169	Breather	1.00	21.13	21.13	\$21.13	N
DZ124403	DEF Inline Supply Filter	1.00	138.19	138.19	\$138.19	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: Page: 16 of 23
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J10030112 JD S670

R539112	O-RING	1.00	74.55	74.55	\$74.55	N
---------	--------	------	-------	-------	---------	---

Labor: \$125.00 Parts: \$233.87 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$358.87

J21001090 JD 616R

COMPLAINT:

22 REPLACE ENGINE FUEL FILTERS

CORRECTION:

Thursday, February 12, 2026 2:48 PM -

-DRAINED FUEL FILTER BOWL

-REMOVED AND REPLACED BOTH FUEL FILTERS. INSTALLED NEW SEALS

-PRIMED SYSTEM. STARTED ENGINE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	FINAL FUEL FILTER	1.00	247.52	247.52	\$247.52	N
DZ130550	Primary Fuel Filter	1.00	243.60	243.60	\$243.60	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$70.00 Parts: \$491.12 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$563.62

JHYDOLCHG JD R4060

COMPLAINT:

23 REPLACE HYDRAULIC OIL AND FILTERS. ALSO REPLACE THE TANK CAP.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Invoice Number:	3542387
Invoice Date:	2/28/2026
Location:	01
Work Order Number:	511976
Payment Type:	
Page:	17 of 23

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 616R 132' CB EA 1600GL

1140

1N0616RXVN0238182

166026

JHYDOILCHG JD R4060

DRAIN HYDRAULIC RESERVOIR.

INSTALL NEW OIL.

CHECK AND ADJUST LEVEL AS REQUIRED.

Thursday, February 12, 2026 2:55 PM -

-DRAINED ABOUT 5 PALES FROM RESERVIOR

-REPLACED FILTERS

-MARKED FILTERS

-FILLED 5 PALS OF HYDRAULIC FLUID

-PRIMED PUMPS

-PURGED AIR FROM SYSTEMS

-REPLACED CAP

-INSPECTED LEVEL IS CLOSE WILL ADJUST AFTER DRIVING AROUND OUT SIDE

Friday, February 27, 2026 10:10 PM - TOPPED UP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK23814	CommandDrive Hydro Pump Filter	1.00	301.54	301.54	\$301.54	N
AKK25690	Hydraulic Reservoir Filler Cap	1.00	89.55	89.55	\$89.55	N
AT318160	HYDRAULIC OIL FILTER	1.00	219.73	219.73	\$219.73	N
KK77228	High Pressure Hyd Filter	1.00	185.11	185.11	\$185.11	N
TY27956	TORQ-GARD II 10W30 CK4 18.9L	6.00	144.50	144.50	\$867.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	3.00	1.25	1.25	\$3.75	N
EF300	ENVIRO FEE	6.00	3.00	3.00	\$18.00	N

Labor: \$210.00

Parts: \$1,662.93

OL&M: \$0.00

Misc: \$21.75

Sub-Total: \$1,894.68

J21001007 JD 616R

COMPLAINT:

24 REPLACE OIL IN PLANETARY WHEEL HUBS.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	18 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

J21001007 JD 616R

DRAINED OIL FROM PLANETARY HOUSINGS
 INSTALLED NEW OIL.
 LEAK CHECKED.

Thursday, February 12, 2026 3:04 PM -
 -DROVE INTO SHOP
 -LOWERED SUSPENSION
 -LIFTED EACH AXLE AND ALIGNED HOUSINGS
 -DRAINED HOUSINGS
 -INSTALLED DRAIN PLUG
 -FILLED TO MIDDLE HOLE
 -LET LEVEL OUT
 -INSTALLED CHECK PLUG

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	11.00	47.83	47.83	\$526.13	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	11.00	0.15	0.15	\$1.65	N
Labor: \$175.00		Parts: \$526.13	OL&M: \$0.00	Misc: \$1.65	Sub-Total: \$702.78	

JCABFILTER JD 616R

COMPLAINT:
 25 REPLACE CAB AIR FILTERS

CORRECTION:
 CLEAN FILTER HOUSING
 REMOVE AND REPLACE CAB AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE333567	CabFreshFilter Carbon	1.00	688.13	688.13	\$688.13	N
RE595871	Cab Recirc Filter Carbon	1.00	332.96	332.96	\$332.96	N
Labor: \$50.00		Parts: \$1,021.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,071.09	

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:	Deliver To:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: Page: 19 of 23
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
Make/Model:	Meter:	Serial Number:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182
		Eq ID: 166026
		Fleet No:

J21001008 JD R4060

COMPLAINT:

26 REPLACE AIR DRYER CARTRIDGE FILTER

CORRECTION:

REPLACE AIR DRYER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
BA5374	DESSICANT AIR DRYER	1.00	76.89	76.89	\$76.89	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
Labor: \$35.00		Parts: \$76.89	OL&M: \$0.00	Misc: \$0.55	Sub-Total: \$112.44	

JGEN04-

COMPLAINT:

27 CLEAN OUT THE AUTO TRAC VALVE STRAINER.

CORRECTION:

Friday, February 13, 2026 12:59 PM -

- FOUND AUTO TRACK VALVE STRAINER ON PARTS
- REMOVED SKID PLATE
- REMOVED LINE
- REMOVED FITTING
- CLEANED OUT FITTING AND SCREEN
- OBTAINED NEW O-RING AND REPLACED
- INSTALLED FITTING
- INSTALLED LINE
- CLEANED
- LEAK TESTED
- INSTALLED SKID PLATE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
51M7045	O-RING M22	1.00	4.60	4.60	\$4.60	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	20 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JGEN04-							
T77857	-8FF O-ring	1.00	3.10	3.10	\$3.10	N	
Labor: \$50.00		Parts: \$7.70	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$57.70		

JGEN05-
COMPLAINT:
 28 LH STEERING BALL JOINTS HAVE FAILED. **NOT FOUND ON THE LAST VMI**

CORRECTION:



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	21 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JGEN05-

Saturday, February 14, 2026 2:36 PM -LOGAN WHILE SETTING TREAD SHIMS, FOUND DRIVERS BOTH BALL JOINTS REALLY LOOSE

- REMOVED COTTER PINS
- LIFTED AXLE AND TURNED WHEEL
- TIGHTEN NUTS MORE THAN TURN
- FOUND BOTH STEERING ARM AND ANCHOR E LONGED
- REMOVED LINES OFF STEERING CYLINDER
- REMOVED BALL JOINT NUTS
- REMOVED STEER CYLINDER
- CHECKED TAPER AND FOUND BOTH HOLES E LONGED AND DAMAGED FROM BALL JOINT BEING SO LOOSE
- REMOVED STEERING ANCHOR
- REMOVED STEERING SENSOR
- REMOVED BRACKET
- REMOVED HOSE BRACKET
- REMOVED KING PIN LOCK BOLT AND PLATE
- REMOVED KING PIN BOLT
- STEERING ARM SIEZED ON TAPPER SHAFT
- HEATED STEERING ARM
- HIT WITH SLEDGE HAMMER CAME LOOSE
- CLEANED UP SHIMS, AND KING PIN SHAFT AND BLEW OUT BOLT HOLES
- INSTALLED BRACKET
- INSTALLED STEERING ANCHOR WITH NEW HARDWARE. DIDNT TORQUE AT THIS POINT
- CLEANED UP

Wednesday, February 18, 2026 11:40 AM -
 -KP

LOOKED UP THE STEERING ARM INSTALLATION SPECS FOR THE SHIMS COULDN'T FIND ANY
 SEARCHED IN OTHER BOOKS COULDN'T FIND ANY SPECS THE OTHER TECH IS CONTACTING DETAC FOR SPECS

Wednesday, February 18, 2026 4:00 PM - LOGAN

- INSTALLED NEW STEERING ARM AND TORQUED BOLT, FOUND GAP SEEMED EXCESSIVE FROM KING KNUCKLE TO STEERING ARM
- NO SPEC FOUND ON GAP
- WHEN TO FOREMAN AND ASKED FOR HELP FINDING, WAS SEND BACK WITH KODY, CHECKED DTAC'S AND MANUAL
- NO SPEC FOUND, WAS TOLD TO CREATED A DTAC
- MADE DTAC CCMS-195693
- RESPONCE WAS NO MORE THAN 0.5MM
- GAP IS 0.8MM.
- SHIMS ONLY COME IN 0.81MM
- SPOKE WITH FOREMAN
- GRIDDED DOWN SHIM TO 0.6MM AND INSTALLED

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2672	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3542387
		Invoice Date:	2/28/2026
		Location:	01
		Work Order Number:	511976
		Payment Type:	
		Page:	22 of 23

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

- INSTALLED SHIM AND CAP BOLT TIGHTEN BOLT TO 570FT LBS
- HAMMERED ON TAPPED AND CHECKED BOLT TORQUE NO MOVEMENT
- GAP IS NOW 0.05MM TURNS FREELY
- SHOWED FOREMAN AND AGREED IS GOOD
- TIGHTENED STEERING ANCHOR BOLT TO 364FT LBS

Thursday, February 19, 2026 9:37 AM - LOGAN

- GREASED KING PIN REALLY GOOD
- INSTALLED LOCK AND TORQUED BOLT TO 37 FT LBS
- INSTALLED STEERING LINE BRACKET
- ADJUSTED STEERING LINES AND TIGHTENED HOLD DOWN I HAD TO LOOSEN
- INSTALLED STEERING CYLINDER
- INSTALLED NEW SEAL AND INSTALLED LINES ON STEERING CYLINDERS
- TORQUED BOTH BALL JOINTS TO 300 FT LBS WET TORQUE, HAMMERED ON TAPPER AND RE CHECKED TORQUE
- INSTALLED COTTER PINS
- CHECKED FLUID LEVEL
- CHECKED INFO FOR STEERING CALIBRATIONS
- GREASED BALL JOINTS.

Friday, February 27, 2026 10:11 PM

TRIED CALIBRATION STEERING SENSOR AFTER REPAIRS, COULD DUE TO ACTIVE CODE. REPAIR AND SENSOR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7087	M4x40 COTTER PIN	2.00	0.72	0.72	\$1.44	N
AKK23055	TIE ROD END -base side	1.00	375.08	375.08	\$375.08	N
AKK23056	Tie Rod End w/castle -rod side	1.00	412.33	412.33	\$412.33	N
KK129864	Steering Anchor LH	1.00	2,994.73	2,994.73	\$2,994.73	N
KK22412	Steering Arm	1.00	1,306.99	1,306.99	\$1,306.99	N
KK54434	Cap Screw M20x70	2.00	25.05	25.05	\$50.10	N
KK54456	Cap Screw M20x80	4.00	29.57	29.57	\$118.28	N
KK54501	Cap Screw M24x80 10.9	1.00	38.89	38.89	\$38.89	N
KK54932	Washer	5.00	2.17	2.17	\$10.85	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3542387 Invoice Date: 2/28/2026 Location: 01 Work Order Number: 511976 Payment Type: Page: 23 of 23
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1140	1N0616RXVN0238182	166026	

JGEN05-

N302953	Steering Shim .813mm .032	1.00	23.97	23.97	\$23.97	N
T77613	-6FF O-ring	2.00	3.04	3.04	\$6.08	N

Labor: \$2,500.00	Parts: \$5,338.74	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$7,838.74
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

Miscellaneous Charges:

SERVICE ACCESSORIES

\$150.00

Customer PO No:
 Tax Exempt No:
 Advisor:

Labor:	\$15,905.00
Parts:	\$22,590.07
OL&M:	\$0.00
Misc:	\$498.48
Grand Total:	\$38,993.55

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date:

001-134



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Invoice Number: **3506826**

Invoice Date: 11/14/2025

Location: 01

Work Order Number: 464241

Payment Type:

Page: 1 of 8

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 616R 132' CB EA 1600GL

1126

1N0616RXV/N0238182

166026

JGLSPR JD ALL

COMPLAINT:

01 SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS

DOES THIS UNIT GET A VALUEMAX STICKER ___ YES ___x___ NO

HAS THE STICKER BEEN INSTALLED ___ YES ___x___ NO

CAB HAS BEEN COMPLETELY CLEANED _____ (INITIAL)

THIS UNIT HAS HAD A FINAL CHECKOVER _____ BO _____ (INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB ___ SW _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:

ONLY SOLUTION REPAIRS WERE DONE FROM INSPECTION. AS PER SALES

Job Total: **\$1,840.00**

JWASH10 USED SPRAYER

COMPLAINT:

02 WASH USED SPRAYER. READY FOR DISPLAY.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preecerville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3506826 Invoice Date: 11/14/2025 Location: 01 Work Order Number: 464241 Payment Type: Page: 2 of 8
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

JWASH10 USED SPRAYER

INCLUDES THE FOLLOWING:

- WASH COMPLETE EXTERIOR.
- WASHING OUT RADIATOR AND ALL COOLERS.
- VACUUM CAB AND WASH FLOOR MAT.
- WASH ALL CAB INTERIOR SURFACES
- CLEAN WINDOWS

Labor: \$1,150.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,150.00
-------------------	---------------	--------------	--------------	-----------------------

JWINTERIZE JD 616R

COMPLAINT:

03 WET SYSTEMS, INSPECT AND WINTERIZE

CORRECTION:

Friday, November 7, 2025 2:46 PM -
 FILLED RINSE TANK WITH WINTERIZER
 BROUGHT SPRAYER TO OPEN AREA IN YARD AND UNFOLDED
 RINSED SOLUTION SYSTEM (1 CYCLE - LOW) SYSTEM ABORTS AT BOOM
 RINSE TANK TRANSFER
 OPEN FRONT FILL UNTIL BLUE, CLOSED VALVE OPENED AIR FOR 5 SECONDS CLOSED VALVE
 TURNED ON FENCE ROWS TILL BLUE
 SPRAYED SECTION BY SECTION UNTIL WHOLE BOOM SPRAYING BLUE
 SPRAYED OUT WHOLE BOOM
 TURNED OFF PUMP
 DRAINED RINSE TANK AND SOLUTION TANK
 DRAINED STRAINERS
 PARKED SPRAYER ON FRONT LINE



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N305634	SPRAYER WINTERIZER 9.46L	6.00	104.37	104.37	\$626.22	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF300	ENVIRO FEE	6.00	3.00	3.00	\$18.00	N
Labor: \$315.00	Parts: \$626.22	OL&M: \$0.00	Misc: \$18.00	Sub-Total: \$959.22		

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preecaville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3506826**
 Invoice Date: 11/14/2025
 Location: 01
 Work Order Number: 464241
 Payment Type:
 Page: 3 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

JSOLUSYSDIAG3 JD ALL

COMPLAINT:

04 SOLUTION SYSTEM REPAIRS. *SYSTEM FROZE*
 MAY REQUIRE MORE PARTS AND LABOUR

- REPLACE CRACKED FITTING ON THE STRAINER HOUSING.
- MANY NOZZLE BODY'S LEAKING.
- FENCE ROW NOZZLES BROKEN OFF.
- MULTIPLE TEE FITTINGS BROKEN.
- CENTER BOOM FITTINGS CRACKED.
- HOUSING ON BOOM CRACKED.
- FILL VALVES CRACKED.
- MULTIPLE NOZZLE BODIES.

- RUN AND TEST AFTER REPAIRS. MAKE SURE THERE ARE ABSOLUTELY NO LEAKS

CORRECTION:



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeseville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3506826
		Invoice Date:	11/14/2025
		Location:	01
		Work Order Number:	464241
		Payment Type:	
		Page:	4 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

JSOLUSYSDIAG3 JD ALL

Monday, October 20, 2025 4:28 PM -
 REMOVED AND REPLACED DAMAGED NOZZLE BODIES ON SPRAYER BOOMS
 REMOVED NOZZLE BODIES FROM PIPE SECTIONS
 REMOVED CRACKED TEE FITTINGS
 FOUND SQUISHED SEAL UNDER FLANGE
 REPLACED SEAL
 INSTALLED NEW TEE FITTINGS AND SEALED FITTINGS WITH TRU-BLUE
 INSTALLED NOZZLE BODIES AND TIGHTENED HARDWARE

Thursday, October 23, 2025 10:22 AM -
 INSTALLED NEW FILL STRAINER HOUSING, SEALS AND CLAMPS
 INSTALLED BALL VALVE, SEALS AND CLAMPS
 INSTALLED BALL VALVE, 90 DEGREE ELBOW AND SEALS, TIGHTENED CLAMPS
 REPLACED CRACKED FITTING ON CENTER BOOM AND INSTALLED NEW SEAL AND CLAMP

Tuesday, October 28, 2025 4:50 PM -
 MULTIPLE NOZZLE FAULTS
 DIAGNOSED AND REPLACED NOZZLE BODY 18 AND 72
 CLEARED ALL PRESENT NOZZLE FAULTS BEFORE TESTING FOR LEAKS
 FILLED RINSE TANK WITH WATER
 RAN RINSE CYCLE
 FLANGE FITTING N405943 LEAKING BY SOLUTION TANK
 FOLDED SPRAYED BOOMS AND BROUGHT INTO SHOP
 REMOVED CLAMPS AND GASKETS FROM FLANGE
 FLANGE CRACKED, ORDERED REPLACEMENT

Monday, November 3, 2025 1:39 PM -
 FILLED SPRAYER
 RAN RINSE SOLUTION SYSTEM
 LEAKING FROM PREVIOUSLY SEALED BALL VALVE
 REMOVED SIDE CONTROL PANEL TO ACCESS BALL VALVE
 REMOVED BALL VALVE
 INSTALLED NEW BALL VALVE, REUSED SEALS AS THEY ARE NEW
 SEVERAL HOSE FITTINGS LEAKING ON TOP OF SOLUTION TANK
 TIGHTENED HOSE CLAMPS ON FITTINGS
 BROUGHT SPRAYER TO WASH BAY AND FILLED RINSE TANK
 LEAKING AT RINSE TANK FILL NOZZLE
 RAN RINSE SOLUTION SYSTEM
 FOUND 3 FITTINGS ON TOP OF SOLUTION TANK STILL LEAKING (2 90 DEGREE FITTINGS AND A "T" FITTING)
 BALL VALVE ON LH SIDE ABOVE NEW BALL VALVE IS LEAKING NOW
 MARKED LEAKING FITTINGS AND BROUGHT BACK TO SHOP

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3506826
		Invoice Date:	11/14/2025
		Location:	01
		Work Order Number:	464241
		Payment Type:	
		Page:	5 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

***** SERVICE HISTORY *****


Tuesday, November 4, 2025 11:16 AM -
 REMOVED SIDE CONTROL PANEL
 REMOVED BALL VALVE MOUNTING BOLTS
 LOOSENESED HOSE CLAMPS
 DISCONNECTED BALL VALVE ACTUATOR
 REMOVED BALL VALVE AND ACTUATOR AS ONE PIECE
 REMOVED BALL VALVE, INSTALLED NEW VALVE ON ACTUATOR
 INSTALLED NEW HOSE SEALS
 INSTALLED ACTUATOR/VALVE
 CONNECTED ACTUATOR AND TIGHTENED MOUNTING BOLTS
 TIGHTENED HOSE CLAMPS
 2 HOSE FITTINGS ON TOP OF SOLUTION TANK LOOSE
 REMOVED HOSE FROM FITTING
 REMOVED FITTING AND APPLIED PIPE SEALANT TO FITTINGS
 INSTALLED FITTINGS AND RECONNECTED HOSES AND TIGHTENED HOSE CLAMPS
 WILL CHECK FOR LEAKS AFTER LUNCH

Tuesday, November 4, 2025 1:00 PM -
 FILLED AND PRESSURIZED SOLUTION SYSTEM, NO LEAKS
 ONLY 4 NOZZLES ARE SPRAYING, SEVERAL NOZZLE FAULTS (72,79,17,18)

Wednesday, November 5, 2025 8:00 AM -
 UPDATED MNC, SRC, NZC ALL UPDATES SUCCESSFUL
 BROUGHT SPRAYER OUTSIDE AND UNFOLDED
 FAULTS ON SEVERAL NEW NOZZLES (63, 67, 60, 43, 19)
 NOZZLE 38 BROKEN

Thursday, November 6, 2025 8:00 AM -
 NOZZLE BODY 19 CONNECTOR O-RING GONE PLUG CORRODED
 GOT NEW PIG TAIL CONNECTOR, CUT DAMAGED CONNECTOR OFF
 CONNECTED PIG TAIL CONNECTOR TO WIRES ON HARNESS
 FUNCTION TESTED NOZZLE, EVERYTHING WORKS NO CODES
 REPLACED NOZZLE BODIES (63, 67, 60, 47, 43, 19)

Friday, November 7, 2025 11:36 AM -
 NOZZLE SOFTWARE VERSIONS DIFFERENT, UPDATED NZC
 BROUGHT SPRAYER TO OPEN SPOT IN YARD UNFOLDED
 SPRAYED, ALL NOZZLES SPRAYING
 2 MINOR LEAKS AT HOSES ON SOLUTION MANIFOLD AT BACK OF SPRAYER
 TIGHTENED HOSE CLAMPS, HOSES NOT LEAKING ANYMORE
 SPRAYED, NO LEAKS ALL NOZZLES WORKING

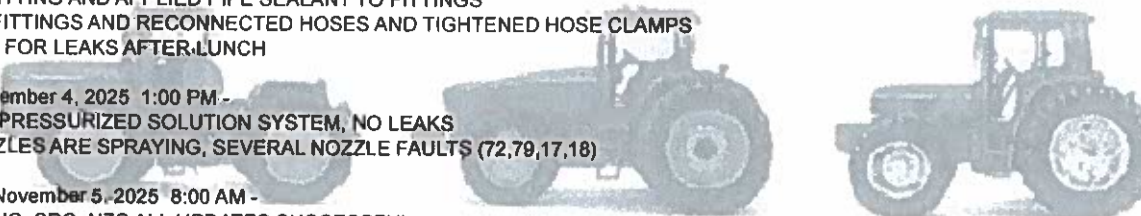

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3506826 Invoice Date: 11/14/2025 Location: 01 Work Order Number: 464241 Payment Type:
		Page: 6 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

STATED, NO LEAKS ALL NOZZLES WORKING
 EMPTIED SOLUTION TANK AND RINSE TANK FOR WINTERIZATION

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
21M7666	Screw M6x30 Phillips SST	9.00	4.39	4.39	\$39.51	N
AA44813	Hand Valve 2"QC_2"Flg	1.00	367.77	367.77	\$367.77	N
AKK34397	Strainer	1.00	794.85	794.85	\$794.85	N
AKK39954	Sprayer Nozzle Electrical Coil	3.00	69.79	69.79	\$209.37	N
AKK44859	EXACT APPLY NOZZLE BODY ASSY 32BIT	17.00	863.26	863.26	\$14,675.42	N
AN302178	2" 80 Mesh strainer	2.00	299.94	299.94	\$599.88	N
AN403562	3way Valve	1.00	328.96	328.96	\$328.96	N
AN403564	220 2-way Valve	1.00	365.11	365.11	\$365.11	N
AN403565	2-way 3"FP Actuated Valve	1.00	1,052.51	1,052.51	\$1,052.51	N
AN405610	Seal Kit	1.00	76.05	76.05	\$76.05	N
KK25358	2" Flg_1"FM Kzco fitting	1.00	64.84	64.84	\$64.84	N
KK39953	Aspirator -HighFlow	1.00	13.04	13.04	\$13.04	N
KK42466	M6x1.0 Nut SST	9.00	0.64	0.64	\$5.76	N
KK67760	Exact Apply Repair Sealed Pigtail	1.00	202.32	202.32	\$202.32	N
N405943	Fitting	1.00	89.92	89.92	\$89.92	N
PM150GV	150 Viton gasket	6.00	18.82	18.82	\$112.92	N
PM200GV	220 VITON GASKET	5.00	31.98	31.98	\$159.90	N
PM300GV	300 Viton gasket	6.00	40.06	40.06	\$240.36	N
PMFC100	1" Flange Clamp	2.00	16.20	16.20	\$32.40	N
PMFC200	1.5" Flange Clamp	4.00	28.47	28.47	\$113.88	N
PMFC220	2" Flange Clamp	3.00	29.39	29.39	\$88.17	N
PMFC300	3" Flange Clamp	4.00	25.10	25.10	\$100.40	N
PMHB075-90	3/4"mNPT_3/4"HB90	1.00	2.76	2.76	\$2.76	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-8459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3506826
		Invoice Date:	11/14/2025
		Location:	01
		Work Order Number:	464241
		Payment Type:	
		Page:	7 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

JSOLUSYSDIAG3 JD ALL

PMM100GV	100 Viton gasket	7.00	9.54	9.54	\$66.78	N
PMM300TEE	3" FLANGE TEE	1.00	101.87	101.87	\$101.87	N
PMMLS220C1	"2""Strainer Cap"	1.00	42.31	42.31	\$42.31	N
PMMLS220R1	2" Strainer Cap NUT	1.00	21.99	21.99	\$21.99	N
PMTEE100	1"NPT TEE	4.00	10.42	10.42	\$41.68	N
PS90920	NozzleCap Blank	1.00	1.63	1.63	\$1.63	N
PSLDMQ2004	Low Drift Max Nozzle -Red	1.00	25.30	25.30	\$25.30	N
PSLDMQ2006	Low Drift Max Nozzle -Grey	1.00	25.30	25.30	\$25.30	N
TY22470	Hose Clamp 40-64mm	1.00	2.66	2.66	\$2.66	N
83-6048-1	6.5" Fir Tree Ziptie EA.	16.00	0.96	0.96	\$15.36	N
83-8002	3/4" Split Loom /ft 50pk	2.00	17.12	17.12	\$34.24	N
SPPM300SWP90	"M300SWP 3"" FLANGE X FLANGE S	1.00	98.88	95.53	\$95.53	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3506826
		Invoice Date:	11/14/2025
		Location:	01
		Work Order Number:	464241
		Payment Type:	
		Page:	8 of 8

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 616R 132' CB EA 1600GL	1126	1N0616RXVN0238182	166026	

JSOLUSYSDIAG3 JD ALL

SUBLET PART	OUTSIDE PART					
Comments: SPRAYER FITINGS		1.00	35.13	35.13	\$35.13	N

Labor: \$11,200.00 Parts: \$20,210.75 OL&M: \$0.00 Misc: \$70.13 Sub-Total: \$31,480.88

INVOICE CONTAINS \$89.18 DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

\$150.00

Customer PO No:
 Tax Exempt No:
 Advisor:

*** DOCUMENT COPY ***

Job Total: \$35,580.10
 Grand Total: \$35,580.10

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: _____ Date: _____