

001-204



PATTISON AGRICULTURE LIMITED
 Hwy 5 East, Box 2109
 Humboldt, SK S0K 2A0
 Phone: (306) 682-2572
 Fax: (306) 682-2510
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3334673
		Invoice Date:	3/10/2025
		Location:	08
		Work Order Number:	480929
		Payment Type:	
		Page:	1 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

JGLC JD X SERIES ALL**COMPLAINT:**

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

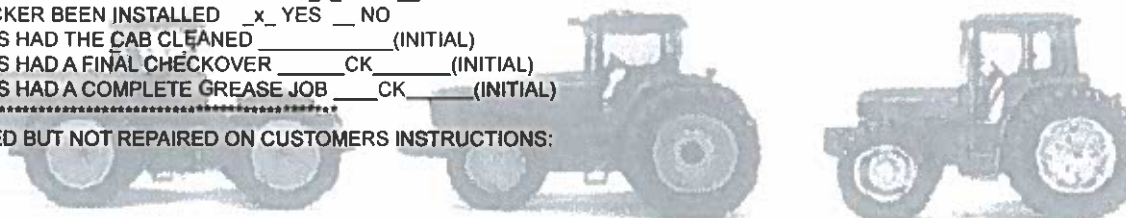
GNB TRADE**CORRECTION:**

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

 HEADER SERIAL # _____
 ENGINE HOURS 524
 SEPERATOR HOURS 385

DOES THIS UNIT GET A VALUEMAX STICKER x YES NO
 HAS THE STICKER BEEN INSTALLED x YES NO
 THIS UNIT HAS HAD THE CAB CLEANED _____ (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER _____ CK _____ (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ CK _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

**Job Total: \$3,860.00****JELECDIAG1 JD ALL****COMPLAINT:**

02 TEMPERATURE ACTUATOR STUCK 3986.07

CORRECTION:

REMOVED CAB ROOF
 REMOVED ACTUATOR
 INSTALL NEW ACTUATOR
 TESTED FOR CODES
 REINSTALLED CAB ROOF

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3334673 Invoice Date: 3/10/2025 Location: 08 Work Order Number: 480929 Payment Type: Page: 2 of 13
-------------------------------------	-------------------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

JELECDIAG1 JD ALL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE593781	Actuator	1.00	441.21	441.21	\$441.21	N
Labor: \$300.00		Parts: \$441.21	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$741.21	

JSOFTWARE JD X9 1100

COMPLAINT:

03 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON _____ CONTROLLERS.
HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CORRECTION:

UPDATED SOFTWARE ON 7 CONTROLLERS.

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN04-

COMPLAINT:

04 CLEAN OUT REVERSER PULLEY

CORRECTION:

CLEAN OUT PACKED DUST AROUND REVERSER PULLEY

Labor: \$54.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$54.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

J06171080 JD X9 1100

COMPLAINT:

05 REPLACE FEEDERHOUSE CONVEYOR DRIVE CHAIN.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3334673 Invoice Date: 3/10/2025 Location: 08 Work Order Number: 480929 Payment Type: Page: 3 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

J06171080 JD X9 1100

REMOVED DRIVE CHAIN.
INSTALLED NEW DRIVE CHAIN.
ADJUSTED TO PROPER TENSION.
RAN MACHINE WITH FEEDERHOUSE ENGAGED, RECHECKED AND ADJUSTED
CHAIN AS NECESSARY.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE82777	X9 FEEDER CHAIN DRIVE BSN 83000 80H	1.00	986.03	986.03	\$986.03	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N

Labor: \$200.00 Parts: \$986.03 OL&M: \$0.00 Misc: \$1.50 Sub-Total: \$1,187.53

J06171151 JD S790

COMPLAINT:
06 FEEDERHOUSE CONVEYOR CHAIN SLAT, REPLCE (ONE) X4

CORRECTION:
UNBOLTED OLD FEEDER CHAIN SLAT
INSTALLED NEW FEEDER CHAIN SLAT
TORQUED BOLTS TO SPEC

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE113327	X9 FEEDER CHAIN SLAT	4.00	67.52	67.52	\$270.08	N

Labor: \$500.00 Parts: \$270.08 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$770.08

JGEN07-

COMPLAINT:
07 REPAIR LEAK ON TRANSMISSION

CORRECTION:

CONTINUED ON NEXT PAGE-->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:	3334673
Invoice Date:	3/10/2025
Location:	08
Work Order Number:	480929
Payment Type:	
Page:	4 of 13

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

524

1H0X911XVP0825490

182903

JGEN07-

REMOVED SHIELD
REMOVED LINES
REMOVED PUMP AND REMOVED O-RING
INSTALLED NEW O-RING AND INSTALLED PUMP
INSTALLED LINES
INSTALLED SHEILDS AND CHECKED FOR LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H80821	O-RING	1.00	6.50	6.50	\$6.50	N
Labor: \$302.00		Parts: \$6.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$308.50	

J06180512 JD X9 1100

COMPLAINT:
08 LEVEL CONCAVES

CORRECTION:
REMOVED SHEILDS AND ONE SEPARATOR GRATE
LEVELED CONCAVES AS PER SERVICE ADVISOR
CALIBRATED BOTH SIDES AND TESTED FUNCTION
REINSTALLED GRATES AND SHEILDS



Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
-----------------	---------------	--------------	--------------	---------------------

JGEN09-

COMPLAINT:
09 FEED ACCELERATOR SUPPORT BENT

CORRECTION:
REMOVED FEEDERHOUSE COVER
REMOVED WINGS FROM BENT SUPPORTS
REMOVED BENT SUPPORTS
CLEANED OUT ACCELERATOR
INSTALLED NEW SUPPORTS
INSTALLED WINGS
INSTALLED COVER

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3334673 Invoice Date: 3/10/2025 Location: 08 Work Order Number: 480929 Payment Type: Page: 5 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

JGEN09-

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H137329	M12x1.75 Flg DT Lock	2.00	3.11	3.11	\$6.22	N
HXE174444	X9 FEED ACCELERATOR/BEATER STRIP ASN 82K	1.00	421.42	421.42	\$421.42	N
HXE177730	X9 FEED ACC/BEATER STRIP ASN 82K	1.00	583.14	583.14	\$583.14	N
L215374	M12x35 CarrSN10.9	2.00	5.07	5.07	\$10.14	N
Labor: \$300.00		Parts: \$1,020.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,320.92	

J06171030 JD S790

COMPLAINT:

10 REPLACE FEED ACCELERATOR BELT

CORRECTION:

REPLACED FEED ACCELERATOR BELT

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE171261	X9 FEED ACCELERATOR BELT HIGH SPEED	1.00	281.98	281.98	\$281.98	N
Labor: \$312.00		Parts: \$281.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$593.98	

JGEN11-

COMPLAINT:

11 UNLOADING AUGER DRIVE BELT TENSIONER REPAIR

CORRECTION:

TENSIONER ROD SCREWED OUT OF EYELET

REINSTALLED WITH RED LOCTITE AND HAMMERED END OF ROD SO IT CANNOT BACK OUT AGAIN

Labor: \$114.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$114.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3334673
		Invoice Date:	3/10/2025
		Location:	08
		Work Order Number:	480929
		Payment Type:	
		Page:	6 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

J06180021 JD X9 1100**COMPLAINT:**

12 CONCAVE REPAIR 1.0 HRS PER CONCAVE X9 ??

CORRECTION:

REPAIR CONCAVES AS NEEDED.

(STRAIGHTENING AND WELDING)

REMOVED ALL CONCAVES

3 CONCAVES HAD TO BE REPLACED WITH ONES THAT WERE REPAIRED BY WIESNERS.

7 CONCAVES HAD BENT BARS THAT I HAD TO STRAIGHTEN AND WELD IF THEY WERE CRACKED

REINSTALLED ALL CONCAVES

Labor: \$2,886.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,886.00
--------------------------	----------------------	-------------------------	---------------------	------------------------------

J06175204 JD X9 1100**COMPLAINT:**

13 TAILINGS ELEVATOR PADDLE CHAIN REMOVE HALF LINK & ADJUST

CORRECTION:

ADJUST TAILINGS ELEVATOR CONVEYOR CHAIN TENSION TO SPECIFICATION.

RUN THE MACHINE AND READJUST TENSION IF REQUIRED.

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06001201 JD X9 1100**COMPLAINT:**

14 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

REMOVE HALF LINK (IF REQUIRED) AND ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN.

TURN CHAIN UNTIL CONNECTING LINK IS VISIBLE.

DISCONNECT CONNECTING LINK. REMOVE HALF LINK.

RECONNECT CONNECTING LINK.

ADJUST TENSION TO SPEC.

RUN UNIT AND READJUST TENSION AS REQUIRED.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3334673
		Invoice Date:	3/10/2025
		Location:	08
		Work Order Number:	480929
		Payment Type:	
		Page:	7 of 13

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

524

1H0X911XVP0825490

182903

J06001201 JD X9 1100

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J06172010 JD S790

COMPLAINT:

15 FLIP CHOPPER HAMMERS.

CORRECTION:

REMOVE CHOPPER HAMMER, FLIP AND REINSTALL AND TORQUED ALL HARDWARE

Labor: \$620.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$620.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN17-

COMPLAINT:

17 REPLACE ENGINE BAY LADDER DOOR LATCH

CORRECTION:

REMOVED AND REPLACED ENGINE DOOR LATCH

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE93048	LATCH	1.00	52.05	52.05	\$52.05	N
H201023	PIN	1.00	25.96	25.96	\$25.96	N

Labor: \$76.00	Parts: \$78.01	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$154.01
-----------------------	-----------------------	-------------------------	---------------------	----------------------------

J06180113 JD S790

COMPLAINT:

18 REPLACE ALL SIEVE AND CHAFFER PITMAN ARMS

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3334673
		Invoice Date:	3/10/2025
		Location:	08
		Work Order Number:	480929
		Payment Type:	
		Page:	8 of 13

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

524

1H0X911XVP0825490

182903

J06180113 JD S790

REMOVED GRAIN LOSS MONITORS AND TAILBOARD
REMOVED CHAFFER DIVIDERS
REMOVED CHAFFER AND SIEVE ELEMENTS
REMOVED THE BOLTS HOLDING THE CHAFFER FRAME TO PITMAN ARMS AND REAR HANGERS
BACKED THE CHAFFER FRAME OUT FAR ENOUGH TO ACCESS SIEVE BOLTS
PROCEEDED WITH CHANGING SIEVE FRAME PITMAN ARMS AND REAR HANGERS
REPLACED ALL CHAFFER PITMAN ARMS AND REAR HANGERS
REINSTALLED CHAFFER FRAME
TIME THE CHAFFER AND SIEVE FRAME AND TORQUE ALL BOLTS TO SPEC
REINSTALLED CHAFFER AND SIEVE ELEMENT
REINSTALLED CHAFFER DIVIDERS
REINSTALLED GRAIN LOSS MONITORS AND TAILBOARD
FACTORY CALIBRATE SIEVE AND CHAFFER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE85935	ARM, SWINGER, LH SIEVE	1.00	457.58	443.49	\$443.49	N
AXE85936	ARM, SWINGER, RH SIEVE	1.00	457.58	443.49	\$443.49	N
Labor: \$1,196.00		Parts: \$886.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,082.98	

J06030020 JD X9 1100

COMPLAINT:

19 REPLACE ROTARY SCREEN DRIVE BELT

CORRECTION:

INSTALLED BELT AND SET TENSION

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE168680	Rotary Screen V-Belt X9	1.00	92.16	92.16	\$92.16	N
Labor: \$140.00		Parts: \$92.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$232.16	

JGEN20-

COMPLAINT:

20 GRAIN TANK LOADING AUGER REPLACE

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Invoice Number: 3334673

Invoice Date: 3/10/2025

Location: 08

Work Order Number: 480929

Payment Type:

Page: 9 of 13

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1100

524

1H0X911XVP0825490

182903

JGEN20-

CORRECTION:

REMOVED SUPPORT BOLTS

REMOVE OLD AUGER FLIGHTING

REMOVED SUPPORT BEARING FROM OLD FLIGHTING

INSTALLED ON NEW AND INSTALLED NEW FLIGHTING

REINSTALL SUPPORT BOLTS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE89023	X9 LOADING AUGER EXT WEAR	1.00	3,873.28	3,873.28	\$3,873.28	N

Labor: \$314.00

Parts: \$3,873.28

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$4,187.28

J06001004 JD X9 1100

COMPLAINT:

23 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE

CORRECTION:

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$30.00

Parts: \$0.00

OL&M: \$0.00

Misc: \$2.50

Sub-Total: \$32.50

J06070003 JD X9 1100

COMPLAINT:

24 TRANSMISSION RETURN FILTER, REPLACE

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	168.03	168.03	\$168.03	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3334673**
Invoice Date: **3/10/2025**
Location: **08**
Work Order Number: **480929**
Payment Type:
Page: **10 of 13**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

J06070003 JD X9 1100

EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
-------	------------	------	------	------	--------	---

Labor: \$90.00 Parts: \$168.03 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$260.53

J06070004 JD X9 1100

COMPLAINT:

25 REPLACE HYDROSTATIC CHARGE FILTER.

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE577250	HYDRAULIC	1.00	156.71	156.71	\$156.71	N
RE577612	HYDRAULIC OIL FILTER	1.00	199.76	199.76	\$199.76	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$50.00 Parts: \$356.47 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$407.72

J06070005 JD X9 1100

COMPLAINT:

26 TRANSMISSION FILTER, REPLACE

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE577250	HYDRAULIC	1.00	156.71	156.71	\$156.71	N
TY22062	HY-GARD J20C 9.46L	1.00	85.28	85.28	\$85.28	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$90.00 Parts: \$241.99 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$333.24

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Invoice Number: **3334673**

Invoice Date: **3/10/2025**

Location: **08**

Work Order Number: **480929**

Payment Type:

Page: **11 of 13**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

J10030100 JD X9 1100

COMPLAINT:

27 REPLACE ENGINE FUEL FILTERS.

CORRECTION:

REPLACED PRIMARY AND SECONDARY FUEL FILTERS.

REMOVED AND CLEANED FUEL STRAINER.

BLEED FUEL SYSTEM.

FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	163.69	163.69	\$163.69	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	157.26	157.26	\$157.26	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
Labor: \$160.00		Parts: \$320.95	OL&M: \$0.00	Misc: \$2.50	Sub-Total: \$483.45	

JCABFILTER JD X9 11

COMPLAINT:

28 REPLACE CAB AIR FILTERS

CORRECTION:

REMOVE CAB AIR FILTERS

CLEAN FILTER HOUSING

INSTALL NEW AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	AIR FILTER	1.00	39.23	39.23	\$39.23	N
TA32591	Cab FreshAir Filter	1.00	135.85	135.85	\$135.85	N
Labor: \$100.00		Parts: \$175.08	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$275.08	

JENGAIRFILT JD X9 11

COMPLAINT:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3334673 Invoice Date: 3/10/2025 Location: 08 Work Order Number: 480929 Payment Type: Page: 12 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

JENGAIRFILT JD X9 11

29 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	463.00	463.00	\$463.00	N
HXE11091	Secondary EngAir Filter	1.00	326.70	326.70	\$326.70	N
Labor: \$100.00		Parts: \$789.70	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$889.70	

JENGOILCHNG JD X9 11

COMPLAINT:

30 REPLACE ENGINE OIL AND FILTER

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER.
CLEAN AREA.
INSTALL NEW OIL AND FILTER.
RUN UNIT AND LEAK CHECK
ADJUST OIL LEVEL AS REQUIRED.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE572785	ENGINE OIL FILTER	1.00	151.85	151.85	\$151.85	N
TY26673	15W40 3.78L Plus-50II CK4/SN	1.00	37.78	37.78	\$37.78	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
45004	Brake Cleaner	2.00	6.01	6.01	\$12.02	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N
EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 5 East, Box 2109
Humboldt, SK S0K 2A0
Phone: (306) 682-2572
Fax: (306) 682-2510
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3334673 Invoice Date: 3/10/2025 Location: 08 Work Order Number: 480929 Payment Type: Page: 13 of 13
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1100	524	1H0X911XVP0825490	182903	

JENGOILCHNG JD X9 11					
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60 N
Labor: \$125.00	Parts: \$714.23	OL&M: \$0.00	Misc: \$10.85	Sub-Total: \$850.08	

INVOICE CONTAINS \$32.13 DISCOUNT

Miscellaneous Charges:
SERVICE ACCESSORIES

\$150.00

Customer PO No:
Tax Exempt No:
Advisor:

*** DOCUMENT COPY ***

Job Total: \$23,894.95
Grand Total: \$23,894.95

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: _____ Date: _____